



PORSCHE

Porsche Connect Support Guideline


Version 2 – including „Embedded SIM Connectivity“

30.06.2017

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

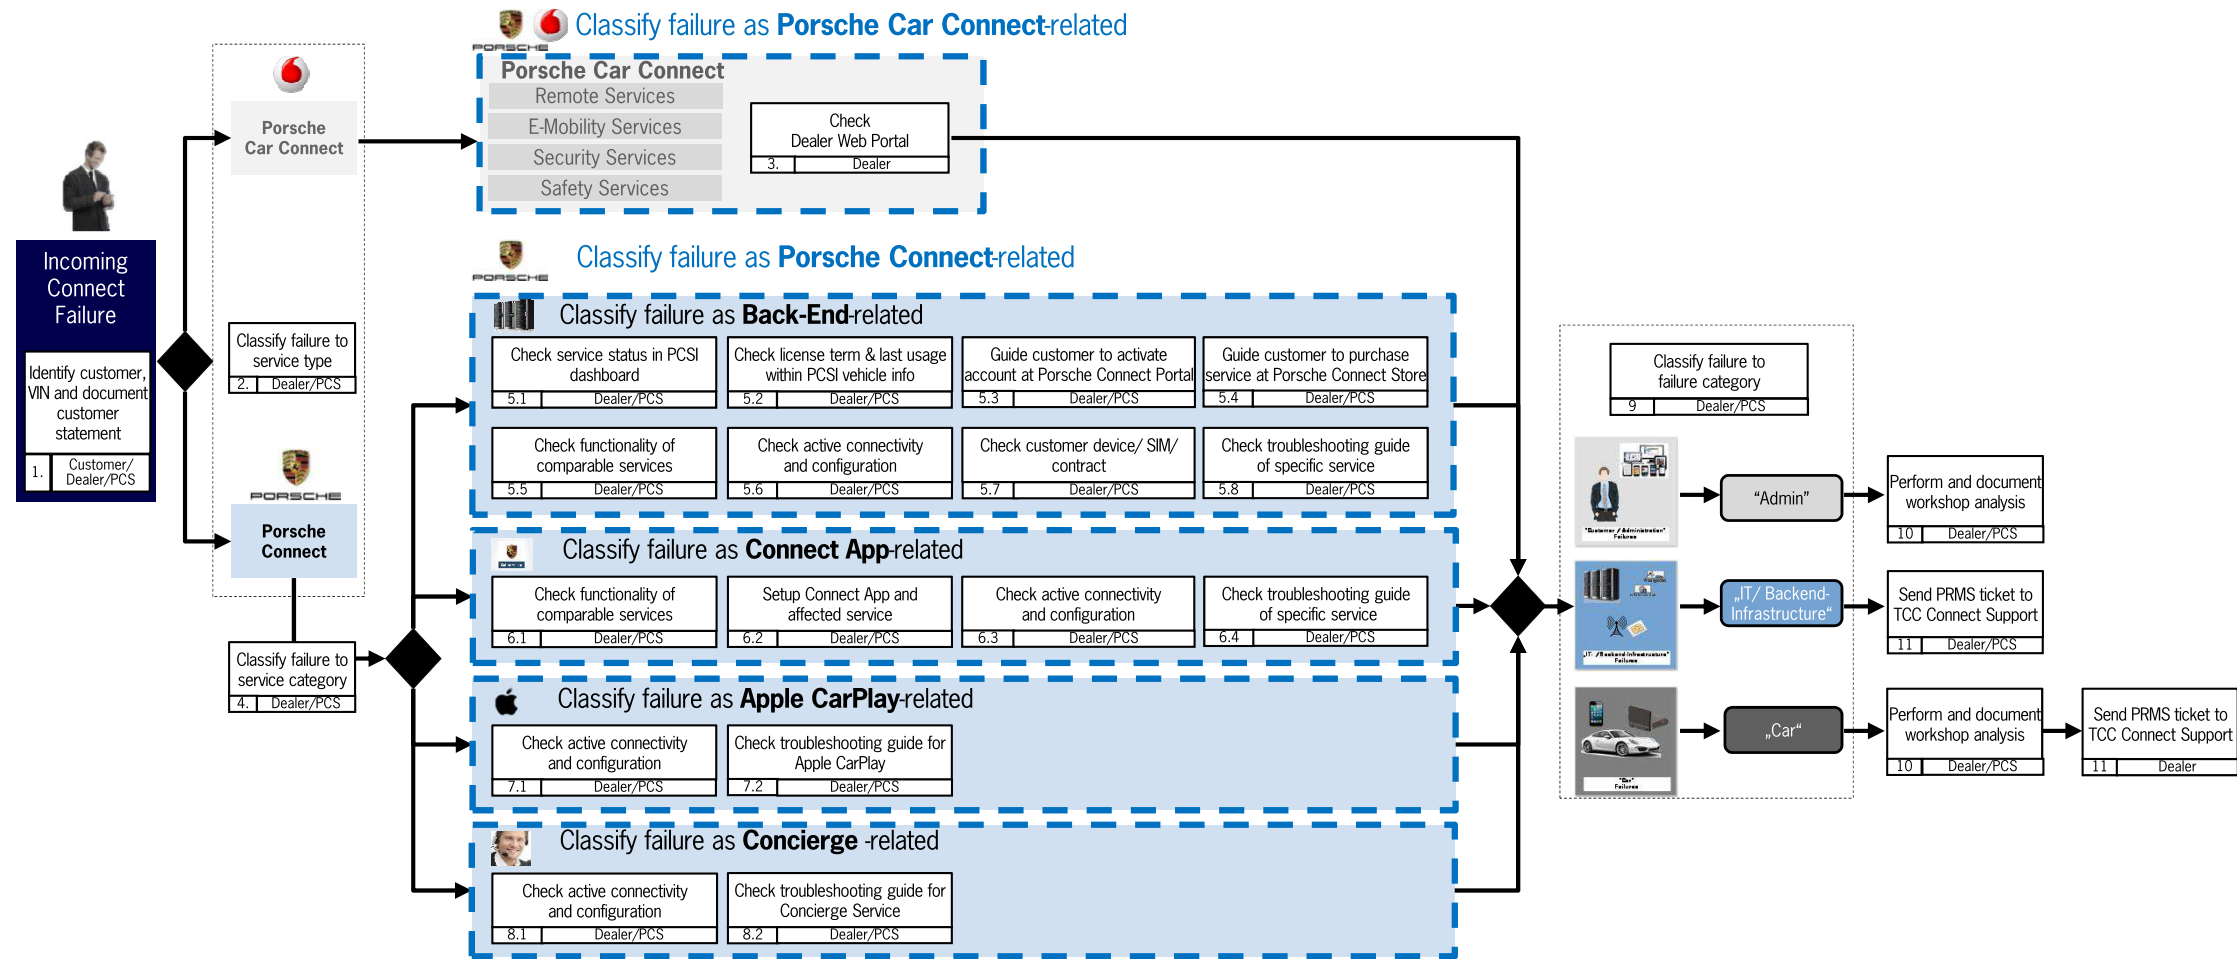


Source: VAM1

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

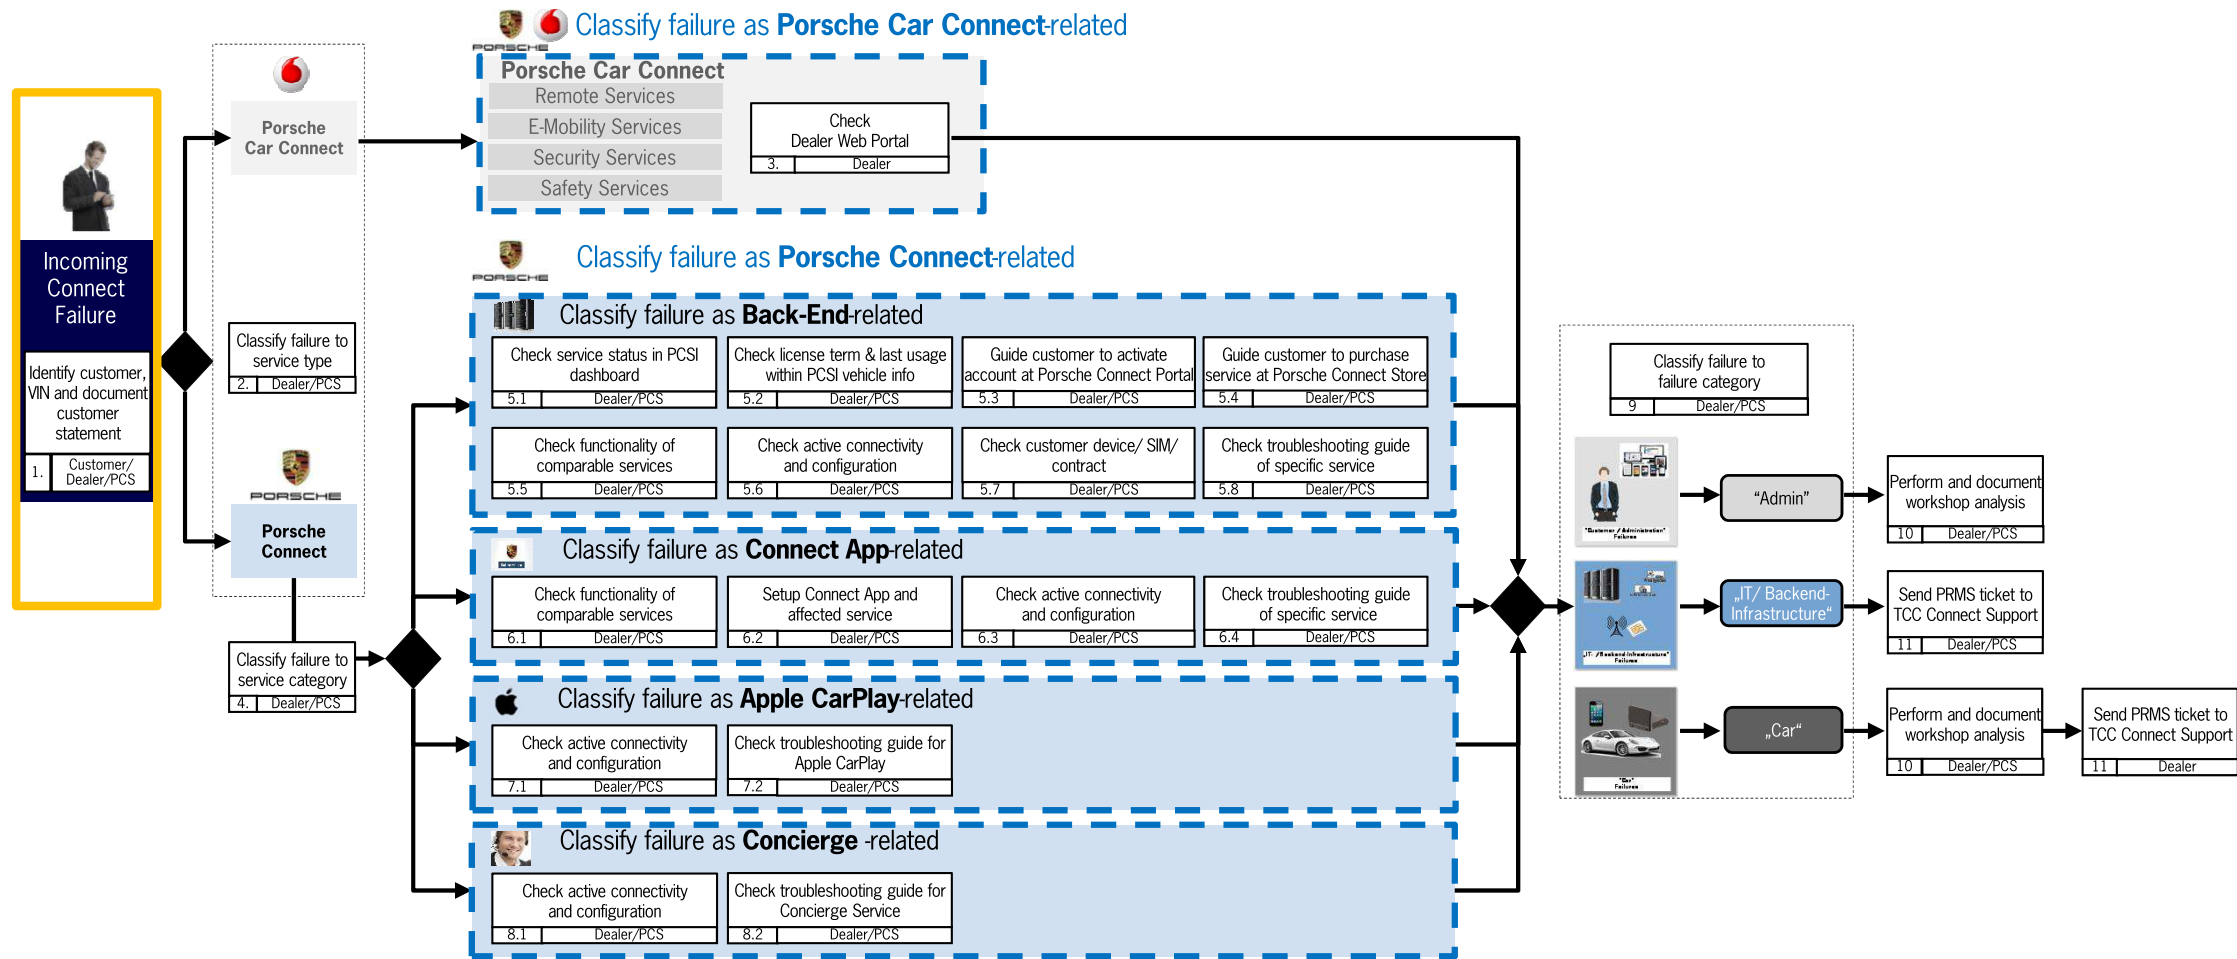

Source: VAM1

Who is the Customer? Which vehicle is affected?

→ Identify customer, VIN and document customer statement

1

2

3

4

Please note: For documentation please use the available standard systems (C@P, PQIS).

PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

In the first step please identify the customer and/ or the corresponding vehicle VIN using following sources:

- 1 VIN available on windshield of customer's car
- 2 Customer provides identification data during call
- 3 VIN or customer ID to be entered in PCSI. Further specific information will be available i.e. Dashboard, Vehicle information etc.
- 4 Alternative: If VIN/ customer ID cannot be provided by customer, further research can be performed in C@P, if access is granted


→ Customer identified
Statement documented

**Classify failure to
service type**

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

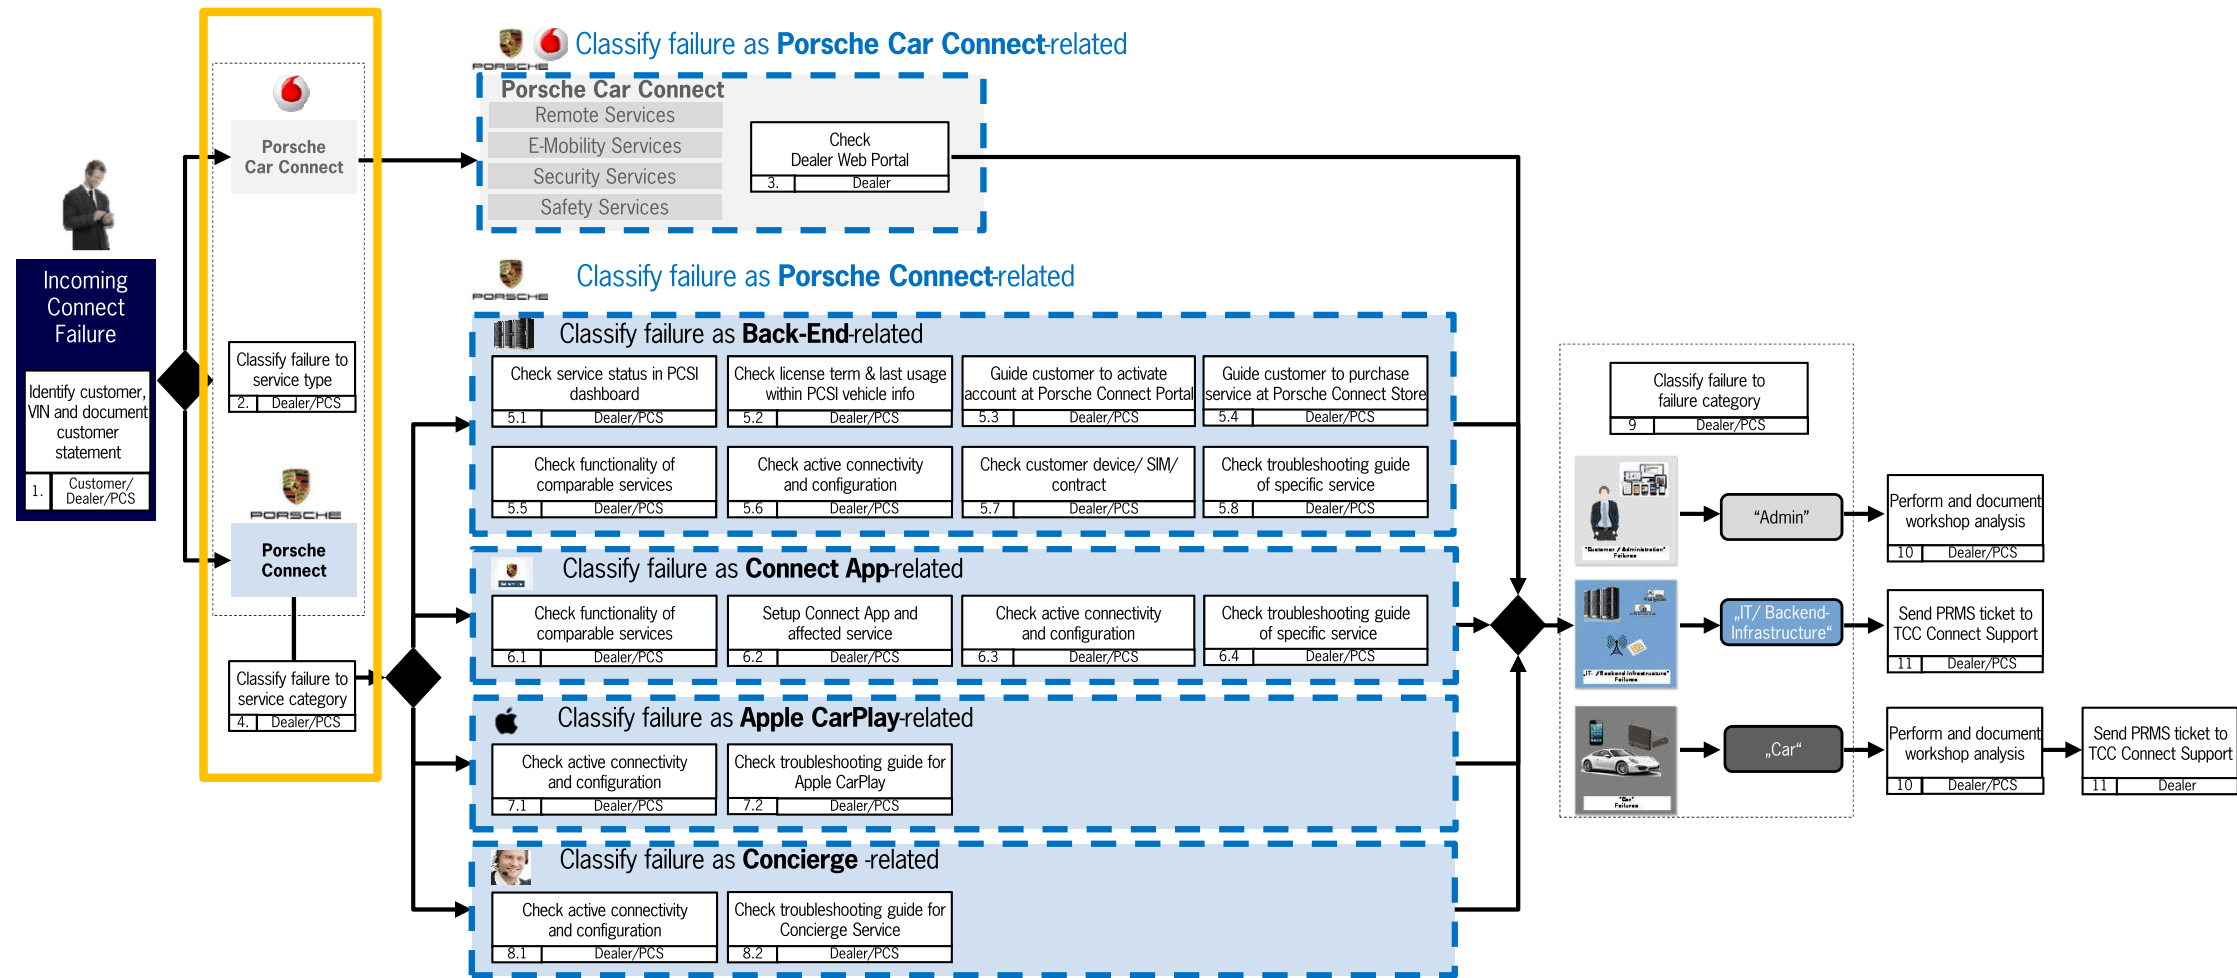

Source: VAM1

Is a Porsche Connect or a Porsche Car Connect service affected?



→ Classify failure to service type

PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

Porsche Connect Service types

Porsche Connect

Porsche Car Connect

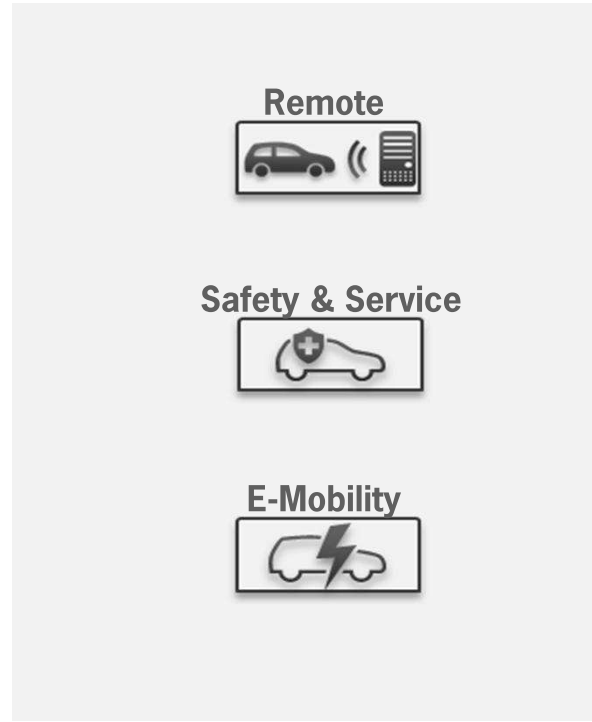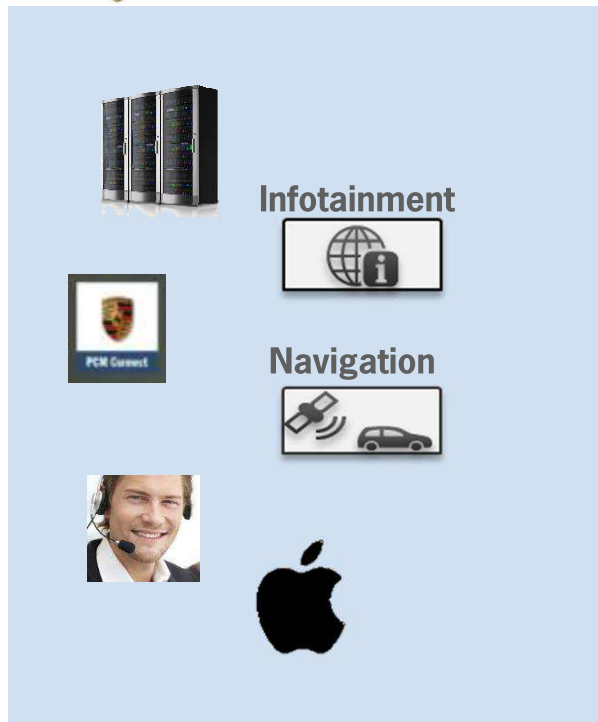

Please note: Classifying failures to service types will lead to different failure diagnosis paths.

Please classify the affected service to a service type:

- Porsche Connect Services**
 - Porsche Connect Services are being offered and supported by Porsche
- Porsche Car Connect Services**
 - Car Connect Services are currently being offered and supported in cooperation of Porsche and Vodafone Automotive

 Porsche Connect

 Porsche Car Connect


Classify Porsche Connect service category

Check Dealer Web Portal

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

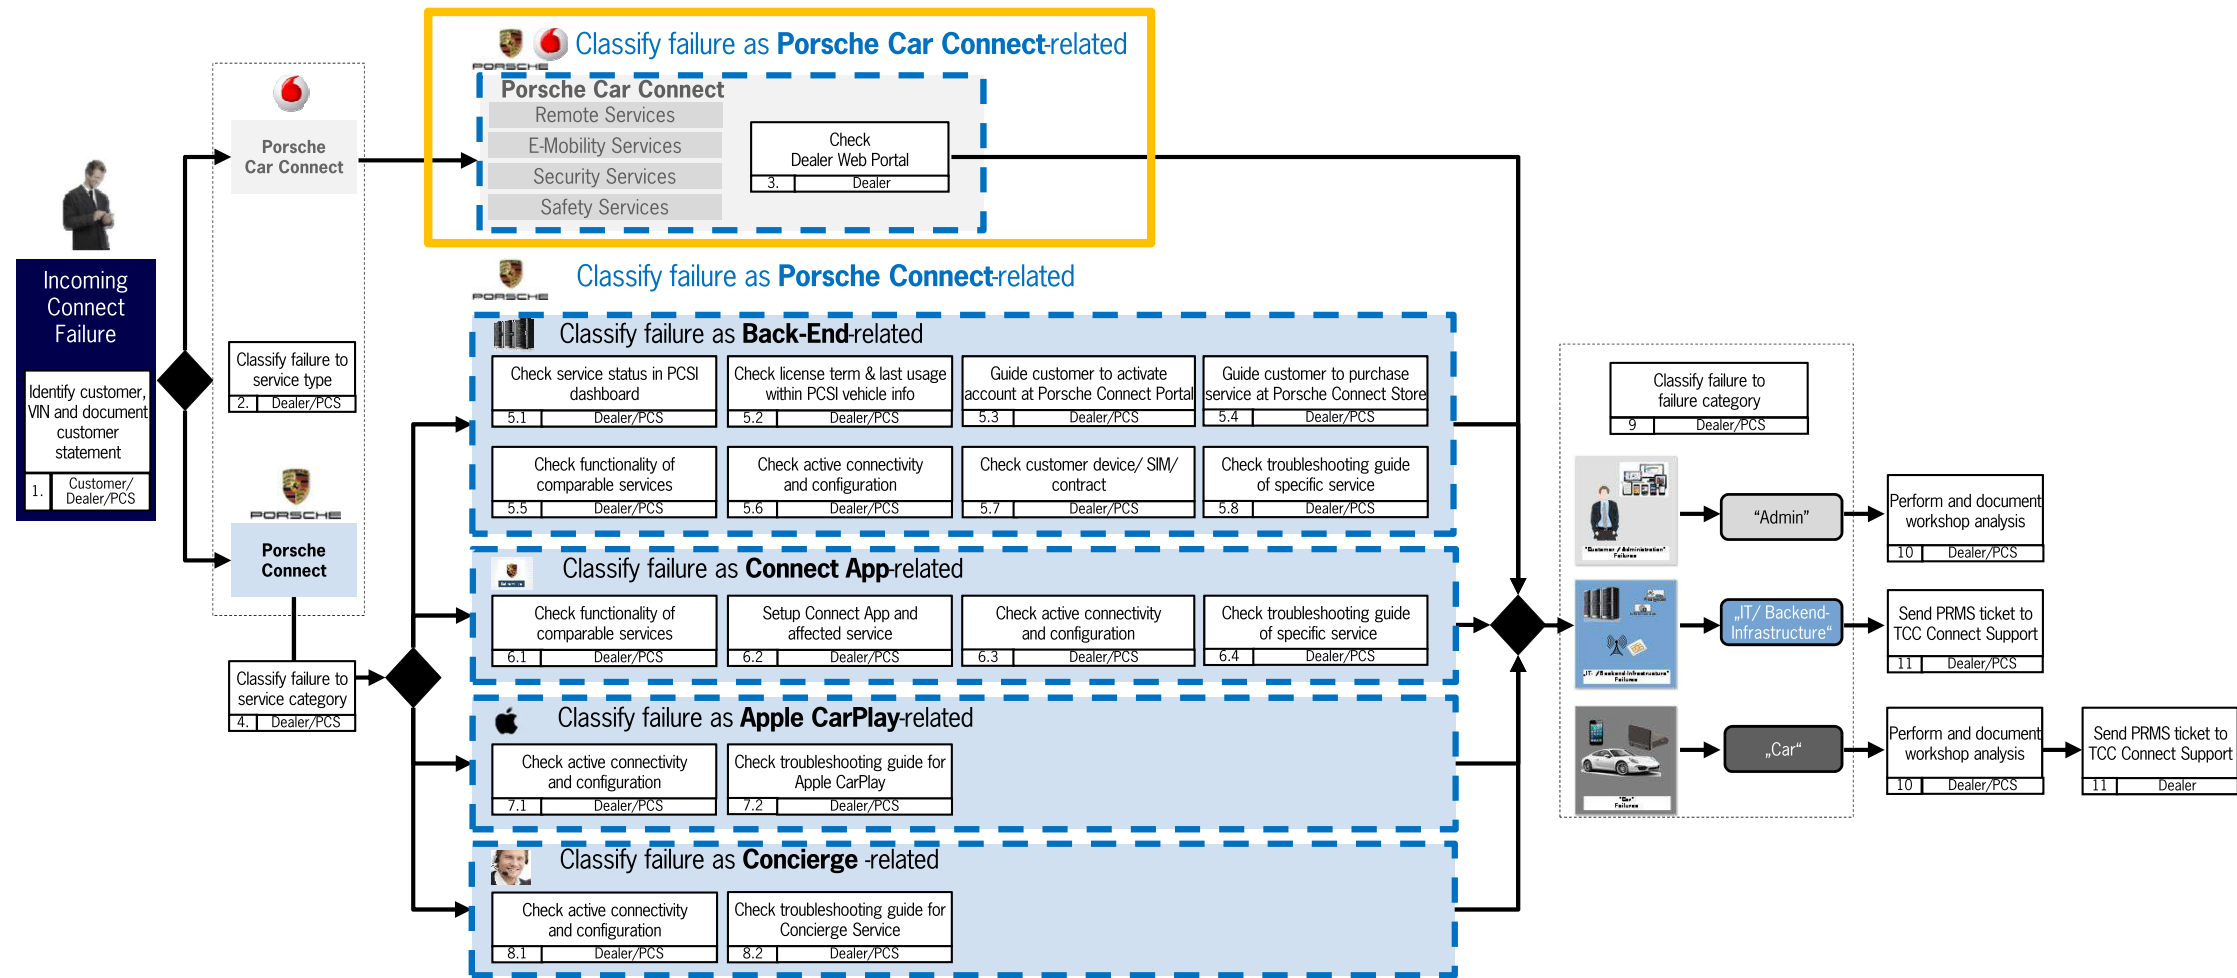

Source: VAM1

Where can further information on Porsche Car Connect be found?

→ Check (Porsche Car Connect) Dealer Web Portal

Porsche Car Connect

Back-End Service

Connect App Service

Apple CarPlay Service

Concierge Service

PCSI

PRMS

PQIS (Lite)

C@P


Connect Portal

Connect Store

Customer

Dealer

PCS

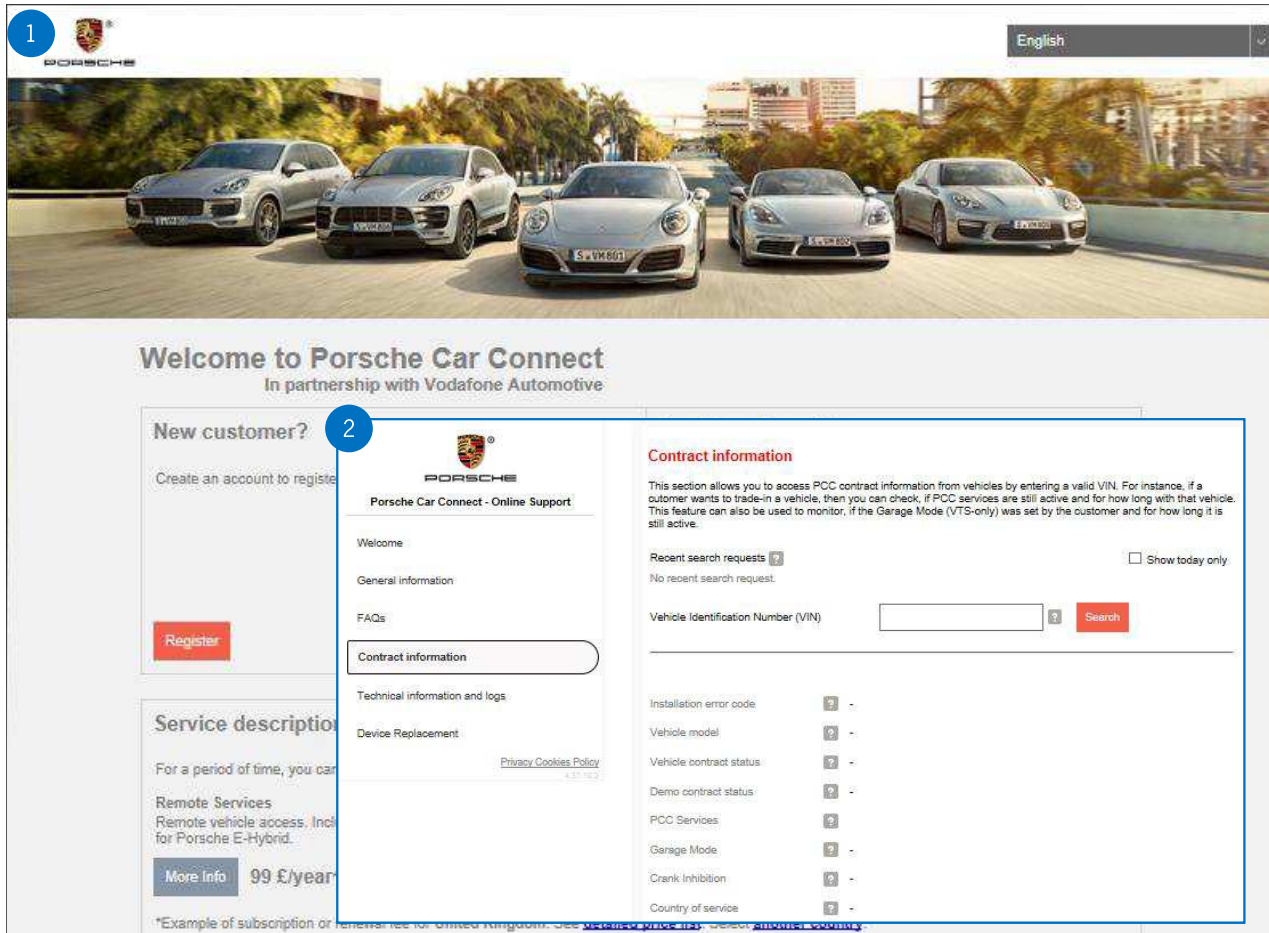

Information on Porsche Car Connect-related failures can be found within the Dealer Web Portal. Precondition for specific customer/ vehicle information on Dealer Web Portal is the VIN. Beside this, there are FAQ's and general information on Porsche Car Connect.

1 Dealer Web Portal

2 Example: Contract information within Dealer Web Portal


➔ Issue not solved

Classify failure to failure categories

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

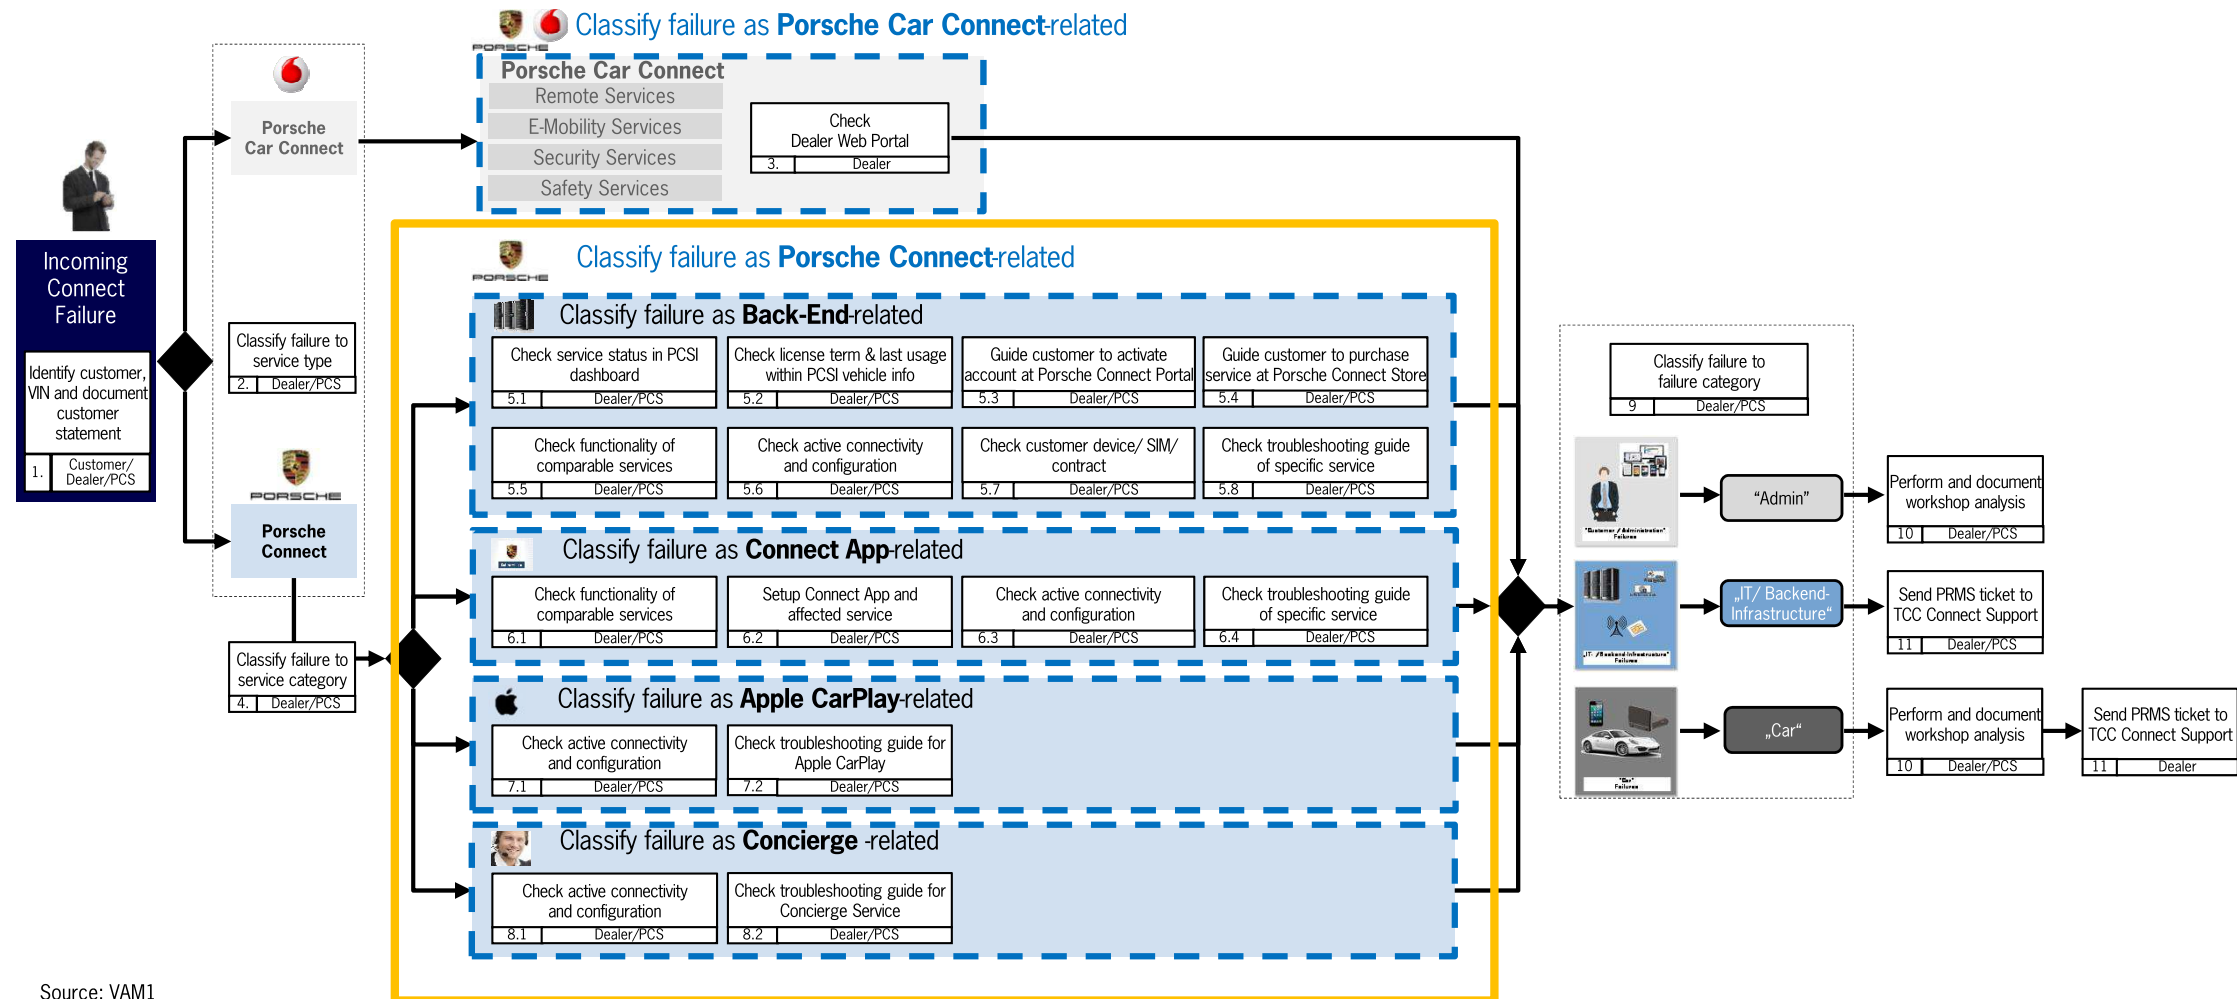

Source: VAM1

Which service category is affected?

→ Classify failure to Porsche Connect service category

Porsche Connect Service categories



Back-End Services

- Real Time Traffic Info
- POI Search
- Google Earth
- Google Street View
- Parking Information
- Petrol Stations
- eCharging Stations
- Event Information
- SMS Dictation
- Weather Information
- Train Information
- Flight Information
- News
- Twitter
- Personal POI
- POI Upload
- POI Voice Search
- Map Update



Connect App Services

- App POI
- Calendar
- Radio.net
- Napster
- Online Search
- Contacts
- Pictures
- RTTI in App



Apple CarPlay Services

- Maps
- Telephone
- Music
- News
- Voice control
- Podcasts
- 70+ CarPlay Services



Concierge Service

- Destination upload & general information services

Please note: Concierge Service is currently available in China & Japan.

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

The failure analysis path will differ depending on the result of this initial analysis step.

Following service categories are available:

- 1 **Back-End Services**
- 2 **Connect App Services**
- 3 **Apple CarPlay Services**
- 4 **Concierge Services**
- 5 **Verify that single service or service category is available in the required country.**



Back-End Service

Check service status in PCSI dashboard



Connect App Service

Check connectivity and configuration



Apple CarPlay Service

Check connectivity and configuration




Concierge Service

Check connectivity and configuration

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

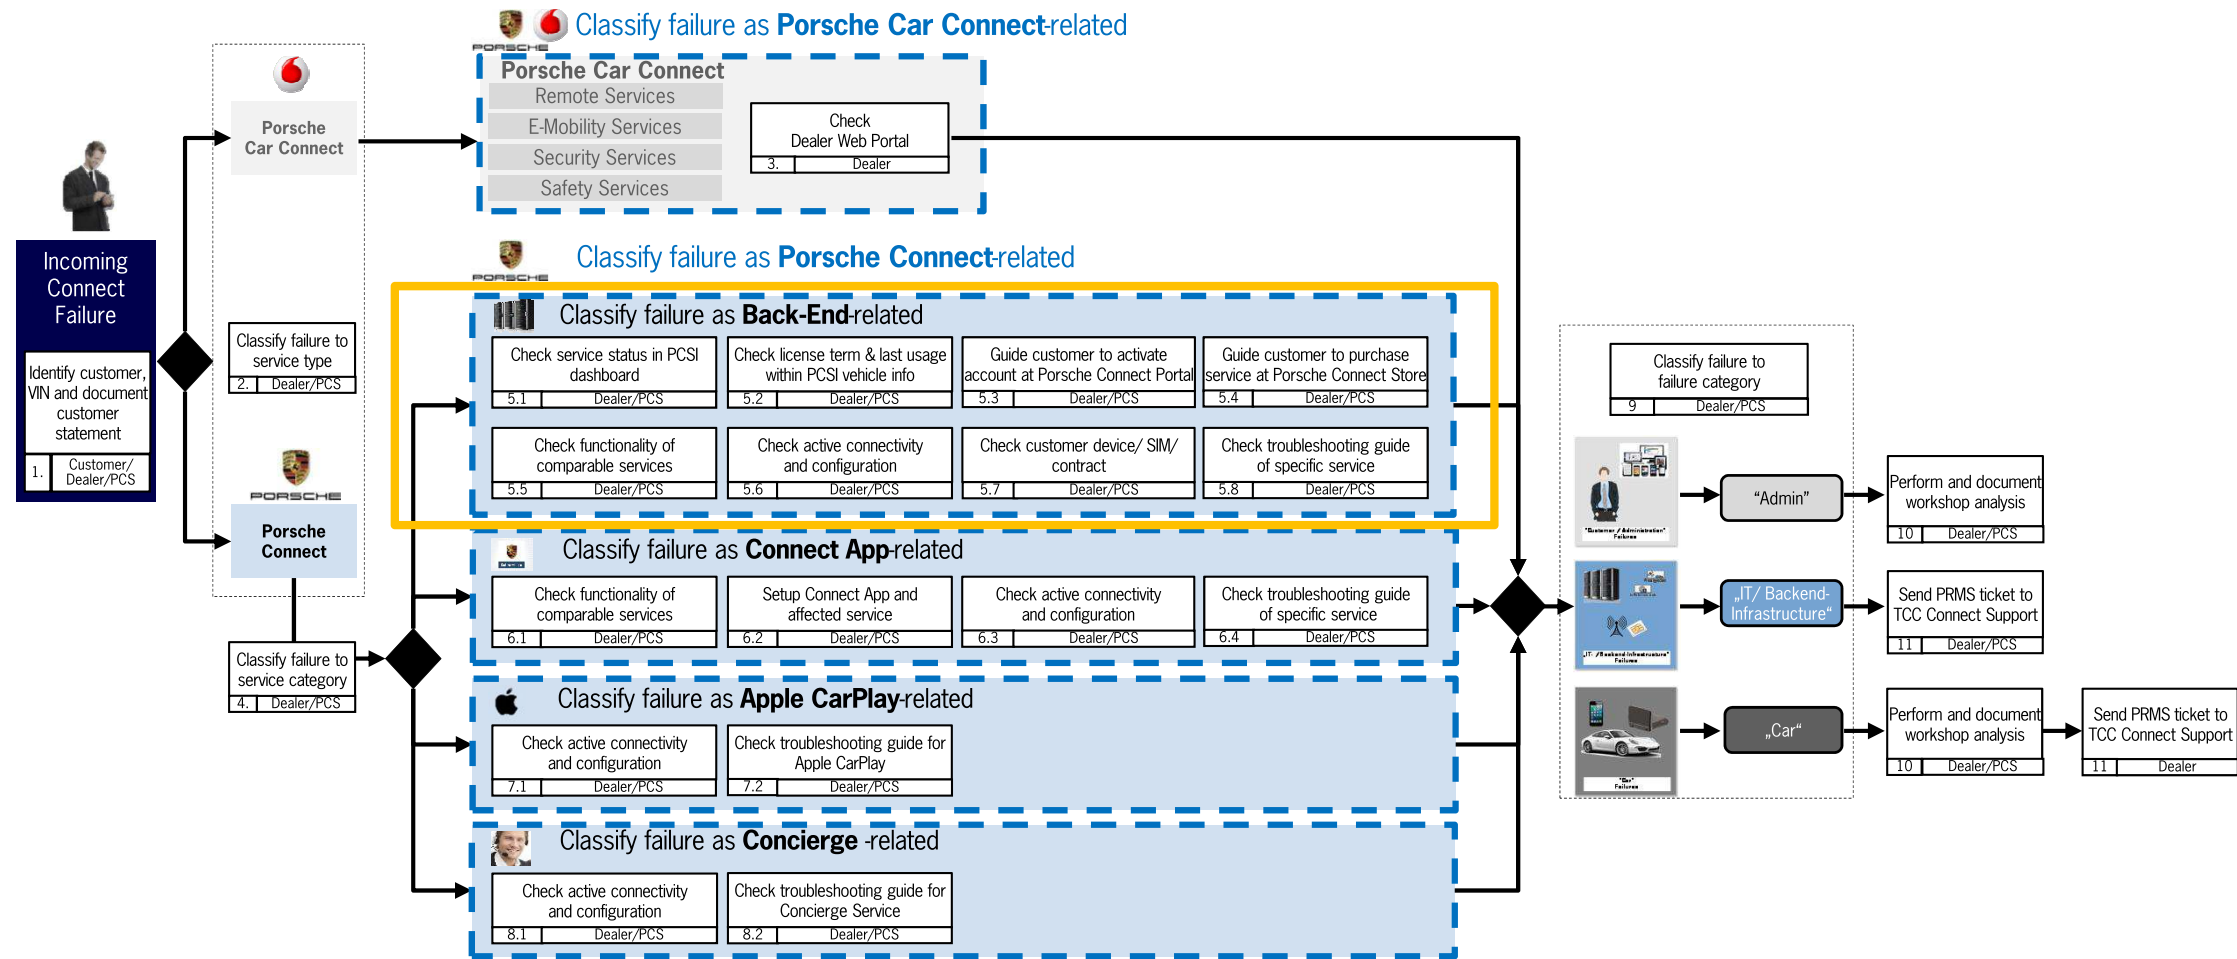

Source: VAM1

What is the system/ service status? Are there known issues?

→ Check service status in PCSI dashboard

Dashboard (3) Information media (1) Vehicle information (1)

Overview System Log Service Log General Hints Log

Systems (4)

- Connect Portal
- Connect Store
- Customer Data
- MBB
- Service Information
- Vehicle Information

Services (5)

- news_v3
- weather_v3

All other services are available

General Hints (6)

- 02 customers have been informed about the new LTE speed in southern Germany.
- The webshop is currently undergoing maintenance updates and longer loading times are expected.
- Fallback Language Hint Error

Contact Centre Support Information

Name Porsche Connect Support USA

E-mail jan.gelbach@porsche.de

Telephone Number +1 23 45678890

Porsche Car Connect

Dashboard Porsche Car Connect >

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer	Dealer	PCS			

To verify the availability of Porsche Connect Back-End Services there is the option to check the PCSI “Dashboard”, where system and service availability is visualized by traffic lights. In case of inactive service/ system further information might be available within the section “General Hints”.

- 1 Open PCSI
- 2 Enter VIN and click “Filter”
- 3 Check “Dashboard”
- 4 Check “Systems” status
- 5 Check “Service” status
- 6 Check “General Hints”

→ All systems/ services green → Status red & General Hint

Check licence term/ last usage in PCSI

Communicate issue to customer

→ Status red & No General Hint → Service not available

Send PRMS ticket to TCC Support

Check licence term/ last usage in PCSI

Connect Service license term expired? Service already used?

→ Check license term & last usage within PCSI vehicle information

OPTION 1: Via PCSI

The left screenshot shows the PCSI system interface with a yellow warning message: "The customer hasn't completed the Porsche Connect Service activation within the Porsche Connect Portal." The right screenshot shows a table of services with their expiration dates and last service use.

Status	Service Name	Expiration date	Latest service use
✓	streetview_v1 - GOOGLE® Street View	12/20/2017 12:00 AM	—
✓	poi_v2 - Online Suche	12/20/2017 12:00 AM	—
✓	traffic-online_v1 - Echtzeit-Verkehrsinformationen	12/20/2017 12:00 AM	—
✓	satelitemaps_v1 - GOOGLE® Earth	12/20/2017 12:00 AM	—
✗	poi_v1 - POI Sprachsuche	—	—
✗	parkinfo_v3 - Parkplätze	—	—
✗	otacunav_v1 - Online Kartenupdate	—	—
✗	flightinfo_v3 - Flugauskunft	—	—
✗	weathergrid	—	—

OPTION 2: Via PCM

PCM 4.1

The screenshot shows the PCM 4.1 interface with a list of services and their expiration dates:

Service	Expiration date
Parkplätze	bis 01.01.2016
Google Earth	bis 01.01.2016
Twitter	bis 01.01.2016
Zieleinspeisung	bis 01.01.2016
Online-Suche	bis 01.01.2016
Echtzeit-Verkehr	bis 01.01.2016
Event Info	bis 01.01.2016
Benzinpreise	bis 01.01.2016
Zugauskunft	bis 01.01.2016

PCM 4.0

The screenshot shows the PCM 4.0 interface with a list of services and their expiration dates:

Service	Expiration date
Google Earth	until 18.01.2017
Web Search	until 18.01.2017
Realtime Traffic Inform	until 18.01.2017
Google Street View	until 18.01.2017

Please note: The initial start-up should be performed during physical handover of vehicle by dealer & customer. Thereby dealer demonstrates the activation and usage of Porsche Connect Services.

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

To verify, if the vehicle is registered at Back-End server a VIN has to be entered in PCSI. VIN related services, their "Expiration date" and information on "Last Service use" will then be shown within the section "Vehicle information". Furthermore, customer has the ability to check the licenses by himself within the PCM.

OPTION 1: Via PCSI

- 1 Open PCSI
- 2 Enter VIN
- 3 Select tab "Vehicle Information"
- 4 Select section "Porsche Connect"
- 5 Check license information, "Expiration date"
- 6 Check last service usage
- 6 If activation has not been performed, a hint will show up

OPTION 2: Via PCM

➡ License ok, usage ok, no funct. ➡ License ok, no usage

Check functionality of comparable services

Guide customer to activate account at Porsche Connect Portal

➡ License (nearly) expired

Guide customer to purchase service at Porsche Connect Store

➡ Service/ license not available

Classify failure to failure category

Has the account at Porsche Connect Portal been activated?

→Guide customer to activate account at Porsche Connect Portal

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

1

2

3

4

5

On purchasing Porsche Connect, the customer receives an automated invitation mail to log on the Porsche Connect Portal. Only after registration and accepting the terms & conditions, the customer can use, buy or renew these services. Otherwise Back-End Services will not be activated.

- 1 Follow the activation link to Porsche Connect Portal (embedded in the invitation eMail)
- 2 Request and enter SMS code
- 3 Accept the Porsche Connect “terms of use” and “data protection guidelines” as a mandatory requirement
- 4 Activate services by accepting “general terms and conditions”
- 5 Check service availability in PCSI again

→ Activation ok

Check licence term/
last usage in PCSI

Please note: The appearance and invitation of the Porsche Connect Portal may differ according to different model lines.

Has the service already been purchased at Porsche Connect Store?

→ Guide customer to purchase service at Porsche Connect Store

Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal
Customer	Dealer	PCS		

1 Filter

2 WPOZZ97ZHL120105

911 Carrera S Cabriolet, 2017, 991320

Service: [dropdown]

Date from: [calendar] Date to: [calendar]

DE - Germany [dropdown]

Filter > Reset ✕

Porsche Connect

Porsche Car Connect

Dashboard Porsche Car Connect >

Porsche Connect

Status	Service Name	Expiration date	Latest service use
☒	traffic-online_v1 - Real Time Traffic Information	20/12/2017 00:00	—
☒	satellitemaps_v1 - GOOGLE® Earth	20/12/2017 00:00	—
☒	streetview_v1 - GOOGLE® Street View	20/12/2017 00:00	—
☒	poi_v2 - Online Search	20/12/2017 00:00	—

4 Porsche.com > Porsche Connect Store

Suchbegriff eingeben

Porsche Connect Store Hilfe

Alle Produkte anzeigen

Kann Fahrzeug ausgewählt

Echtzeit-Verkehrsinformation

Dienst

ab 5,00 € / Tag

Dienst nur an Dienstpaket erhältlich

Dieses Angebot ist erhältlich ab Oktober 2016 für bestimmte Porsche Modelle mit der Ausstattungsoption Connect Plus.

Enthalten in: Dienstpaket Navigation & Infotainment Services

Im Dienstpaket Navigation & Infotainment Services

Galerie Beschreibung

6 Porsche Connect

Porsche Car Connect

Dashboard Porsche Car Connect >

Porsche Connect

Status	Service Name	Expiration date	Latest service use
☒	traffic-online_v1 - Real Time Traffic Information	20/12/2017 00:00	—
☒	satellitemaps_v1 - GOOGLE® Earth	20/12/2017 00:00	—
☒	streetview_v1 - GOOGLE® Street View	20/12/2017 00:00	—
☒	poi_v2 - Online Search	20/12/2017 00:00	—

Connect Services can be purchased within the Porsche Connect Store. Guide user to the specific section of the Porsche Connect Store and the purchasing options of the Connect Service.

- 1 Open PCSI
- 2 Enter VIN (or other identification data)
- 3 Click on Connect Service in PCSI vehicle info
- 4 Pop-up opens to Porsche Connect Store
- 5 Purchase Connect Service (future option)
- 6 Check service availability in PCSI again

➡ Purchase ok, function not ok


Check functionality of comparable services

Please note: Only relevant in future after “inclusive customer and dealer license periods” have expired.


Check, if just one or several comparable services are affected?

→ Check functionality of comparable services

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

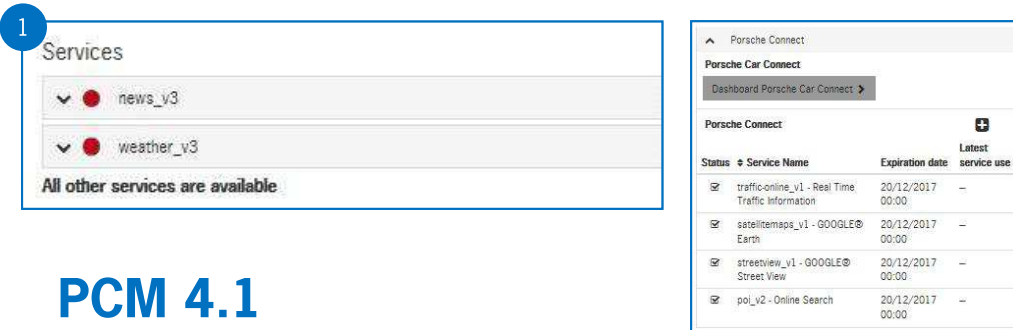

PCM 4.1

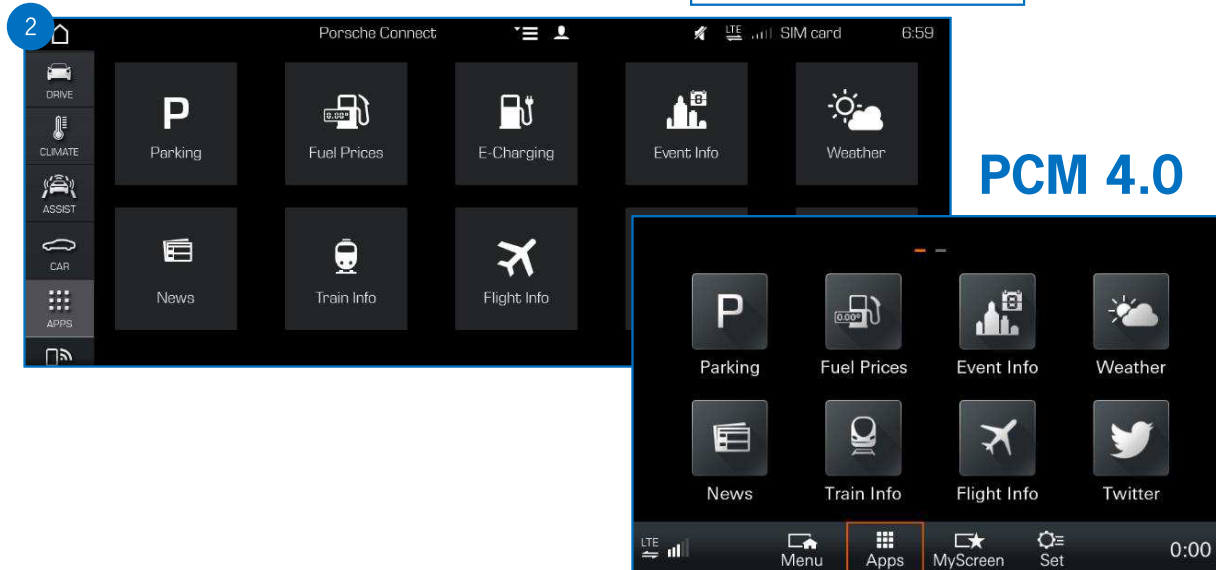

PCM 4.0

For further analysis of the issue it is necessary to check the behavior of other similar/ comparable services within a specific service category.

- 1 Check status of comparable services in PCSI
- 2 Check functionality of comparable services in PCM

→ Single service affected

Check troubleshooting guide of specific service


→ Several services affected

Check active connectivity and configuration


Are connectivity and PCM settings correct?

→ Check active connectivity and configuration

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

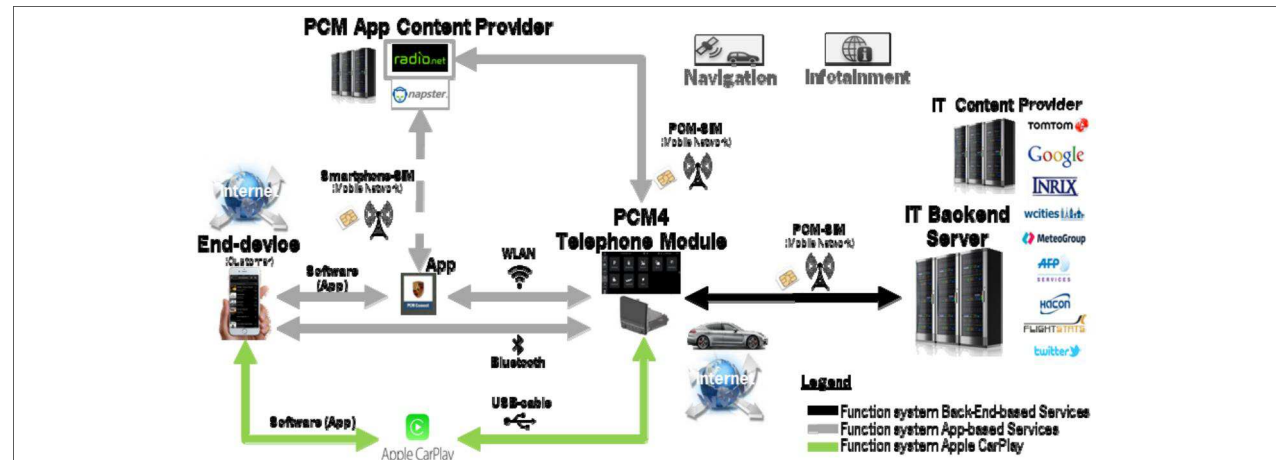

PCM 4.1

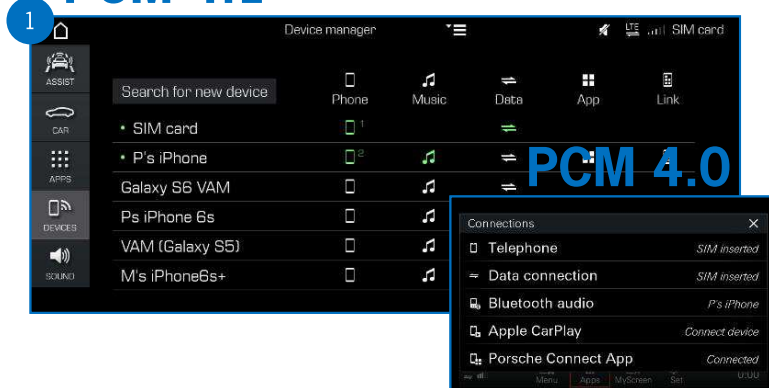

Please Note: In this case please verify, if the connection between PCM and Back-End server is established via a PCM-SIM card (mobile network) or mobile hotspot (customer device).

To check the connectivity of Porsche Connect Services there are several options:

- 1 Check PCM "Connections/Device Manager":**
 - The Device Manager of the PCM shows the different active and inactive connection types. Depending on the Service category there are different connection requirements/ options.
- 2 Check Connectivity**
 - Verify the configuration and active connectivity status, "Customer SIM card" or "Embedded eSIM" functionality of PCM. Verification by use of the PCM "Device Manager". In case of no connectivity replace SIM or, with embedded eSIM, compare connectivity with an external SIM card or use an Smartphone hotspot.
- 3 Check Owner's Manuals**
 - The manuals precisely describe how to use the different connection types and the Connection Manager.

→ Connectivity ok

Check customer device/
SIM/ contract

Is data rate limited? Has data volume been used up?

→ Check SIM / eSIM or customer device, contract and data packages

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

PCM 4.1

1

Check data rate within PCM network symbol

PCM 4.0

Check data rate within Smartphone settings

2

Check data volume status via MNO SMS

Check data consumption within phone settings

Verify, purchase/ extend data package (customer's responsibility)

Embedded SIM card

If a Porsche Connect failure occurs sporadically the following issues might be the cause:

- 1 Connection & data rate**
 - The data rate and online connectivity can be checked via the network symbol on the PCM. As online connectivity data rates can be influenced by a large number of factors it is recommended to use services with 3G or LTE data rates.
- 2 SIM Contract data, eSIM & data consumption**
 - Usage of online services causes different data consumption. If data volume has almost been used up, the critical status of the monthly data volume is usually being sent by the mobile network operator by SMS.
 - On some mobile devices data consumption can also be checked within phone settings.
 - In case of using an embedded SIM check also the status of availability of "Data packages" for WLAN hotspot and webradio functionality.

→ Customer device/ SIM / contract ok

Check troubleshooting guide of specific service

Please note: There is no option to check data consumption on the PCM.

Are service specific functionalities causing the problem?

→ Check troubleshooting guide of the specific service

1. Open PCSI

2. Enter VIN/ Porsche ID

3. Open tab "Information media"

4. Open tab "Troubleshooting guide"

5. PCS: Access via knowledge database

6. Dealer: Access via PIWIS information media

6 Troubleshooting guides can be found within PIWIS Information media (Workshop Manual).

Please note: Troubleshooting guides will also be available in PIWIS (repair group 9940 as workshop manual).

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

To analyze the failure cause of a single application in detail, it is recommended to check the service-specific troubleshooting guide.

- 1 Open PCSI
- 2 Enter VIN/ Porsche ID
- 3 Open tab "Information media"
- 4 Open tab "Troubleshooting guide"
- 5 PCS: Access via knowledge database
- 6 Dealer: Access via PIWIS information media


➔ Troubleshooting not successful

Classify failure to failure category

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

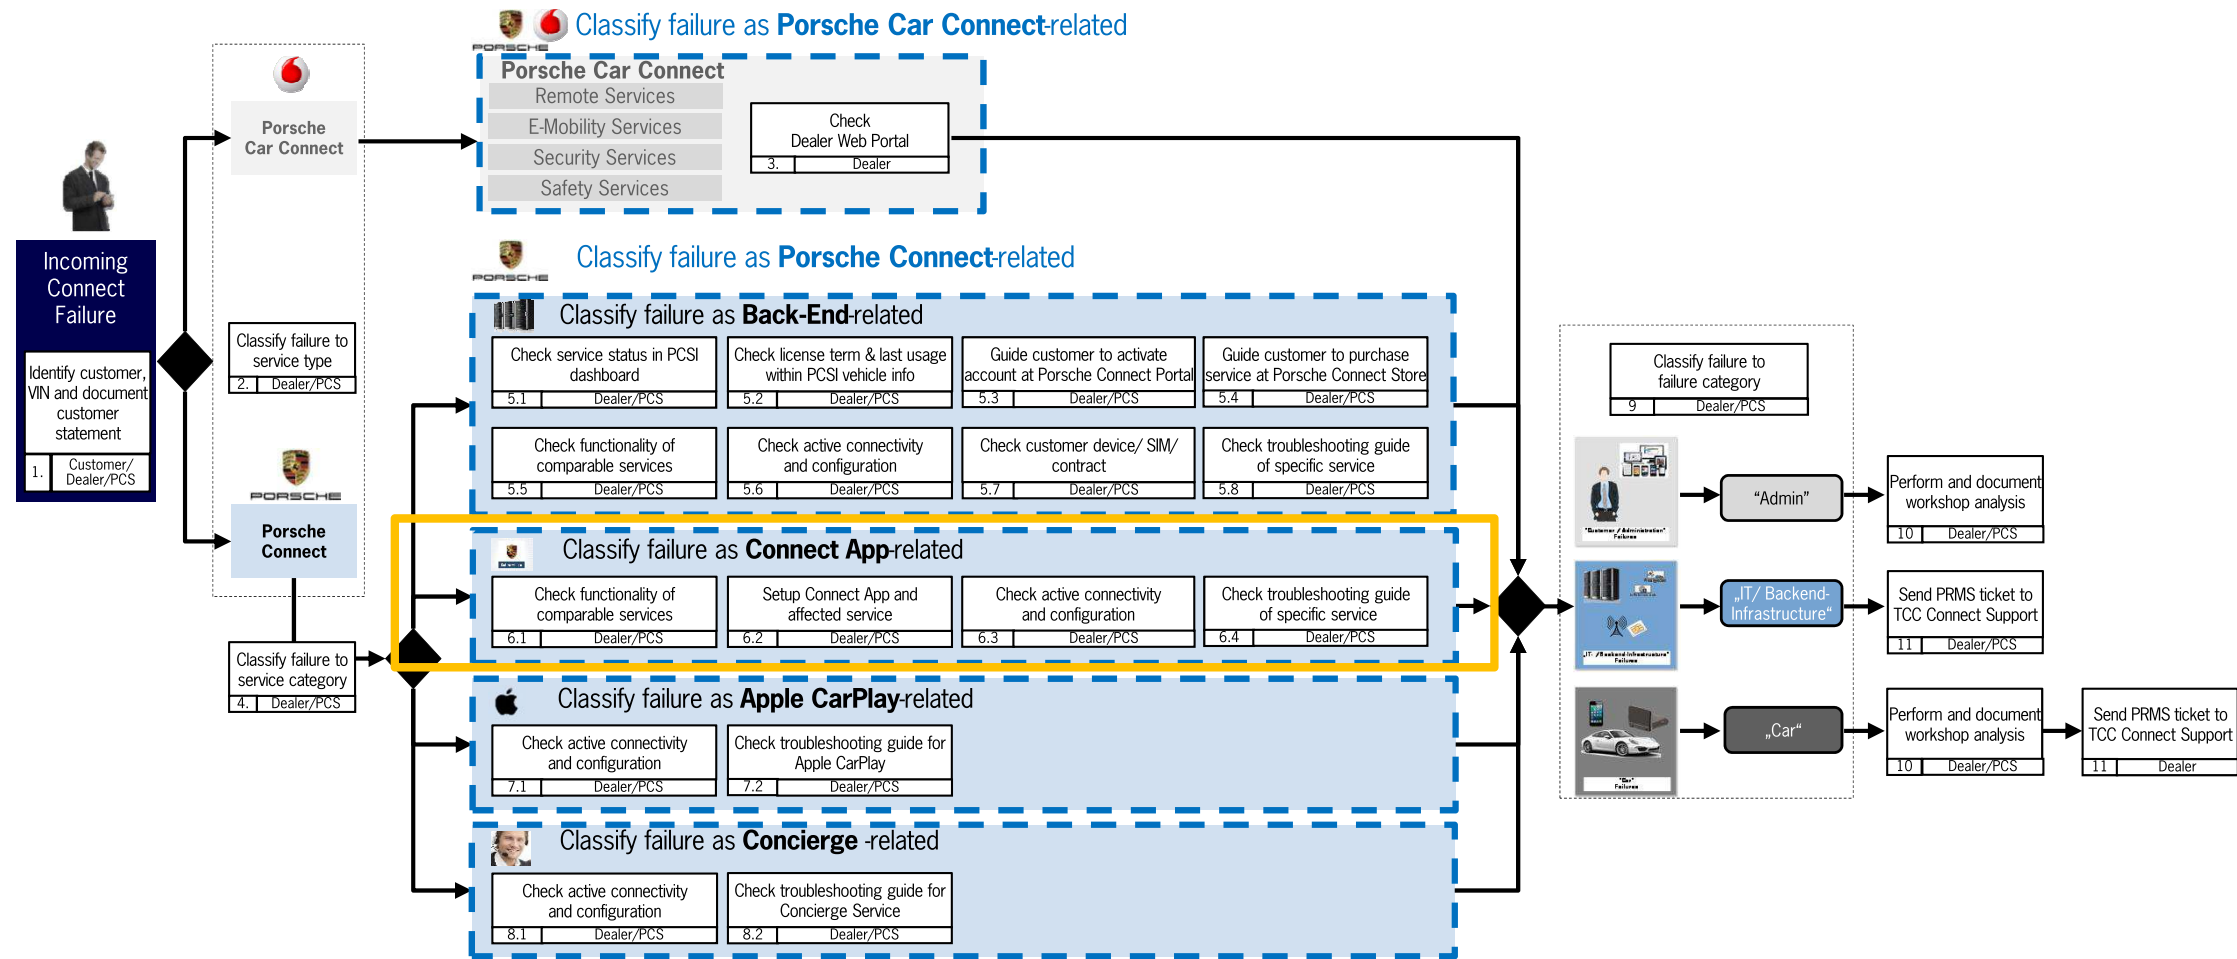


Source: VAM1

Check, if just one or several comparable services are affected?

→ Check functionality of comparable services

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

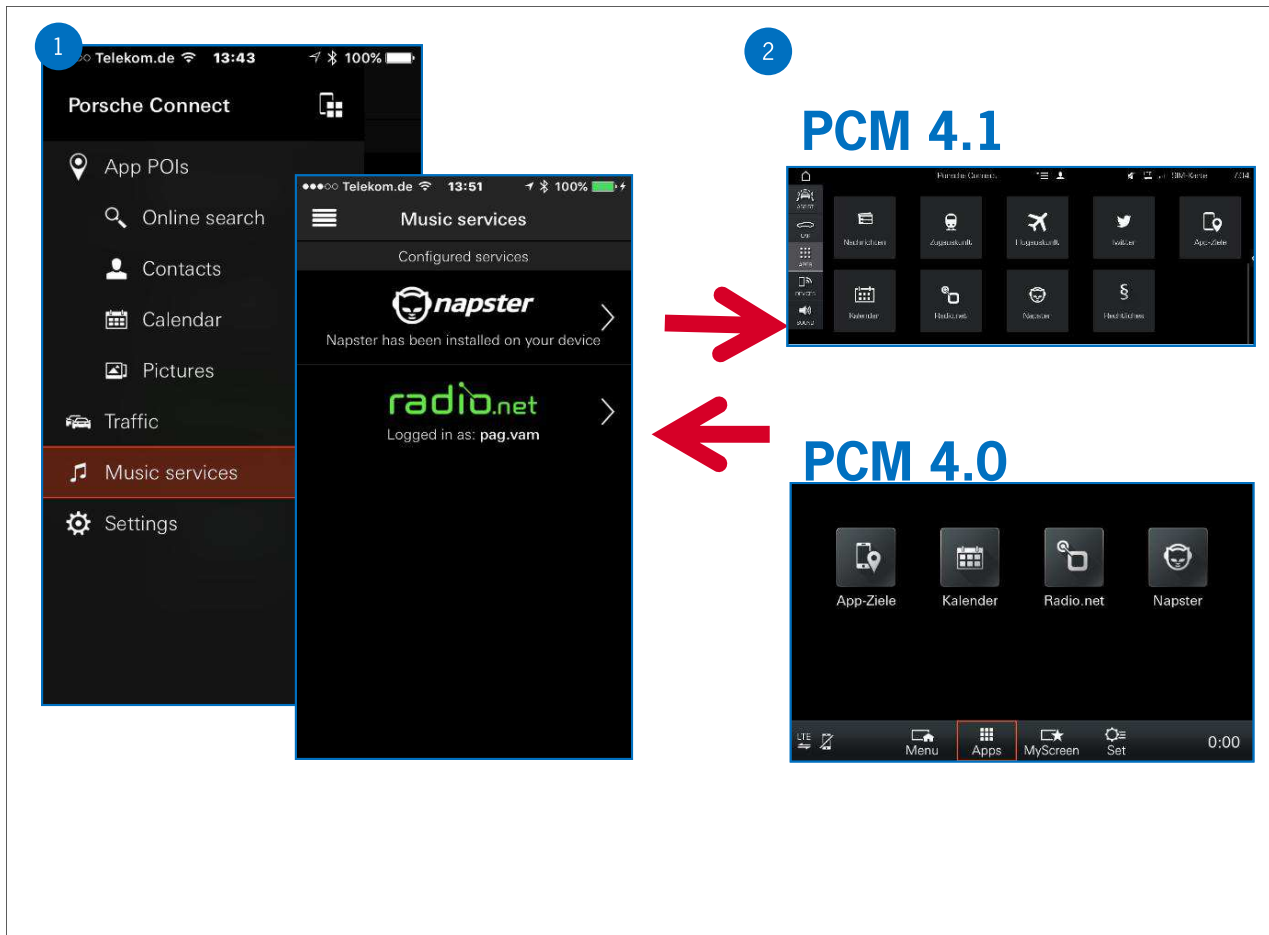

For further analysis of the issue it is necessary to check the behavior of other similar/ comparable services within a specific service category.

- 1 Check functionality of comparable services in Connect App (Example: Music services within Connect App)
- 2 Check functionality of comparable service in PCM

- Single service affected
 - Several services affected
- Check troubleshooting guide for specific service
- Setup Connect App and affected service

Is a correct setup of PCM, Connect App and App Service established?

→ Setup Connect App and affected service

Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal
Connect Store				
Customer		Dealer		PCS

To activate the Connect App-based Services please follow these steps:

- 1 App Store (Apple) or Play Store (Google/ Android)
- 2 Download "Connect App"
- 3 Install Connect App
- 4 Start Connect App

➡ Setup successful

Check active connectivity and configuration


1. App Store




2. Download



3. Install

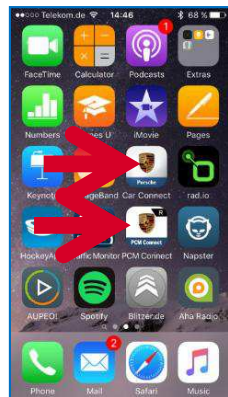


4. Start App

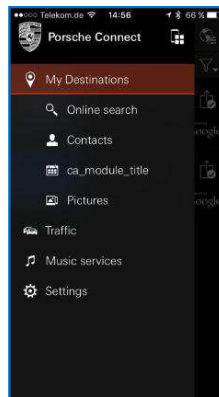

Are connectivity, PCM and App settings correct?

→ Check active connectivity and configuration

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

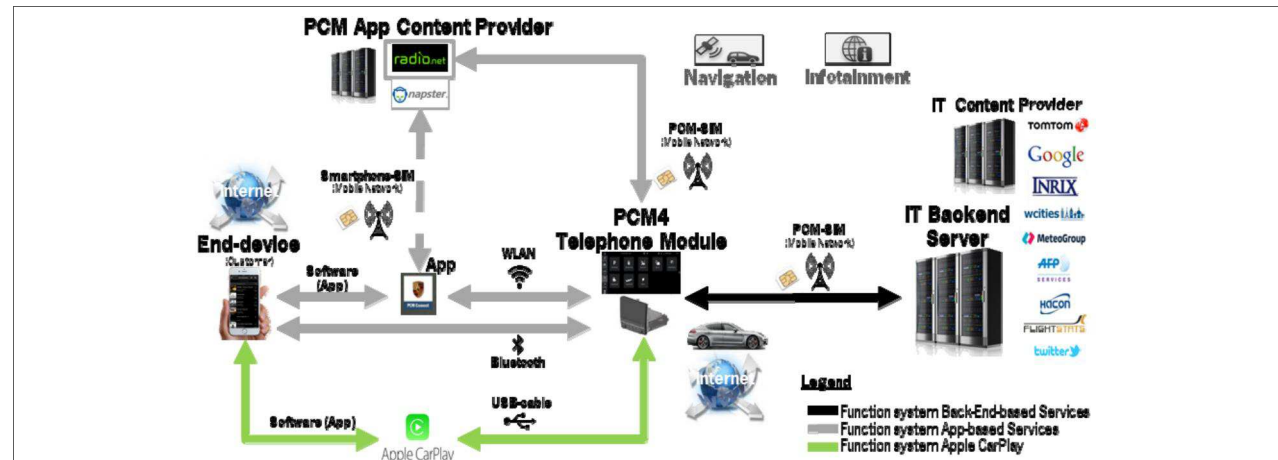

To check the connectivity of Connect App service there are several options:

- Check connection settings and status in Connect App:**
 - Under „Settings“ of Porsche Connect App verify the active/ inactive connection status.
- Check Owner's Manuals**
 - The manuals precisely describe how to use the different connection types and the PCM Connection Manager.

1

2

For internal use only!

Porsche Connect App
The Porsche Connect App enables you to transfer personal PCM (points of interest) and destinations from your mobile phone's address book or calendar to the PCM. You can access music tracks with the music streaming function – once the necessary apps have been installed or you have created an account.

WARNING Setting and operating when driving:
Changing app settings or using the app while driving can distract you from the traffic. You may lose control of the vehicle.
• Operate and adjust settings only while the vehicle is stationary.

Information
For information on operating the Porsche Communication Management (PCM):
• Refer to chapter "Operating the Porsche Communication Management (PCM)" on page 217.

Connecting Porsche Connect App to PCM using WiFi and opening in PCM

- ✓ Porsche Connect App is installed on your mobile phone (Download from Apple® App Store or GOOGLE® Play Store).
- ✓ Porsche Connect App has been started.
- ✓ WiFi is enabled on the mobile phone.
- Refer to chapter "Configuring WiFi settings" on page 309.

Transferring a navigation destination and calendar entry to the PCM

✓ Porsche Connect App is connected to the PCM.

- In the app, select a navigation destination or calendar entry.
 - Online search: Select destination using the Online search function.
 - Contacts: Select contact incl. address details.
 - Calendar: Select calendar incl. address details.
 - Pictures: Select destination using a stored picture.
- Add the destination to the MyDestinations favourites list using the symbol. Entries that have already been added to the Favourites list are marked by a check.
- If the Porsche Connect App is connected to the PCM, the content of MyDestinations is transferred to the PCM. If necessary, you may have to refresh the PCM display manually using the button MyDestinations → Apps.
- Use the button → Apps → Select My Points of Interest or Calendar.
 - or –
 - button → Stored destinations → Select MyDestinations.
- Start route calculation to the transferred destination.

Information
– You can also view the PCM's WiFi access data by pressing the button → SET PHONE → WiFi settings → Configure WiFi hotspot in PCM.
– For information on the Device Manager:
• Refer to chapter "Device Manager" on page 150.

➔ Connectivity ok

Check troubleshooting guide of specific service

Please Note: In this case please verify, if the WLAN connection between PCM and Smartphone is established and if the Connect App is correctly installed and started.

Are service specific functionalities causing the problem?

→ Check troubleshooting guide of the specific service

The screenshot shows the Porsche Connect support portal. Annotations include:

- 1**: Points to the top right corner of the page.
- 2**: Points to the VIN input field containing 'WPOZZZ97ZHL120105'.
- 3**: Points to the 'Information media' tab in the top navigation bar.
- 4**: Points to the 'Troubleshooting guide' tab in the top navigation bar.
- 5**: Points to a search bar with the text 'Show troubleshooting guide within the knowledge database.'.
- 6**: Points to a dropdown menu in the bottom left corner, specifically to the 'Information media' option. A text box next to it states: 'Troubleshooting guides can be found within PIWIS Information media (Workshop Manual)'.

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

To analyze the failure cause of a single application in detail, it is recommended to check the service-specific troubleshooting guide.

- 1 Open PCSI
- 2 Enter VIN/ Porsche ID
- 3 Open tab "Information media"
- 4 Open tab "Troubleshooting guide"
- 5 PCS: Access via knowledge database
- 6 Dealer: Access via PIWIS information media


➡ Troubleshooting not successful

Classify failure to failure category

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

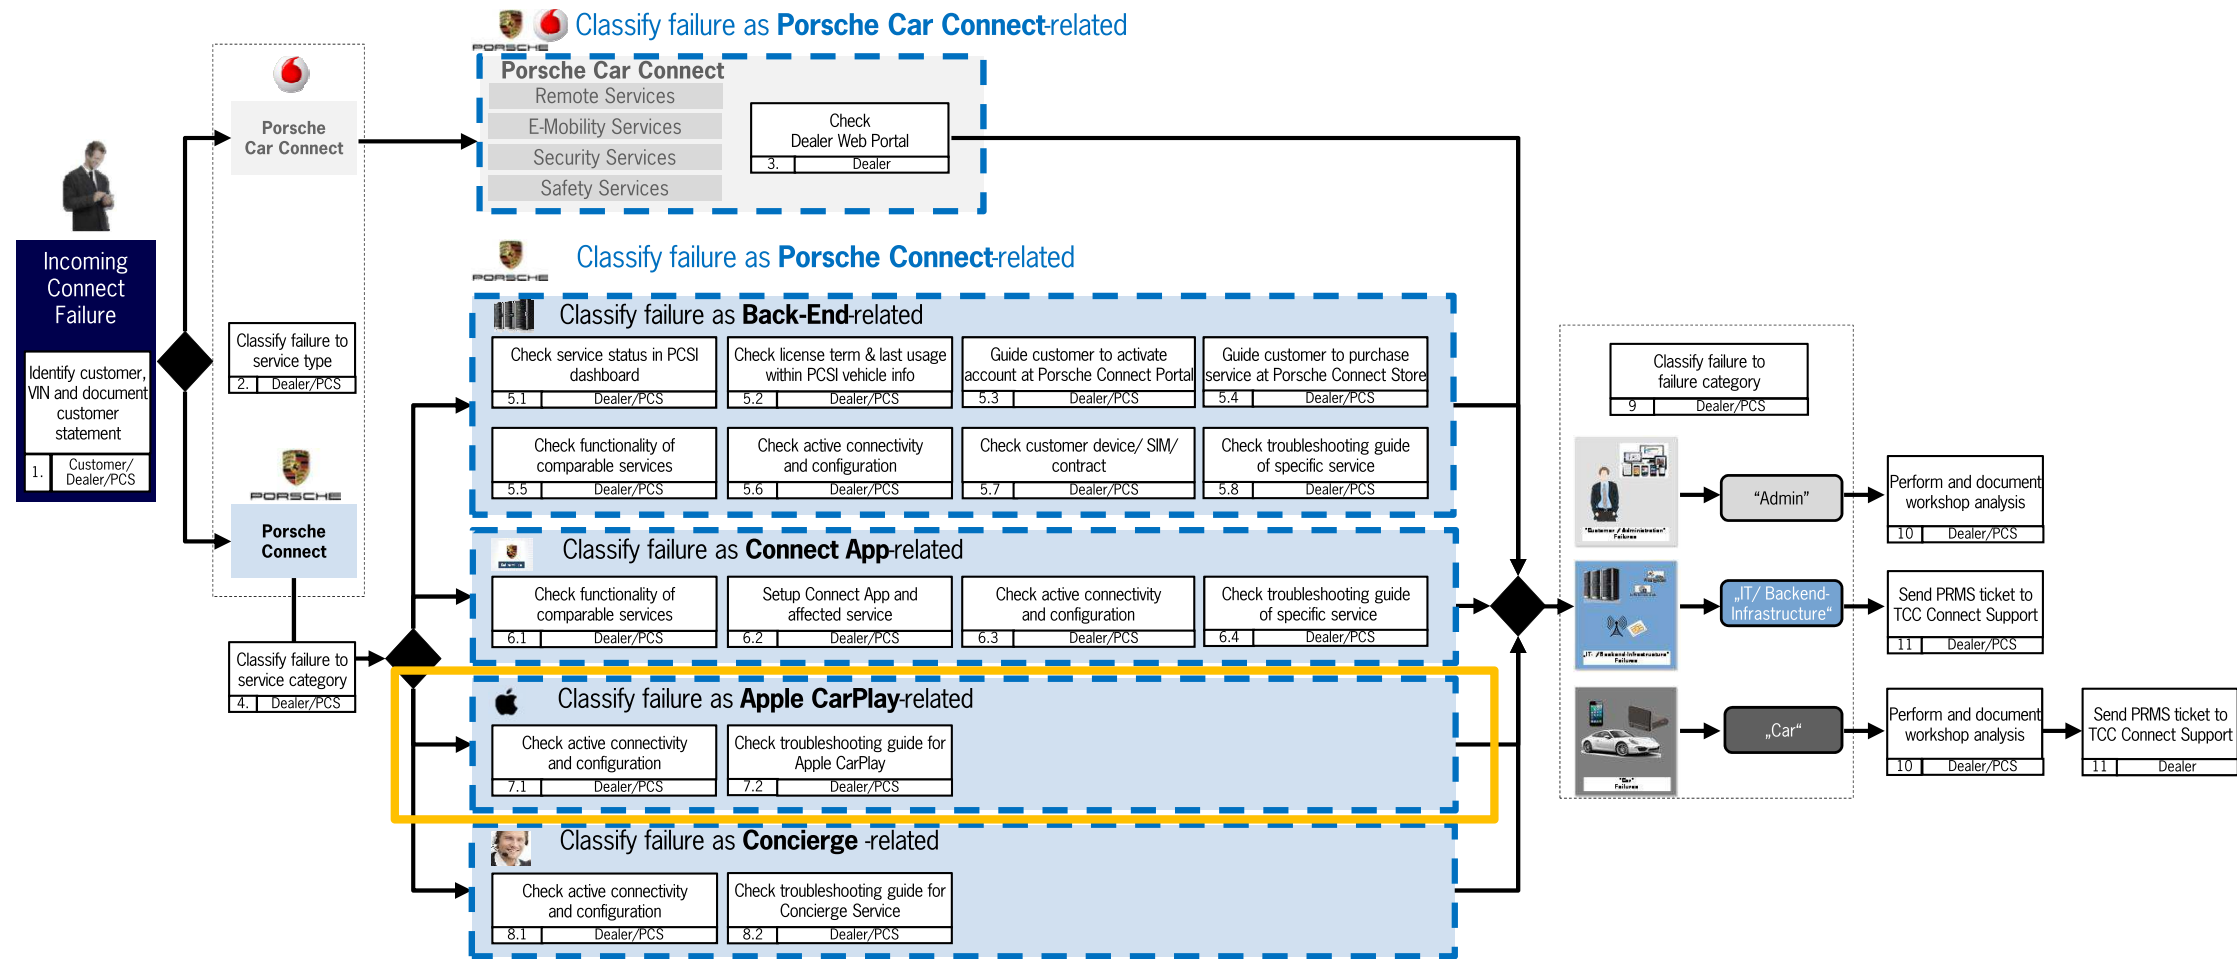


Source: VAM1


Are connectivity, PCM and iPhone settings correct?

→ Check active connectivity and configuration

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

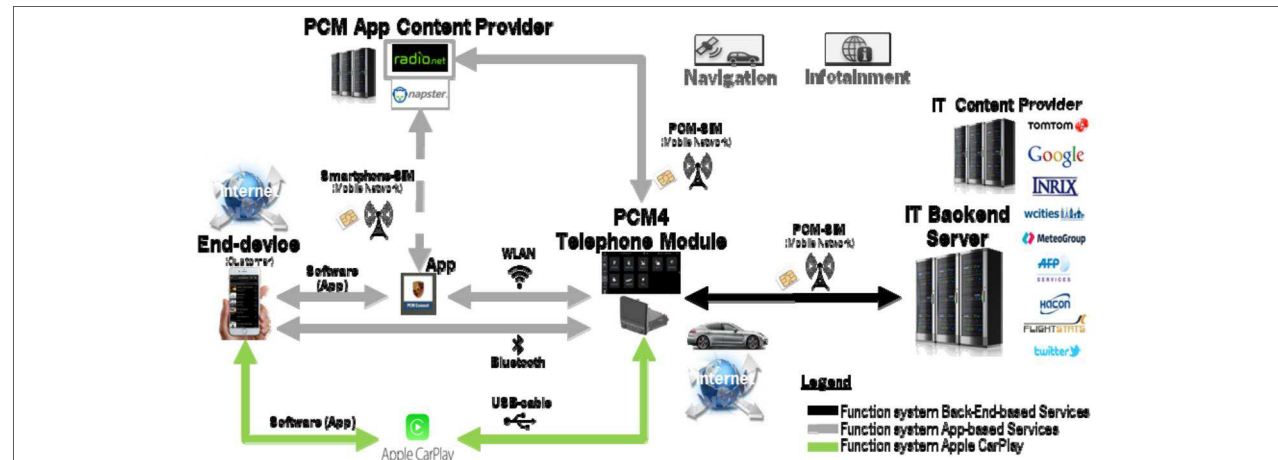

PCM 4.1

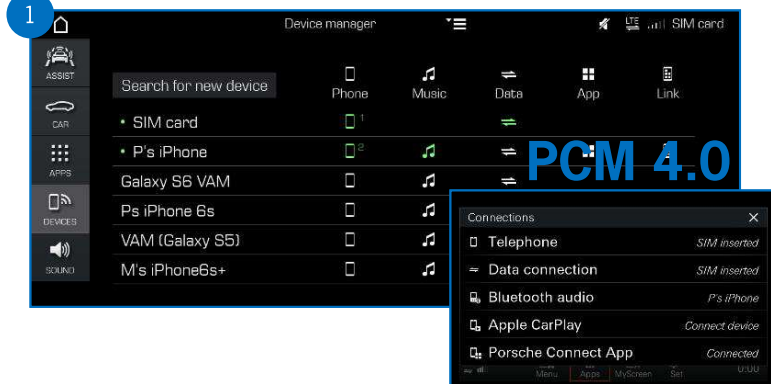

Please Note: In this case please verify, if the connection between PCM and Smartphone is established via the USB-hub within the center console.

To check the connectivity of Apple CarPlay there are several options:

- Check PCM Connectivity Manager:**
 - The Connection Manager of the PCM shows the different active and inactive connection types.
- Check Owner's Manual**
 - The manuals precisely describe how to use the different connection types and the Connection Manager.

→ Connectivity ok

Check troubleshooting guide for Apple CarPlay

Are service specific functionalities causing the problem?

→ Check troubleshooting guide for Apple CarPlay

1

2 WP0ZZZ97ZHL120105

3

4

5 Show troubleshooting guide within the knowledge database. >

6 Troubleshooting guides can be found within PIWIS Information media (Workshop Manual).

Most relevant issues



Please note: Verify Apple CarPlay relevant i-option (i.e. "9WT").

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

Apple CarPlay can be considered as one service. To exclude a basic failure within Apple CarPlay, please verify the following points:

- 1 Open PCSI
- 2 Enter VIN/ Porsche ID
- 3 Open tab "Information media"
- 4 Open tab "Troubleshooting guide"
- 5 PCS: Access via knowledge database
- 6 Dealer: Access via PIWIS information media
- 7 **Verify iPhone iOS compatibility:** Apple CarPlay only available for iPhone 5 or newer AND only for iOS 7.1 or newer. Porsche is recommending at least iOS 8.4.
- 8 **Verify USB hub/ iPhone cable:** Customer's iPhone should be enabled to use Apple CarPlay and should be connected via the USB hub with an USB/ Lightning cable within the center console.


→ Troubleshooting not successful

Classify failure to failure category

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

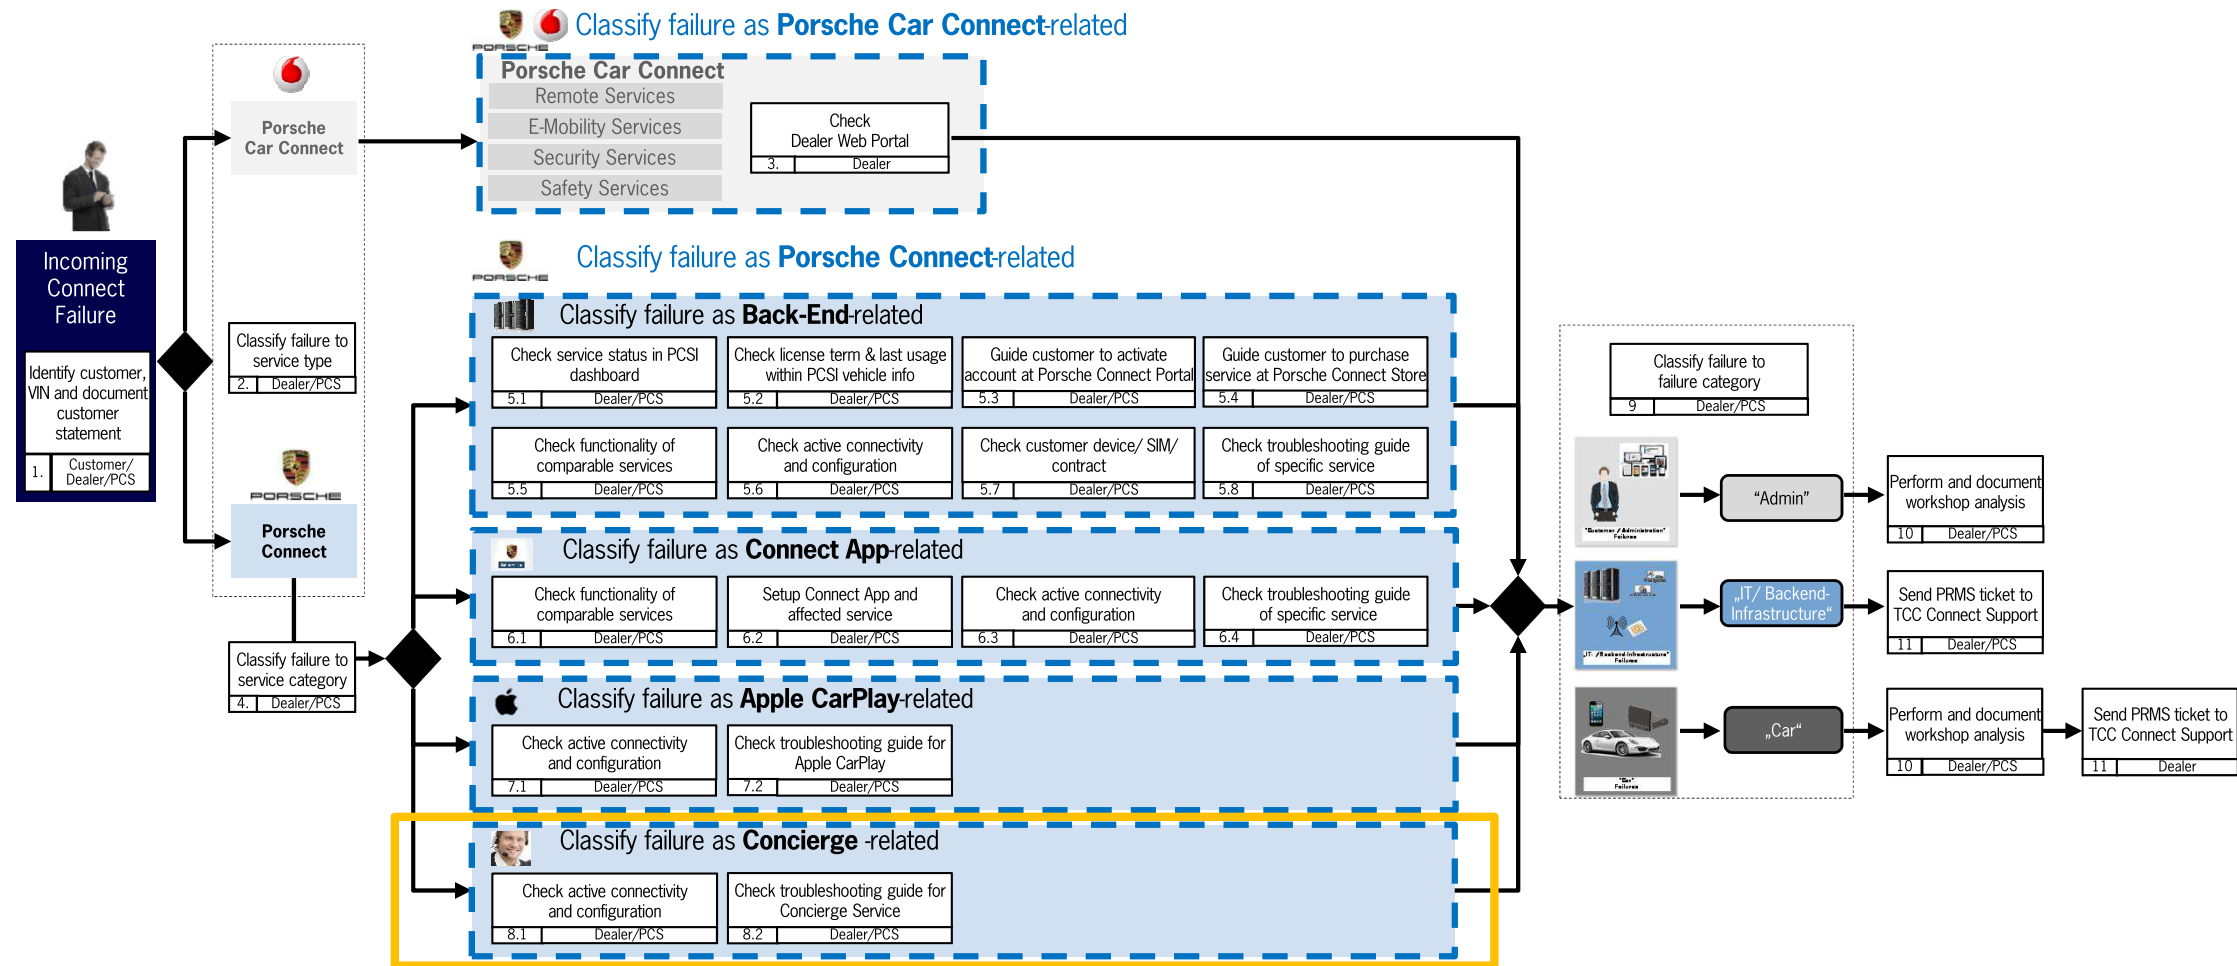


Source: VAM1


Are connectivity and PCM settings correct?

→ Check active connectivity and configuration

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

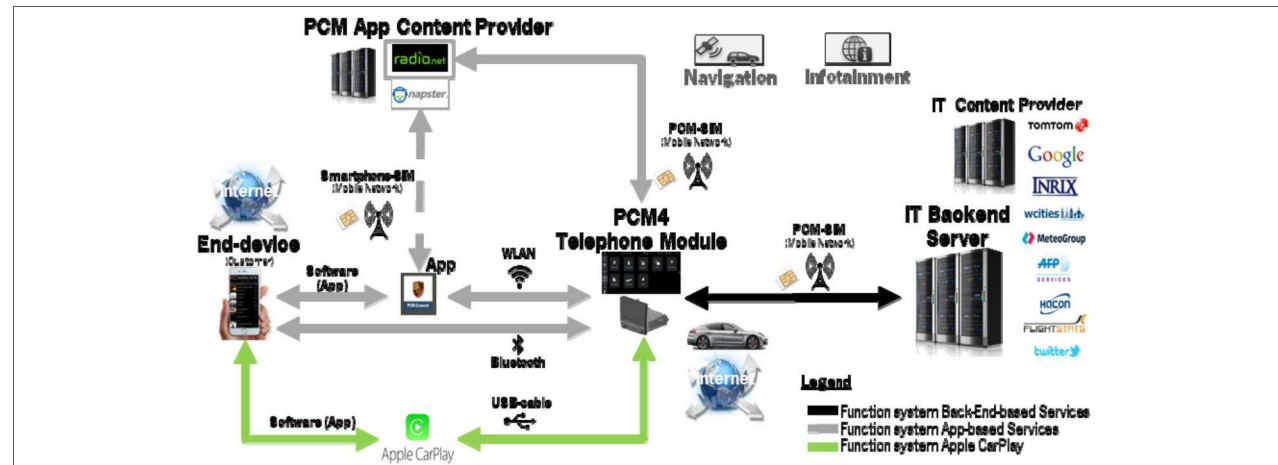

PCM 4.1

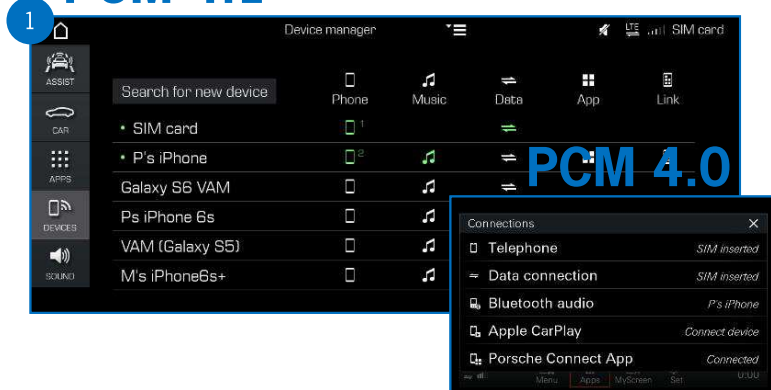

Please Note: In this case please verify, if the connection between PCM and Back-End server is established via a PCM-SIM card (mobile network) or mobile hotspot (customer device).

To check the connectivity of Porsche Connect Services there are several options:

- Check PCM Connection Manager:**
 - The Connection Manager of the PCM shows the different active and inactive connection types. Depending on the service category there are different connection requirements/ options.
- Check Owner's Manuals**
 - The manuals precisely describe how to use the different connection types and the Connection Manager.

→ Connectivity ok

Check troubleshooting guide for Concierge Service

Are service specific functionalities causing the problem?

→ Check troubleshooting guide for Concierge Service

Most relevant issues

- Upload of navigation destinations or routes to vehicle
- General information services
- Information services
- i.e. Hotel reservation, ...

Please note: Concierge is currently starting in China and Japan.

	Porsche Car Connect	Back-End Service	Connect App Service	Apple CarPlay Service	Concierge Service
PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

Concierge can be considered as one service. To exclude a basic failure within the Concierge Service, please verify the following points:

- 1 Open PCSI
- 2 Enter VIN/ Porsche ID
- 3 Open tab "Information media"
- 4 Open tab "Troubleshooting guide"
- 5 PCS: Access via knowledge database
- 6 Dealer: Access via PIWIS information media
- 7 Check basic Concierge availability in PCM
- 8 Check call connectivity PCM to PCS Call Centre
- 9 Check return of information from PCS Call Centre to PCM/ customer


→ Troubleshooting not successful

Classify failure to failure category

Porsche Connect Support Guideline

Failure analysis process

- 1 Service types
- 2 Service categories
- 3 Specific failure analysis steps
- 4 Failure categories
- 5 Documentation/ Ticketing

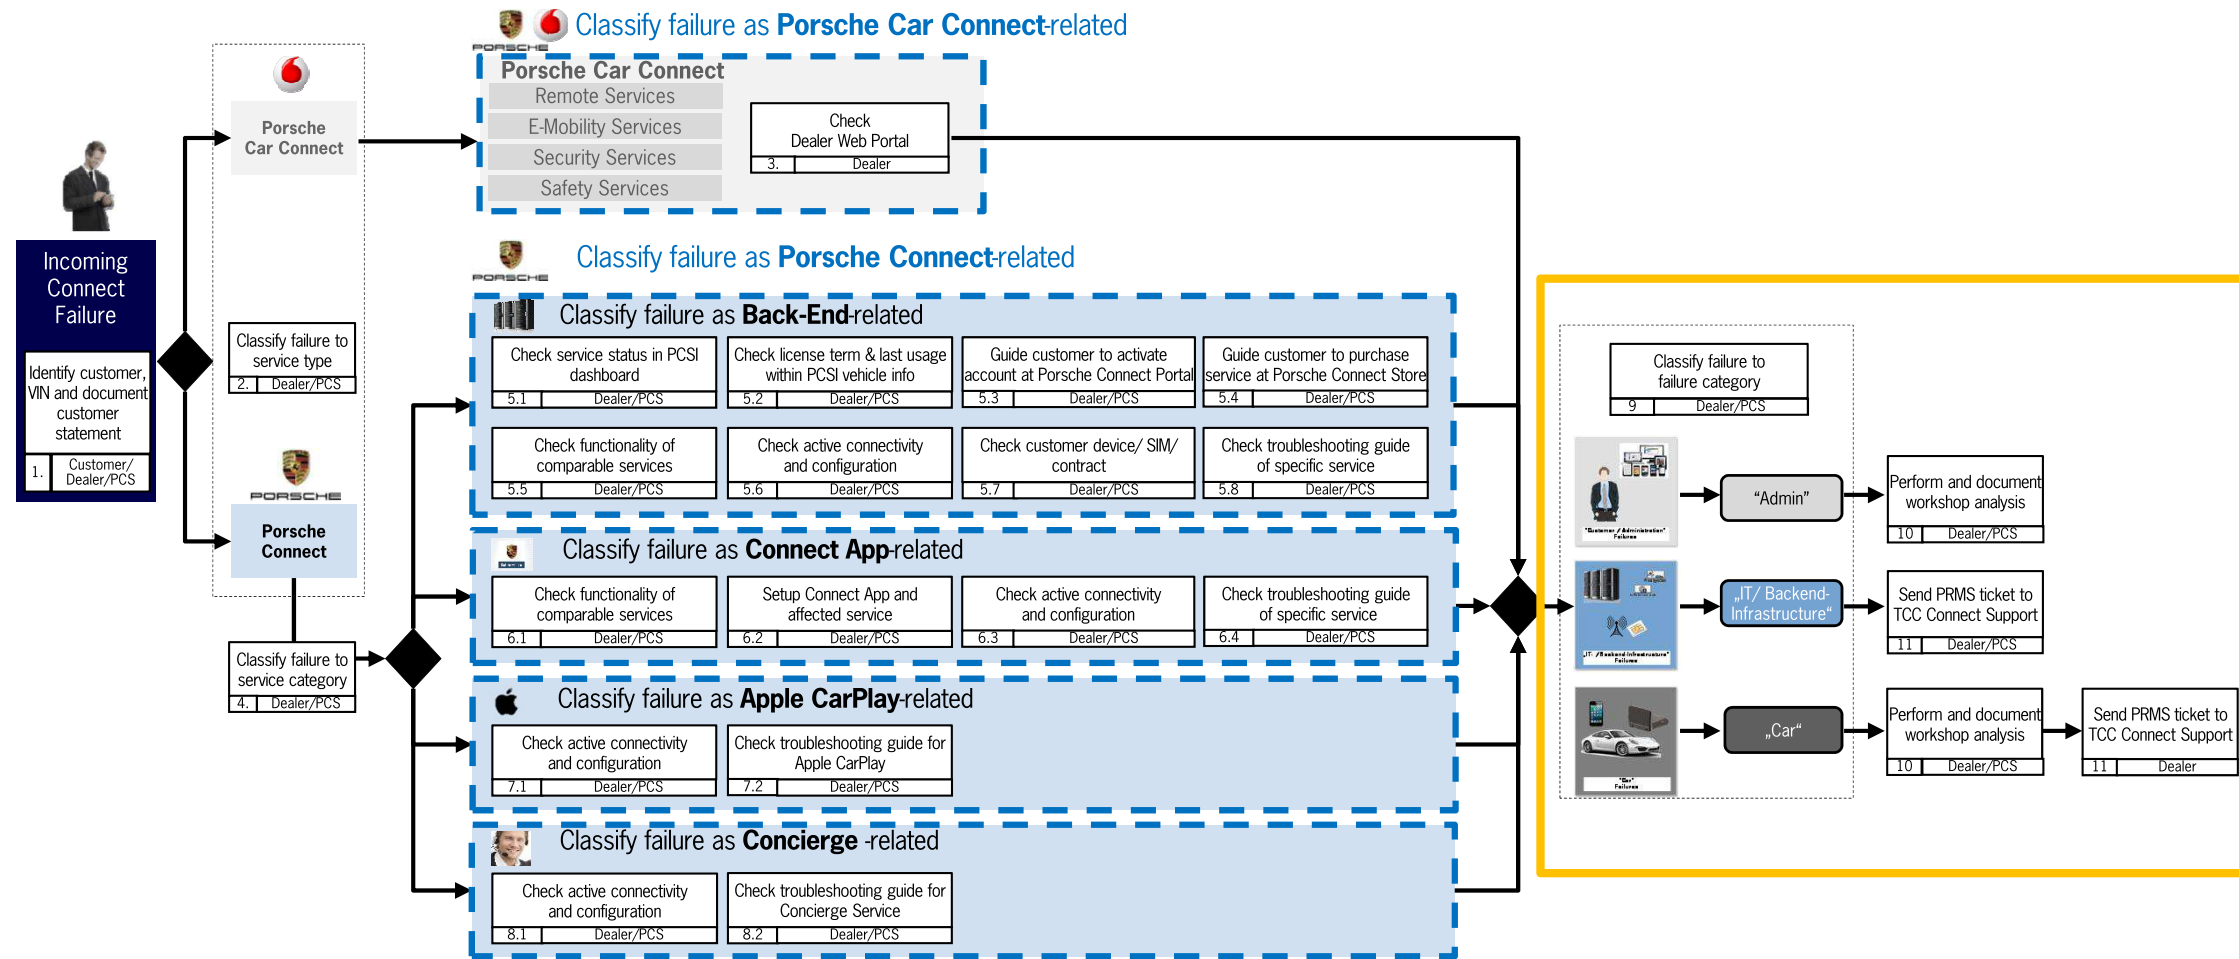


Source: VAM1

How can the failure be specified?

→ Classify failure to failure category

Examples for Porsche Connect failure categories

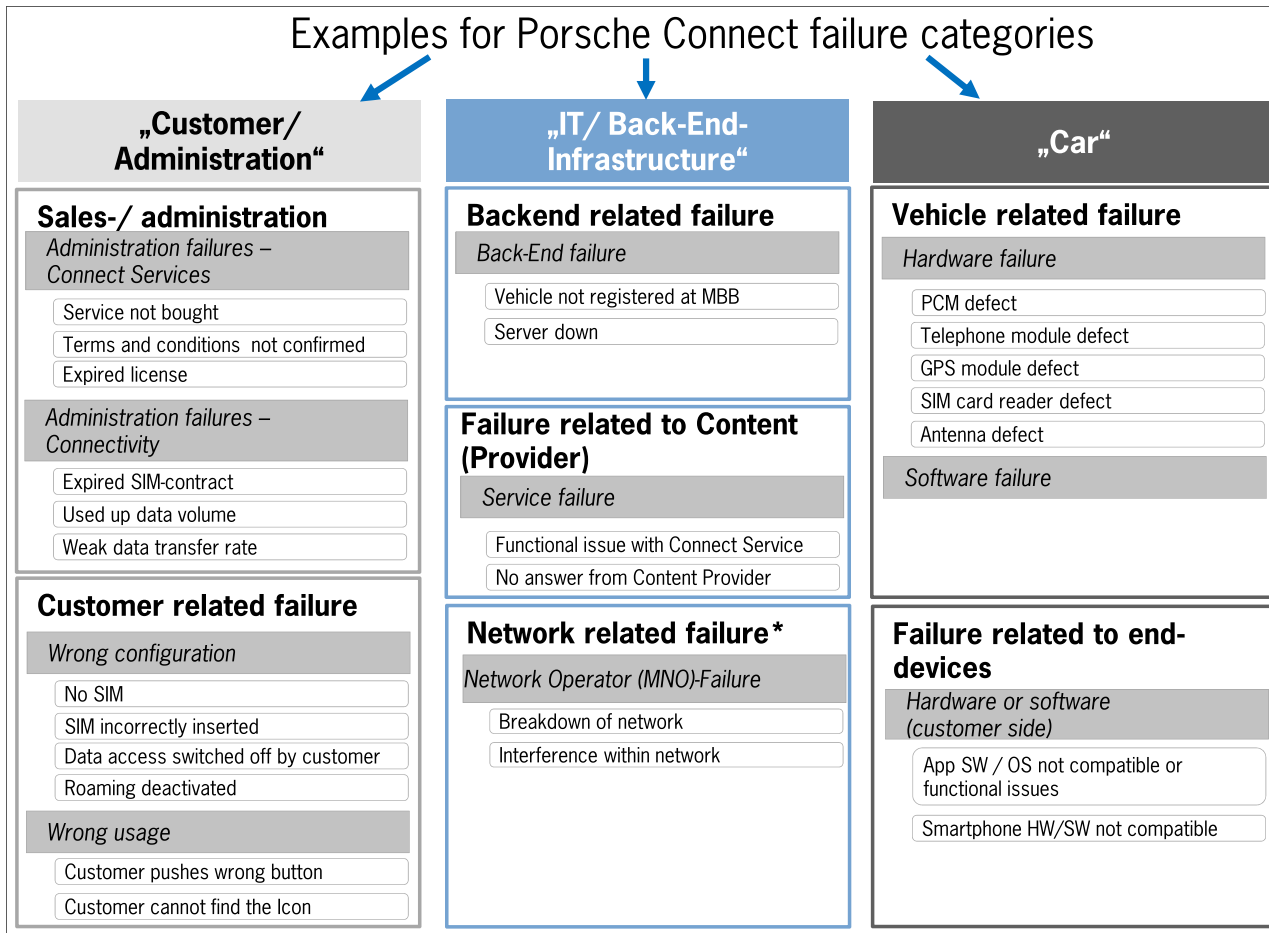

Please note: Customer/ and Admin failures should be solved within the 1st support level.

*only for dealer, cooperation of some markets with local network operators

PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer	Dealer	PCS			

The classification of failures to failure categories helps to decide how to document the case and where to forward it to.

- 1 “Customer / Administration” Failures
- 2 “IT- / Back-End-Infrastructure” Failures
- 3 “Car“-related Failures

➡ IT/ Back-End failure

Send PRMS ticket to TCC
Connect Support

➡ Admin failure

Perform and document
workshop analysis

➡ Car failure

Perform and document
workshop analysis

Can failure be clearly classified as Vehicle failure?

→ Perform and document workshop analysis

1 PQIS Lite Job (PCS)

2 PQIS Job (Porsche Centre)

3 Workshop analysis with PIWIS Tester

Please note: If a failure could not be solved at Porsche Centre (after handover), the case should be documented in PRMS and forwarded stepwise to Importer & PAG (TCC Connect Support).

PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer		Dealer		PCS	

For handover/ documentation of vehicle-related cases to Porsche Centre it is necessary to open a PQIS (lite) Job. After the case has been handed over to Dealer, further analysis steps will be performed.

1 PQIS Lite Job (by PCS only)

2 PQIS Job in PIWIS (by Dealer only)

3 Further workshop analysis possibilities:

- Check Dashboards, FAQs, Troubleshooting guide
- Analysis with PIWIS Tester
- Create Vehicle Analysis Log (VAL)
- Read error memory
- Perform trouble-shooting and repair

➡ Workshop analysis w/ o result

Send PRMS ticket to TCC Connect Support

Can incident clearly be classified as IT-/ Back-End failure?

→ Send PRMS ticket to TCC Connect Support

< Draft of next generation PRMS >

PRMS Porsche Connect

Request type*

Short problem description*

Vehicle information

Vehicle identification number (VIN) Model Model year Type Order type Mileage km/miles

Connect information

Has the service already been working* ☐ yes ☐ no

The failure can be reproduced* ☐ yes ☐ no

Reproducible with customer device ☐ yes ☐ no

Reproducible with substitute device ☐ yes ☐ no

The complaint occurs ☐ static ☐ sporadic

Under which condition does the problem occur?

Place and circumstances Time of first occurrence

Service category

Service / Function / System

PCM Version

Connection type

Network provider

☐ Connection available

☐ Data volume available

Mobile device - manufacturer

Mobile device - software version

Connect App - version

Browser

Browser version

Utilized information media

Media	Utilized	Info
Porsche Connect Service Information	☒	Please edit here
Owners Manual	☐	
Troubleshooting Guide	☐	
FAQ	☐	
Produkt Description	☐	

Attachments

Name	Create date	Submitter

Forms

Name	Info

Case documentation

If possible please attach vehicle analysis protocol!

1

Please note: Incomplete analysis or insufficient PRMS tickets will lead to immediate return.

PCSI	PRMS	PQIS (Lite)	C@P	Connect Portal	Connect Store
Customer	Dealer	PCS			

To handover IT-/ Back-End-/ Infrastructure related cases to TCC Connect Support it is necessary to send a PRMS ticket, which requires following content:

- New PRMS Mask (i.e.):**
 - Request Type:** Customer systems
 - Porsche ID:** xxx@xxx.de (mandatory)
 - FIN:** WP0ZZZ99ZHS123456
 - Priority:** C (mandatory)
 - Short problem description:** Connect Store not available (mandatory)
 - Case documentation:** Detailed description (mandatory)
 - Attachment:** Screenshots etc.

END