



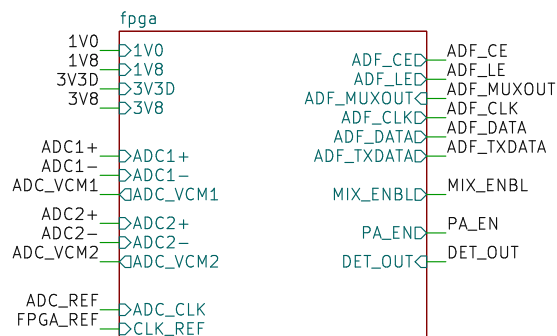


File: fpga.kicad_sch

1V0: 100 mA
1V8: 30 mA
3V6: 80 mA
3V3D: 70 mA

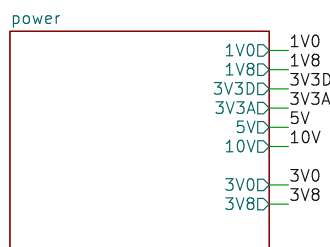


File: power.kicad_sch

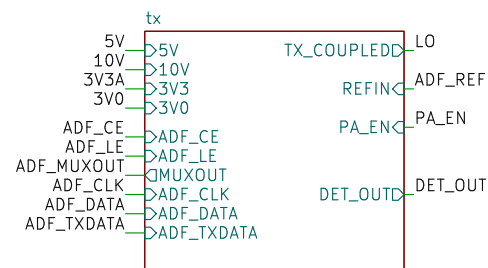


File: tx.kicad_sch


10V: 5 mA
3.3V current: 35mA
3.0V current: 27mA
5V current: 750mA

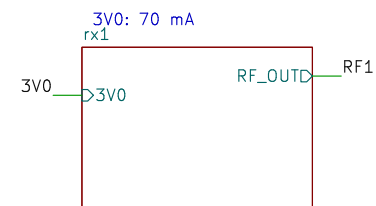


File: rx.kicad_sch

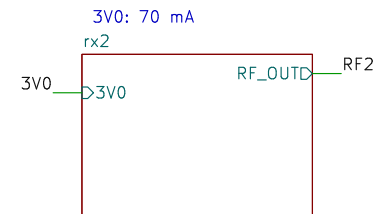

File: rx.kicad_sch

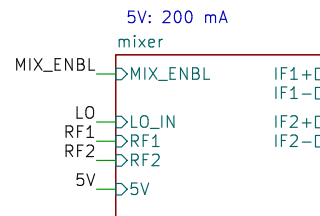


File: mixer.kicad_sch

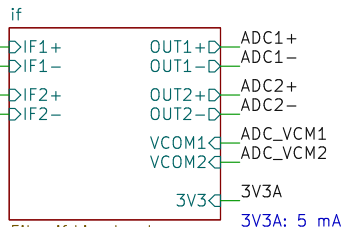


File: if.kicad_sch

1V0: 100 mA
1V8: 30 mA
3V0: 170 mA
5V: 900 mA
3.3VA: 540 mA
3.3VD: 100 mA
3V8: 80 mA
10V: 5 mA


Power:
TX: 1.65 W
LNA: 0.45 W
Digital: 0.7 W
Mixer: 1.0 W
IF: 0.01 W
Clock: 0.1 W
= 4 W

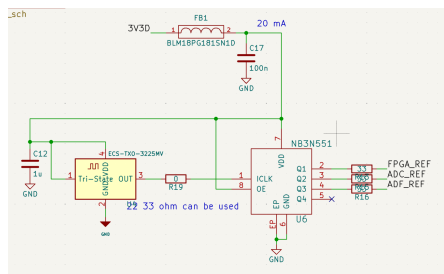

This is the prev design:
NB3N551 is obs.
Also this txo is generating pure sin.
ADC might need cmos like input not sin.
That could be the reason of duty stabilizer.

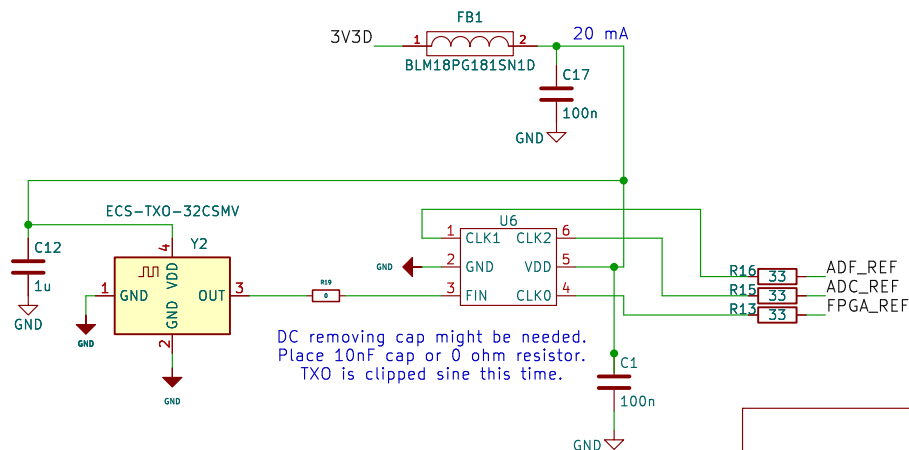

DC removing cap might be needed.
Place 10nF cap or 0 ohm resistor.
TXO is clipped sine this time.

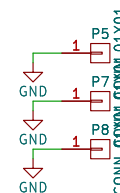

Sheet: /
File: fmcw3.kicad_sch


Title: FMCW3 by CENK KESKİN


Size: A4
KiCad E.D.A. 9.0.7


Date:

Rev:

Id: 1/10








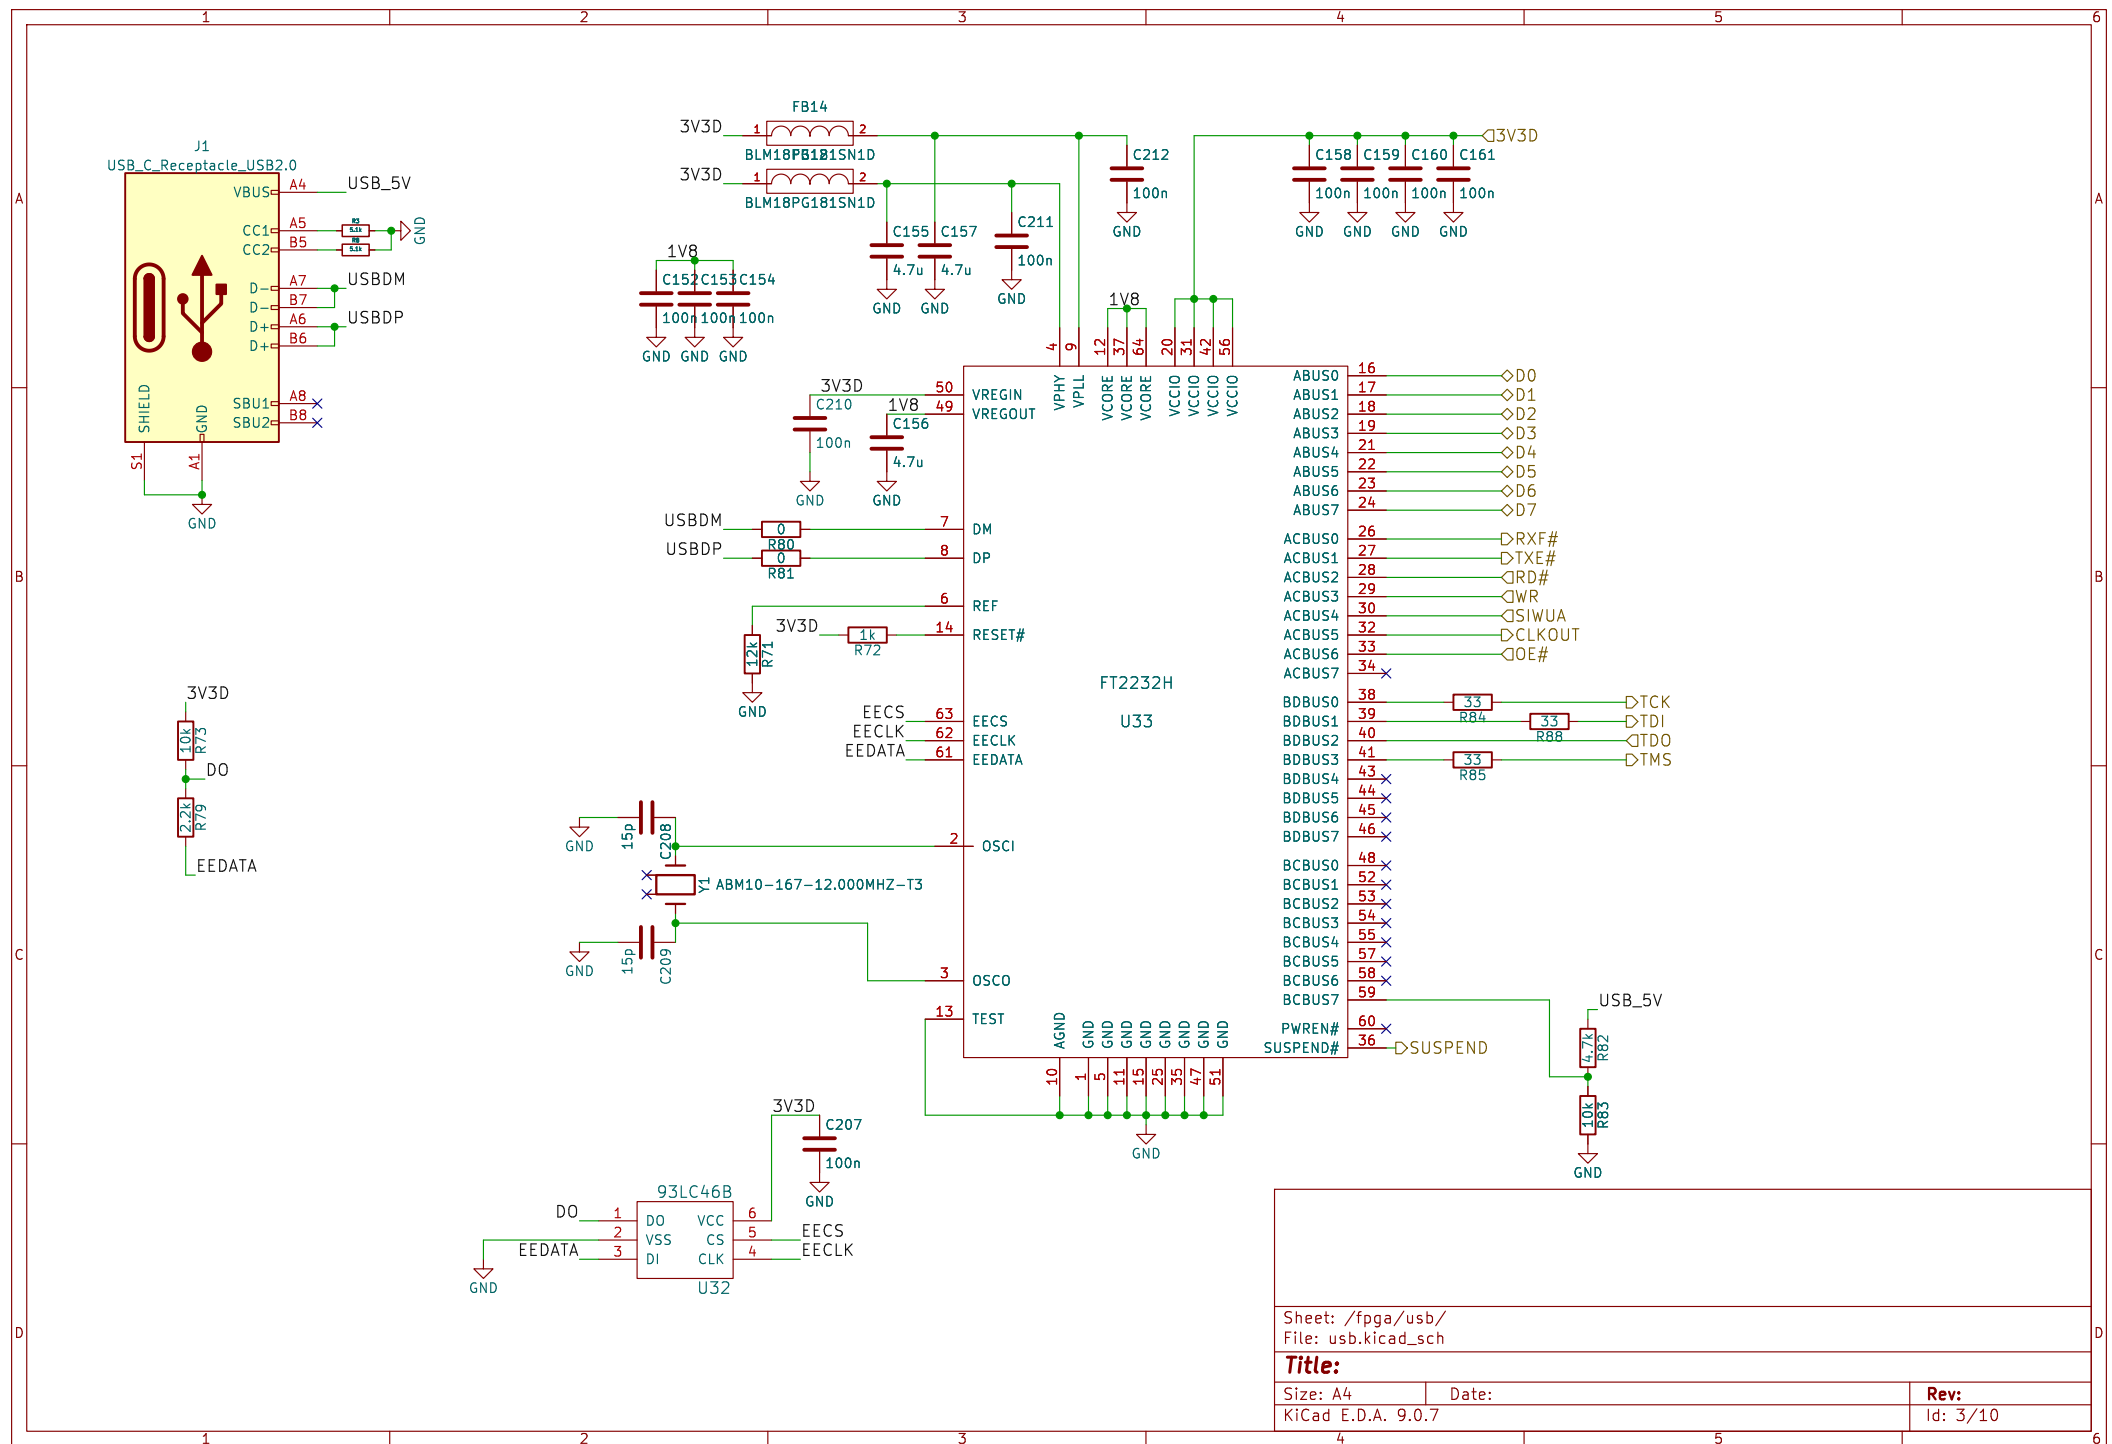


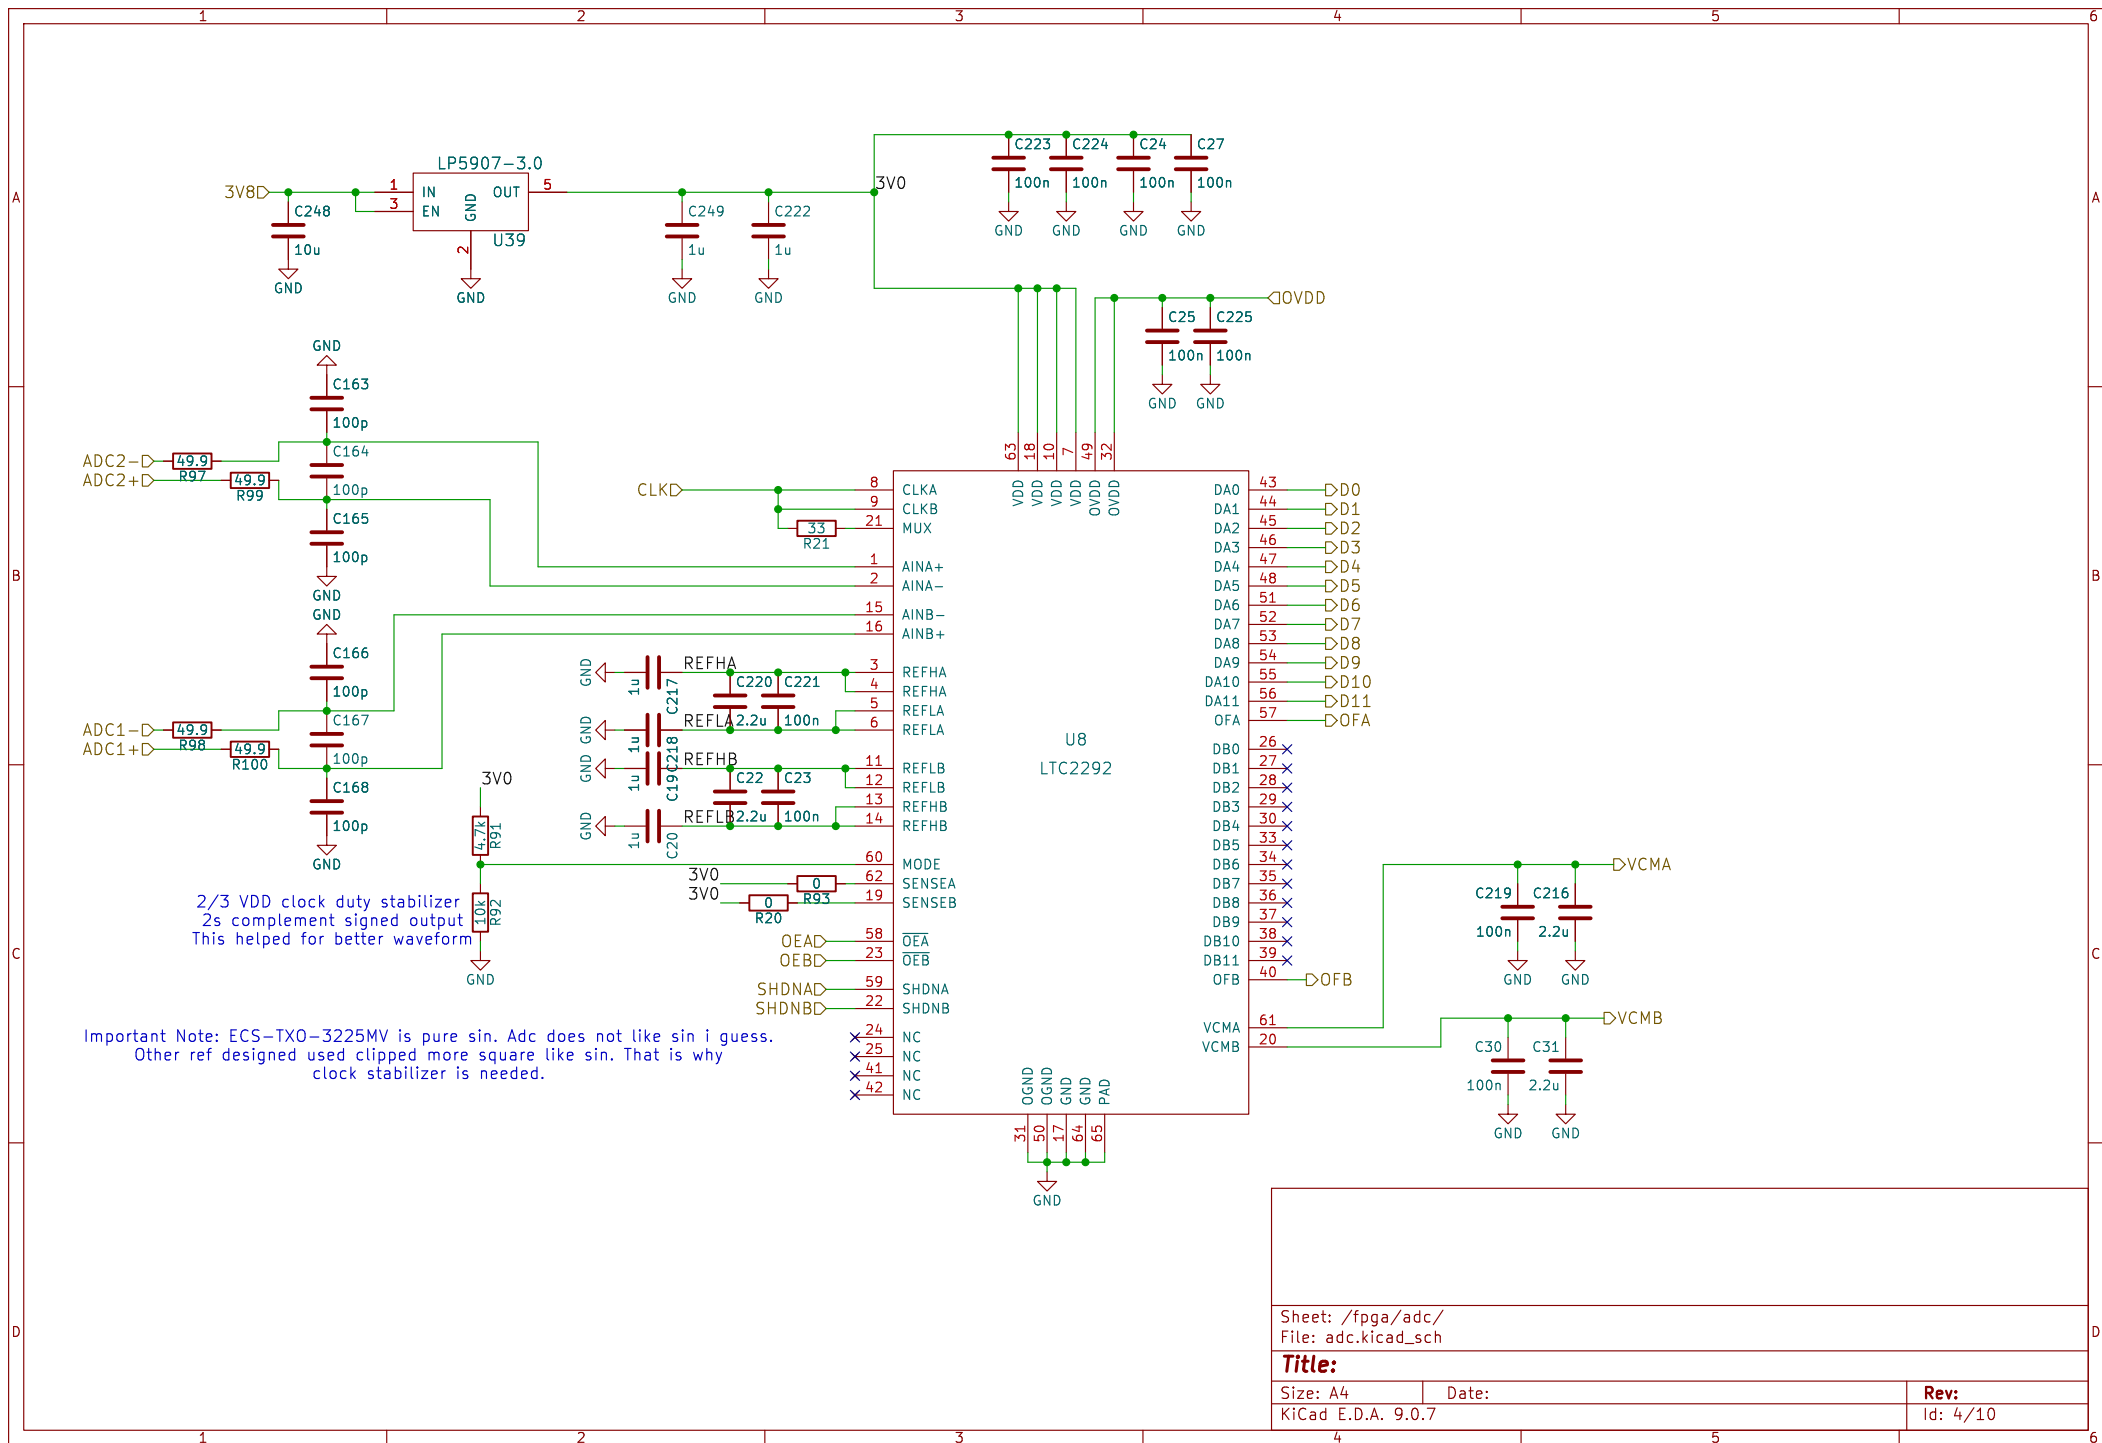

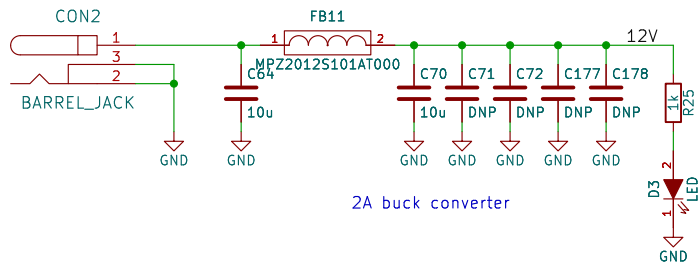

2A buck converter

In the Artix-7 data sheet it states that the recommended power-on sequence is VCCINT, VCCBRAM, VCCAUX, and VCCO. 1v0 first 1v8 then 3v3 is the sequence so use power good

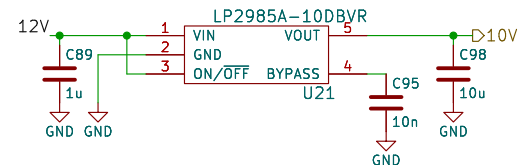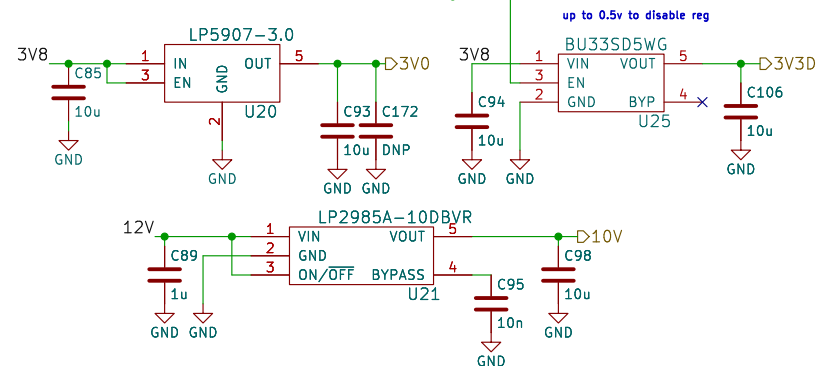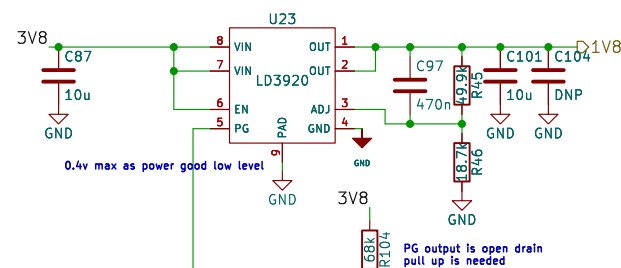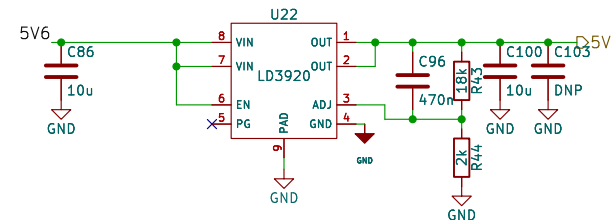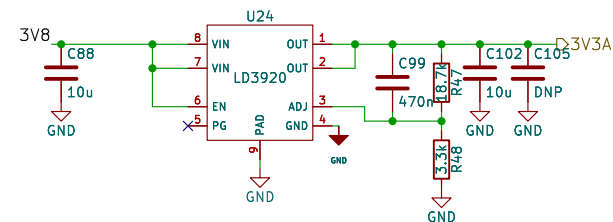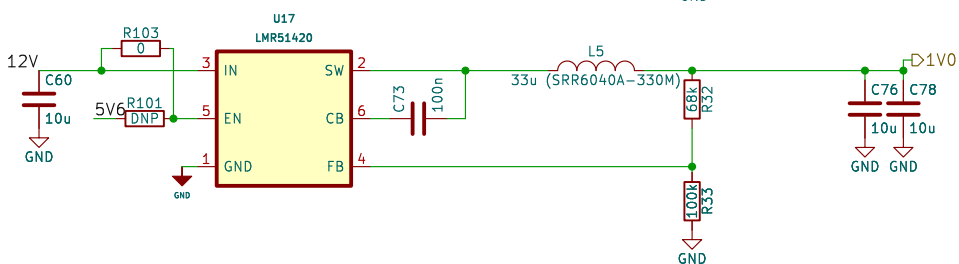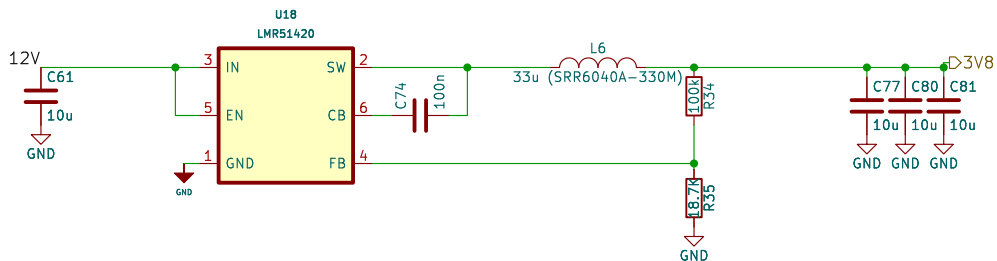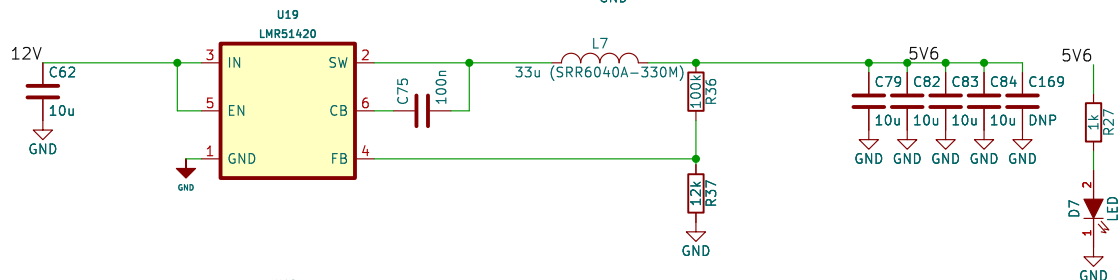

Sheet: /power/
File: power.kicad_sch

Title:


Size: A4
KiCad E.D.A. 9.0.7


Date:


Rev:

Id: 5/10


Rev:
Id: 6/10

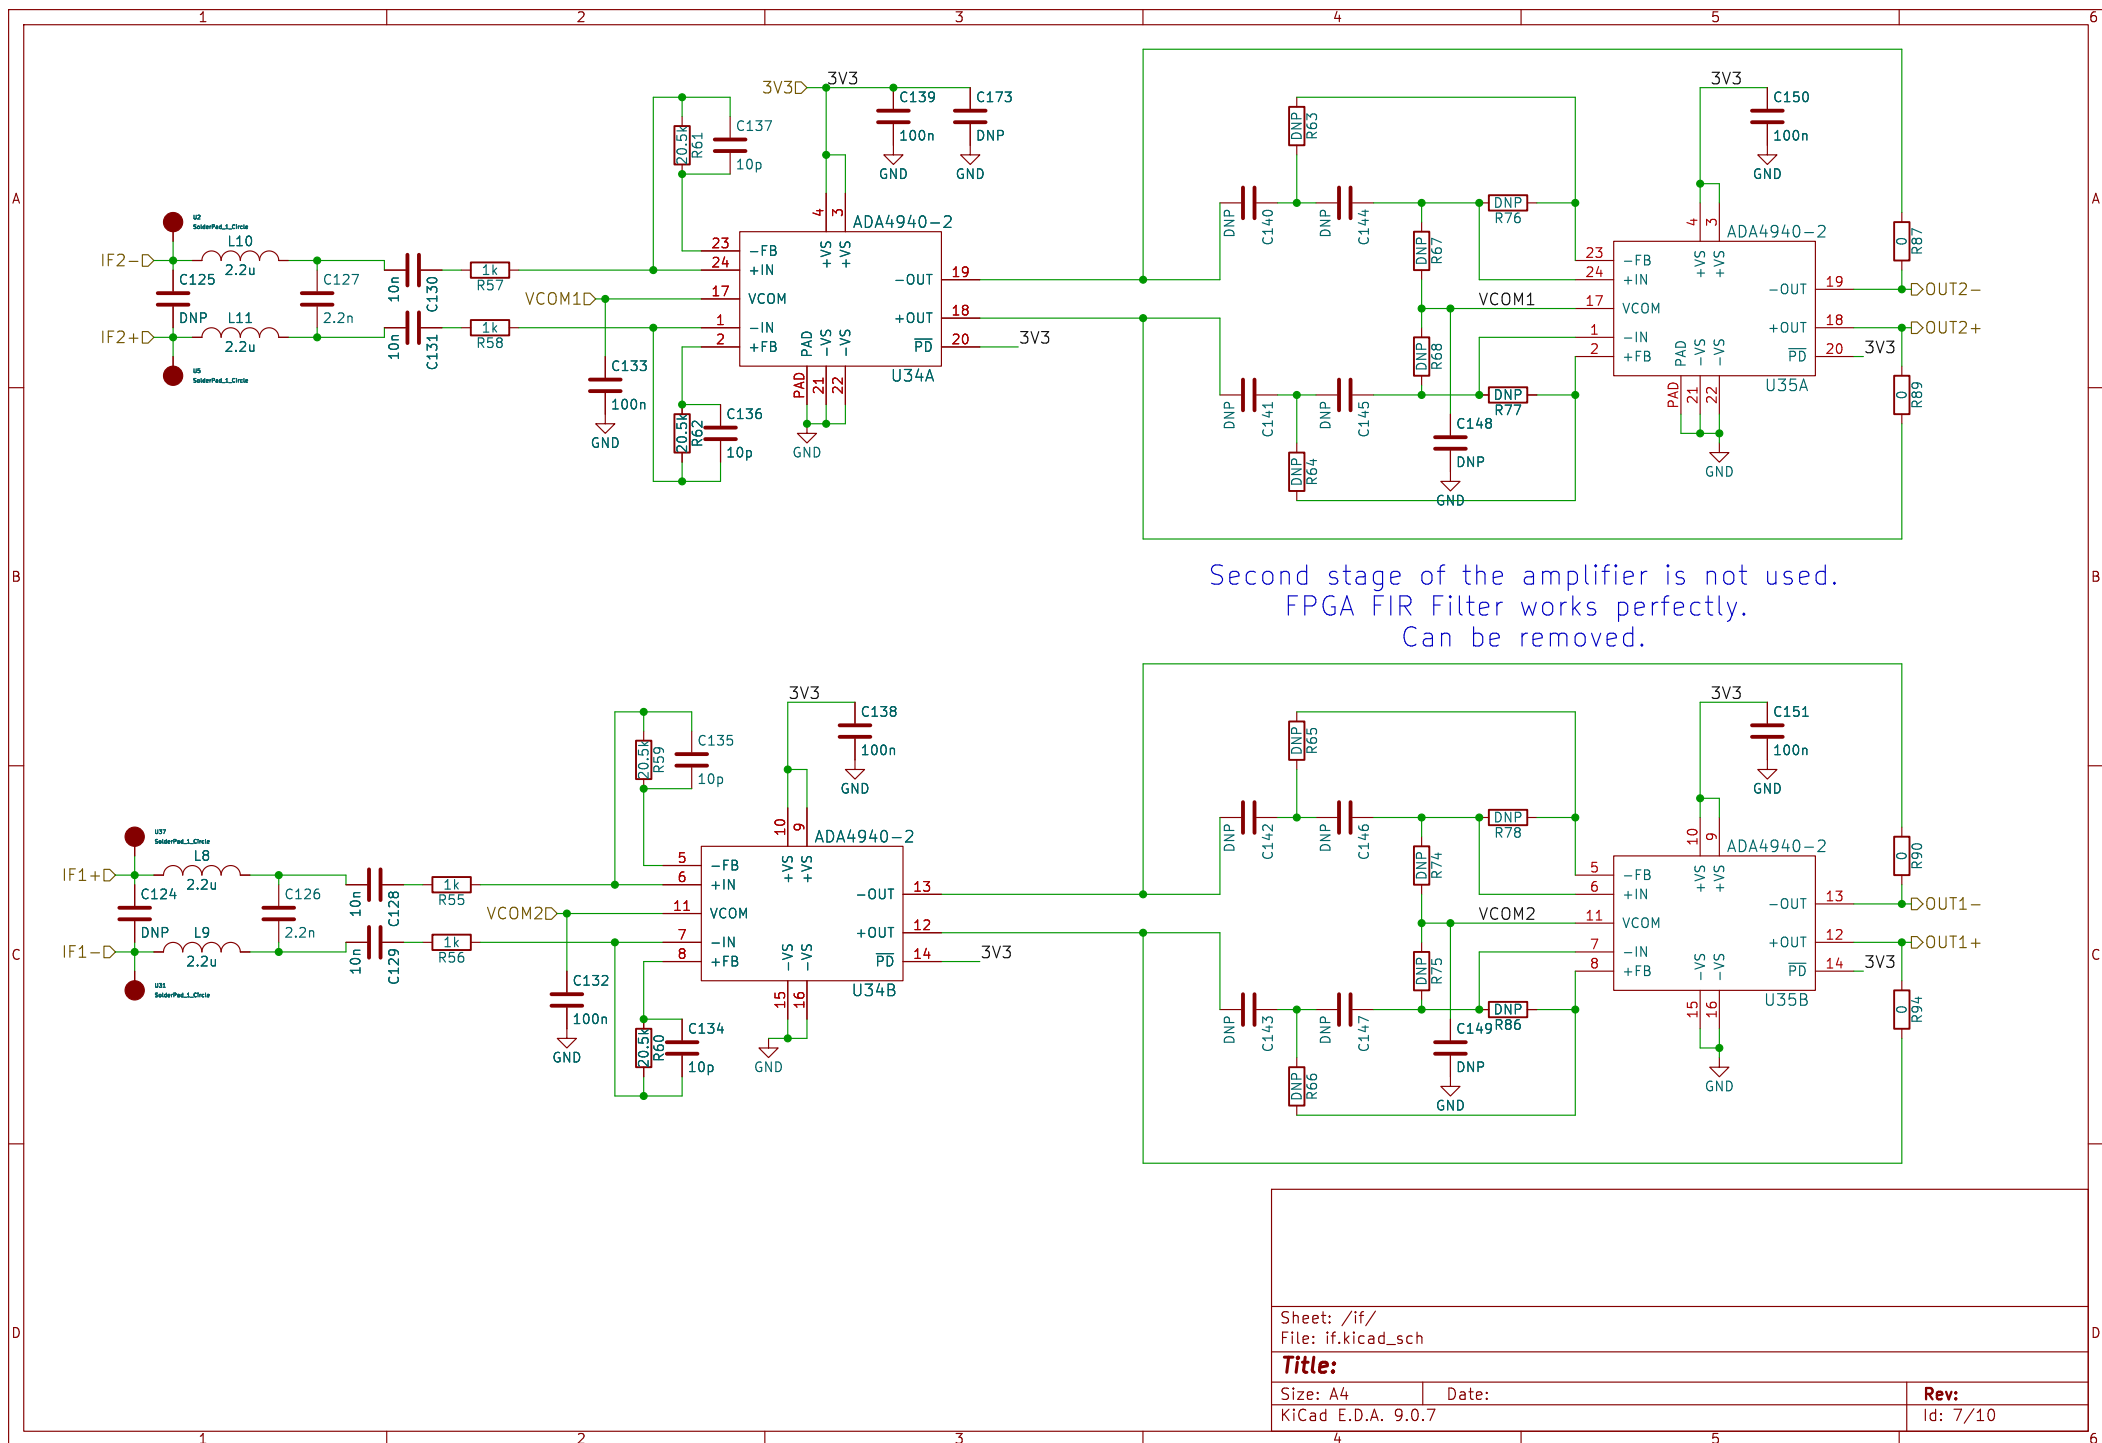

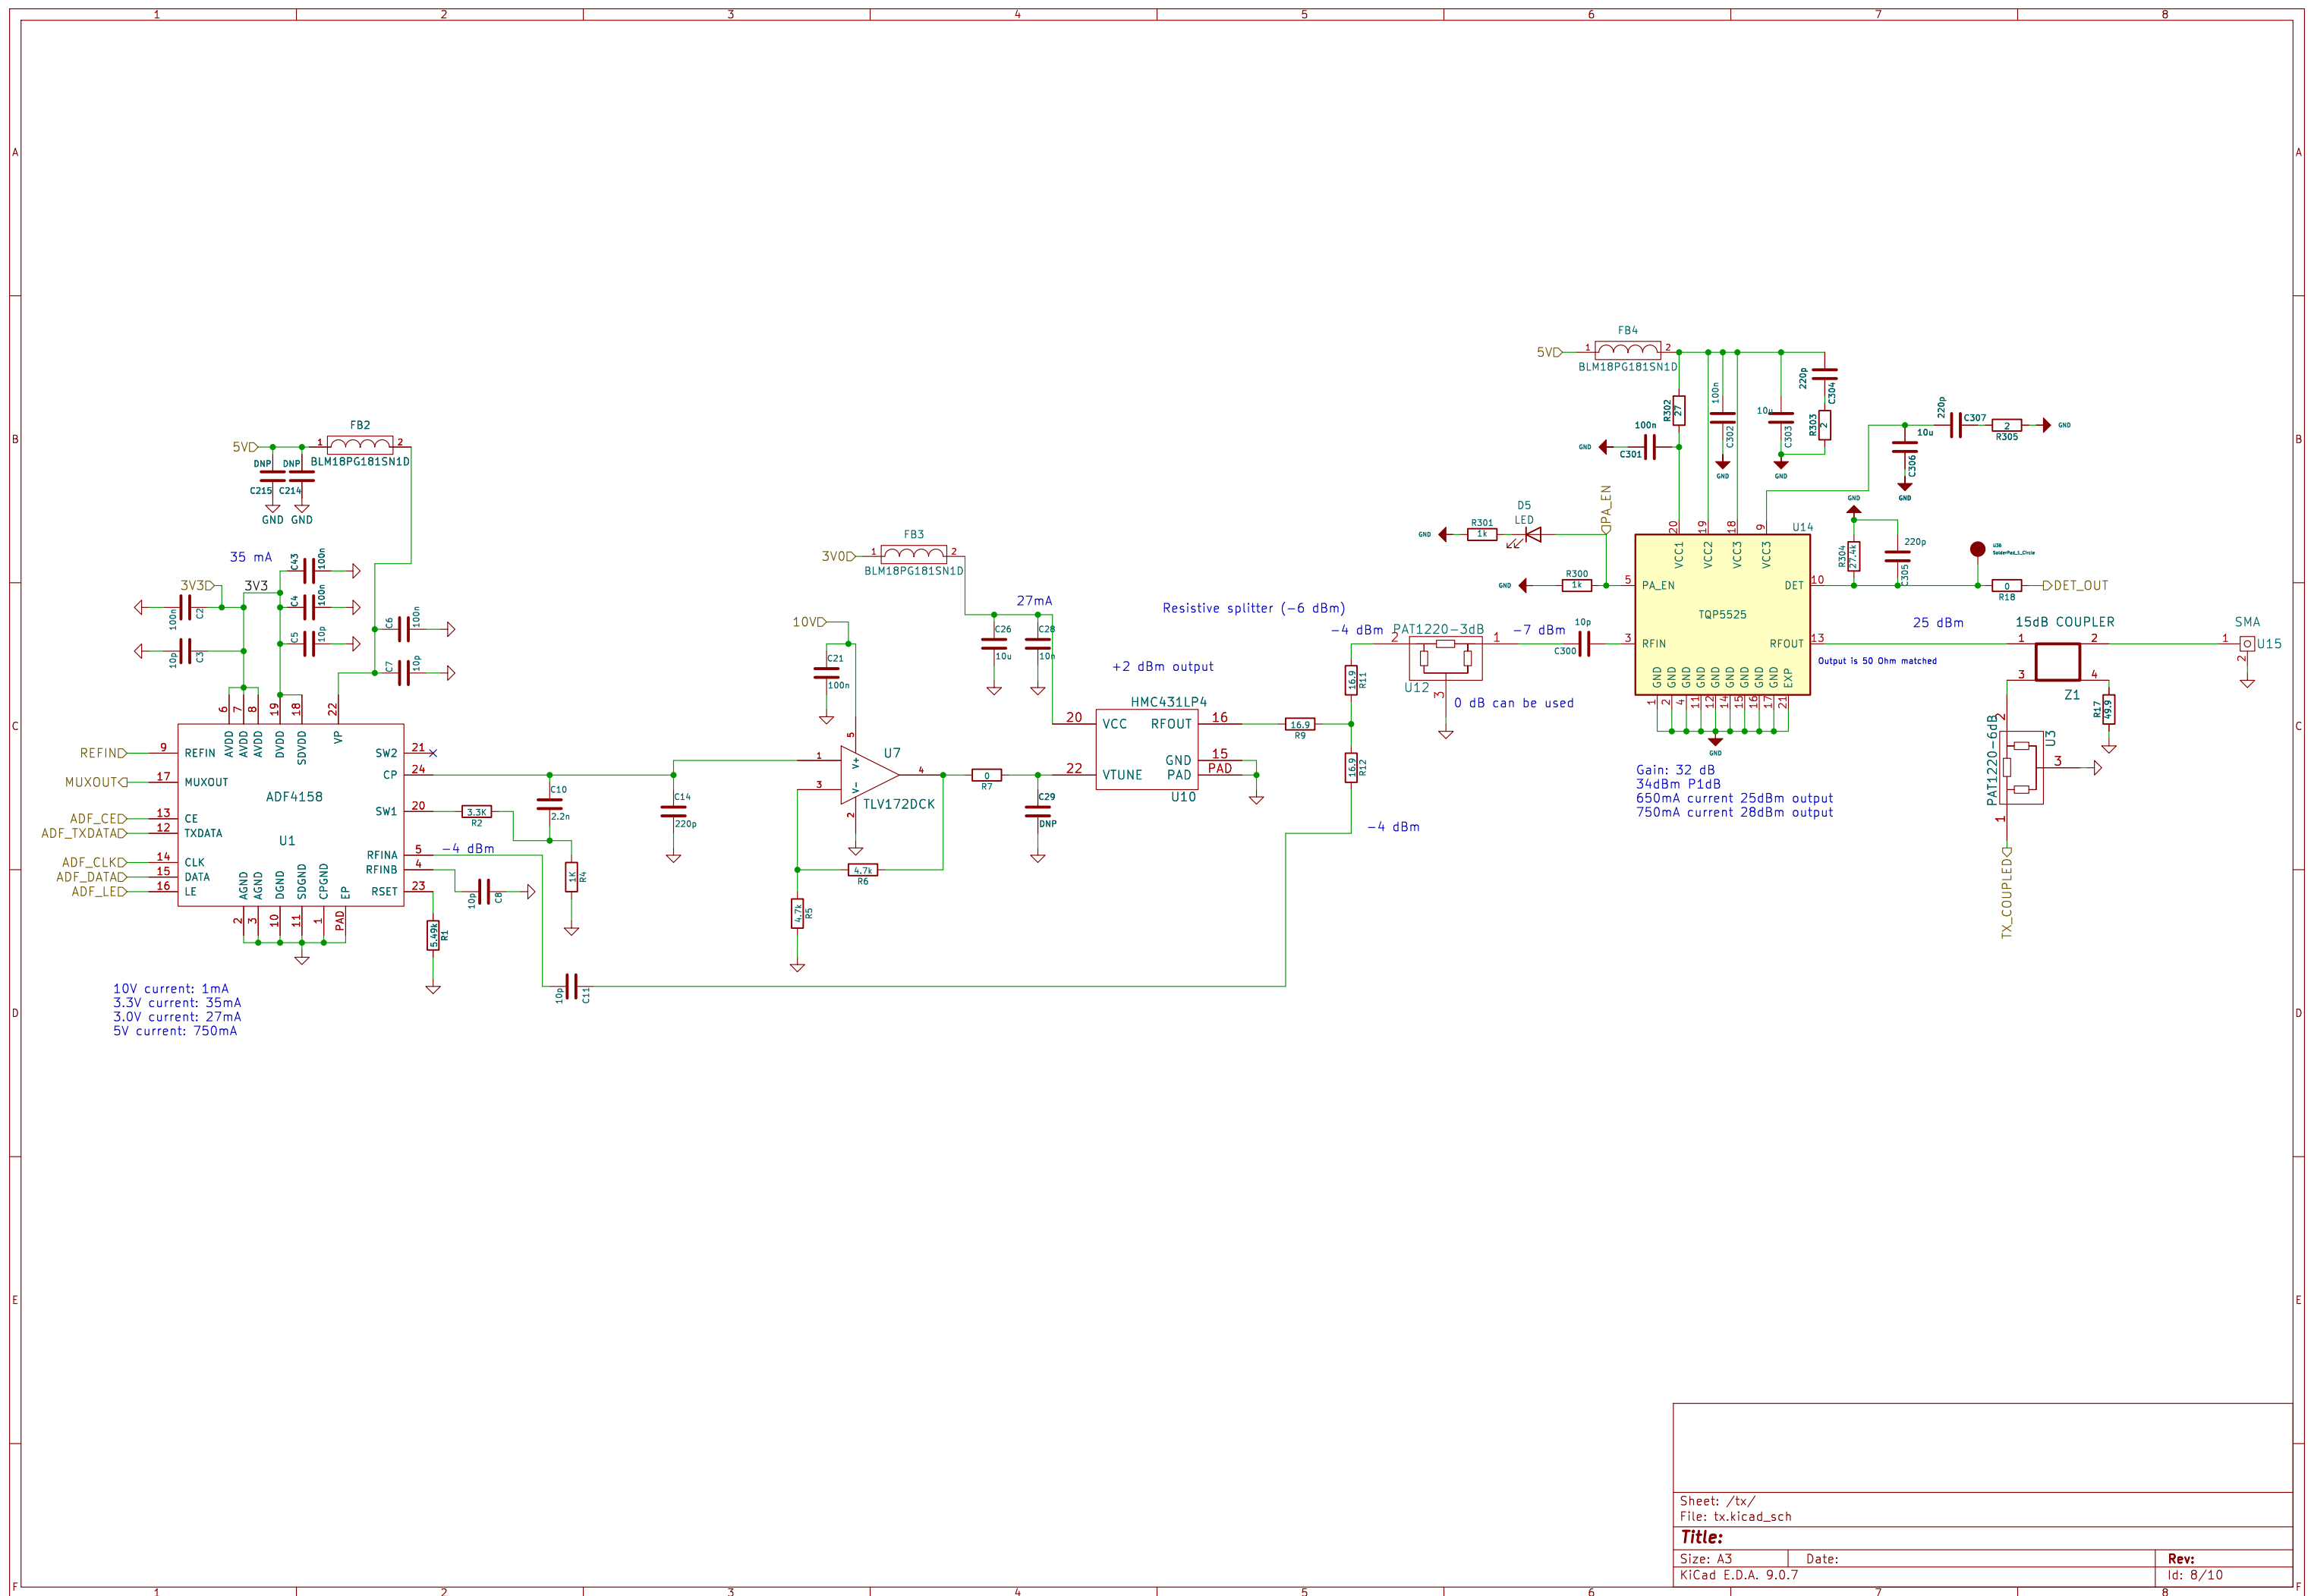

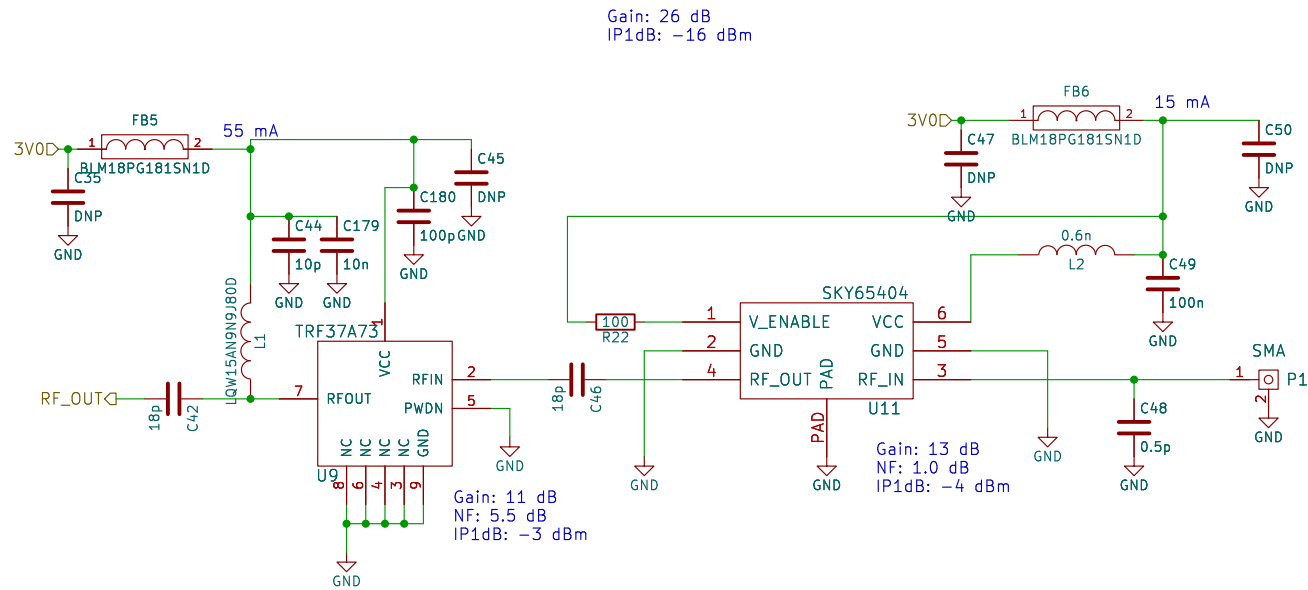

Sheet: /rx1/ File: rx.kicad_sch		
Title:		
Size: A4	Date:	Rev:
KiCad E.D.A. 9.0.7	Id: 9/10	

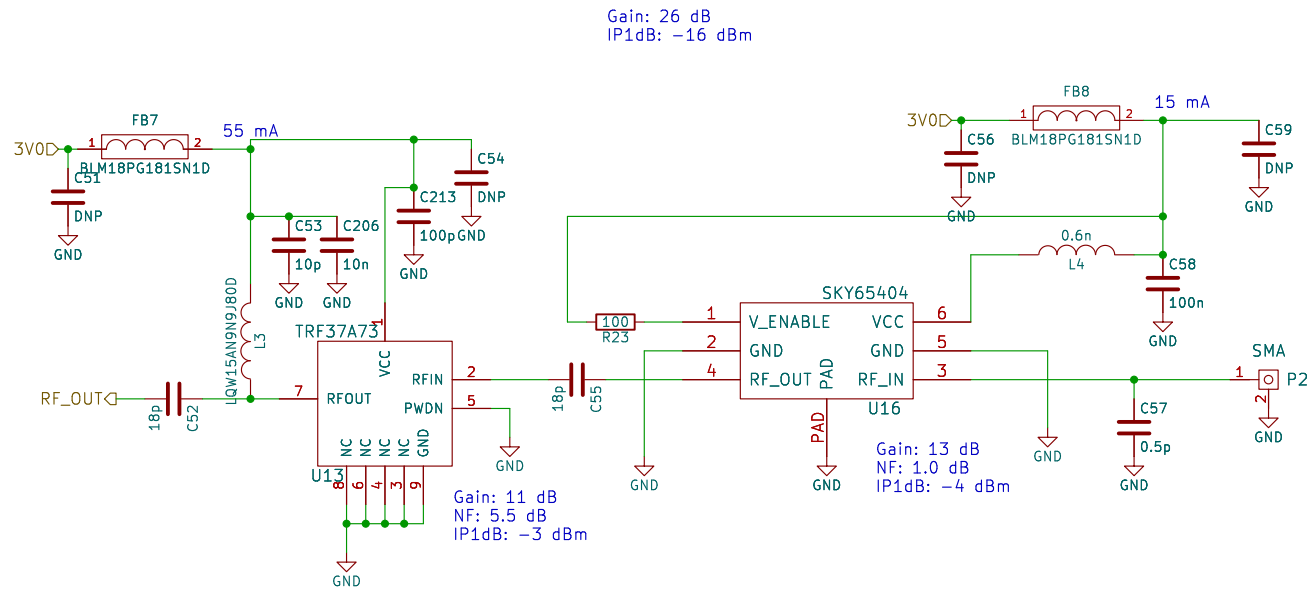

Sheet: /rx2/
File: rx.kicad_sch

Title:

Size: A4
KiCad E.D.A. 9.0.7

Date:

Rev:
Id: 10/10