

STATE OF UTAH DEPARTMENT OF NATURAL RESOURCES DIVISION OF OIL, GAS AND MINING										FORM 8
WELL COMPLETION OR RECOMPLETION REPORT AND LOG										1. WELL NAME Federal 3-18D-65
2. TYPE OF WELL Oil Well			3. TYPE OF WORK DRILL NEW ☒ REENTER P&A ☐ DEEPEN ☐ RECOMP ☐				4. API NUMBER 4301354019			
5. NAME OF OPERATOR Berry Petroleum Company LLC						6. OPERATOR PHONE		7. FIELD NAME BRUNDAGE CANYON		
8. ADDRESS OF OPERATOR 11117 River Run Boulevard, Bakersfield, CA, 93311						9. OPERATOR E-MAIL		10. UNIT NAME		
11. MINERAL LEASE NUMBER UTU77328			12. MINERAL OWNERSHIP FEDERAL			13. SURFACE OWNERSHIP FEDERAL		14. COUNTY DUCHESNE		
15. DATE SPUDDED (SPUD RIG) 10/12/2023		16. DATE SPUDDED (ROTARY RIG) 06/08/2024		17. DATE TOTAL DEPTH REACHED 06/13/2024		18. DATE COMPLETED/ABANDONED 07/13/2024		19. DATE OF FIRST PROD. / INJ. PROD:08/06/2024 INJ:		
20. DEPTH REFERENCE GROUND LEVEL ☐ KELLY BUSHING ☒ DERRICK FLOOR ☐					21. DEPTH REFERENCE ELEVATION 7029 (US Feet)		22. GRADED GROUND LEVEL ELEVATION 7016 (US Feet)			
23. WELLBORE DEVIATION PROFILE VERTICAL ☐ DIRECTIONAL ☒ HORIZONTAL ☐					24. TOTAL DEPTH MD 5759 TVD 5676		25. PLUGGED BACK TOTAL DEPTH MD 5759 TVD 5676			
26. CURRENT WELL STATUS Producing										

27. LOCATION OF WELL									
WELL POSITION	FOOTAGES		QTR-QTR	SECTION	TOWNSHIP	RANGE	MERIDIAN	UTM EASTING	UTM NORTHING
Surface	160 FSL	2151 FWL	SESW	7	6.0 S	5.0 W	U	543444	4424289
Producing Interval Top	371 FNL	2166 FWL	NE	18	6.0 S	5.0 W	U		
Producing Interval Bottom	775 FNL	2192 FWL	NE	18	6.0 S	5.0 W	U		
Total Depth	786 FNL	2108 FWL	NE	18	6.0 S	5.0 W	U		

28. HOLE, CASING AND CEMENT INFORMATION															
STRING	HOLE SIZE	CASING O.D.	WEIGHT	GRADE	THREAD	TOP (MD)	BOTTOM (MD)	DV TOOL DEPTH	LEAD TAIL	CEMENT TYPE	SACKS	YIELD	WEIGHT	CEMENT TOP	BASIS FOR TOP
COND	24.0	16.0	32.7	UKN	LTC	0	80			Type I	188	1.15		13	Circulate
SURF	12.14	8.625	32.0	J-55	LTC	0	569			Class G Cement	427	1.17	15.8	13	Circulate
PROD	7.921	5.5	17.0	N-80	LTC	0	5761		T	Class G Cement	408	1.98	12.5		
									L	Class G Cement	260	2.9	11.5	13	Circulate

29. TUBING RECORD			
TUBING SIZE	TOP (MD)	BOT (MD)	PACKER DEPTH
2.875	13	5620	

30. RETRIEVABLE / TEMPORARY PLUGS		
PLUG	DEPTH (MD)	TYPE

31. PERMANENT / ABANDONMENT PLUGS		
PLUG	TOP (MD)	BOTTOM (MD)

32. FORMATION DETAILS and STRATIGRAPHIC MARKERS				
FR	FORMATION NAME	TOP (MD)	TOP (TVD)	DESCRIPTION, CONTENTS, ETC.
1	GREEN RIVER	388	388	
	OIL SHOW? ☐ GAS SHOW? ☐ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☐ COMMINGLED? ☐			
2	GREEN RIVER - UPPER	799	794	
	OIL SHOW? ☐ GAS SHOW? ☐ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☐ COMMINGLED? ☐			
3	MAHOGANY	1269	1256	
	OIL SHOW? ☐ GAS SHOW? ☐ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☐ COMMINGLED? ☐			
4	DOUGLAS CREEK	2276	2246	TGR3
	OIL SHOW? ☐ GAS SHOW? ☐ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☐ COMMINGLED? ☐			
5	DOUGLAS CREEK	3050	3008	
	OIL SHOW? ☒ GAS SHOW? ☒ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☒ COMMINGLED? ☐			
6	BLACK SHALE	3763	3710	
	OIL SHOW? ☐ GAS SHOW? ☐ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☐ COMMINGLED? ☐			
7	CASTLE PEAK	4106	4048	
	OIL SHOW? ☒ GAS SHOW? ☒ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☒ COMMINGLED? ☐			
8	UTELAND BUTTE	4556	4490	
	OIL SHOW? ☒ GAS SHOW? ☒ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☒ COMMINGLED? ☐			
9	WASATCH	4735	4667	
	OIL SHOW? ☒ GAS SHOW? ☒ WATER FLOW? ☐ DRILL STEM TESTED? ☐ CORED? ☐ COMPLETED OR TESTED? ☒ COMMINGLED? ☐			

10	WASATCH	5365	5286	CR-4 Wasatch			
	OIL SHOW? ☒	GAS SHOW? ☒	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☒	COMMINGLED? ☐
11	WASATCH	5703	5621	CR -6 Wasatch			
	OIL SHOW? ☐	GAS SHOW? ☐	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☐	COMMINGLED? ☐

33. COMPLETED and TESTED INTERVALS (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)						
FR	TOP (MD)	BOTTOM (MD)	TOP (TVD)	BOTTOM (TVD)	STIMULATION TREATMENT	INTERVAL STATUS
5	3298	3697			Fracture Stimulated	PRODUCING
7	4162	4442			Fracture Stimulated	PRODUCING
8	4628	4766			Fracture Stimulated	PRODUCING
9	4851	5269			Fracture Stimulated	PRODUCING
10	5367	5668			Fracture Stimulated	PRODUCING

34A. PRODUCTION INFORMATION (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)								
FR	TOP (MD)	BOTTOM (MD)	DATE FIRST PROD.	TEST DATE	HRS. TESTED	TBG. PRESSURE	CSG. PRESSURE	PROD. METHOD
5	3298	3697	08/06/2024	08/11/2024	24	190	350	Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API GAS BTU
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)	3962	0.0
	104	412	112	104	412	112		
7	4162	4442	08/06/2024	08/11/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API GAS BTU
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)	3962	0.0
	0	0	0	104	412	112		
8	4628	4766	08/06/2024	08/11/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API GAS BTU
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)	3962	0.0
	0	0	0	104	412	112		
9	4851	5269	08/06/2024	08/11/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API GAS BTU
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)	3962	0.0
	0	0	0	104	412	112		
10	5367	5668	08/06/2024	08/11/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API GAS BTU
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)	3962	0.0
	0	0	0	104	412	112		

35. WELL TREATMENTS (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)						
FR	TREATMENT TYPE	TOP (MD)	BOTTOM (MD)	START DATE	END DATE	AMOUNT AND TYPE OF MATERIAL
5	Hydraulic Fracture	3298	3697	07/12/2024	07/13/2024	Stage 4 1227 bbls fluid 95000 lbs 40/70 local sand 60 Bio balls
7	Hydraulic Fracture	4162	4442	07/12/2024	07/13/2024	Stage 3 2724 bbls fluid 180400 lbs 40/70 local sand 60 Bio balls
8	Hydraulic Fracture	4628	4766	07/12/2024	07/13/2024	Stage 2 2381 bbls fluid 235000 lbs 40/70 local sand 57 Bio Balls
9	Hydraulic Fracture	4851	5269	07/12/2024	07/13/2024	Stage 1 2152 bbls fluid 110,000 lbs 40/70 local sand, 57 Bio Balls
10	Hydraulic Fracture	5367	5668	07/12/2024	07/13/2024	Stage 1 same as FR9

36. LOGS, SURVEYS, AND REPORTS (PDF file of each and LAS file of logs if available are to be submitted.)	
REPORTS AND OTHER INFORMATION.	
Dx Survey ☒	DST Report ☐ Core Analysis ☐ DOGM Form 7 ☐ Geologic Report ☐ Wellbore Diagram ☒ Other ☐
SUBMITTED PDF LOGS CEMENT BOND	SUBMITTED LAS LOGS

OGM Official Use Only

37. I hereby certify that the foregoing and attached information is complete as determined from all available records.		
NAME TaraLee Knutson	TITLE Administrative Supervisor	DATE 09/02/2024
SIGNATURE N/A	PHONE 435-722-1325	EMAIL TKnutson@bry.com




Automated Drilling Wellbore Schematic

Well Name: FEDERAL 3-18D-65

API/UWI (10) 4301354019		Field Name UNTA - AREA X - ASHLEY FOREST		County Duchesne		State/Province UT		Section 7	Township 006-S	Range 005-W	Survey	Block
Gr Elev (ft) 7,016.50	KB Datum Elevation (ft) 7,029.50	KB-Grd (ft) 13.00	Spud Date 6/9/2024	Rig Release Date 6/16/2024	TD Date 6/13/2024	Latitude (NAD 27) (°) 39.9676800000		Longitude (NAD 27) (°) -110.4905700000		Operated? Yes		

Vertical (0° to 15°), Original Hole, 9/4/2024 11:33:59 AM

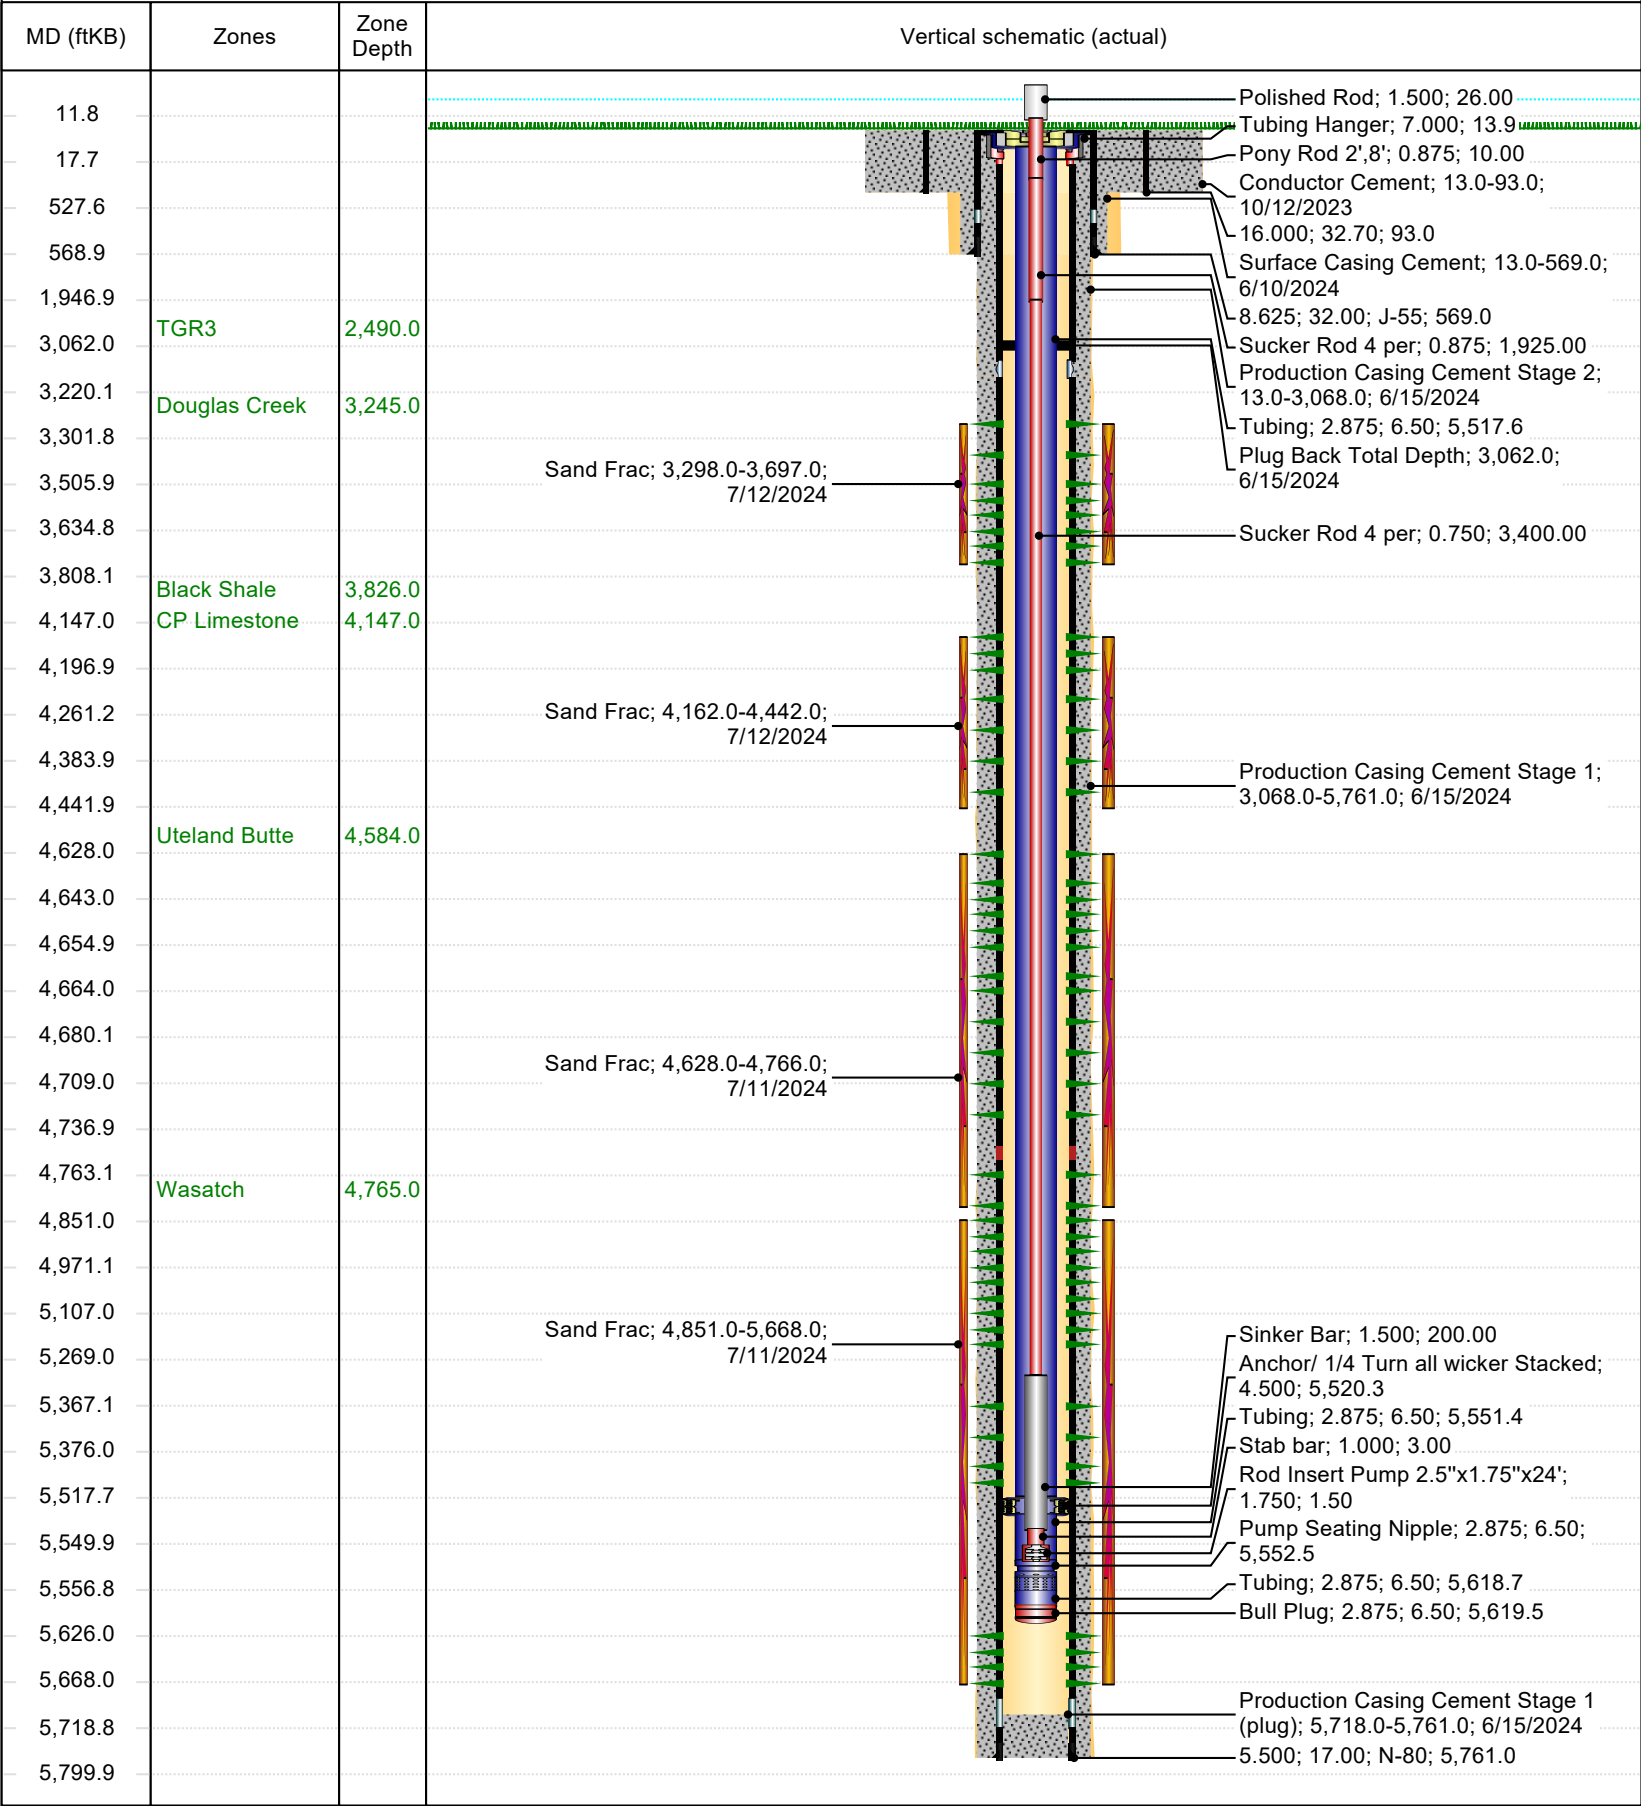



Operations Summary

Well Name: FEDERAL 3-18D-65

API/UWI (10) 4301354019		Surface Legal Location Sec 7 T6S R5W USB&M		County Duchesne		State/Province UT			
Spud Date 6/9/2024		Rig Release Date 6/16/2024		KB-Ground Distance (ft) 13.00		Ground Elevation (NAD 83) (ft) 7,016.50			
Job Category Completion		Primary Job Type Initial Completion		Secondary Job Type AFE		Start Date 6/25/2024		End Date 7/20/2024	
6/25/2024 08:00 - 6/25/2024 09:00									
Operations at Report Time Install Tubing head				Operations Next Report Period MIRU completion rig					
Operations Summary HSM, Reviewed JSA. MIRU, remove night cap. Install 7"10K tubing head. Torque to spec with Hyd. wrenches. SWI, RDMO									
Com									
HSM, Reviewed JSA. MIRU, remove night cap. Install 7"10K tubing head. Torque to spec with Hyd. wrenches. SWI, RDMO									
6/28/2024 07:00 - 6/28/2024 19:30									
Operations at Report Time MIRU. Drill DV tool.				Operations Next Report Period LD all tubing. RDMO					
Operations Summary HSM, Reviewed JSA. MIRU. TIH w/ Mill assembly, tubing to DV tool. Drill out. TIH to Float collar. Circulate clean. SWI SDFN									
Com									
HSM, Reviewed JSA. MIRU. Spot in, prep & function test BOP's. Remove WH, Install BOP's. Rig up work floor & 2 7/8" tubing equipment. Spot in Pump & tank. Rig up pump & flow back lines. Spot in tubing. Prep tally, pick up & TIH w/ 1-4 ¾" RBS mill & string mill welded assembly. 1-2 3/8" IF x 2 7/8" EUE X-over, 1-2 7/8" x 6' tubing pup joint. 1-jt 2 7/8" J-55 tbg, 1-2 7/8" PSN, 98-jts 2 7/8" J-55 tbg & tag stage tool 4' out on jt 98 @3062.30'. Lay down jt 98. Rig up Weatherford power swivel. Stab Washington rubber. Pump down csg up tbg @2 BPM & catch circulation w/ 1 BW. Drill on stage tool for 1.5 hours. Swivel kept losing torque. Tried torque adjustment & could not make any change in torque output. Circulate 30 bbls to clean well bore. Call for new swivel, Rack out old swivel (Had to use tongs to break connections due to no torque). Wait for RBS swivel. Drill out stage tool & ream with string mill until it went through smoothly. (32 more minutes to drill & clean up w/ string mill). Circulate 20 bbls down csg up tbg until returns were clean. Rig down swivel. Continue to pick up & TIH w/ 88-jts 2 7/8" J-55 tbg to float collar19' out on jt 184 @5717.50'. Rig up power swivel, circulate 120 bbls treated wtr down csg up tbg. Door seals were leaking on BOP's. LD jt 184 Rig down power swivel. TOH & lay down 3-jts 2 7/8" J-55 tbg on float. XO door seals on BOP (will pressure test csg in AM) SWI EOT @5605 & SDFN.									
6/29/2024 07:00 - 6/29/2024 13:30									
Operations at Report Time LD all tubing. Run CBL				Operations Next Report Period Frac Ops					
Operations Summary HSM, Reviewed JSA. TOH laying down all tubing and mill assembly. RDMO rig and support equipment. Preform CBL. SWI SDFN									
Com									
SITP 0 psig. SICP 0 psig Review one step JSA for: Laying down tubing, removing BOP's, installing wellhead & rigging down. (Check for H2s w/ 4 gas monitor, none present) Pressure test csg @2100 psig (good test). TOH & lay down 180-jts 2 7/8" J-55 tbg & BHA on float. Remove BOP's, install well head. RDMO, rack out pump. Clean location. Load equipment. Leave 1 pump operator to hold pressure on csg while logging. MIRU wireline. TIH w/ CBL tools. Tag plug back @ 5708', preform CBL. Cement top @ 450'. RDMO wireline. Install wellhead. SWI SDFN									
7/1/2024 13:00 - 7/1/2024 15:30									
Operations at Report Time Test production casing				Operations Next Report Period Perf Stage 1-Frac Prep					
Operations Summary Move in & rig up Weatherford testing equipment for casing test and frac stack install. Conduct morning safety meeting HMS-JSA discussed-High pressure testing-suspended loads-working at heights over 4 ft. Install 10 WFT 7 1/6 master valve and pressure test casing to 7700 Psi and chart for 30 minutes- test held-well was bled off. continue with frac stack install									
Com									
Move in & rig up Weatherford testing equipment for casing test and frac stack install. Conduct morning safety meeting-JSA discussed-High pressure testing-suspended loads-working at heights over 4 ft. Use manlifts at all heights over 4 ' with safety harness Install 10 WFT 7 1/6 master valve and pressure test casing to 7700 Psi and chart for 30 minutes- test held-well was bled off. continue with frac stack install-all stacks will be tested & charted to 10,000 Psi.									
7/2/2024 07:00 - 7/2/2024 16:00									
Operations at Report Time Test Frac Stack				Operations Next Report Period Perf Stage #1-Frac Prep location					
Operations Summary Rig up WFT testing equipment-Safety meeting-JSA discussed-Heavy suspended loads-Tripping hazards-pinch points-high pressure lines Instal frac stack and pressure to a max Psi of 10,000-test low at 500 psi for 5 min and test high at 10K for 15 min-chart all testing- Job complete, rig down WFT equipment and release from location									
Com									
Morning safety meeting with Weatherford crews-JSA & SWA discussed Begin remainder of frac stack instal with bottom master valve-HCR valve -flow cross-master valve & goat head with 10K 7 1/16 X 5" 10K wire line spool-stack was pressure test on low side to 500 psi for 5 minutes-pressured to 10k and held for 15 minutes with no leaks and 30.. psi loss in pressure- bleed off pressure and secure well.									
7/3/2024 16:00 - 7/3/2024 17:30									
Operations at Report Time Perform 1st shoot stage #1				Operations Next Report Period Frac Prep					
Operations Summary Move in and rig up Extreme wireline-Conduct safety meeting with cfrew-JSA working with heavy suspended loads-using safety harness working at heights-Hot windy conditions-all PPE required Inspect guns for stage #1, measure and pick up guns trip in									
Com									
Move in rig up Extreme wireline-conduct safety meeting with crew-JSA heavy suspended loads-watch hand & foot placement-be aware of possible well pressure after perforating-working at heights over 4 ft using fall protection in man basket-all PPE required Wasatch Formation: Perf Satge #1 as follows--5665-68---5626-27---5414-16---5375-76---5367-69---5107-09---5011-13---4969-71---4851-54--@ 2 SPF -180 degree phasing 41" of penetration. 3 1/8 HSE guns with 22.7 gram charges .42 entry-Check guns to insure all shots fired- close in and secure well. No pressure on well after perforating.									
7/11/2024 06:00 - 7/12/2024 06:00									
Operations at Report Time Begin 24 Hour frac operatios				Operations Next Report Period Continue with 24 hour frac operations					
Operations Summary Morning Safety Meeting with all crew members. Perforate stage #2. Frac stages #1 and #2. Jobs pumped as per design/100% of proppant placed.									
Com									
Continue with rig up operations-Start with this well first due to rig lock leaking on 2-18D-65 Pressure test all Iron to 8000 psi -Positive test-conduct safety meeting Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location Define emergency escape vehicles Discuss nearest hopital and phone numbers Discuss tripping hazards-hand placements-overhead loads High pressure pumping occuring along with wireline operations-Only authorized Personnel to operate HCR valves- stay clear of red zone Caution tape all extended trailer tongs-HCR valve stems Head level hazards Remote location-no phone access-WiFi access thru frac van---									



Operations Summary

Well Name: FEDERAL 3-18D-65

Com	
ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #1 Wasatch Frac as follows : Perfs -4851-54---4969-71---5011-13---5107-09---5267-69---5367-68---5375-76---5414-16---5626-27---5665-68-All @ 2 spf-total of 38 Perfs Initial breakdown pressure 2100 @ 10 bpm Well Open @ 1425 Hrs hrs PSI 150 WHP 40 bbl injection Test Pre Frac shut in pressures ISIP 682 Psi 5 min 500 Psi 10 min 442 Psi 15 Min 407 psi Pumped 1000 gals 7.5% HCL Break down of 15 BPM @ 2100 psi. Drop 57 Bio Balls for diversion saw 500 psi differential with balls at perfs- Max Rate =79.5 BPM Max psi.- 4292 Average Rate =-72.3 Bpm Average psi @ 2152 -Total fluid pumped = 2107 bbls Final Frac Gradient = 0..56 Total Prop Used 110,000 #'s of 40/70 -Local ISIP 745 psi 5 minute 631 psi 10 minute 601 psi 15 minute 582 psi SICP = 1260 psi. Pick up lube and #2 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6/29/2024. Uteland Butte: Guns are 3-1/8” HSC, 2 spf, 22.7 grams with .41” -entry hole and 180 -deg phasing. Perforate Stage #2 as follows- 4628-29---4641-43---4647-49---4655-57---4664-66---4677-80---4685-86---4709-10---4735-37---4763-66 Set KLX Dissolvable Frac Plug @ 4790' Pull out of the hole with wireline. All guns Fired. Plug Did not Set - Setting tool did not Stroke. Run in W/ new Plug & Setting tool Set Plug @ 4790' Good Set. Turn well over to Frac Equipment. ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #2 Uteland Butte Frac as follows : Perfs - 4628-29 - 4641-43 - 4647-49 - 4655-57 - 4664-66 - 4677-80 - 4685-86 - 4709-10 - 4735-35 - 4763-66 -All @ 2 spf-total of 38 Perfs Initial breakdown pressure 2350 @ 11 bpm Well Open @ 611 psi Hrs hrs PSI 150 WHP 22 bbl injection Test Pre Frac shut in pressures ISIP 1065 Psi 5 min 642 Psi 10 min 516 Psi 15 Min 463 psi Pumped 1000 gals 7.5% HCL Break down of 25 BPM @ 1592 psi. Drop 57 Bio Balls for diversion saw 200 psi differential with balls at perfs- Max Rate =81.1 BPM Max psi.- 3076 psi - Average Rate =-80.2 Bpm Average psi @ 2103 psi -Total fluid pumped = bbls Final Frac Gradient = 0..67 Total Prop Used 235,000 #'s of 40/70 -Local ISIP 1124 psi 5 minute 786 psi 10 minute 728 psi 15 minute 696 psi Wait to perf stage #3	
7/12/2024 06:00 - 7/13/2024 06:00	
Operations at Report Time 24 horu frac operations	Operations Next Report Period 24 hour frac operations
Operations Summary Morning Safety Meeting with all crew members: Perforate stages #3 and #4. Frac stages #3 and #4. Jobs pumped as per design with 100% of proppant placed. Stimulation complete.	
Com	
Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location Define emergency escape vehicles Discuss nearest hopital and phone numbers Discuss tripping hazards-hand placements-overhead loads High pressure pumping occuring along with wireline operations-Only authorized Personnel to operate HCR valves- stay clear of red zone Caution tape all extended trailer tongs-HCR valve stems Head level hazards Remote location-no phone access-WiFi access thru frac van--- SICP = 540 psi. Pick up lube and #3 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6-29-2024. Castle Peak Guns are 3-1/8” HSC, 2 spf, 22.7 grams with .41” -entry hole and 180 -deg phasing. Perforate Stage #3 as follows-4162-66---4197-4201---4258-61---4320-23---4384-88---4440-42 Total Holes 40 Set KLX Dissolvable Frac Plug @ 4500 Pull out of the hole with wireline. All guns Fired - ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #3 Castle Pek Frac as follows :Perfs 4162-66---4197-4201---4197-4201---4258-61----4320-23---4384-88---4440-42-All @ 2 spf-total of 38 Perfs Initial breakdown pressure 2350 Well Open @ 0730 hrs PSI 1466 - Pumped 1000 gals 7.5% HCL Break down of 20 BPM @ 2350 psi. Drop 60 Bio Balls for diversion saw 350 psi differential with balls at perfs- ISDP-550 after Breakfown 5 Minute 415 Psi 10 Minute-413 Psi 15 Minute-411 Psi Frac Gradient = 0..57 Total Prop Used 180,400 #'s of 40/70 -Local Max Rate =81.1 BPM Max psi.- 2310 Average Rate = 78.8 Bpm Average psi 1592 Total fluid pumped = 2724 bbls Post Frac ISIP-717 5 Min 517 10 Min 455 15 Min 421 F.G. .59 Wait to perf & frac 4-18D-65 Wait to frac 2-18D SICP = 1260 psi. Pick up lube and #4 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6/29/2024. Douglas Creek:: Guns are 3-1/8” HSC, 2 spf, 22.7 grams with .41” -entry hole and 180 -deg phasing. Perforate Stage #4 as follows- 3298-3302---3427-32---3506-3509---3631-35---3692-97 Set KLX Dissolvable Frac Plug @ 3750 Pull out of the hole with wireline. All guns Fired.42 Total holes-Drop 63 Bio Balls	



Operations Summary

Well Name: FEDERAL 3-18D-65

Com	
ProFrac Well Service. Pressure test lines good at 8000 psi.	
Stage #4 Douglas Creek Frac as follows :Perfs 3298-3302---3427-3432---3506-09---3631-3635---3692-97-All @ 2 spf-total of 42 Perfs Initial breakdown pressure 1605 @ 20 bpm Well Open @ 1610 hrs PSI 337 - Pumped 1000 gals 7.5% HCL Break down of 20 BPM @ 1600 psi 30 bbls pumped. Drop 60 Bio Balls for diversion saw 3500 psi differential with balls at perfs- ISDP-858 after Breakdown 5 Minute 397 Psi 10 Minute-333 Psi 15 Minute-298 Psi Frac Gradient = 0.57 Total Prop Used 95,000 #'s of 40/70 -Local Max Rate =81 BPM Max psi.- 5300 Average Rate = 77.7 Bpm Average psi 1669. Total fluid pumped = 1227 bbls	
Post Frac ISIP-1031 5 Min 789 10 Min 731 15 Min 689 Post F.G .72 Final Closing pressure 670psi.	
Well Complete Final closing pressure 685 Close in bottom Mater Valve Bleed well off Cose in HCR valve	
7/17/2024 13:00 - 7/17/2024 18:00	
Operations at Report Time MIRU for Drill Out	Operations Next Report Period Pick up tbg & drill out plugs
Operations Summary HSM, Review JSA. MIRU. Spot in tbg trailer. CSG press 1300 psi attempt to blow well down flowing & surging oil, gas & wtr @ approx 2-3 bpm. MIRU Extreme Wireline to set kill plug. RIH w/10 k CBP set @ 3265'. RDMO Wireline. Bleed well down & shut in for night. SDFN.	
Com	
HSM, Review JSA. MIRU. Spot in tbg trailer. CSG press 1300 psi attempt to blow well down flowing & surging oil, gas & wtr @ approx 2-3 bpm. MIRU Extreme Wireline to set kill plug. RIH w/10 k CBP set @ 3265'. RDMO Wireline. Bleed well down & shut in for night. SDFN.	
7/18/2024 07:00 - 7/18/2024 19:00	
Operations at Report Time Drill out plugs	Operations Next Report Period TOH w/drill out assembly. TIH w/prod tbg. Prep & PU/rods
Operations Summary HSM, Review JSA. Func test BOP & Install on top of Frac master valve. Prep & tally tbg. PU/4-3/4" rock bit, bit sub w/float, 1 jt 2-7/8" J-55 tbg, X-nipple, 105 jts 2-7/8" tbg tag Kill plug @3265'. RU/power swivel. Brk circ w/46 bbls treated wtr. Press test BOP, pump & return lines to 1500 psi good test. D/O kill plug, 1st plug @ 3750' was gone, C/O 126' of sand to 2nd plug @ 4500' drilled in 1 min, 3rd plug @ 4790' was gone. PU/tbg tag @ 5617'. RU/power swivel. C/O 101' of sand to PBTD @ 5718' Circ well clean. Rack out power swivel. LD/3 jts 2-7/8" tbg. TOH above top perf @ 3298' w/78 jts 2-7/8" tbg EOT @ 3225'. SWI & SDFN.	
Com	
SITP 0 psig. SICP 0 psig Review one step JSA for: Bleeding down tbg. Picking up tubing, rigging up pump, tank & power swivel. Drilling & TOH w/ tubing. (Check for H2s w/ 4 gas monitor, none present) Bleed down well. Shut in for 30 minutes & it built to 150 psig. Spot in, prep & function test BOP's. Install BOP on top of master valve. Rig up work floor & 2 7/8" tubing equipment. Prep tally, pick up & TIH w/ 1-4 3/4" Rock bit. 1-2 7/8" Bit sub w/ float. 1-jt 2 7/8" J-55 tbg, 1-2 7/8" X-Nipple, 104-jts 2 7/8" J-55 tbg & tag kill plug 6' out on jt 105 @3265'. Lay down jt 105. Rig up Landmark power swivel. Stab Washington rubber. Pump down tbg up csg @3.5 BPM & catch circulation w/ 46 BW. Shut pipe rams & test BOP, CSG & lines @1500 psig (good test). Pump down tbg up csg @2.5 BPM, hold 600 psig back pressure on csg. Drill out kill plug 6' out on jt 149 @3265' (8 minutes to drill, lost 600 psig but regained returns). RIH & tag fill 10' out on jt 142 #4374'. (Plug was gone, 126' above plug #2, 624' below plug #1). Clean out fill & drill out plug #2 3' out on jt 146 @4500' (1-minute to drill out plug #2. Was flowing gas & water back up csg @300-500 psig while RIH from KP to fill)). RIH & tag fill 14' in on jt 183 @5617'. Clean out 101' of fill to float collar 16' out on jt 187 @5787.30'. Circulate 130 bbls treated water down tbg up csg @4.3 BPM 600 psig until returns were clean. Lay down 3-jts 2 7/8" J-55 tbg on float. (8 total jts on float). TOH w/ 78-jts 2 7/8" J-55 tbg, SWI EOT @3225' Top Perf @3298' SWI & SDFN. Kill Plug @3265' (no fill, 8 minutes to drill, 600 psig loss but regained circ.) Dissolvable Plug #1 @3750' (no fill, plug was gone). Dissolvable Plug #2 @4500' (126' of fill, 1 minute to drill then plug dropped away), Dissolvable Plug #3 @4790' (no fill, plug was gone). Float Collar @5718' (101' of fill, cleaned to it but didn't drill it out).	
7/19/2024 07:00 - 7/19/2024 17:30	
Operations at Report Time TOH w/bit. TIH w/prod tbg	Operations Next Report Period Prep & PU/prod rod string
Operations Summary HSM, Review JSA. Circ 80 bbls treated wtr around to clear gas migration. TOH w/tbg. Pumped 45 bbls 9.8# brine. TIH w/BHA, 182 jts 2-7/8" J-55 tbg. (Fought well control issues all day tripping out & in the hole). SWI & SDFN.	
Com	
SITP 0 psig. SICP 600 psig Review one step JSA for: Bleeding down well, pump operations, TOH w/ tubing, TIH w/ tubing, removing BOP's, installing wellhead, picking up rods, & rigging down. (Check for H2s w/ 4 gas monitor, none present) Bleed down well. Circ. Down tbg up csg w/ 80 bbls wtr. TOH w/ 102-jts 2 7/8" J-55 tbg, 1-X-nipple, 1-jt 2 7/8" J-55 tbg, lay down bit sub & bit. TIH w/ production tbg as follows: 1-2 7/8" Bull plug, 2-jts 2 7/8" J-55 tbg, 1-2 7/8" x 4' J-55 perforated pup jt, 1-2 7/8" PSN, 1-jt 2 7/8" J-55 tbg, 1-2 7/8" x 5 1/2" TAC (1/4 set, 45k shear, wicker slips), 179-jts 2 7/8" J-55 tbg. (Fought well control issues all day on TOH & TIH. Pumped 45 bbls brine to start in w/ production). SWI & SDFN to circulate in AM & land well.	
7/20/2024 07:00 - 7/20/2024 17:00	
Operations at Report Time Prep & PU/prod rod string	Operations Next Report Period Drill out Complete
Operations Summary HSM, Review JSA. SITP/800 psi, SICP/1300 psi. Circ 80 bbls to control well. Remove Stripping rubber. Land tbg on hanger w/TIW valve in tbg. Remove BOP & Frac master valve. Circ 80 bbls to control well. Set 1/4 turn TAC. Install WH. PU/1-3/4"x24" pump, 1- 1" stab bar, 8 wt bars, 136- 3/4" 4 per D-rods, 77- 7/8" 4 per D-rods, 2', 8' ponies, 26' pol rod. Fill w/15 bbls & stroke test pump to 500 psi good test. HWO w/84" of polish rod above stuffing box. RDMO & TOTP.	
Com	
SITP 800 psig. SICP 1300 psig Review one step JSA for: Bleeding down well, pump operations, removing BOP's, installing wellhead, picking up rods, & rigging down. (Check for H2s w/ 4 gas monitor, none present) Bleed down well. Circ. Down tbg up csg w/ 80 bbls wtr. Remove wash rubber. Make up 4' sub, HGR, 6' sub, 2' sub & FOSV. Land tbg on dummy HGR. Remove BOP's & master valve. Circ. Down tbg up csg w/ 80 bbls wtr. Set TAC @5517.56' w/ 12k tension (15"), SN @5551.40', EOT @5619.49'. Remove dummy HGR. Land tbg on production Hanger. Install well head. Test new pump @surface. TIH w/ 25-175-20-5-4-0 (24') pump #BP 6883, 1-1" 3 per rod centralizer, 8-1 1/2" Sinker bars, 136-3/4" 4 per D rods, 77-7/8" 4 per D rods, 8',2' x 7/8" pony rods & 1-1 1/2" x 26' polish rod. Seat pump & test @500 psig w/ 15 BW (good test). Clamp off w/ 7' of polish rod above stuffing box. Rig down. Drain & oil pump. Rack out hard line. Clean up trash & MOLO. Move rig & equipment by 4-way intersection on Cottonwood & SDFWE.	