

STATE OF UTAH DEPARTMENT OF NATURAL RESOURCES DIVISION OF OIL, GAS AND MINING										FORM 8
WELL COMPLETION OR RECOMPLETION REPORT AND LOG										1. WELL NAME Federal 15-7D-65
2. TYPE OF WELL Oil Well			3. TYPE OF WORK DRILL NEW ☒ REENTER P&A ☐ DEEPEN ☐ RECOMP ☐				4. API NUMBER 4301354030			
5. NAME OF OPERATOR Berry Petroleum Company LLC					6. OPERATOR PHONE			7. FIELD NAME BRUNDAGE CANYON		
8. ADDRESS OF OPERATOR 11117 River Run Boulevard, Bakersfield, CA, 93311					9. OPERATOR E-MAIL			10. UNIT NAME		
11. MINERAL LEASE NUMBER UTU77328			12. MINERAL OWNERSHIP FEDERAL			13. SURFACE OWNERSHIP FEDERAL		14. COUNTY DUCHESNE		
15. DATE SPUDDED (SPUD RIG) 10/10/2023		16. DATE SPUDDED (ROTARY RIG) 05/22/2024		17. DATE TOTAL DEPTH REACHED 05/28/2024		18. DATE COMPLETED/ABANDONED 07/12/2024		19. DATE OF FIRST PROD. / INJ. PROD:08/06/2024 INJ:		
20. DEPTH REFERENCE GROUND LEVEL ☐ KELLY BUSHING ☒ DERRICK FLOOR ☐					21. DEPTH REFERENCE ELEVATION 7044 (US Feet)			22. GRADED GROUND LEVEL ELEVATION 7031 (US Feet)		
23. WELLBORE DEVIATION PROFILE VERTICAL ☐ DIRECTIONAL ☒ HORIZONTAL ☐					24. TOTAL DEPTH MD 5947 TVD 5817			25. PLUGGED BACK TOTAL DEPTH MD 5947 TVD 5817		
26. CURRENT WELL STATUS Producing										

27. LOCATION OF WELL									
WELL POSITION	FOOTAGES		QTR-QTR	SECTION	TOWNSHIP	RANGE	MERIDIAN	UTM EASTING	UTM NORTHING
Surface	201 FSL	2083 FWL	SESW	7	6.0 S	5.0 W	U	543423	4424302
Producing Interval Top	446 FSL	1500 FWL	SESW	7	6.0 S	5.0 W	U		
Producing Interval Bottom	617 FSL	1049 FWL	SESW	7	6.0 S	5.0 W	U		
Total Depth	636 FSL	1003 FWL	SESW	7	6.0 S	5.0 W	U		

28. HOLE, CASING AND CEMENT INFORMATION																
STRING	HOLE SIZE	CASING O.D.	WEIGHT	GRADE	THREAD	TOP (MD)	BOTTOM (MD)	DV TOOL DEPTH	LEAD TAIL	CEMENT TYPE	SACKS	YIELD	WEIGHT	CEMENT TOP	BASIS FOR TOP	
COND	24.0	16.0	32.7			13	93			Type I	188	1.15				
SURF	15.5	8.625	32.0	J-55	LTC	13	557			Class G Cement	427	1.17	15.8	0	Circulate	
	15.5	8.625	32.0	J-55	LTC	557	558									
	15.5	8.625	32.0	J-55	LTC	558	598									
	15.5	8.625	32.0	J-55	LTC	598	600	600								
PROD	7.921	5.5	17.0	N-80	LTC	13	17		T	Class G Cement	408	1.98				
	7.921	5.5	17.0	N-80	LTC	17	5900		L	Class G Cement	272	2.9				
	7.921	5.5	17.0	N-80	LTC	5900	5944									
	7.921	5.5	17.0	N-80	LTC	5944	5947	5947								

29. TUBING RECORD			
TUBING SIZE		TOP (MD)	BOT (MD)
2.875		14	5663

30. RETRIEVABLE / TEMPORARY PLUGS		
PLUG	DEPTH (MD)	TYPE

31. PERMANENT / ABANDONMENT PLUGS		
PLUG	TOP (MD)	BOTTOM (MD)
1	5663	5664

32. FORMATION DETAILS and STRATIGRAPHIC MARKERS							
FR	FORMATION NAME	TOP (MD)	TOP (TVD)	DESCRIPTION, CONTENTS, ETC.			
1	GREEN RIVER	2465	2411	TGR3			
	OIL SHOW? ☐	GAS SHOW? ☐	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☐	COMMINGLED? ☐
2	DOUGLAS CREEK	3231	3159				
	OIL SHOW? ☒	GAS SHOW? ☒	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☒	COMMINGLED? ☐
3	BLACK SHALE	3923	3835				
	OIL SHOW? ☐	GAS SHOW? ☐	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☐	COMMINGLED? ☐
4	CASTLE PEAK	4266	4171				
	OIL SHOW? ☒	GAS SHOW? ☒	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☒	COMMINGLED? ☐
5	UTELAND BUTTE	4719	4612				
	OIL SHOW? ☒	GAS SHOW? ☒	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☒	COMMINGLED? ☐
6	WASATCH	4891	4780				
	OIL SHOW? ☒	GAS SHOW? ☒	WATER FLOW? ☐	DRILL STEM TESTED? ☐	CORED? ☐	COMPLETED OR TESTED? ☒	COMMINGLED? ☐

33. COMPLETED and TESTED INTERVALS (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)
--

FR	TOP (MD)	BOTTOM (MD)	TOP (TVD)	BOTTOM (TVD)	STIMULATION TREATMENT	INTERVAL STATUS
2	2248	3711			Fracture Stimulated	PRODUCING
4	4243	4540			Fracture Stimulated	PRODUCING
5	4721	4853			Fracture Stimulated	PRODUCING
6	5155	5958			Fracture Stimulated	PRODUCING

34A. PRODUCTION INFORMATION (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)								
FR	TOP (MD)	BOTTOM (MD)	DATE FIRST PROD.	TEST DATE	HRS. TESTED	TBG. PRESSURE	CSG. PRESSURE	PROD. METHOD
2	2248	3711	08/06/2024	08/12/2024	24	0	50	Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)		GAS BTU
	152	478	240	152	478	240	3145	33.0
4	4243	4540	08/06/2024	08/12/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)		GAS BTU
	0	0	0	152	478	240	3145	0.0
5	4721	4853	08/06/2024	08/12/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)		GAS BTU
	0	0	0	152	478	240	3145	0.0
6	5155	5958	08/06/2024	08/12/2024	24			Pumping
	TEST PRODUCTION VOLUMES			24-HOUR PRODUCTION RATES			GAS-OIL RATIO	OIL API
	OIL (BBL)	GAS (MSCF)	WATER (BBL)	OIL (BBL)	GAS (MSCF)	WATER (BBL)		GAS BTU
	0	0	0	152	478	240	3145	0.0

35. WELL TREATMENTS (Formation Reference (FR) 1, 2, 3, ..., etc. as in Section 32.)						
FR	TREATMENT TYPE	TOP (MD)	BOTTOM (MD)	START DATE	END DATE	AMOUNT AND TYPE OF MATERIAL
2	Hydraulic Fracture	2248	3711	07/13/2024	07/13/2024	Stage 4 2246 bbls fluid 106740 lbs 40/70 local sand 53 Bio balls
4	Hydraulic Fracture	4243	4540	07/13/2024	07/13/2024	Stage 3 2428 bbls fluid 200000 lbs 40/70 local sand 57 Bio balls
5	Hydraulic Fracture	4721	4853	07/13/2024	07/13/2024	Stage 2 2634 bbls fluid 202000 lbs 40/70 local sand 57 Bio Balls
6	Hydraulic Fracture	5155	5958	07/12/2024	07/12/2024	Stage 1 1546 bbls fluid 91120 lbs 40/70 local sand 57 Bio Balls

36. LOGS, SURVEYS, AND REPORTS (PDF file of each and LAS file of logs if available are to be submitted.)	
REPORTS AND OTHER INFORMATION.	
Dx Survey ☒	DST Report ☐
Core Analysis ☐	DOGM Form 7 ☐
Geologic Report ☐	Wellbore Diagram ☒
Other ☐	
SUBMITTED PDF LOGS	SUBMITTED LAS LOGS
CEMENT BOND	

OGM Official Use Only

37. I hereby certify that the foregoing and attached information is complete as determined from all available records.		
NAME	TITLE	DATE
TaraLee Knutson	Administrative Supervisor	09/02/2024
SIGNATURE	PHONE	EMAIL
N/A	435-722-1325	TKnutson@bry.com




Automated Drilling Wellbore Schematic

Well Name: FEDERAL 15-7D-65

API/UWI (10) 4301354030		Field Name UNTA - AREA X - ASHLEY FOREST		County Duchesne		State/Province UT	Section 7	Township 006-S	Range 005-W	Survey	Block
Gr Elev (ft) 7,016.50	KB Datum Elevation (ft) 7,029.50	KB-Grd (ft) 13.00	Spud Date 5/22/2024	Rig Release Date 5/31/2024	TD Date 5/29/2024	Latitude (NAD 27) (°) 39.9677940000		Longitude (NAD 27) (°) -110.4908140000		Operated? Yes	

Vertical (0° to 15°), Original Hole, 9/4/2024 6:53:27 AM

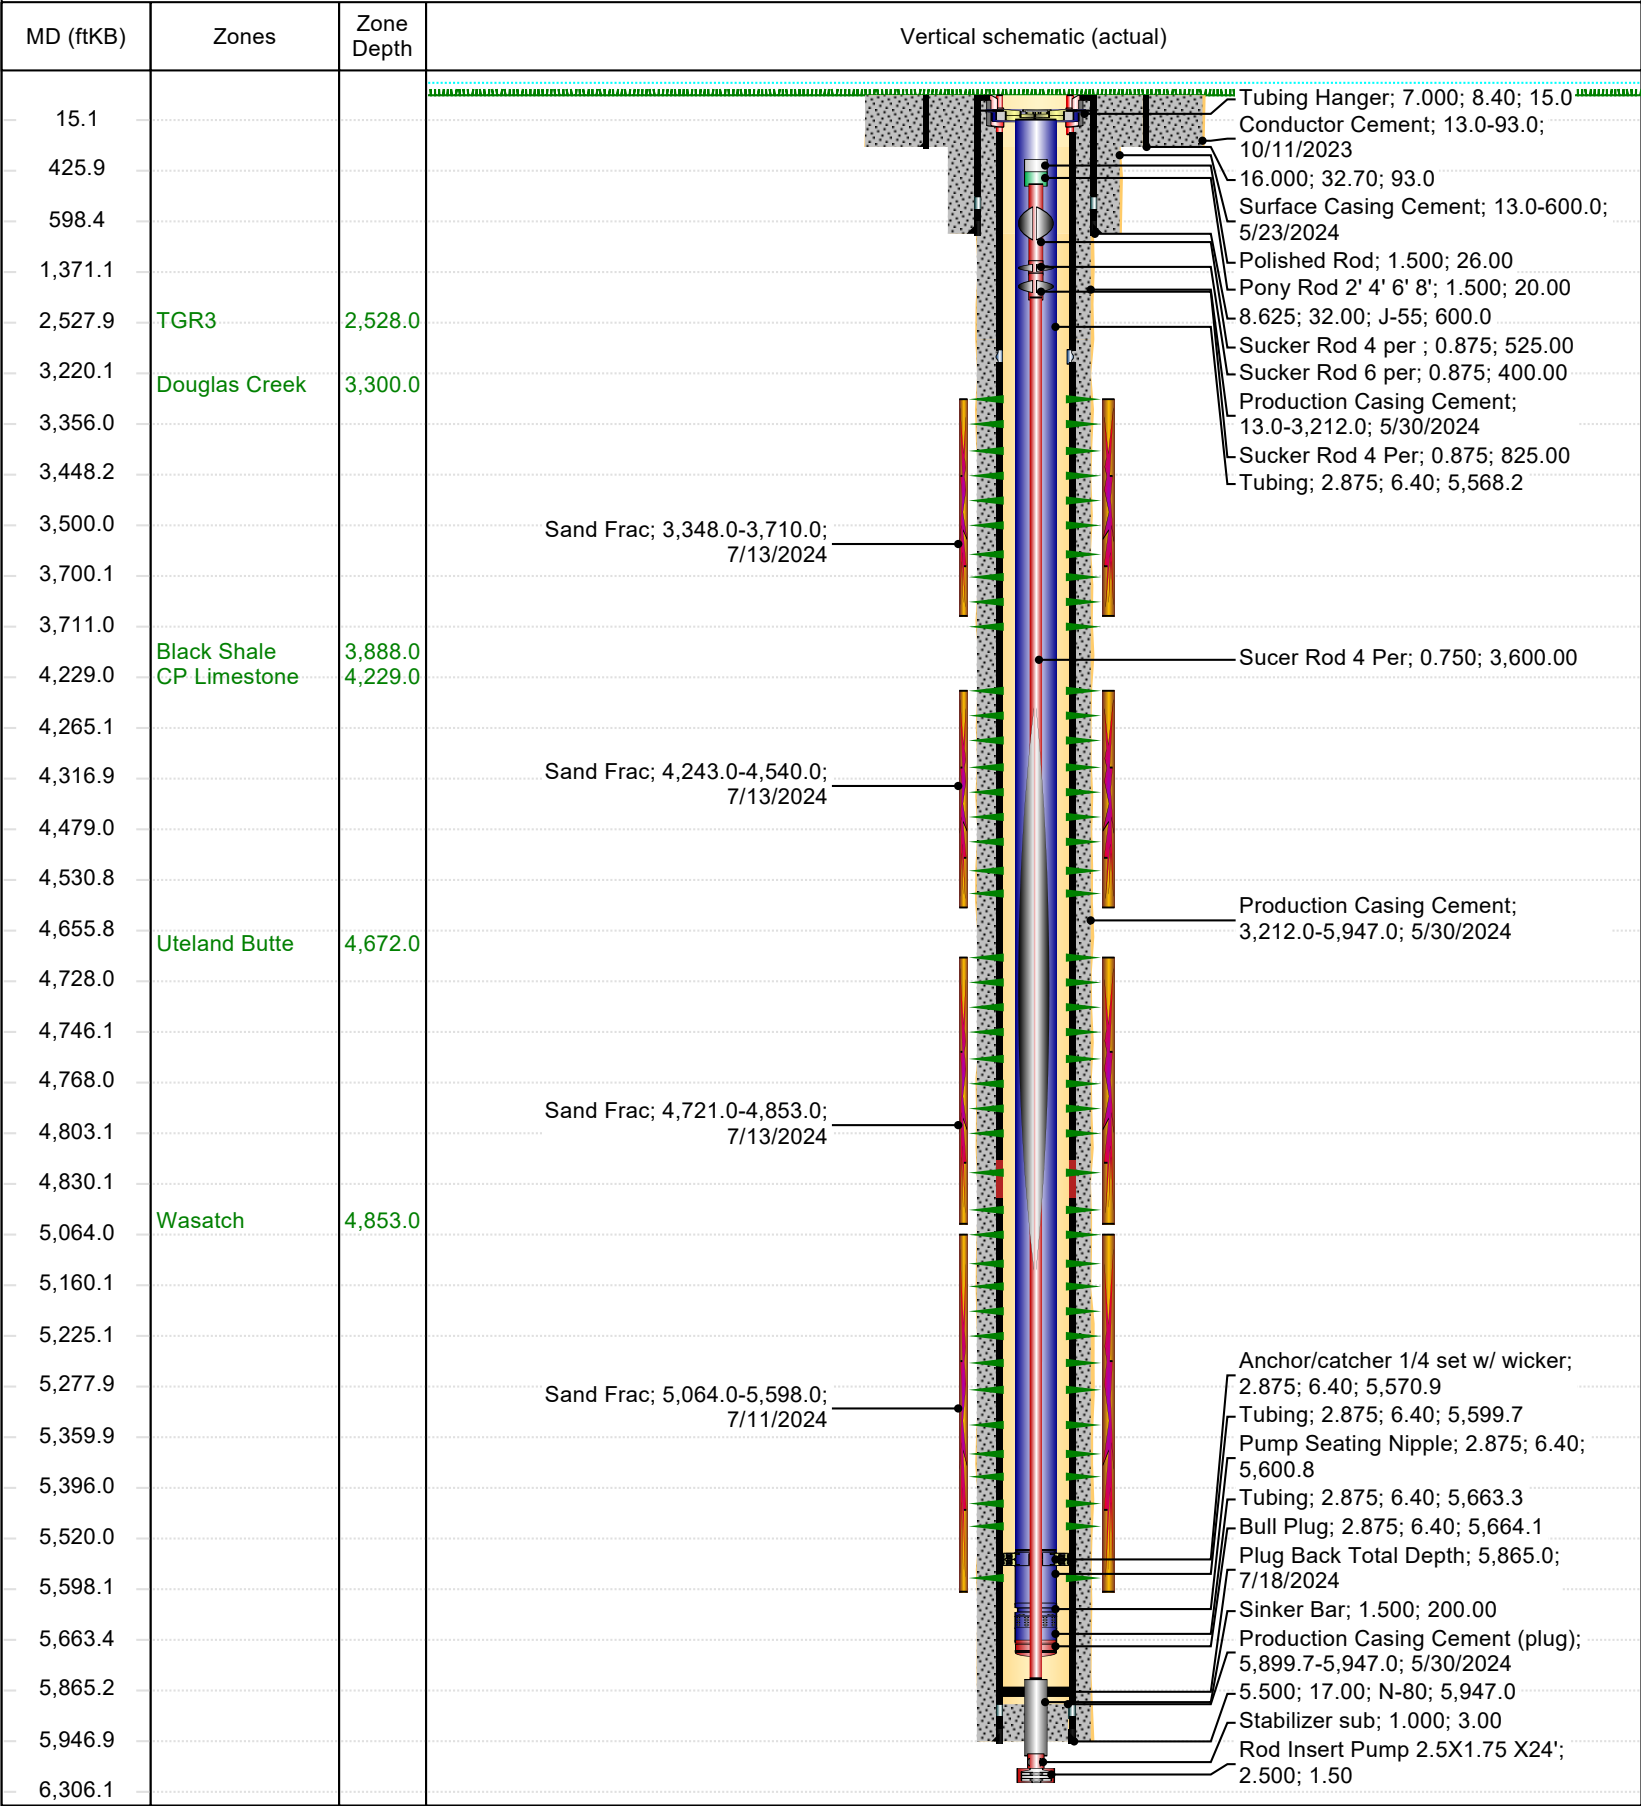



Operations Summary

Well Name: FEDERAL 15-7D-65

API/UWI (10) 4301354030		Surface Legal Location Sec7 T6S R5W USB&M		County Duchesne		State/Province UT			
Spud Date 5/22/2024		Rig Release Date 5/31/2024		KB-Ground Distance (ft) 13.00		Ground Elevation (NAD 83) (ft) 7,016.50			
Job Category Completion		Primary Job Type Initial Completion		Secondary Job Type AFE		Start Date 6/25/2024		End Date 7/19/2024	
6/25/2024 07:00 - 6/25/2024 11:00									
Operations at Report Time Install 10 7 1/16 Tubing heads					Operations Next Report Period Wait on well prep for completion				
Operations Summary Schlumberger installing 11 3/4 X 7 1/16 10K tubing head									
Com									
Schlumberger installing Tubing Heads 11 3/4 X 10K & torque to specs & test to 5K									
6/27/2024 07:00 - 6/27/2024 17:30									
Operations at Report Time Clean out operations					Operations Next Report Period Clean out operatins-run CBL				
Operations Summary Move in rig up Peak 2300 for drill out/clean out operations-Conduct morning safety meeting-HMS JSA Hand & foot placement-high pressure testing-Check area for H2s & LEL-None detected- Pick up mill & string mill and trip in to mill up stage collar-3212 103 jts-swivel up mill thru 40 minutes-circ 2 1/2 bottoms up -trip in float collar Tag @ 5897 Circ bottoms up at 4.2 bpm- trip out 15 jts -rig down swivel & close well in for night									
Com									
Safety meeting rack out swivel pipe wrangler rig down fill casing with 15 bbl remove bops off the 2-18D-65 install bops rig up spot in tubing pick up run in with bit string mill and 103 joints tag D V tool lay down 1 joint rig up swivel rig up pump lines drill with mill 33 minuets 13:22 to 13:55 make connection drill with string mill for 39 minuets 14: 09 to 4:28 swivel in 1 joint roll hole with 50 bbl rig down swivel pick up 85 joints tag PBTD @ 5897' with 190 joints lay down 1 joint roll hole with 130 bbl test to 2000 # good test rack out swivel lay down tubing installing thread protectors 15 joints down 175 left in hole EOT 5469' shut down for night Held 1000 # on casing on the 2-18D-65 wile running log bump up 750 to 1000 3 times									
6/28/2024 07:00 - 6/28/2024 12:00									
Operations at Report Time Trip out clean out assembly					Operations Next Report Period Logging operations				
Operations Summary HMS review-JSA discussed-suspended loads-pinch points-Check area for H2s & LEL -none detected-0 psi on well-inspect fall protection Open pipe rams and lay down 175 jts of 2 7/8 tbg J-55- close in & secure well rig down Peak 2300 and park rig off location									
Com									
Daily Operations Summary Safety meeting no pressure on well lay down 175 joints 2 7/8" tubing mill string mill assembly rig down floor rack out pump rig down remove bops load up road									
7/1/2024 07:00 - 7/1/2024 12:00									
Operations at Report Time Pressure test production casing					Operations Next Report Period Test Stack equipment				
Operations Summary Move in & rig up Weatherford testing equipment for casing test and frac stack install. Conduct morning safety meeting-JSA discussed-High pressure testing-suspended loads-working at heights over 4 ft. Install 10 WFT 7 1/6 master valve and pressure test casing to 7700 Psi and chart for 30 minutes- test held-well was bled off. continue with frac stack install									
Com									
Move in & rig up Weatherford testing equipment for casing test and frac stack install. Conduct morning safety meeting-JSA discussed-High pressure testing-suspended loads-working at heights over 4 ft. Use manlifts at all heights over 4 ' with safety harness Install 10 WFT 7 1/6 master valve and pressure test casing to 7700 Psi and chart for 30 minutes- test held-well was bled off. continue with frac stack install-all stacks will be tested & charted to 10,000 Psi.									
7/3/2024 07:00 - 7/3/2024 13:00									
Operations at Report Time Instal Frac Stack					Operations Next Report Period Perf Stage #1				
Operations Summary Rig up WFT testing equipment-Safety meeting-JSA discussed-Heavy suspended loads-Tripping hazards-pinch points-high pressure lines Instal frac stack and pressure to a max Psi of 10,000-test low at 500 psi for 5 min and test high at 10K for 15 min-chart all testing- Job complete, rig down WFT equipment and release from location									
Com									
Rig up WFT testing equipment-Safety meeting-JSA discussed-Heavy suspended loads-Tripping hazards-pinch points-high pressure lines Instal frac stack and pressure to a max Psi of 10,000-test low at 500 psi for 5 min and test high at 10K for 15 min-chart all testing- Job complete, remove 2 way check and . tbg hanger-install blanking flanger, rig down WFT testing equipment & release crew.-									
7/7/2024 10:00 - 7/7/2024 12:00									
Operations at Report Time Perforate Stage #1					Operations Next Report Period Inactive -wait to frac				
Operations Summary Move in and rig up Extreme wireline-Conduct safety meeting with cfrew-JSA working with heavy suspended loads-using safety harness working at heights-Hot windy conditions-all PPE required Inspect guns for stage #1, measure and pick up guns trip in and Perf Stage #1									
Com									
Move in rig up Extreme wireline-conduct safety meeting with crew-JSA heavy suspended loads-watch hand & foot placement-be aware of possible well pressure after perforating-working at heights over 4 ft using fall protection in man basket-all PPE required Wasatch Formation Perf Satge #1 as follows--5595-98---5518-20---5509-10---5395-96---5385-86---5359-60---5278-79---5230-32---5225-26---5172-75---5160-61---5155-56---5064-66--@ 2 SPF -180 degree phasing 41" of penetration. 3 1/8 HSE guns with 22.7 gram charges .42 entry-Check guns to insure all shots fired- close in and secure well. No pressure on well after perforating.									
7/12/2024 06:00 - 7/13/2024 06:00									
Operations at Report Time 24 Hour Frac Operation					Operations Next Report Period Frac & Perf 4 Stage Frac				
Operations Summary Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location. Perforate stages # 2 and # 3. Frac stages #1 through #3. All jobs pumped as per design. 100% of proppant placed.									
Com									
Wait to finishZipper frac operations on the: Federal 4-18D-65 Federal 3-18D-65 federal 2-18D-65									
Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location Define emergency escape vehicles Discuss nearest hopital and phone numbers Discuss tripping hazards-hand placements-overhead loads High pressure pumping occuring along with wireline operations-Only authorized Personnel to operate HCR valves- stay clear of red zone Caution tape all extended trailer tongs-HCR valve stems Head level hazards Remote location-no phone access-WiFi access thru frac van--- Remove well Cap, Install Rig Lock System & torque to Specs W/ Weatherford torque Wrench.									



Operations Summary

Well Name: FEDERAL 15-7D-65

Com	
ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #1 Wasatch Frac as follows : Perfs --5595-98---5518-20---5509-10---5395-96---5385-86---5359-60---5278-79---5230-32---5225-26---5172-75---5160-61---5155-56---5064-66-All @ 2 spf-total of 41 Perfs Initial breakdown pressure psi ISIP -1502 psi. @ 20 bpm. ISIP @ 311 psi. Well Open @ 21:00 hrs PSI 160. Pumped 1000 gals 7.5% HCL Break down of 11 BPM @ 1186 psi. Drop 57 Bio Balls for diversion saw 211 psi differential with balls at perfs- Max Rate =81.8 BPM Max psi.- 3050 Average Rate = 80.7 Bpm Average psi @ 1977 Total fluid pumped = 1546 bbls ISDP- 601 psi Final Frac Gradient = 0..55 Total Prop Used 91,120#s of 40/70 -Local Continue Moving Crane & Wireline Truck into new position for Frac Ops. (Note Had to reposition from original spot due to lube weight & distance to well being possible unstable) SICP = 557 psi. Pick up lube and #2 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6/29/2024. Uteland Butte: Guns are 3-1/8" HSC, 2 spf, 22.7 grams with .41" -entry hole and 180 -deg phasing. Perforate Stage #2 as follows- 4721-22 - 4728-29 - 4740-41 - 4746-49 - 4755-57 - 4768-72 - 4775-77 - 4803-04 - 4828-30 - 4851-53 Set KLX Dissolvable Frac Plug @ 4900 Pull out of the hole with wireline. All guns Fired ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #2 Uteland Butte Frac as follows : Perfs - 4721-22 - 4728-29 - 4740-41 - 4746-49 - 4755-57 - 4768-72 - 4775-77 - 4803-04 - 4828-30 - 4851-53--All @ 2 spf-total of 38 Perfs Initial breakdown pressure 2650 psi @ 17.5 bpm. ISIP @1233 psi. Well Open @ 03:00hrs PSI 485 Pumped 1000 gals 7.5% HCL Break down of 11 BPM @ 2176 psi. Drop 57 Bio Balls for diversion saw 4300 psi differential with balls at perfs- Shut Down & Surge Ballsoff perfs. Max Rate =80.9 BPM - Max psi.- 3469 Average Rate = 77.8 Bpm Average psi @ 2909 Total fluid pumped = 2634 bbls ISDP- 1122 psi Final Frac Gradient = 0..67 Total Prop Used 202,000 #’s of 40/70 -Local SICP = 553 psi. Pick up lube and #3 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6/29/2024. Castle Peak: Guns are 3-1/8" HSC, 2 spf, 22.7 grams with .41" -entry hole and 180 -deg phasing. Perforate Stage #3 as follows- 4243-46 - 4260-65 - 4287-89 - 4314-17 - 4449-52 - 4478-79 - 4495-96 - 4530-31 - 4539-40 Set KLX Dissolvable Frac Plug @ 4585 Pull out of the hole with wireline. All guns Fired ProFrac Well Service. Pressure test lines good at 8000 psi. Stage #3 Castle Peak Frac as follows : Perfs - 4243-46 - 4260-65 - 4287-89 - 4314-17 - 4449-52 - 4478-79 - 4495-96 - 4530-31 - 4539-40--All @ 2 spf-total of 40 Perfs Initial breakdown pressure 2100 psi @ 25 bpm. ISIP - 605 psi. Well Open @ 05:00 hrs PSI 486. Pumped 1000 gals 7.5% HCL Break down of 11 BPM @ 2945 psi. Drop Bio Balls for diversion saw 4100 psi differential with balls at perfs- Shut Down & Surge Balls off perfs, Wait 5 min & Start back into stage. Max Rate =80.9 BPM Max psi.- 3261 Average Rate = 77.4 Bpm Average psi @ 1912 Total fluid pumped = 2428 bbls ISDP- 669 psi Final Frac Gradient = 0..59 Total Prop Used 200,000#’s of 40/70 -Local	
7/13/2024 06:00 - 7/14/2024 06:00	
Operations at Report Time 24 hour Frac operations	Operations Next Report Period Frac & Perf 4 Stage Frac
Operations Summary Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location. Perforate stage #4. Frac stage #4. All jobs pumped as per disgn. 100% of proppant placed.. Stimulation complete.	
Com	
Safety Meeting with all contractors on location Review JSA - Safe work Permit - Muster area at entrance to location Define emergency escape vehicles Discuss nearest hopital and phone numbers Discuss tripping hazards-hand placements-overhead loads High pressure pumping occuring along with wireline operations-Only authorized Personnel to operate HCR valves- stay clear of red zone Caution tape all extended trailer tongs-HCR valve stems Head level hazards Remote location-no phone access-WiFi access thru frac van--- SICP = 400 psi. Pick up lube and #4 stage gun string. Stab onto the well with tools. Pressure test connection good at 2500 psi Run in the hole with guns and KLX Dissolvable Frac Plug- corelate depth to Extreme CBL performed on 6/29/2024. Douglas Creek Guns are 3-1/8" HSC, 2 spf, 22.7 grams with .41" -entry hole and 180 -deg phasing. Perforate Stage #4 as follows- 3348-49 - 3356-58 - 3442-43 - 3448-50 - 3456-60 - 3500-01 - 3614-15 - 3766-69 - 3701-03 - 3708-10 Set KLX Dissolvable Frac Plug @ 3745 Pull out of the hole with wireline. All guns Fired	



Operations Summary

Well Name: FEDERAL 15-7D-65

Com

ProFrac Well Service. Pressure test lines good at 8000 psi.

Stage #4 Douglas Creek Frac as follows : Perfs - 3348-49 - 3356-58 - 3442-43 - 3448-50 - 3456-60 - 3500-01 - 3614-15 - 3766-69 - 3701-03 - 3708-10--All @ 2 spf-total of 40 Perfs
Initial breakdown pressure 2020 psi. @ 21 bpm.
ISIP - 810 psi. F.G. .65
Well Open @ 0625 hrs PSI 320. Pumped 1000 gals 7.5% HCL Break down of 25 BPM @ 2021 psi. Drop 53 Bio Balls for diversion saw 3200 psi differential with balls at perfs- Max Rate =80.6 BPM Max psi.- 4871 Average Rate = 75 Bpm -Average psi 2246 Total fluid pumped = 2052 bbls
ISDP- 1131 psi
5min. 937
10 min. 886
15 min. 850
Final Frac Gradient = 0.75
Total Prop Used 106,740 #'s of 40/70 -Local

All stages completed-close in bottom master valve-bleed off pressure-close in HCR valve for Double barrier
Final shut in pressure 850 Psi-well secured
Rig down frac fleet and all support equipment
Move in rig for clean out operations

7/17/2024 13:00 - 7/17/2024 17:00	
Operations at Report Time Clean out operations	Operations Next Report Period Run production equipment
Operations Summary Morning safety meeting-HMS rewiew-JSA discussed-Heavy suspended loads-tripping & fall hazards-inspect fall protection equipment-Check area for H2s-& LEL with 4 way, none detected.SICP 100-Light flow on well-	

Com

Morning safety meeting-HMS rewiew-JSA discussed-Heavy suspended loads-tripping & fall hazards-inspect fall protection equipment-Check area for H2s-& LEL with 4 way, none detected Move over spot in rig up SICP 100 # blow down well flowing ½ bpm water rig up floor pick up 4 ¾” bit bit sub 1 joint 2 7/8” j-55 tubing X N Nipple 39 joints 2 7/8” j-55 tubing stab Washington rubber shut down for night EOT 1206’.

7/18/2024 07:00 - 7/18/2024 17:00	
Operations at Report Time Clean Out/Run Production	Operations Next Report Period Wait on production team .
Operations Summary Morning safety meeting-HMS rewiew-JSA discussed-Heavy suspended loads-tripping & fall hazards-inspect fall protection equipment-Check area for H2s-& LEL with 4 way, none detected. SICP 100 SITP 0-Open casing to flow back tank & continue tripping in to top dissolvable plug-tag @ 3709 on jt 121 Pick up power swivel-& circ down to plug-drill up plug & continue in hole-clear out last plug @ 4900 pick up 1 jt and circ for 1.5 hours clean-trip into PBTD and tag @ 5865-trip out with clean out assembly-Pick up production BHA & trip in hole to depth -close well in for night	

Com

Daily Operations Summary
Safety meeting SITP 0 # SICP 100 # open casing to tank tally and pick up tubing tag up @ 3709’ with 121 joints in hole Get circulation swivel up on joint 122 drill plug @ 3738’ roll clean with 80 bbl pick up tubing tag plug @ 4585 fell tag sand @ 4842’ with158 joints wash to plug @ 4893 drill out on joint 160 roll clean with 120 bbl loosing water 80 bbl pick up tubing tag @ 5865’ with 190 joints in hole lay down 9 joints rack out swivel pull out of hole with 181 joints 2 7/8” j-55 tubing lay down X N Nipple Bit sub and bit run in hole with bull plug 2 joints 2 7/8” j-55 tubing perforated sub PSN 1 joint 2 7/8” j-55 tubing ¼ set Anchor 180 joints 2 7/8” j-55 tubing shut down for night

7/19/2024 07:00 - 7/19/2024 17:30	
Operations at Report Time Run production pump & rods	Operations Next Report Period Wait on production team
Operations Summary Morning safety meeting-HMS rewiew-JSA discussed-Heavy suspended loads-tripping & fall hazards-inspect fall protection equipment-Check area for H2s-& LEL with 4 way, none detected. SICP 700 SITP 0 open well & circ kill fluid-tbg on vac after 180 bbls-casing is static-install tbg hanger and land tbg -remove Bops & 10K frac valve-set TAC & land with 12 K tension -instal well head and prep new rod string outlined in time log.	

Com

Safety meeting SITP 0 # on a suck SICP 700 # open well blow down gas started giving fluid pump down tubing roll out gas with 180 bbl shut in casing for 5 min open and casing is dead pick up hanger land tubing on hanger rig down floor remove bops and frack valve set anchor land tubing on hanger with 12 k tension install wellhead change over to rods pick up prime pump-2.5X1.75X24’ 1 stabilizer 8 sinker bars 144 ¾” 4 per 33 7/8” 4 per 16 7/8” 6 per 21 7/8” 4 per space out with 2’ 4’ 6’ 8’ x 7/8” pony rods pick up polish rod, fill and test to 500 good test rig down move over rig upon the 13-7D-65 shut down for night
NOTE: All components that were installed were new including flow tee,ratigen, polished rod, rotator, stuffing box