

SEPTIC

WASTEWATER SOLUTIONS & DESIGN

Russell B Williams "Wastewater Specialist"

4919 E. Maiden Rd.

Maiden, NC 28650

ph. 980-429-1580

fax, 828-428-3028

E-mail rwilliams9534@bellsouth.net

INSPECTION

No representation, warranties or opinions are hereby given, written or expressed otherwise, as to the future performance of onsite wastewater system described herein. This onsite wastewater system inspection is a presentation of system facts in place on date of inspection.

Property Address:

1135 Brook Path Trail
Denver Street NC 28037
City St Zip

Current owner of Record:

Inspection requested by:

☐ Owner of record

☒ Other Name:

Company:

Phone:

Buyer, Jonathan Reynolds
c/o Jake Reed

Date of Inspection:

5-23-25

bedrooms or design flow:

—

MLS #:

☐ Copy of Operations permit from

Lincoln

County Environmental Health attached

☒ Operations permit not available

Type of water supply ☒ Well ☐ Public Water ☐ Community Water ☐ Other:

1. System components setbacks:

7 ft. from house or structure

— ft. from well if applicable

— ft. from water line if applicable

— ft. from property line

NA ft. from surface water

15+ ft. from swimming pool

— ft. from OTHER:

Required separation: 5 ft.

Required separation: 50 ft.

Required separation: 10 ft.

Required separation: 10 ft.

Required separation: 50 ft.

Required separation: 15 ft.

Required separation: — ft.

2. Septic tank details:

Able to locate tank:

☒ yes

☐ no

If no, explain:

Approximate depth from ground surface to tank access:

20+ inches

Access riser(s) present:

☒ yes

☐ no

N.A.

Tank lids intact:

☐ yes

☐ no

If no, explain:

Tank has baffle wall:

☒ yes

☐ no

N.A.

Influent from facility to tank confirmed:

☒ yes

☐ no

If no, explain:

Outlet T is present:

☒ yes

☐ no

If no, explain:

Effluent screen present:

☒ yes

☐ no

N.A.

Effluent exits the tank through the outlet:

☒ yes

☐ no

If no, explain:

Roots present in tank:

☐ yes

☒ no

If yes, describe:

Evidence of infiltration:

☐ yes

☒ no

If yes, describe:

Evidence of exfiltration:

☐ yes

☒ no

If yes, describe:

Structural integrity (Check all that apply):

☐ Cracks

☐ Deformation

☐ No problems noted

☐ Exposed reinforcement

☐ Corrosion

☒ Other: Not Evaluated - under concrete

Date tank was last pumped

☐ unknown

Percent of liquid depth occupied by solids (sludge plus scum) measured in tank 13 %

This septic tank was or was not opened on the inlet and outlet side access ports to examine the condition of the interior of the septic tank and access lids. The effluent is then examined by an instrument to determine by cross section the amount of sludge and scum in the septic tank. The sludge and scum are measured and together make up the solid portion of the tank. If the solids make up more than 33% of the liquid capacity of the septic tank, the tank should be pumped.

3. System includes a dosing tank: ☒ yes (complete this section) ☐ no

Approximate depth from surface to top of tank 24 inches

Access risers: ☒ yes ☐ no If no, explain: _____

Structural integrity (Check all that apply):

☐ No problems noted

☐ Exposed reinforcement

☐ Corrosion:

☐ Cracks

☐ Deformation

☒ Other: Concrete riser with 4" hole

4. Dosing device:

☒ pump

☐ siphon

5. Control panel:

☐ yes

☒ no

If no, explain: _____

Cords -

Panel integrity (Check all that apply):

☐ No problems noted

☐ Melted wires

☐ Corrosion

☐ Cracks

☐ Leakage

☐ No conduit seal

☒ Other: No panel

Panel working:

☐ yes

☒ no

If no, explain: _____

Pump wired to house with plug

Pump or siphon working

☒ yes

☐ no

If no, explain: _____

☐ Unable to operate pump due to lack of electricity at site at time of inspection

6. System requires an NC Certified Subsurface Operator per Rule .1961: ☐ yes ☒ no

If yes, Operator Name _____

Cert. #: _____

Phone _____

Copy of most recent operator report attached ☐ yes ☐ no

7. Type of drainfield:

☒ Trench

☐ Bed

☐ Other: _____

Nature of media: Stone

Type of distribution:

☐ Gravity

☒ Pressure-dosed gravity

☐ Pressure - LPP

☐ Pressure - Drip

☐ Other: _____

Evidence of past or current surfacing at time of inspection:

☐ yes

☒ no

If yes, describe: _____

Large trees or other vegetation noted over or near drainfield area:

☐ yes

☐ no

If yes, describe: _____

Encroachments:

☐ yes

☐ no

If yes, describe: _____

NA

Evidence of traffic over drainfield:

☒ yes

☐ no

If yes, describe: _____

Concrete drive is over

Designated repair/reserve area free of encroachments: If no, describe: _____

8. Advanced pretreatment: ☐ yes ☒ no

If yes, describe: _____

Functioning in accordance with manufacturer specifications:

☐ yes

☐ no

☐ Not determined.

If no, explain: _____

Functioning in accordance with permit requirements:

☐ yes

☐ no

☐ Not determined.

If no, explain: _____

9. Other components not covered above:

Concrete drive was built over septic tank

10. Proper surface and subsurface water diversion over and around system components:

☐ yes

☐ no

If no explain: _____

Not evaluated

11. Other pertinent facts noted during inspection (attach additional sheets as needed):

This system is working but has many issues. #1 Concrete Drive over tank. #2- Non Code wiring of septic pump - Using Drop cord. #3 Pump tank Riser is Not Code. #4- Should install Riser on Inlet side of Septic tank. #5- Repair high water Alarm.

Inspector Name: Russell B. Williams

Certification #: 3137-I


Address: 4919-E. Maiden Bldg. Maiden, NC 28650

Phone: 980-429-1580

Inspector Signature: Russell B. Williams

Date: 5-23-25

Well & Septic Site Plan

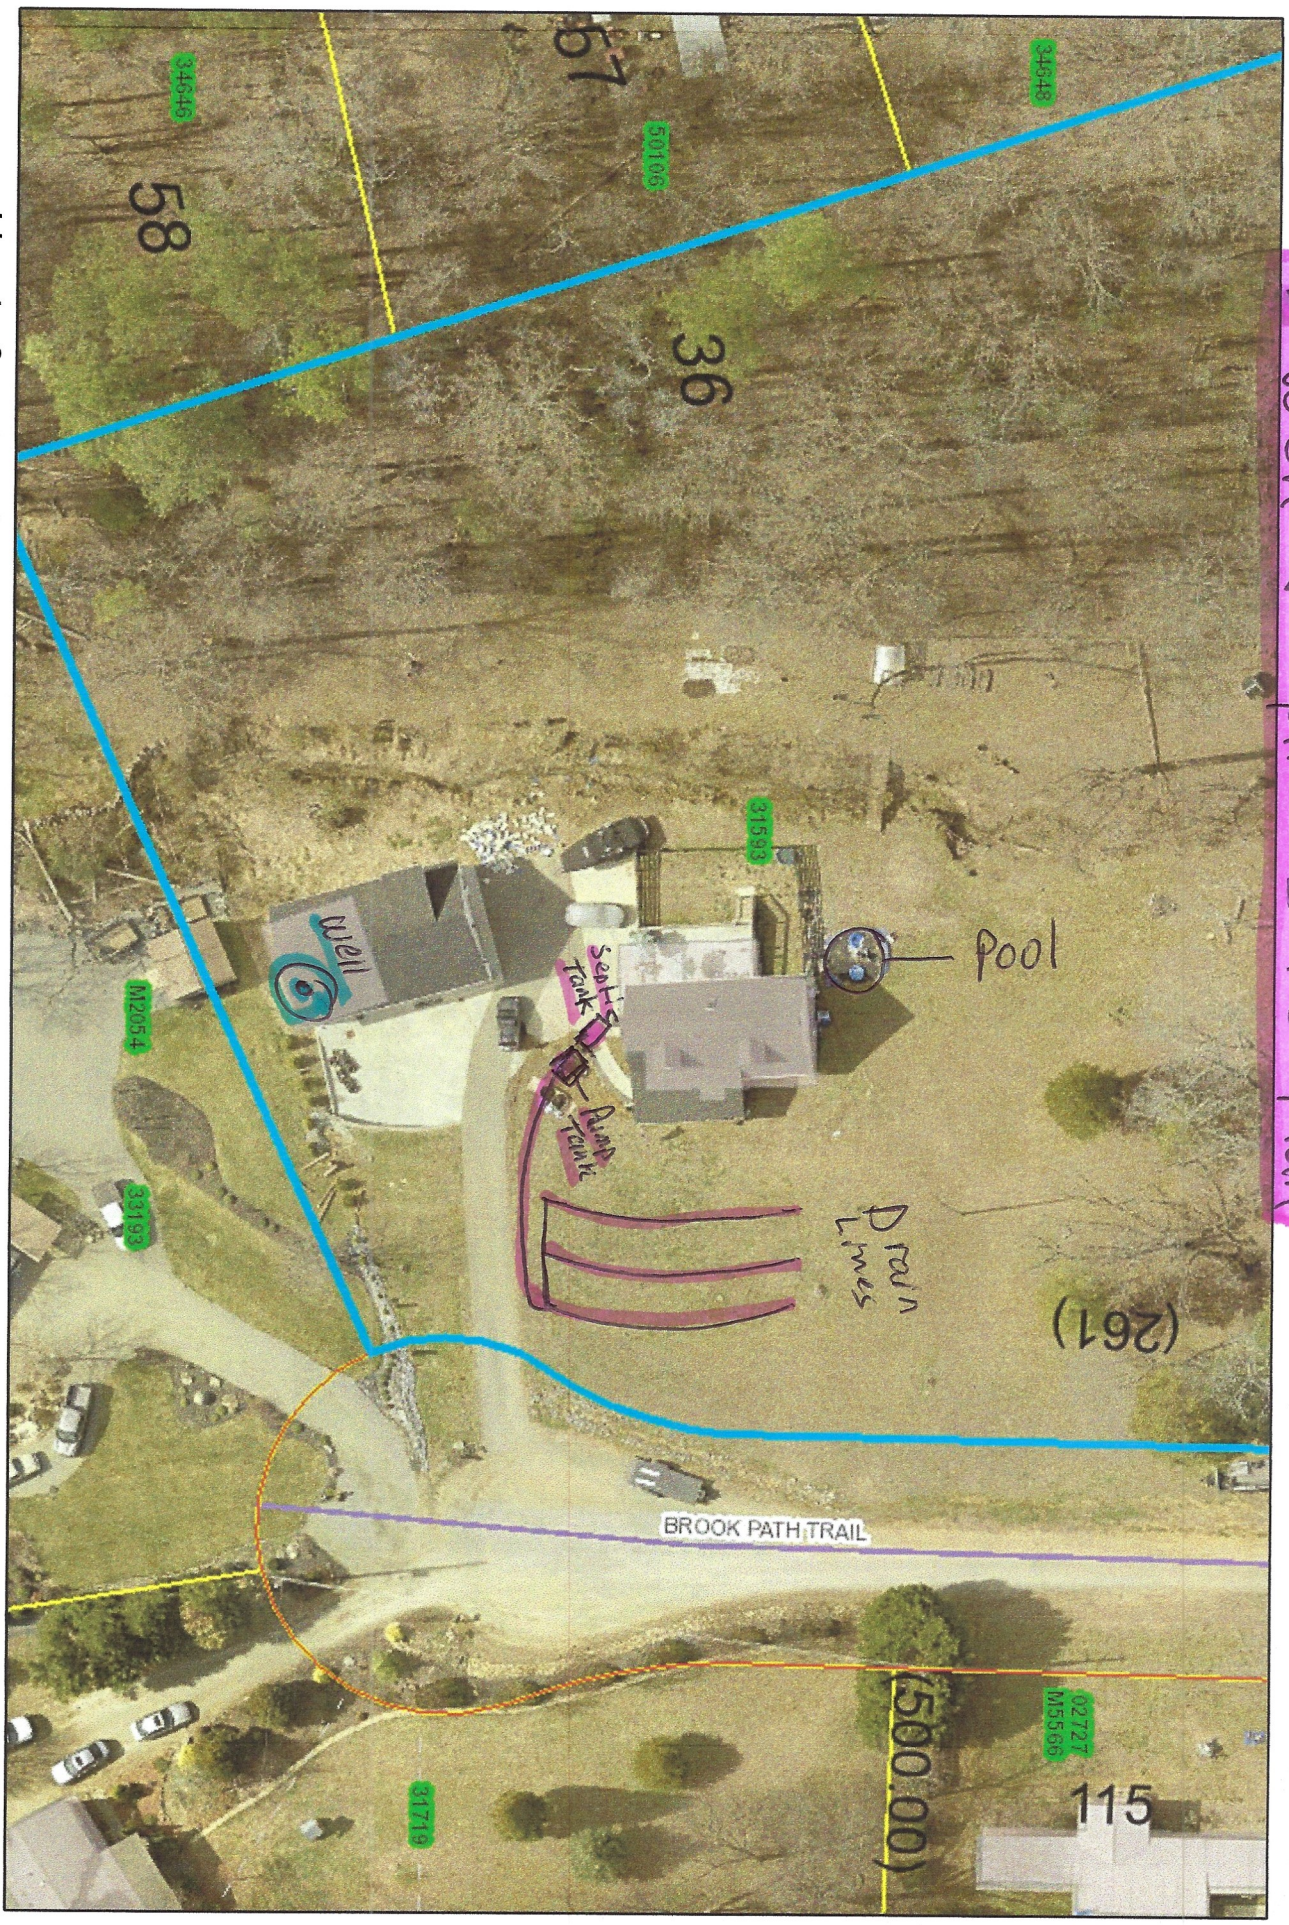

Lincoln County, NC

Office of the Tax Administrator, GIS Mapping Division

Neither Lincoln County nor its employees, elected officials, agents, or contractors assume any legal responsibility for the information contained herein, which is provided "as is" with no warranties of any kind. Lincoln County disclaims all liability of any kind arising out of the use of, or misuse of, this information and disclaims all express or implied warranties, including warranties of merchantability, fitness for a particular purpose, and non-infringement of proprietary rights.

May 26, 2025



Septic Tank
Location




pump tank



Outlet side of septic tank with a
pvc outlet Tee and Filter



4" hole with
Drop cord entering
pump tank

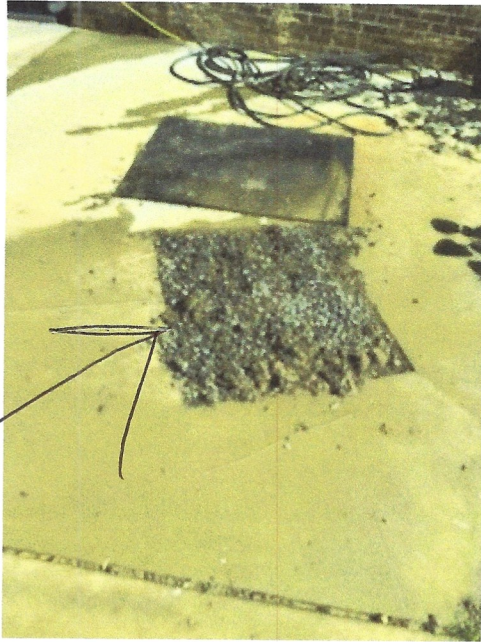

Someone cut a 24" square in the concrete to access the inlet side of the septic tank



Inside the Pump Tank

WELL HEAD INSPECTION REPORT

FOR PRIVATE WATER SUPPLIES

1. General															
Inspection Requested By <i>Jonathan Reynolds</i>						Telephone Number									
Mailing Address															
City, State, ZIP Code															
Owner's Name						Telephone Number									
Mailing Address															
City, State, ZIP Code															
2. Location Information				County of Water System Location <i>Lincoln</i>											
Grid or Street Address or Road Name and Number (if available) <i>1135 Brook Path Trail Denver</i>															
Subdivision Name				Lot #		Block #		3. Source Information				Source ☒ Drilled ☐ Driven Point ☐ Dug ☐ Spring ☐ Jetted ☐ Other			
Gov't Lot #		1/4 1/4 1/4		Section		Township		Range		E/W		Well serves <u>1</u> # of homes and/or (Ex. barn, restaurant, church, school, industry, etc.)			
Lat. DEG		MIN		Long. DEG		MIN		Unique Well No. <i>No</i>		High Capacity Well? ☐ Yes ☒ No		High Capacity Property? ☐ Yes ☒ No			
4. Well Data				From ☐ Well Construction Report ☐ Pump Installer ☐ Owner's Memory ☐ Measurement				Constructed by <i>No Info</i>				Approximate year well constructed			
Well Location: ☐ Outside ☐ In Basement ☐ In Pit/Alcove ☐ In Crawl Space ☒ In Building <i>Garage</i> ☐ In Pumphouse				Casing Diameter <i>6 1/4</i> (inches)				Well Terminates ☒ Above the ☒ Floor ☐ Outside Grade		Casing Material <i>PVC</i>		Well Depth (ft.) (if known)		Well Yield	
Well Located In Floodplain? ☐ Yes ☒ No				Well Properly Separated From Contamination Sources On Well Property? ☐ Yes ☒ No				Well Properly Separated From Contamination Sources On Neighboring Property? ☒ Yes ☐ No ☐ Unknown							
5. Pump Data				Location: ☐ In Well ☐ In Basement ☐ In Pit/Alcove ☐ In Crawl Space ☐ In Building ☐ In Pumphouse											
Pump Name & Type <i>Submersible Pump</i>				Age		Pipe Material in Well		Method of Discharge <i>Sub Pump</i>		Cross Connections? <i>NA</i>					
Pump Installer's Name <i>No Info</i>				Amp Draw		Pipe Material Before Pressure Tank <i>PEX</i>		Water Quality Characteristics							
Pumped At GPM <i>—</i> for <i>—</i> Hours				Horsepower		Cap Type <i>Seal</i>		Vermin Proof? ☒ Yes ☐ No		Water Treatment Equipment <i>Cartridge Filters</i>					
Pressure Tank Type & Size <i>Bladder Tank</i>				Voltage <i>230</i>		Wires enclosed ☒ Yes ☐ No		Bacti Sample Taken ☒ Yes ☐ No		Where Sampled? <i>Dist Top</i>					
6. Conclusions & Recommendations				Water system working correctly? ☒ Yes ☐ No		Visible portions comply with ch. NR 812 in effect at time of installation? ☐ Yes ☐ No <i>NA</i>		Well abandonment needed? ☐ Yes ☒ No		Variance exists? ☐ Yes (Describe) ☒ No ☒ Not Needed					
The information on this form lists facts and conditions of the visible portions of the well and pressure system at the time of inspection and does not imply or give any kind of guarantee. It is a statement of the opinion of the inspector regarding the compliance and operation of the system at the time of inspection.															
Comments or Repairs Needed: <i>The well is functioning properly - A garage has been built over the existing well - Code is a 25' setback from a well and any structure. This well does not meet code unless</i>															
Inspector's Name <i>Russell B. Williams</i>						Telephone Number <i>980-429-1580</i>				Date Signed <i>5-23-25</i>					


Wastewater Solutions & Design

Russell B Williams
"Wastewater Specialist"

4919 E. Maiden Rd.
Maiden, NC 28650


Ph. 980-429-1580

Fax. 828-428-3028 rwilliams9334@a.ellisouth.net

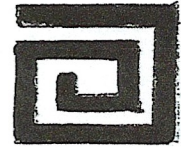

"Certified Septic Installer, Inspector & Operator"

a Variance is used by the State of NC.

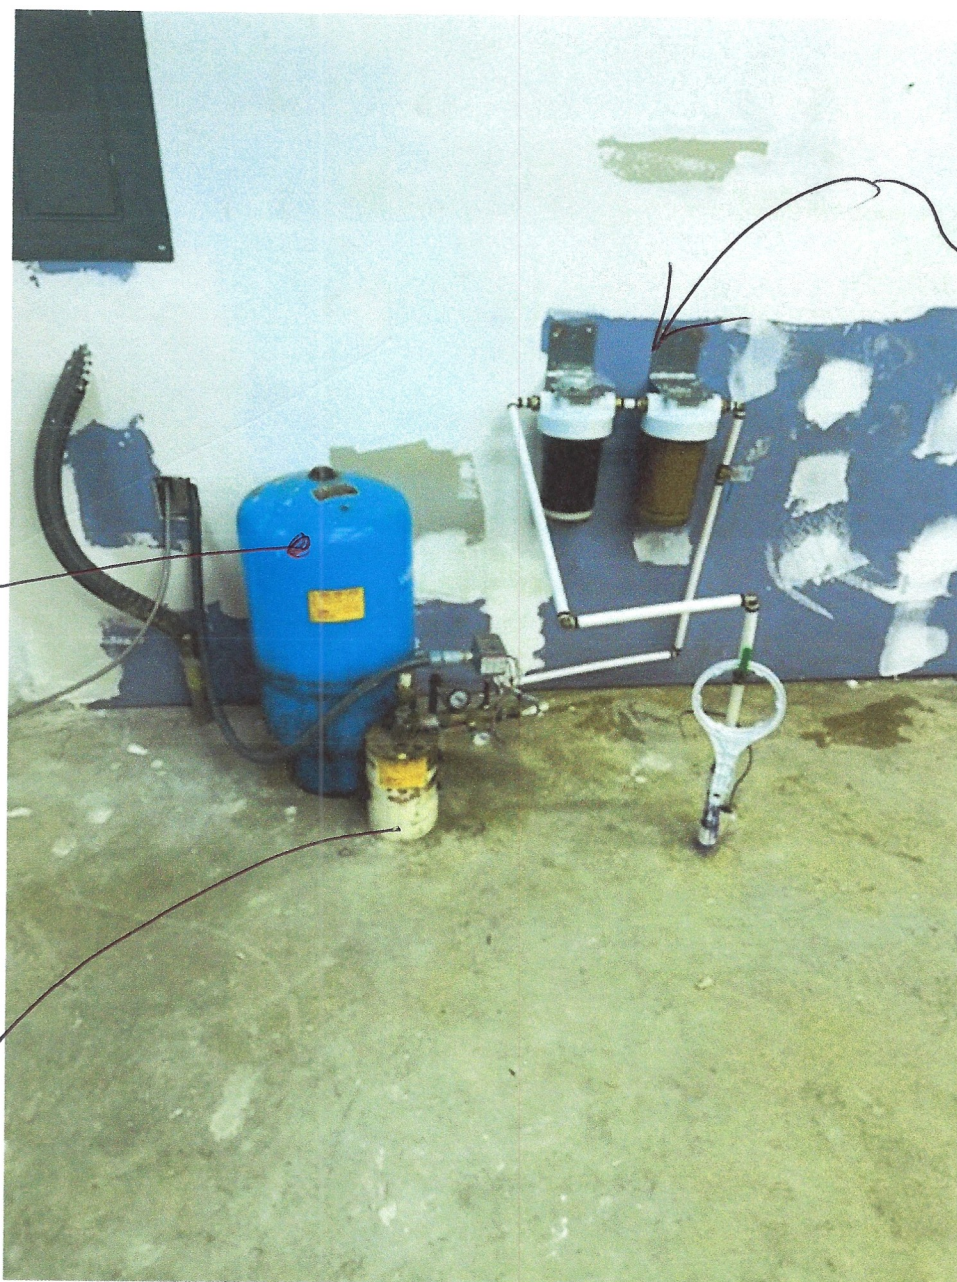

Bladder
Tank

Cartridge
Filters

6 1/4" Drilled Well

Wastewater Solutions & Design

4919 E Maiden Rd

5/26/2025

Maiden, NC 28650-8116

5:15 PM

(980) 429-1580

<http://WastewaterSolutionsanddesign.com>

Custom Amount**\$683.10**

Well & Septic Inspection at 1135

Brook Path Trail Denver, NC

Total**\$683.10**

Receipt 5QCa

MasterCard

Authorization 06711Z

6868