Plaid v1 — Cut Plan

Two end-grain plaid cutting boards built from cherry, walnut, and brown maple.


Cut list for the finished design, in build order.

1. Warnings

#	Lvl	Type	Message
1	WARNING	Ghost Boards	3 board(s) must be bought (not in inventory): GH-B, GH-C, GH-W.
2	WARNING	Small Margin	Board BM2A leaves only ⅛″ margin (< ¼″) — too tight; prone to under-supplying strips if the board runs narrow.
3	WARNING	Small Margin	Board BC1A leaves only 0″ margin (< ¼″) — too tight; prone to under-supplying strips if the board runs narrow.
4	WARNING	Small Margin	Board BC2A leaves only 1/16″ margin (< ¼″) — too tight; prone to under-supplying strips if the board runs narrow.
5	WARNING	Planer Gang Too Small	There aren't enough 3″ strips to gang together to safely pass through the planer without tipping over. You might need sacrificial wood to tape onto it in order to prevent movement.

2. Finished board pattern

2 finished boards. Final thickness 1¼″.

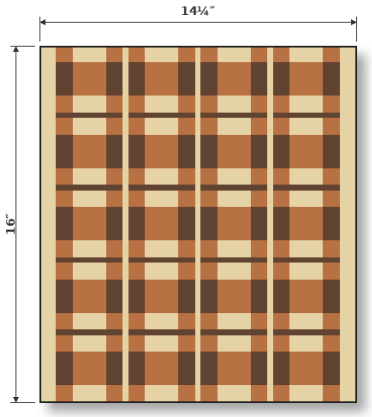

3. Volume Sanity Check

Review the per-species volumes against inventory.

Species	Available	Required	Volume Offset
maple	4.7 BF	1.4 BF + 1.0 BF loss = 2.4 BF	+2.3 BF (196%)
cherry	2.6 BF	1.6 BF + 1.0 BF loss = 2.6 BF	+0.0 BF (101%)
walnut	2.7 BF	1.0 BF + 0.7 BF loss = 1.7 BF	+1.0 BF (156%)

4. Crosscut Blanks

This plan involves cutting blanks from the inventory — review the inventory and the planned cuts.

Raw board	Species	Raw length	Blanks (id = length)	Leftover
BM1	maple	60″	BM1A = 48″	11⅞″
BM2	maple	60″	BM2A = 48″	11⅞″
BC1	cherry	40″	BC1A = 40″ (used whole)	0″
BC2	cherry	40″	BC2A = 40″ (used whole)	0″
BW1	walnut	48″	BW1A = 48″ (used whole)	0″
BW2	walnut	48″	BW2A = 48″ (used whole)	0″

Crosscut Diagram



5. Initial board rips (the cut list)

Review the rip list.

Board	Origin	Species	Length	Rips (width × count)	Used	Loss	Margin
BM1A @ 7″	BM1	maple	48″	1½″ ×4	6″	¾″	¼″
BM2A @ 7″	BM2	maple	48″	¾″ ×5 · ¼″ ×5	5″	1⅞″	⅛″
GH-B @ ⅞″	*None*	maple	48″	¼″ ×2	½″	⅜″	0″
BC1A @ 6″	BC1	cherry	40″	1½″ ×3 · ¾″ ×1	5¼″	¾″	0″
BC2A @ 5½″	BC2	cherry	40″	1½″ ×1 · ¾″ ×4	4½″	15⁄16″	1⁄16″
GH-C @ 2 13⁄16″	*None*	cherry	48″	¾″ ×3	2¼″	9⁄16″	0″
BW1A @ 5″	BW1	walnut	48″	3″ ×1 · ¾″ ×1	3¾″	⅜″	⅞″
BW2A @ 5″	BW2	walnut	48″	¾″ ×5	3¾″	15⁄16″	5⁄16″
GH-W @ 1⅞″	*None*	walnut	48″	¾″ ×2	1½″	⅜″	0″


Board Rip Diagram

Review the board rip diagrams against the rip list.

BM1A (48″ x 7″ x 13⁄16″)




BM2A (48″ x 7″ x 13⁄16″)

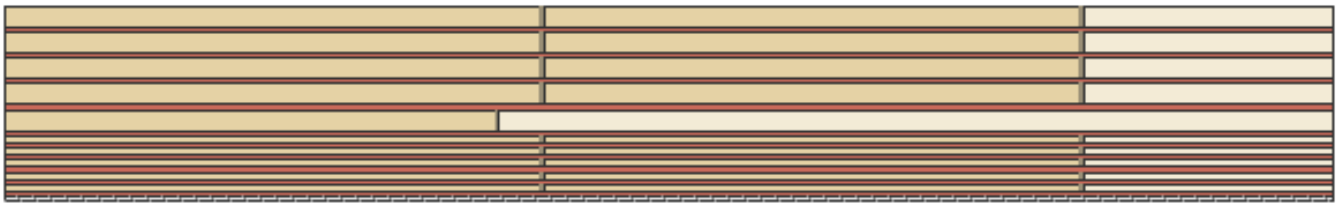


GH-B (Not Available)



BC1A (40″ x 6″ x 13⁄16″)

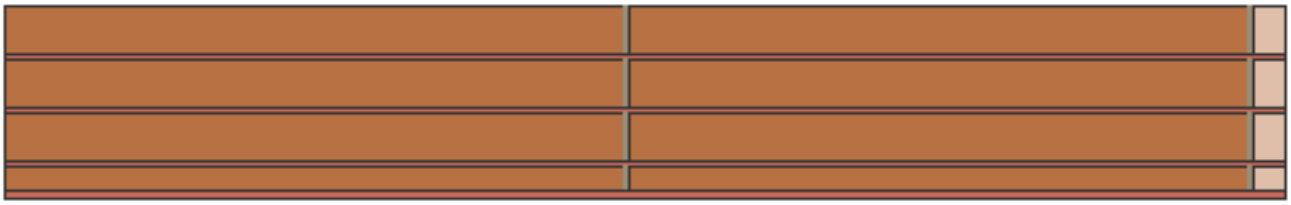


BC2A (40″ x 5½″ x 13⁄16″)

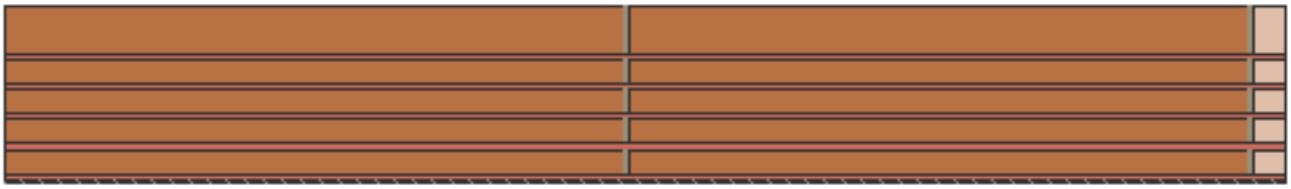


GH-C (Not Available)



BW1A (48″ x 5″ x 13⁄16″)

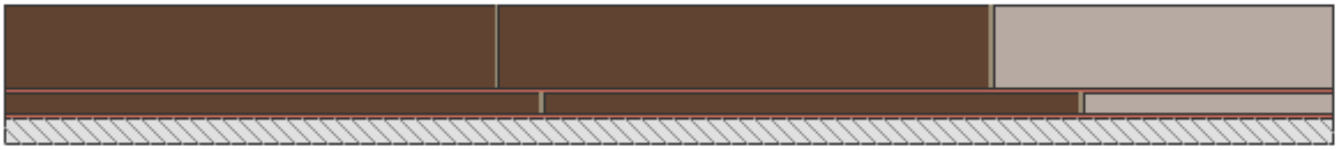

BW2A (48″ x 5″ x 13⁄16″)

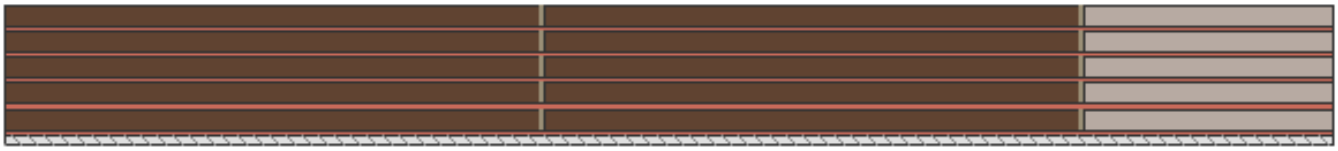

GH-W (Not Available)




6. Panels overview

Panel	Qty	Length	Slices	Height	Ripped	Sequence (outer → in)
SL	2	19⅜″	11	¾″	—	Me · C2 · M1 · C2 · Md · C2 · M1 · C2 · Md
SR	2	19⅜″	11	¾″	—	Me · C2 · M1 · C2 · Md · C2 · M1 · C2
ML	2	19⅜″	11	¾″	—	Me · W2 · C1 · W2 · Md · W2 · C1 · W2 · Md
MR	2	19⅜″	11	¾″	—	Me · W2 · C1 · W2 · Md · W2 · C1 · W2
H	1	17¾″	10 (L:5 + R:5)	¼″	2× (¼″)	Me · W1 · Md · W1 · Md


Panel End Grain Diagram

Review the panel end-grain diagrams.

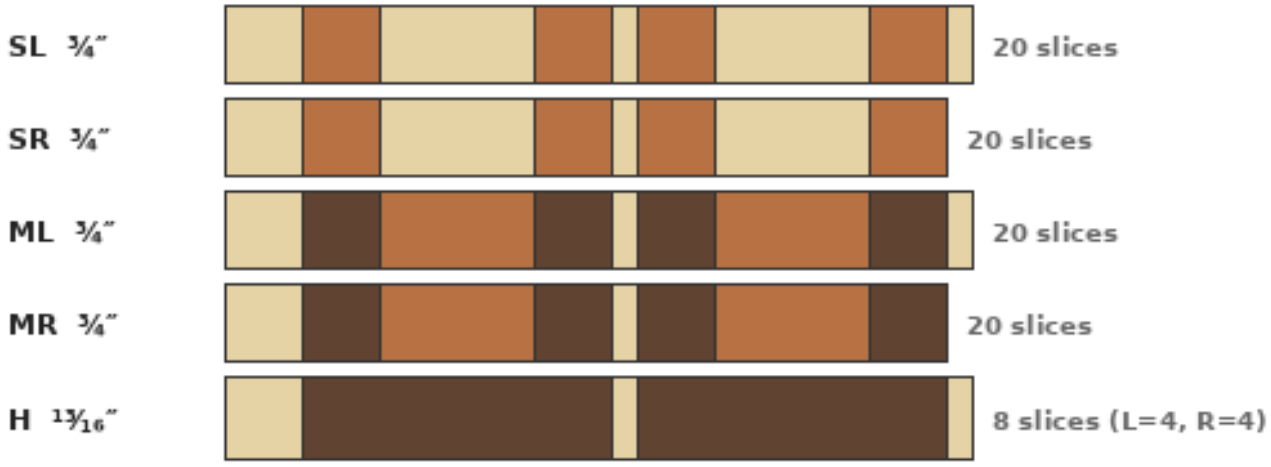

Panel Face Diagram

Review the panel face diagrams.

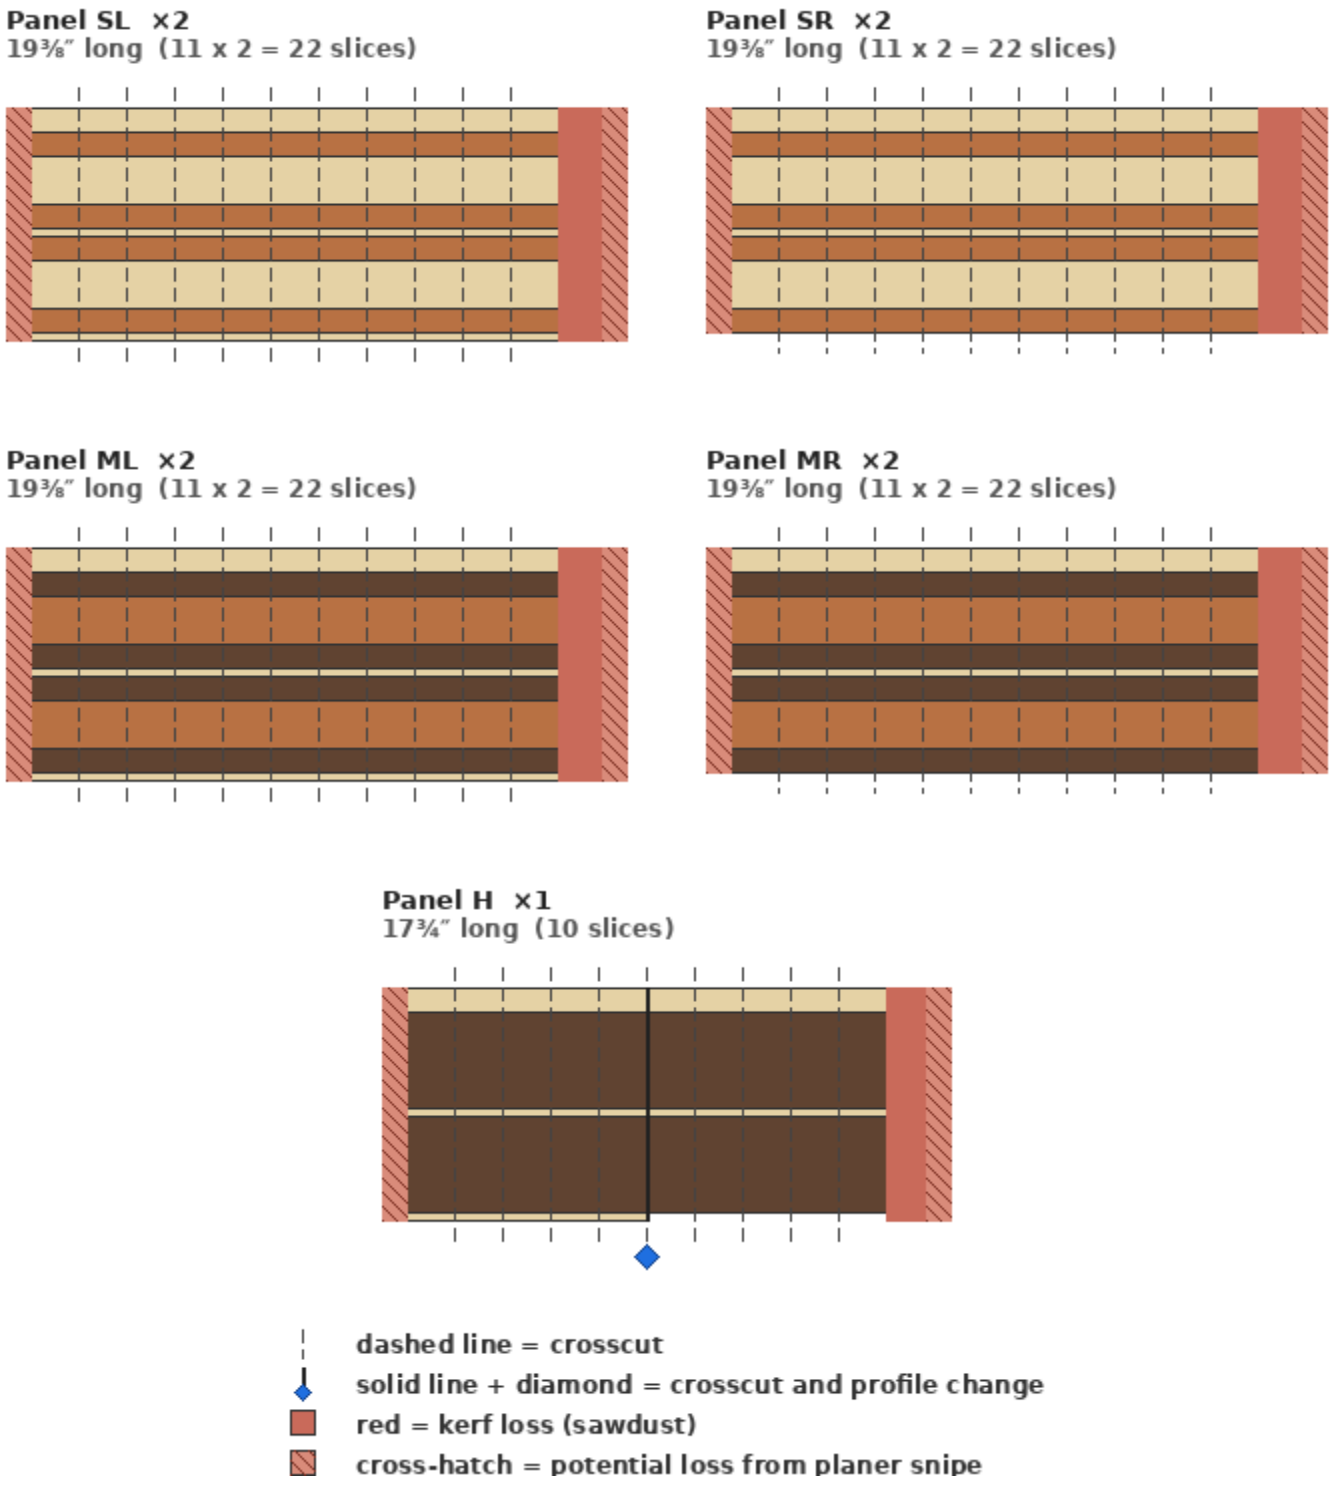

Slice Fulfillment

Review slice demand, supply, and offset.

Slice	Demand	Supplied	Supply Offset
SL	10 × 2 = 20	22	+2
SR	10 × 2 = 20	22	+2

Slice	Demand	Supplied	Supply Offset
ML	10 × 2 = 20	22	+2
MR	10 × 2 = 20	22	+2
H-L	4 × 2 = 8	5 × 2 = 10	+2
H-R	4 × 2 = 8	5 × 2 = 10	+2

7. Components

Review component demand, fulfillment, and shortfall.

Component	Species	Width	Length	Demand	Fulfilled	Shortfall
C1	cherry	1½″	19⅜″	8	8	0
C2	cherry	¾″	19⅜″	16	16	0
M1	maple	1½″	19⅜″	8	8	0
Md	maple	¼″	19⅜″	12	12	0
Md	maple	¼″	17¾″	2	2	0
Me	maple	¾″	19⅜″	8	8	0
Me	maple	¾″	17¾″	1	1	0
W1	walnut	3″	17¾″	2	2	0
W2	walnut	¾″	19⅜″	16	16	0

8. Panels (profiles and sequence)

Review the panels and their quantities.

Panel	Qty	Length	Profiles (slices)	Component sequence
SL	2	19⅜″	single: 11	Me · C2 · M1 · C2 · Md · C2 · M1 · C2 · Md
SR	2	19⅜″	single: 11	Me · C2 · M1 · C2 · Md · C2 · M1 · C2
ML	2	19⅜″	single: 11	Me · W2 · C1 · W2 · Md · W2 · C1 · W2 · Md
MR	2	19⅜″	single: 11	Me · W2 · C1 · W2 · Md · W2 · C1 · W2
H	1	17¾″	L: 5, R: 5	Me · W1 · Md · W1 · Md