

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	Not Known
Work Provider:	OTHER	Able to Authorise Repairs:	TBA
Claim Reference:		Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	TBA
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	C 200 AMG LINE MHEV AUTO C 450 AMG 4MATIC/AMG C 43 4MATIC
Model Sheet Number:	3AW
Engine:	
Registration Number:	EK25YSG
VIN Number:	W1KAH4CBXS195094
Registration Month:	March
Registration Year:	2025
Odometer:	Not Known
Colour:	BLACK
Paint Code:	Not Known
Build Date:	FR PRODUCTION START
Selection Type:	AudaVIN
Fuel Type:	Hybrid
Vehicle Imported:	No

Model Specs

FR PRODUCTION START
FRT COLLISION ALARM
DRIVER ASSISTANT SYS
LANE KEEPING ASSIST
AUTOMATIC BRAKE SYS
PARK PACK
PARK ASSISTENT
PEDESTRIAN PROTECT
AMG NIGHT-PACKET
TWO COAT METALLIC

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Severity of Impact:
Steering Rim Ply:	Vehicle Status on Inspection:
Brakes Pedal Travel:	Date of Inspection:
Place of Inspection:	03/07/2026
Pre-Accident Damage:	

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:

Tread Depth RHF:
Tread Depth RHR:



Damage Areas:

Direction of Impact:

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

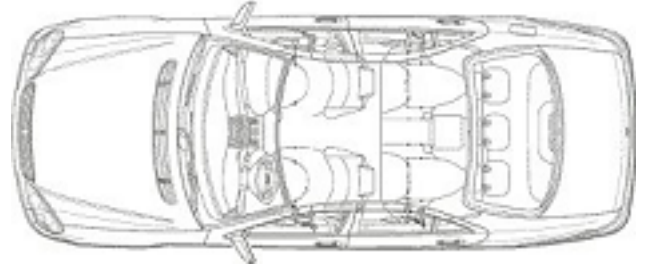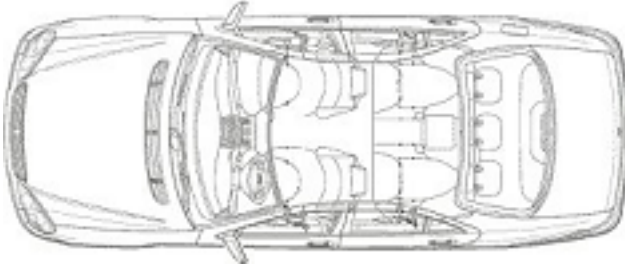

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

Addresses

No addresses entered.

Cost Summary

Total Labour	£2,121.51
Total Paint/Material	£405.35
Total Parts	£928.60
Additional Costs	£939.91
Grand Total Exc VAT:	£4,395.37
20 % VAT:	£879.07
Grand Total Inc VAT:	£5,274.44
Excess:	TBA

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £118.52/HR

Repair / Guide

Number	Description	Work Units
54-7989 01	R + R BATTERY EARTH CABLE (WHEN DISCONNECTING ELECTRIC PLUG AND SOCKET CONNECTIONS)	3.0
61-1086 01	R + R FRONT AND CENTRE ENGINE COMPARTMENT COVERING	3.0
88-1102 01	R + R FRONT BUMPER CPL	9.0
88-1105 ZAX	DIS + ASS FRONT BUMPER (BUMPER REMOVED)	4.0
88-1380 01	AFTER CHECK: RENEW PARTS IF NECESSARY ADDITION TO DIS + ASS FRONT BUMPER (VEHICLE WITH PARKING AID AND DISTRONIC PLUS)	3.0
88-1374 01	ADDITION TO FRONT BUMPER DIS + ASS (VEHICLE WITH PEDESTRIAN PROTECT)	1.0
82-4720 01)	R + R RIGHT HEADLAMP (BUMPER REMOVED/DETACHED)	3.0
82-1110 01	ADJUST HEADLAMPS	2.0
1000	REMOVE&REFIT BUMPER TO STAND	2.0*
0283	REPAIR FRONT BUMPER COVER	15.0*
1000	Specialist QC AND ROAD TEST	10.0*
1000	Specialist PRE REPAIR CLEAN	5.0*
1000	Specialist POST REPAIR CHECK	10.0*
1000	Specialist PRE REPAIR CHECK	10.0*
1000	Specialist WASH AND VACUUM	10.0*
1000	Specialist STANDARD SHUTDOWN	10.0*

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

1000	Specialist YARD CHARGE		10.0*
1000	Adas EXTENSIVE ROAD TEST		5.0*
1000	Specialist EV / HYBRID RISK		5.0*
		Total Work Units	120.0
		Total Panel / Mechanical Labour	12.00 HRS £1,422.24

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £118.52/HR

Repair /Guide	Description		
Number	TWO COAT METALLIC		Work Units
98-1731 01	FRONT BUMPER COVER PAINTING STAGE III		8.0
98-1710 ZAX	L/F OUTER SENSOR PAINTING STAGE II		1.0
98-1710 ZAX	R/F OUTER SENSOR PAINTING STAGE II		1.0
98-9925 ZAX	ADD COLOUR SAMPLE 1		2.0
98-1025 ZAX	OUTER CLEANING CARRY OUT		3.0
98-1020 ZAX	POLISH VEHICLE		3.0
	FOR PAINT BLENDING		
98-1030 ZAX	NON WATER BASED REMOVE		3.0
	DIRT, PRESERVER (GREASE, WAX)		
NN	DENIB / POLISH Paint		3.0*
98-1050 ZAX	SECURITY MEASURES BEFORE		3.0
	CARRYING OUT OVEN DRYING TIME		
98-1350 01	PREPARATION WORK FOR TWO COAT PAINTING		7.0
	OF REMOVED PLASTIC PARTS		
98-9918 ZAX	CARRY OUT COLOUR SHADE DETERMINATION		3.0
	INCLUDES: ADJUSTABLE COMPONENT		
	POLISHING AND COLOR TINTING WITH		
	COLOR PATTERN/MEASURING INSTRUCTIONS		
98-1362 ZAX	ADD FOR PREPARATION WORK		3.0
	COVER REMOVED COMPLETED PARTS		
98-9985 01	REPAIR PLASTIC PART WITH SWAGE		6.0
	(SCRATCH DAMAGE)		
	(PART REMOVED)		
98-1620 ZAX	PRIME PLASTIC/METAL PARTS		3.0
98-1630 ZAX	APPLY SMOOTHG FILLER ON PLAST/MET PARTS		3.0
98-1625 ZAX	REPAIR/APPLY FILLER ON PLAST/METAL PARTS		2.0
98-1620 ZAX	APPLY PRIMER FRONT BUMPER (ADD/WORK)		1.0
98-1630 ZAX	APPLY FILLER FRONT BUMPER (ADD/WORK)		1.0
98-1625 ZAX	APPLY FILLER PASTE FRONT BUMPER (ADD)		3.0
		Total Work Units	59.0
		Total Paintwork Labour	5.9 HRS. £699.27

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

MATERIAL COST - PAINT

COST

Total Paint Cost	£289.15
Sundry Paint Material	£116.20
Pre-Painting Sundry Materials	£0.00
Total Excluding Pearlescent Uplift	£405.35
Pearlescent Uplift @ 0.0%	£0.00
Total Paint And Material Cost	£405.35

PARTS

Price Valid: 01/06/2026

Guide No.	Description	Part Number	Bet.	Price
351	SCREW	N000000 000543	0%	£6.00
352	NUT	003 994 9145	0%	£5.20
562	RIGHT HEADLAMP ASSY		0%	£886.00 *
Sub Total				£897.20
Deduction from RRP (0.0 %)				£0.00
Sundry Parts (3.5 %)				£31.40
Total Parts				£928.60

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
ASSESSMENT FEE Specialist	0%	£176.96
EPA CHARGE Specialist	0%	£31.23
VEHICLE CARE KIT Specialist	0%	£10.41
PAINT CONSUMABLE Specialist	0%	£30.00
PANEL SUNDRIES P/P Specialist	0%	£26.02
FIRST CALIBRATION Adas Cal	0%	£312.30
HYBRID FULL RECHARGE Specialist	0%	£20.82
SUBSEQUENT CAL Adas Cal hdlamp	0%	£156.15
ENVIR SUSTANABILITY Specialist	0%	£26.02
COLLECT/DELIVER Specialist	0%	£150.00
Total Extras		£939.91

Calculation

03/07/2026

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002151
Version: VBR040CH/1

Full Report
Printed: 03/07/2026

Labour			
	Total Panel/Mechanical	£1,422.24	
	Total Paintwork	£699.27	
Total Labour			£2,121.51
Total Paint/Material Costs			£405.35
Total Parts			£928.60
Additional Costs			
	Cost of Specialist	£939.91	
Total Additional Costs			£939.91
Grand Total Excl VAT			£4,395.37
	VAT @ 20 %		£879.07
Grand Total Incl VAT			£5,274.44
	Excess		TBA

Assessment Notes

No assessment notes entered.