

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	27/03/2026
Work Provider:	OTHER	Able to Authorise Repairs:	TBA
Claim Reference:	SBL-B0665717	Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	TOYOTA
Model:	AYGO X Edge
Model Sheet Number:	Y6B
Engine:	1.0 LTR 53 KW
Registration Number:	FG25VOH
VIN Number:	JTDAGNAC100289329
Registration Month:	March
Registration Year:	2025
Odometer:	17774 miles
Colour:	Blue
Paint Code:	2VL
Build Date:	FROM 01/2025
Selection Type:	AudaVIN+
Fuel Type:	Petrol
Vehicle Imported:	No

Model Specs

FROM 01/2025
AUTO AIR CON
TINT GLASS (PRIVACY)
FRT ELECTRIC WINDOWS
HEATED DOOR MIRRORS
4 SPEAKER
RADIO WITH DISP 9.0
FOG LAMPS
LEATHER STRG WHEEL
SENSOR RAIN/FOG
BONNET STICKER SET
RR BUMPER MLDG PAINT
PAINTED DOOR HANDLES
TOW BAR
SUN VISOR MIRROR
REARVIEW CAMERA
1.0 LTR 53 KW
5 SPEED GEARBOX
175/60 HR 18
WHEELS 5J X 18 ALLOY
VERSION K
VSC SYSTEM
PREPARE OFF VEHICLE
TWO COAT PEARL/MICA
TWO COAT PEARL/MICA

Vehicle Condition

Vehicle Status

Pre-Accident Condition:		Severity of Impact:	
Steering Rim Ply:		Vehicle Status on Inspection:	
Brakes Pedal Travel:		Date of Inspection:	19/06/2026
Place of Inspection:	Repairer		
Pre-Accident Damage:			

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

Tyres Condition:


Tread Depth LHF:

Tread Depth LHR:


Tread Depth RHF:

Tread Depth RHR:

Damage Areas:

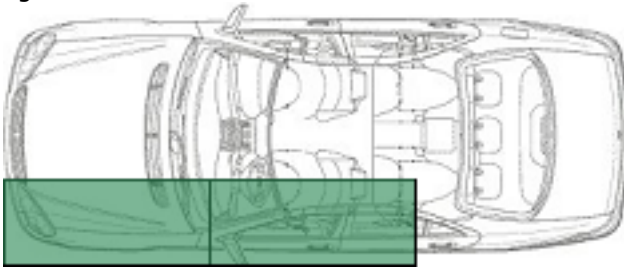

Direction of Impact:

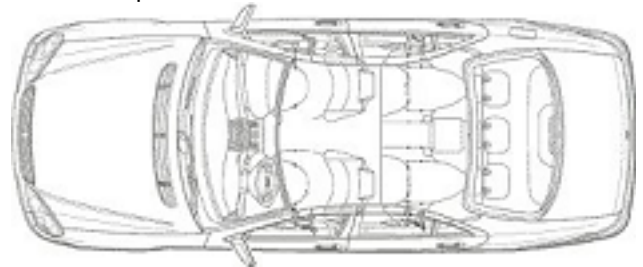

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

Addresses

Assessor

PHIL SHEDDEN
Mobile Tel : 07788289146

Insured

DRIVALIA UK LTD
250 BATH ROAD
SLOUGH
SL1 4DX

Repairer

GD PAINTWORK LTD
UNIT 10 VICTORY CLOSE
WOOLSBRIDGE
WIMBORNE
BH21 6SX
Business Tel : 01202082078
Email Address :
INFO@GDPAINWORK.CO.UK

Cost Summary

Total Labour	£2,173.61
Total Paint/Material	£938.24
Total Parts	£965.71
Additional Costs	£681.42
Grand Total Exc VAT:	£4,758.98
20 % VAT:	£951.80
Grand Total Inc VAT:	£5,710.78
Excess:	£0.00

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £83.28/HR

Repair / Guide

Number	Description	Work Units
B010	R+R BOTH FRONT WING COVERS	3.0
B010	R + R FRONT BUMPER	6.0
NO NUMBER	R + R FRONT CENTRE BUMPER COVER	4.0
NO NUMBER	R + R FRONT NUMBER PLATE	1.0
NO NUMBER	R + R FRONT BADGE	1.0
B040	R + R L/HEADLAMP	3.0
NO NUMBER	ADJUST HEADLAMPS	2.0
531041)	R + R LEFT FRONT WHEELHOUSE SHELL	3.0
810261	R + R L/REPEATER LAMP	2.0
670301	R + R LEFT FRONT DOOR TRIM	3.0
672191)	R + R LEFT FRONT OUTER DOOR HANDLE	1.0
NO NUMBER	R + R L/F INNER DOOR COVER	1.0
752051)	R + R LEFT MIRROR	1.0
B100	R + R L/SILL PANEL COVER	3.0
670311	R + R L/R DOOR TRIM	2.0
672201)	R + R L/R OUTER DOOR HANDLE	3.0

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

NO NUMBER	R + R L/R UPPER SIDE PANEL TRIM	2.0
NO NUMBER	R + R R/R UPPER SIDE PANEL TRIM	2.0
B430	R + R ROOF COVER PANEL ATTACHED PARTS	11.0
NO NUMBER	R + R FRONT ROOF LAMP	2.0
752101	R + R SUN VISORS	2.0
860101)	R + R ROOF AERIAL	1.0
B440	R + R LEFT FRONT SEAT	2.0
B440	R + R RIGHT FRONT SEAT	2.0
B450	R + R COMPLETE REAR SEAT CUSHION	3.0
420091)	R + R FRONT WHEEL (WHEELS)	1.0
420091A	R + R L/F WHEEL/TYRE	3.0
042214)	BALANCE WHEEL/S	2.0
NN	NSF DOOR MOULDING R&R / NEW PARTS	3.0*
1625	REMOVE&REFIT L/OUTER CHANNEL SEAL	3.0*
1000	REMOVE&REFIT SPARE WHEEL SWAP	5.0*
1000	REMOVE&REFIT RAMP LOAD & UNLOAD	2.0*
1000	FRT BUMPER 2ND MAN LIFT	2.0*
0741	REPAIR L/F WING	5.0*
1481	REPAIR LEFT FRONT DOOR	5.0*
0561	CHECK LEFT HEADLAMP ASSY	
7202	CHECK R/F WHEEL	*
1000	CHECK DIAG POST SCAN	10.0*
1000	CHECK DIAG PRE SCAN	10.0*
1000	CHECK QC & ROAD TEST	10.0*
1000	CHECK VEHICLE SHUTDOWN	10.0*
1000	CHECK WASH & VAC	10.0*
1000	CORR. PROT. EXT. TO 2 PANELS	4.0*

Total Work Units	151.0
Total Panel / Mechanical Labour	15.10 HRS £1,257.53

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £83.28/HR

Repair /Guide	Description	
Number		Work Units
281	FRONT BUMPER REPAIR PAINT PLASTIC	13.0
741	L/F WING REPAIR PAINTING <50%	10.0
1481	LEFT FRONT DOOR REPAIR PAINTING <50%	17.0
1781	L/R DOOR SURFACE PAINT	7.0
1000	DE NIB&POLISH SURFACE PAINT	12.0*
1000	DOOR GLASS MASK X2	6.0*
1000	SCREEN MASK FRT EDGESURFACE PAINT	3.0*
	PREPARATION FOR PRE-PAINTING	42.0

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

Total Work Units	110.0
Total Paintwork Labour	11.0 HRS. £916.08

MATERIAL COST - PAINT

COST

Total Paint Cost	£624.47
Sundry Paint Material	£0.00
Pre-Painting Sundry Materials	£299.90
Total Excluding Pearlescent Uplift	£924.37
Pearlescent Uplift @ 1.5%	£13.87
Total Paint And Material Cost	£938.24

PARTS

Price Valid: 09/01/2026

Guide No.	Description	Part Number	Bet.	Price
747	L/F WING EXTENSION	53714 0H020	0%	£28.85
1589	L/F HANDLE SEAL	69241 0D020	0%	£10.92
1591	L/F HANDLE CVR SEAL	69242 0H020	0%	£10.92
1713	L/INNER DOOR COVER	67832 0H050	0%	£108.56
1739	L/F WING TRIM	75602 0H021	0%	£129.44
1885	L/R HANDLE SEAL	69242 0H020	0%	£10.92
1887	L/R HANDLE SEAL	69241 0D030	0%	£8.60
2015	L/R INNER DOOR COVER	67841 0H030	0%	£13.53
2187	LEFT SILL MOULDING	75860 0H020	0%	£375.96
7203	L/F PRESSURE VALVE		0%	£6.43 *
7227	L/F TYRE		0%	£160.00 *
1000	NSF DOOR MOULDING	t75072-0h010	0%	£68.92 *
Sub Total				£933.05
Deduction from RRP				(0.0 %) £0.00
Sundry Parts				(3.5 %) £32.66
Total Parts				£965.71

NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras

Description	Betterment	Price
4 WHEEL ALIGNMENT CHECK&ADJUST	0%	£174.88
ARIES FEE Specialist	0%	£26.02
BODY FILLER	0%	£26.02
CAR CARE KIT Specialist	0%	£10.41

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR002073
Version: VBR040CH/1

Full Report
Printed: 22/06/2026

E.P.A. CHARGE	Specialist	0%	£31.23
ESTIMATE	INC IIR&METHODS	0%	£176.96
COMPILATION			
SOFT EDGE TAPE	NOT IN AZT	0%	£8.00
WHEEL BALANCE X1	Specialist	0%	£25.00
PAINT CONSUMABLE	Specialist	0%	£30.00
COLLECT/DELIVER	Specialist	0%	£150.00
Total Extras			£658.52

Calculation

22/06/2026

Labour

Total Panel/Mechanical	£1,257.53
Total Paintwork	£916.08

Total Labour **£2,173.61**

Total Paint/Material Costs **£938.24**

Total Parts **£965.71**

Additional Costs

Corrosion Protection Materials External	£22.90
Cost of Specialist	£658.52

Total Additional Costs **£681.42**

Grand Total Excl VAT **£4,758.98**

VAT @ 20 % **£951.80**

Grand Total Incl VAT **£5,710.78**

Excess **£0.00**

Assessment Notes

No assessment notes entered.