

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	Not Known
Work Provider:	OTHER	Able to Authorise Repairs:	TBA
Claim Reference:		Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	TBA
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	MERCEDES
Model:	A CLASS A 180 [177.
Model Sheet Number:	3A4
Engine:	
Registration Number:	BU72MPO
VIN Number:	W1K1770842J359479
Registration Month:	September
Registration Year:	2022
Odometer:	Not Known
Colour:	BLACK
Paint Code:	191
Build Date:	FROM VIN J246148/N..
Selection Type:	AudaVIN+
Fuel Type:	Petrol
Vehicle Imported:	No

Model Specs

FROM VIN J246148/N..
H-LAMP LED HIGH PER
DYNAMIC SELECT
STR WHL SHFT PAD CHR
AMBIENT-LIGHT 64 COL
KNEE AIRBAG
HEADLINING BLACK
MULTI FUNC ST/WHEEL
GUARD 360 PROTECT
RR TORSION BEAM AXLE
MODIFICAT PACK 21/2
MODEL 2022
AIR CON THERMOTRONIC
TINTED REAR WINDOWS
HEADUNIT ECE/ROW
DAB TUNER
SPEED SIGN RECOGN
RAIN SENSOR
ACTIVE TRACK ASSIST
ACTIVE BRAKE ASSIST
NAVIGAT HARD DRIVE
EDITION 2020
TOUCHPAD
SMARTPHONE INTEGRAL
CONNECT 20 MID
CENTRAL DISPLAY
LIGHT-/VIEW PACKAGE
FOLDING REAR SEAT
MICROFIBRE PAD
AMG LINE
AMG LINE
NIGHT-PACKET
DOUBLE CUP HOLDER
ELEC FOLD DR MIRRORS
OUT/IN MIRR AUTO DIM
PASS AIRBAG INTERRUPT

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

S/BELT W/WARNING DEV
MIRROR PACKAGE
STORAGE BOX
SEAT COMFORT PACKAGE
ILLUM SUN VISORS
EMERGENCY CALL SYS
MOBILE KOM-MOD UMTS
ANTI-THEFT ALARM
REARVIEW CAMERA
INCR ANTI THEFT DEV
EXHAUST WITH OPF GEN
RADIATOR SHROUD
UPPER RADIATOR BLIND
CYLINDER MANAGEMENT
REINFORCED BRAKE
TYRE PRESSURE SENSOR
CRUISE CONTROL
EMISSIONS EURO 6D
7 SPEED AUTOMATIC
DIRECT STEERING
COMFORT SUSPENSION
INTERIOR PROTECTION
TYRES 225/45 WR 18
WHEELS 7.5J X 18 ALU
DR MIRROR GPS AERIAL
TYRE FIT
EURO NCAP COUNTRIES
HEATED FRONT SEATS
PEDESTRIAN PROTECT
ACTIVE PARK-ASSIST
COMPRESSOR VARIABLE
PROD LAND GERMANY
AMG STYLING
PARK PACK
TWO COAT METALLIC
REFRIGERANT R1234YF
CLEAR COAT HARD

Vehicle Condition

Vehicle Status

Pre-Accident Condition:
Steering Rim Ply:
Brakes Pedal Travel:
Place of Inspection:
Pre-Accident Damage:

Severity of Impact:
Vehicle Status on Inspection:
Date of Inspection: 30/01/2026

Tyres Condition:
Tread Depth LHF:
Tread Depth LHR:


Tread Depth RHF:
Tread Depth RHR:

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY


Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

Damage Areas:

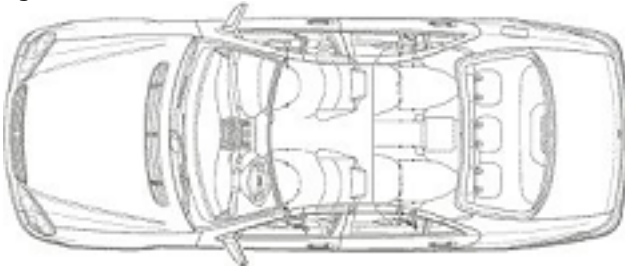

Direction of Impact:

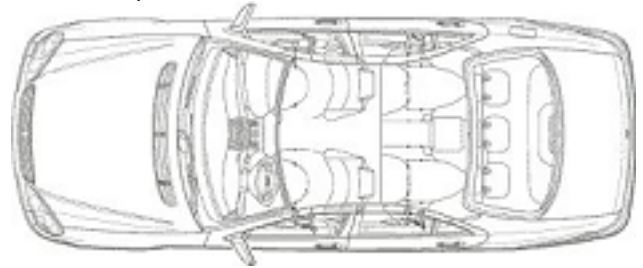

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKES ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

Addresses

No addresses entered.

Cost Summary

Total Labour	£2,854.76
Total Paint/Material	£1,007.39
Total Parts	£2,081.13
Additional Costs	£726.51
Grand Total Exc VAT:	£6,669.79
20 % VAT:	£1,333.96
Grand Total Inc VAT:	£8,003.75
Excess:	TBA

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £103.06/HR

Repair / Guide

Number	Description	Work Units
54-1011 01	SHORT TEST	3.0
	INCLUDES: CONNECT + DISCONNECT STAR	
	DIAGNOSIS,	
	PRINT DATA,	
	DELETE ERROR MEMORY	
61-1128 01	R + R REAR UNDERBODY COVERING	3.0
54-0650 01	MAIN BOARD MAINTAINED	1.0
	(FOR CHECK AND DIAGNOSIS WORK)	
88-9960 01	R + R DRIP MOULDINGS	4.0
60-4593 01)	R + R L/R SIDE PANEL ATTACHED PARTS	3.0
60-4593 01)	R + R R/R SIDE PANEL ATTACHED PARTS	3.0
NO NUMBER	RENEW TAILGATE	42.0
	INCLUDES: TAILGATE TRIM, BOTH	
	GAS PRESSURE DAMPER, REAR WIPER ARM,	
	WIPER MOTOR, REAR SPOILER, REAR SCREEN,	
	BOTH REAR LAMPS AND REQUIRED	
	ATTACHED PARTS R + R	
88-8802 02	R + R REAR BUMPER	15.0
NO NUMBER	DIS + ASS REAR BUMPER (REMOVED)	7.0
88-8956 01	R + R REAR BUMPER CARRIER	5.0
	(REAR BUMPER REMOVED)	
54-1076 01	R + R REAR PARKTRONIC SENSOR/S	3.0
	(BUMPER REMOVED)	
40-1590 01	R + R TWO WHEELS	3.0
40-1470 01	ADD TO L/R WHEEL REMOVE AND REFIT	1.0
	(ASSEMBLY ON WHEELS FROM 17 INCH	

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

40-1470 01	ADD TO R/R WHEEL REMOVE AND REFIT (ASSEMBLY ON WHEELS FROM 17 INCH	1.0
54-1790 01	ADJUST BACKUP CAMERA	3.0
1000	REMOVE&REFIT RAMP LOAD & UNLOAD	2.0*
1000	Specialist QC AND ROAD TEST	10.0*
1000	Specialist PRE REPAIR CLEAN	5.0*
1000	Specialist POST REPAIR CHECK	10.0*
1000	Specialist PRE REPAIR CHECK	10.0*
1000	Specialist WASH AND VACUUM	10.0*
1000	Specialist STANDARD SHUTDOWN	10.0*
1000	Specialist CORRISON MAT LABOUR	3.0*
1000	Adas EXTENSIVE ROAD TEST	5.0*
Total Work Units		162.0
Total Panel / Mechanical Labour		16.20 HRS £1,669.57

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £103.06/HR

Repair /Guide	Description	
Number		Work Units
LE 2583	REAR BUMPER COVER PAINTING	8.0
98-1710 ZAX	R/R INN PARKING SENS PAINTING	1.0
98-1710 ZAX	L/R CTR PARK SENSOR PAINTING	1.0
98-8415 01	BOOTLID/TAILGATE PAINTING STAGE I-M	15.0
98-7046 01	L/R SIDE PANEL PAINTING STAGE II	11.0
	WITH ROOF SIDE PANELLING LESS DOOR SHUT	
98-7446 01	R/R SIDE PANEL PAINTING STAGE II	11.0
	WITH ROOF SIDE PANELLING LESS DOOR SHUT	
98-7956 01	FUEL FILLER FLAP PAINTING STAGE II	3.0
98-9925 ZAX	ADD COLOUR SAMPLE 1	2.0
98-1025 ZAX	OUTER CLEANING CARRY OUT	3.0
98-1020 ZAX	POLISH VEHICLE	3.0
	FOR PAINT BLENDING	
98-1030 ZAX	NON WATER BASED REMOVE	3.0
	DIRT, PRESERVER (GREASE, WAX)	
NN	ADDITIONAL MASK FRT SCREEN	5.0*
NN	ADDITIONAL MASKING TAILGATE SHUT	3.0*
NN	DENIB / POLISH Paint	18.0*
NN	ADDITIONAL MASKING TAILGATE	3.0*
NN	TOUCH UP BOLTS SURFACE PAINT	2.0*
98-1050 ZAX	SECURITY MEASURES BEFORE	3.0
	CARRYING OUT OVEN DRYING TIME	
98-1340 01	PREPARATION WORK FOR TWO COAT PAINTING	14.0
	OF FITTED BODY PARTS	
98-1362 01	ADD FOR PREPARATION WORK	3.0

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

98-9918 ZAX	COVER REMOVED COMPLETED PARTS	
	CARRY OUT COLOUR SHADE DETERMINATION	3.0
	INCLUDES: ADJUSTABLE COMPONENT	
	POLISHING AND COLOR TINTING WITH	
	COLOR PATTERN/MEASURING INSTRUCTIONS	

Total Work Units	115.0
Total Paintwork Labour	11.5 HRS. £1,185.19

MATERIAL COST - PAINT

COST

Total Paint Cost	£897.14
Sundry Paint Material	£110.25
Pre-Painting Sundry Materials	£0.00
Total Excluding Pearlescent Uplift	£1,007.39
Pearlescent Uplift @ 0.0%	£0.00
Total Paint And Material Cost	£1,007.39

PARTS

Price Valid: 01/02/2026

Guide No.	Description	Part Number	Bet.	Price
2583	REAR BUMPER COVER	177 880 4801 9999	0%	£602.00
2591	L/R BUMPER SUPPORT	177 885 7301	0%	£20.70
2592	R/R BUMPER SUPPORT	177 885 7401	0%	£28.50
2640	REAR BUMPER C-MEMBER	177 610 5300	0%	£142.00
2641	RR INNER BUMPER PART	177 885 6302	0%	£46.30
2645	L/R BUMPER DAMPER	177 885 3302	0%	£21.70
2646	R/R BUMPER DAMPER	177 885 3402	0%	£21.70
2647	L/R SIDE REFLECTOR	222 820 0774	0%	£15.90
2648	R/R SIDE REFLECTOR	222 820 0874	0%	£15.90
2663	L/R CTR SPACER RING	000 542 1251	0%	£2.25
2664	R/R CTR SPACER RING	000 542 1251	0%	£2.25
2665	L/R OUT SPACER RING	000 542 1251	0%	£2.25
2666	R/R OUT SPACER RING	000 542 1251	0%	£2.25
2667	L/R INN SPACER RING	000 542 1251	0%	£2.25
2668	R/R INN SPACER RING	000 542 1251	0%	£2.25
2670	R/R INN PARKING SENS	000 905 5504 9999	0%	£68.50
2671	L/R CTR PARK SENSOR	000 905 5504 9999	0%	£68.50
2702	REAR NUMBER PLATE	KNPL6	0%	£0.00
2703	REAR NO PLATE REINF	KNPLO	0%	£0.00
2931	BOOTLID/TAILGATE	177 740 1400	0%	£613.00

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

2973	REAR LOCK STRIKER	246 740 0032	0%	£12.60
2977	BOOT/TAILGATE LOCK	099 740 0400	0%	£102.00
2983	REAR HANDLE CONTROL	099 750 3500	0%	£69.50
3010	STAR EMBLEM	177 817 0000	0%	£23.10
3011	REAR BADGE	177 817 1900	0%	£42.60
3051	CLIP FASTENING	000 991 5000	0%	£10.35
3160	REAR SCREEN BOND KIT	000 989 4905 11	0%	£66.00
3164	REAR SCREEN SUPPORTS	000 987 4766	0%	£6.40

Sub Total		£2,010.75
Deduction from RRP	(0.0 %)	£0.00
Sundry Parts	(3.5 %)	£70.38
Total Parts		£2,081.13

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras			
	Description	Betterment	Price
	ASSESSMENT FEE Specialist	0%	£176.96
	EPA CHARGE Specialist	0%	£31.23
	VEHICLE CARE KIT Specialist	0%	£10.41
	PAINT CONSUMABLE Specialist	0%	£30.00
	CORROSION MAT Specialist	0%	£15.61
	FIRST CALIBRATION Adas Cal	0%	£312.30
	COLLECT/DELIVER Specialist	0%	£150.00
	Total Extras		£726.51

Calculation **24/02/2026**

Labour			
	Total Panel/Mechanical	£1,669.57	
	Total Paintwork	£1,185.19	
Total Labour			£2,854.76
Total Paint/Material Costs			£1,007.39
Total Parts			£2,081.13
Additional Costs			
	Cost of Specialist	£726.51	
Total Additional Costs			£726.51
Grand Total Excl VAT			£6,669.79
	VAT @ 20 %		£1,333.96

TEL: COLLISION ENGINEERS
01515590762 77-79 HOYLAKE ROAD
MORETON
WIRRAL, CH46 9PY

Assessment Number: NR001216
Version: vbr040ch/1

Full Report
Printed: 24/02/2026

Grand Total Incl VAT				£8,003.75
	Excess			TBA

Assessment Notes

No assessment notes entered.