

FAO The Court
C/o Accident Exchange Ltd (AX)
Unit 2, Liberty Park
Burton Old Road
WS14 9HY

REPAIRABLE REPORT

Dear Sirs


RE: Road traffic Accident: Mr Hamid Reza Azod Azad: 09/06/2026


In accordance with your instructions received on 16/06/2026 requesting us to provide an independent accident damage report, we assessed the damage on 18/06/2026. Vehicle located at Image-based Assessment. Our findings are as detailed below:

Make	TOYOTA	Registration	SC21VMR
Model	COROLLA ICON HEV C	Status	Repair
Category		Salvage Value	
Repair Cost	£4,473.82	Legal Status	Unroadworthy
Engineer Value	£9,525.00	Impact Magnitude	Moderate



Impact Area

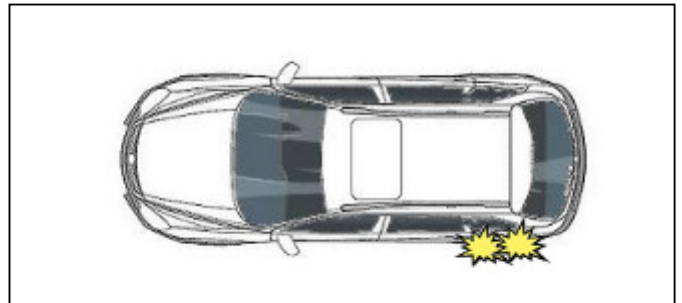

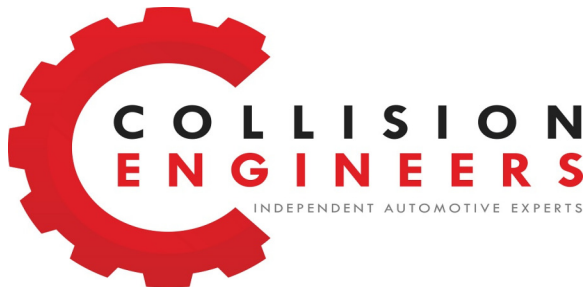

Our Ref: ax26353

Your Ref: 1070571

Date: 18/06/2026

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the left hand side.

ENGINEER'S COMMENTS

Please note the vehicle is unroadworthy / unfit for purpose due to the damage sustained. We do not expect the vehicle to comply with the local licensing authority regulations.

VEHICLE HISTORY CHECK

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

RESERVE

We consider that a repair reserve of £4,475.00 would be reasonable on this occasion.


Vehicle Data

Retail Value	£9,525.00
Trade Value	£7,350.00
Engineer's Value	£9,525.00
Glass's Code	
VIN	SB1K93BEX0E228104
Odometer	161000
Engine	1798
Fuel	
Extras	
Condition	Good

Main new parts required

Left Rear Door Covering Sheet (Skin)
Left Rear Door Outer Trim Seal

Left Rear Door Outer Handle Seal

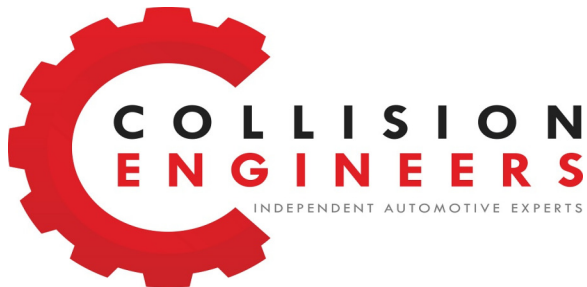

Our Ref: ax26353

Your Ref: 1070571

Date: 18/06/2026

Repairs required

Left Rear Door Shell
Left Rear Side Panel

Left Sill Panel Cover (Plastic)

Additional operations

.Assessment Damage Appraisal Charge

.Pre repair cleaning charge

.Sundries

.System Diagnostic Check (Pre Repair)

.Wash/Clean

Corrosion Protection

De-nib

Electric / hybrid shutdown and power up

NSR tyre

.Yard Charge

Paint Left Rear Door, Complete

Paint Left Sill Panel Protective Moulding

Paint Left Rear Side Panel, Complete

Paint Prep. metal (on vehicle without pre-painting)

Paint Colour mixing (1)

.Environmental Charge

.QC & Road Test

.System Diagnostic Check (Post Repair)

.Vehicle Care Kit

Alloy Wheel Refurbish

Corrosion Protection additional panel

Electric / hybrid risk assessment

Miracle Pull

Wheel Alignment (check)

Paint Left A-Post, Upper

Paint Left Rear Door Outer Handle

Paint Left Roof Panel, Side A

Paint Left Fuel Filler Lid

Paint Prep. synthetics (combined-operation work)

Paint Sample colour creation (1)

Repair Cost Calculations

Hours	28.60
Hourly Rate	£83.28
Total Labour	£2,381.81
Parts	£25.98
Paint/Materials	£661.12
Specialist/Other	£659.27
Sub total	£3,728.18
Vat	£745.64
Total Estimated Cost	£4,473.82




















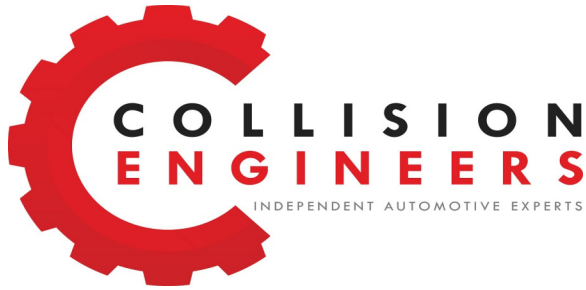

Our Ref: ax26353

Your Ref: 1070571

Date: 18/06/2026

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully

A Patterson - M.Inst.IAEA

engineers@collisionengineers.co.uk

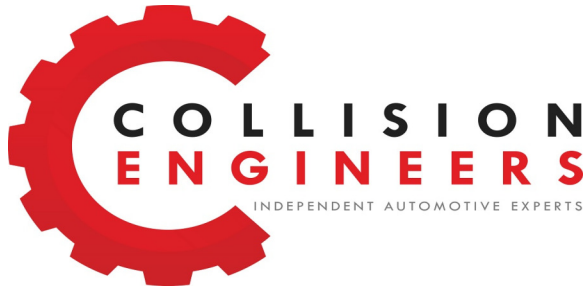

Our Ref: ax26353

Your Ref: 1070571

Date: 18/06/2026

FAO The Court
C/o Accident Exchange Ltd (AX)
Unit 2, Liberty Park
Burton Old Road
WS14 9HY

Fee Note

SC21VMR.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference ax26353.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o Accident Exchange Ltd (AX) confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10