

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

Summary Information

Claim

Authorisation Status:	Interim	Date of Incident:	11/05/2026
Work Provider:	Bodyshop/Repairer	Able to Authorise Repairs:	TBA
Claim Reference:		Repairs Authorised?	TBA
Policy Number:		VAT Portion Payable:	TBA
Other Reference:		Repairer:	
		Estimated Repair Time (Working Days):	

Vehicle Details

Vehicle

Manufacturer:	TESLA
Model:	MODEL 3 Base Model
Model Sheet Number:	TL03
Engine:	ELECTRIC MOTOR 175KW
Registration Number:	LD710GY
VIN Number:	LRW3F7EK7MC321713
Registration Month:	September
Registration Year:	2021
Odometer:	37853 miles
Colour:	WHITE
Paint Code:	Not Known
Build Date:	FROM MODEL 2021
Selection Type:	AudaVIN+
Fuel Type:	
Vehicle Imported:	

Model Specs

FROM MODEL 2021
AUTO DAY/NIGHT MIRR
W/PUMP CLIMATE SYSTM
AUDIOSYS "PREMIUM"
DOOR MIRROR CHROME
LED FOG LAMPS
FRT/RR HEATED SEATS
AUTOPILOT
REARVIEW CAMERA
GEARBOX 1-SPEED
BATTERY 75 KWH
TYRES 235/45 VR 18
ALU WHEELS 8.5J X 18
FOUR WHEEL DRIVE
ELECTRIC MOTOR 175KW
PREPARE OFF VEHICLE
THREE COAT PEARL

Vehicle Condition

Vehicle Status

Pre-Accident Condition:	Good	Severity of Impact:	Light
Steering Rim Ply:	Not testable	Vehicle Status on Inspection:	Roadworthy
Brakes Pedal Travel:	Not testable	Date of Inspection:	13/05/2026
Place of Inspection:			
Pre-Accident Damage:			

Tyres Condition: Good
Tyres - Tread Depth (MM):

	Axes	Left Tyre Depth	Right Tyre Depth	
LHF	0	6.0	6.0	RHF
LHR	1	6.0	6.0	RHR



Damage Areas:

Direction of Impact:

TEL: BMC BODYSHOP (HEMEL HEMPSTEAD) LIMITED FAX:
01923 266772 UNIT 3 KENWOOD ESTATE HARTHALL LANE 01923 266682
HEMEL HEMPSTEAD
HERTFORDSHIRE, HP3 8SD

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

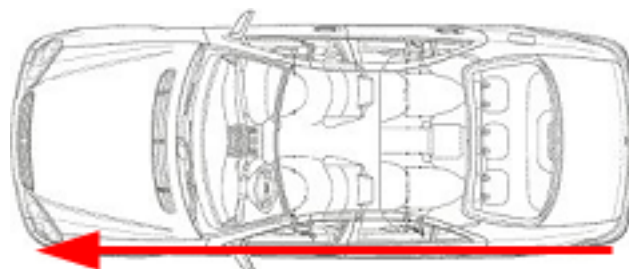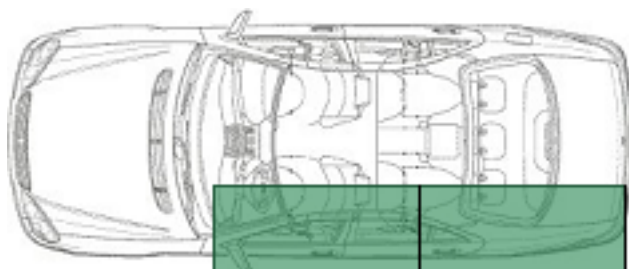

TEL: BMC BODYSHOP (HEMEL HEMPSTEAD) LIMITED FAX:
01923 266772 UNIT 3 KENWOOD ESTATE HARTHALL LANE 01923 266682
HEMEL HEMPSTEAD
HERTFORDSHIRE, HP3 8SD

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

Addresses

Insured

Karin Solomons
n/a
07904124666
Mobile Tel : 07808095749

Repairer

BMC BODYSHOP (HEMEL HEMPSTEAD)
LTD
UNIT 3 KENWOOD INDUSTRIAL ESTATE
HARTHALL LANE
KINGS LANGLEY
HP3 8SD
Business Tel : 01923 266772

User Driver

Cost Summary

Total Labour	£4,605.60
Total Paint/Material	£1,323.74
Total Parts	£2,142.08
Additional Costs	£990.89
Grand Total Exc VAT:	£9,062.31
20 % VAT:	£1,812.46
Grand Total Inc VAT:	£10,874.77
Excess:	TBA

Repair Information

LABOUR

Time Basis 10 WU = 1 HR. Price = £95.00/HR

Repair / Guide

Number	Description	Work Units
NO NUMBER	VEHICLE PREPARATION TIME	3.0
NO NUMBER	TOOLBOX TESLA DIAGNOS SCHALT/AB-ANSCHALT	1.0
NO NUMBER	PROGRAM CHARGING CONNECTION	3.0
15203101)	R + R HEADLINING	1.0
20012002)	R + R L/HEAD AIRBAG	10.0
15130202	R + R L/F DOOR TRIM	3.0
11701112)	R + R L/F INNER DOOR CHANNEL MOULDING	1.0
11703002	R + R L/F OUTER WINDOW CHANNEL MOULDING	1.0
11500102)	R + R LEFT FRONT DOOR WINDOW	1.0
12091101)	R + R LEFT MIRROR	1.0
11701001)	R + R L/F DOOR MODULE	3.0
11451002)	R + R LEFT FRONT OUTER DOOR HANDLE	2.0
NO NUMBER	R + R L/OUTER MIRROR COVER	0.6
12202602	R + R L/DOOR SILL PROTECTOR	3.0
15184002	R + R LEFT UPPER A-PILLAR TRIM	1.0
11700502)	R + R L/R WEATHERSTRIP	2.0
NO NUMBER	R + R L/FR SILL PANEL COVER	1.0

TEL: BMC BODYSHOP (HEMEL HEMPSTEAD) LIMITED FAX:
01923 266772 UNIT 3 KENWOOD ESTATE HARTHALL LANE 01923 266682
HEMEL HEMPSTEAD
HERTFORDSHIRE, HP3 8SD

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

15183002	R + R LEFT UPPER B-PILLAR TRIM	1.0
10106502)	RENEW L/R DOOR (DOOR REMOVED)	13.0
	INCLUDES: ATTACHED PARTS R + R	
NO NUMBER	RENEW L/R SIDE PANEL CPL	154.0
15245002)	R + R L/R SIDE PANEL TRIM	3.0
12011102)	R + R LEFT REAR WHEELHOUSE SHELL	1.0
15111102	R + R UPPER BOOT TRIM	1.0
15184102	R + R RIGHT UPPER A-PILLAR TRIM	1.0
15183102	R + R RIGHT UPPER B-PILLAR TRI	1.0
10107001	R + R BOOT LID	8.0
10204111)	R + R REAR SCREEN	18.0
11702002)	R + R BOOT LID SEAL	2.0
10013001)	R + R REAR BUMPER	8.0
NO NUMBER	R + R REAR FLOOR CARPET	5.0
13055102	R + R LEFT REAR OUTER SEAT ARMREST	1.0
13055202	R + R RIGHT REAR OUTER SEAT ARMREST	1.0
13051002	R + R REAR SEAT CUSHION	2.0
34015202)	R + R L/R TYRE	2.0
11500010	L/F WINDOW: ADJUST	1.0
	INCLUDES: 0-POINT THE DOOR WINDOW	
	CALIBRATE WITH VEHICLE TOUCHSCREEN,	
	VEHICLE SERVICE MODE	
11500010	L/R WINDOW: ADJUST	1.0
	INCLUDES: 0-POINT THE DOOR WINDOW	
	CALIBRATE WITH VEHICLE TOUCHSCREEN,	
	VEHICLE SERVICE MODE	
34015201	R + R LEFT REAR WHEEL	3.0
NO NUMBER	R + R L/R TYRE PRESSURE SENSOR	0.6
	BEAD SEALER Renew	
	SOUND PAD SMALL Renew	
NN	HEAVY STONE CHIP R&R / NEW PARTS	5.0*
	BORON DRILLS (8MM) Renew	
	WELDING MATERIALS Renew	
1000	HEALTH SAFETY 2 MAN LIFT	3.0*
1000	REMOVE&REFIT DOOR TO STAND	2.0*
1000	REPAIR TEST WELD	5.0*
1000	ROAD TEST AND QUALITY CONTROL	10.0*
1000	CHECK WASH AND VAC	10.0*
1000	Adas EXTENSIVE ROAD TEST	5.0*
1000	Specialist / EV POWER DOWN VEHICLE	30.0*
1000	Specialist YARD CHARGE	10.0*
1000	CHECK WATER TEST	5.0*
1000	Corrosion Prote TO 2 PANELS	4.0*
Total Work Units		354.2
Total Panel / Mechanical Labour		35.42 HRS
		£3,364.90

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

PAINT WORK

Time Basis 10 WU = 1 HR. Price = £95.00/HR

Repair /Guide	Description	
Number		Work Units
1781	L/R DOOR NEW PART PAINTING	16.2
3481	L/R SIDE PANEL CPL NEW PART PAINTING	24.9
1481	LEFT FRONT DOOR SURFACE PAINT	10.5
2125	L/R SILL PR2 SURFACE PAINT	7.6
2265	L/UPP A-PILLAR SURFACE PAINT	6.2
2363	L/ROOF RAIL SURFACE PAINT	6.2
1000	DE NIB	15.0*
1000	SCREEN MASK FRT SURFACE PAINT	5.0*
1000	TOUCH UP BOLTS SURFACE PAINT	2.0*
1000	OPEN APPERTURE X1 DETAIL MASK	3.0*
	PREPARATION FOR PRE-PAINTING	34.0
Total Work Units		130.6
Total Paintwork Labour		13.1 HRS. £1,240.70

MATERIAL COST - PAINT

COST

Total Paint Cost	£1,056.95
Sundry Paint Material	£0.00
Pre-Painting Sundry Materials	£247.23
Total Excluding Pearlescent Uplift	£1,304.18
Pearlescent Uplift @ 1.5%	£19.56
Total Paint And Material Cost	£1,323.74

PARTS

Price Valid: 18/05/2026

Guide No.	Description	Part Number	Bet.	Held Date	Price
1781	L/R DOOR		0%		£750.00 *
1921	L/R DOOR SEAL		0%		£60.83 *
2027	L/R DOOR INSULAT	108519600D	0%		£4.96
2029	L/R MOUNTING KIT	USE SINGLE PARTS	0%		£2.50
2033	L/FASTENING CLIP	113514700A	0%		£22.50
2035	L/SCREW	152699899A	0%		£0.76
2037	L/TANK STRAP	111815900D	0%		£1.58
3152	RR SCRIN FRT UP SEAL	111178700A	0%		£50.00
3153	REAR SCREEN LWR SEAL	153323900G	0%		£43.33

TEL: BMC BODYSHOP (HEMEL HEMPSTEAD) LIMITED FAX:
01923 266772 UNIT 3 KENWOOD ESTATE HARTHALL LANE 01923 266682
HEMEL HEMPSTEAD
HERTFORDSHIRE, HP3 8SD

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

3160	REAR SCREEN BOND KIT	104864500A	0%		£5.59
3161	REAR SCREEN PRIMER	105965800A	0%		£3.84
3163	REAR SCREEN HARNESS	110274900B	0%		£18.33
3164	REAR SCREEN HARNESS	110275000C	0%		£17.08
3481	L/R SIDE PANEL CPL		0%		£825.00 *
3491	LH PANEL REPAIR KIT	USE SINGLE PARTS	0%		£0.00
3493	BLIND RIVET	106930800A	0%		£0.36
3495	SHORT RIVET 4.8MM	102693600A	0%		£0.21
3497	BLIND RIVET	106932800A	0%		£0.29
3499	BLIND RIVET	106932900A	0%		£1.46
3501	RIVET SET C 5X7 H4	106933000A	0%		£1.46
3503	STRUCTURE ADHESIVE	110482600A	0%		£123.38
3581	L/R WDW ADHESIVE KIT	104864500A	0%		£5.59
3583	L/R S-WINDOW PRIMER	105965800A	0%		£3.84
9559	L/R WHEEL COVER	104423199B	0%		£21.38
1000	BEAD SEALER	Renew	0%		£20.00 *
1000	SOUND PAD SMALL	Renew	0%		£13.00 *
1000	HEAVY STONE CHIP	Renew	0%		£17.50 *
1000	BORON DRILLS (8MM)	Renew	0%		£72.87 *
1000	WELDING MATERIALS	Renew	0%		£12.49 *

Sub Total		£2,100.13
Deduction from RRP	(0.0 %)	£0.00
Sundry Parts	(2 %)	£41.95
Total Parts		£2,142.08

THIS ASSESSMENT CONTAINS UNPRICED PARTS
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

Extras				
	Description		Betterment	Price
	E.P.A. CHARGE	Specialist	0%	£31.23
	METHODS RESEARCH	Specialist	0%	£45.00
	POST_REP_DIAG_CHEC	Specialist	0%	£83.28
	K			
	PRE_REP_DIAG_CHECK	Specialist	0%	£83.28
	CAR CARE KIT	Specialist	0%	£10.41
	BODY FILLER	Specialist	0%	£8.00
	GLASS LIFTING TAPE	Specialist	0%	£14.00
	WHEEL ALIGNMENT	CHECK	0%	£112.42
	TYRE DISPOSAL	Specialist	0%	£5.00
	TYRE NSR	Specialist	0%	£155.00
	FIRST CALIBRATION	Adas Cal	0%	£312.30
	PAINT CONSUMABLE	Specialist	0%	£30.00
	DELIVERY TO CLIENT	RETURNING VEH	0%	£78.07
	Total Extras			£967.99

Assessment Number: BMC05155
Version: vbr040ch/2

Full Report
Printed: 22/06/2026

Calculation

22/06/2026

Labour			
	Total Panel/Mechanical	£3,364.90	
	Total Paintwork	£1,240.70	
Total Labour			£4,605.60
Total Paint/Material Costs			£1,323.74
Total Parts			£2,142.08
Additional Costs			
	Corrosion Protection Materials External	£22.90	
	Cost of Specialist	£967.99	
Total Additional Costs			£990.89
Grand Total Excl VAT			£9,062.31
	VAT @ 20 %		£1,812.46
Grand Total Incl VAT			£10,874.77
	Excess		TBA

Assessment Notes

No assessment notes entered.