

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026

FAO The Court
C/o QDOS Assistance
3rd Floor, Crown House
Manchester Road
Wilmslow
SK91BH

REPAIRABLE REPORT

Dear Sirs


RE: Road traffic Accident: Mrs Ruby Wiggett: 15/05/2026


In accordance with your instructions received on 18/05/2026 requesting us to provide an independent accident damage report, we assessed the damage on 18/05/2026. Vehicle located at Image Based Assessment. Our findings are as detailed below:

Make	VOLKSWAGEN	Registration	DF72LVV
Model	T-ROC LIFE TSI S-A	Status	Repair
Category		Salvage Value	
Repair Cost	£4,823.87	Legal Status	Roadworthy
Engineer Value	£19,143.00	Impact Magnitude	Moderate



Impact Area

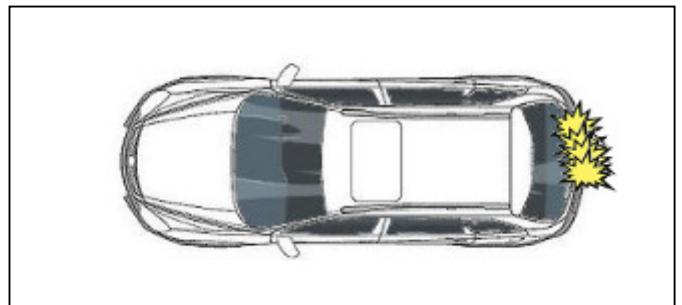

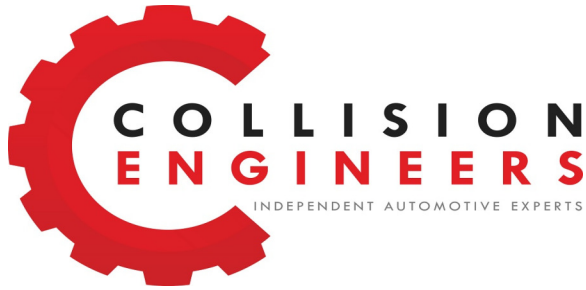

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the rear.

ENGINEER'S COMMENTS

The mileage has been calculated from online MOT data.

VEHICLE HISTORY CHECK

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

RESERVE


We consider that a repair reserve of £4,825.00 would be reasonable on this occasion.

REPAIR DURATION

We consider that this repair will take some 4 to 5 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

Vehicle Data

Retail Value	£19,143.00
Trade Value	£16,463.00
Engineer's Value	£19,143.00
Glass's Code	
VIN	WVGZZZA1ZPV619640
Odometer	30982
Engine	1498
Fuel	Petrol
Extras	
Condition	Good

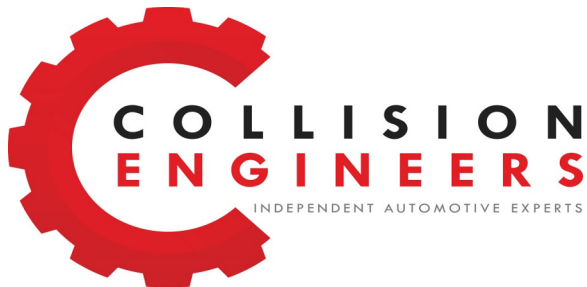

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026

Main new parts required

Rear Cover Bumper
Rear Bumper Support
Rear Number Plate
R/R Inner Sensor
R/R Inn Sensor Brkt
R/F Side Sens Brkt
Applicator
L/In/Rr Park Sens SI
L/Ct/Rr Park Sens SI
L/Ou/Rr Park Sens SI
R/R Reflector
Right Clip Mntg
Right Clip Mntg

Rr Lwr Bumper Cover
Rr Bumper Moulding
R/R Outer Sensor
L/R Inn Sensor Brkt
L/F Side Sens Brkt
Plastic Primer
2-Comp Adhesive Sens
R/In/Rr Park Sens SI
R/Ct/Rr Park Sens SI
R/Ou/Rr Park Sens SI
Left Clip Mntg
Left Clip Mntg
Sundry Parts

Additional operations


Paint Rear Cover Bumper New Part Paint K1r
Paint R/R Inner Sensor New Part Paint K1r
Blend R/Side Panel Surface Paint
Paint Preparation For Pre-Painting
Epa Charge
Paint Consumable

Paint R/R Outer Sensor New Part Paint K1r
Blend L/Side Panel Surface Paint
Paint Denib / Polish Paint
Assessment Fee
Vehicle Care Kit
Collect/Deliver

Repair Cost Calculations

Hours	16.90
Hourly Rate	£95.77
Total Labour	£1,618.51
Parts	£1,345.76
Paint/Materials	£657.02
Specialist/Other	£398.60
Sub total	£4,019.89
Vat	£803.98
Total Estimated Cost	£4,823.87



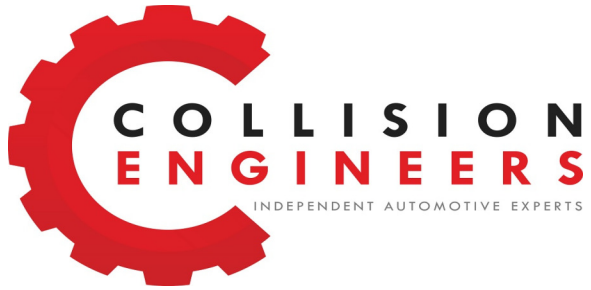

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026





**COLLISION
ENGINEERS**


INDEPENDENT AUTOMOTIVE EXPERTS

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026



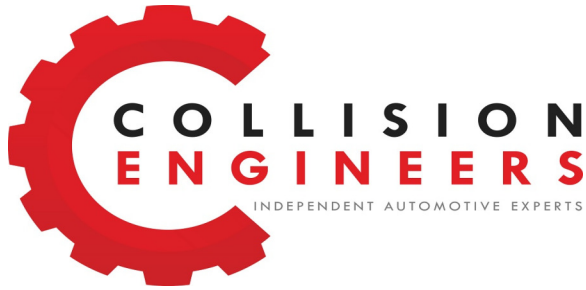

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully

N O'Reilly - ATA VDA

engineers@collisionengineers.co.uk

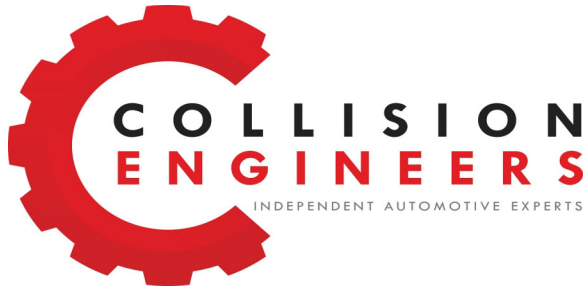

Our Ref: a.qdos261270

Your Ref: JF/45391/1

Date: 19/05/2026

FAO The Court
C/o QDOS Assistance
3rd Floor, Crown House
Manchester Road
Wilmslow
SK91BH

Fee Note

DF72LVV.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference a.qdos261270.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10