

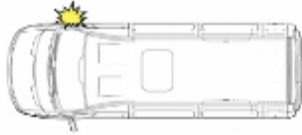
Palm (Yorkshire)
Unit 5 Swinnow Court
Leeds
LS
LS13 4ER

Date: 28/04/2026
Our Ref: 00034949/JEFFP
Your Ref: EHR100470 \ A22625

To the Court REPAIRABLE REPORT

Dear Sirs,
Client: **Palm (Yorkshire)**

We refer to your instructions received on **23 April 2026** and we confirm that we have attended to this matter and we are pleased to report our findings as follows;

Vehicle: VAUXHALL VIVARO 2700 BITURBO CDT		Colour: WHITE	Speedo: 107288 Miles
Reg No: FH66NBB	Registered: Jan 2017	Type: Panel Van	Trans: Manual
Vin No: WOLF7D60XHV609842	MOT Exp: 	R/H/F Tyre 7.3	R/H/R Tyre 7.7
Mods: Not Seen	Cond: Good	R/H/F Belt Not Tested	R/H/R Tyre2
Audio: Not Seen	Manfd: 2017		Spare Tyre Not Know
Brakes: Not Known	Tax Exp: 		Centre Belt Not Tested
Steering: Not Known	Fuel: Diesel		
Extras: Not Seen	C.C.: 1598		
Air Bags Deployed: Not Known	BHP: 125	L/H/F Belt Not Tested	L/H/R Tyre2
Damage: Moderate Collision/Impact RH Front Mirror	Incident: 22/04/2026	L/H/F Tyre 6.9	L/H/R Tyre 6
Vehicle Value: £6,931.00		Repair Cost: £994.06 exc VAT (14.34% of PAV)	Roadworthy: No

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the right hand front mirror.

VEHICLE HISTORY CHECK

28/04/2026 - We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

REPAIR SCHEDULE

New parts required:-R/Door Mirror, R/Door Mirror Cover, R/Door Mirror Glass, Outer Temp Sensor, Car Care Kit, Sundry Parts

Repaint only parts:-Basecoat Clear

Specialist/Sundry charges:-Bsi Compliance, Tech Data +, E.P.A. Charge, Adas Methods

Remove And Refit parts:-Description, Right Mirror, Renew R/Door Mirror (Removed), Outside Temp Gauge, Road Test And Quality Control

Parts to check:-Pre Repair Wash, And Clean Car, Veh Diag Pre, Veh Diag Post, Identify Adas

COST OF REPAIRS

The repairers, Rightways Paint & Body Yorkshire (Tel. 01535 289500), have compiled an estimate in the sum of £449.71 plus parts at manufacturer's list prices plus £149.15 for specialist/sundry charges. Having calculated the

time involved in this repair we consider this to be reasonable. The labour charge is based on 5.4 hours at a rate of £83.28 per hour. The cost of the necessary replacement parts will be approximately £395.20, the specialist/sundry charges will be £149.15, giving a total repair cost of £994.06 plus VAT **subject to any undisclosed damage** and as the owner is eligible to recover the VAT there will be no tax liability for your good selves on this repair.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

PRE-INCIDENT VALUE

According to the information available to us the vehicle was first registered in 31/01/2017. The corresponding Cazana Guide (model code: 87774) adjusted retail value for vehicles of this type and age in the April 2026 guide is £6,931.00 at 107288 Miles, trade value is £5,406.00 and mid value is £6,168.50. We place the pre-accident value of this particular vehicle at £6,931.00 bearing in mind the condition described herein. As this is a commercial vehicle these values are excluding VAT.

OWNER'S CONTRIBUTION

We do not consider that any betterment contribution is required on this occasion.

RESERVE

Although the total cost of this repair will be approximately £994.06 plus VAT we consider that a repair reserve of £1,000.00 would be reasonable on this occasion.

INSTRUCTIONS ISSUED

We are pleased to confirm that we have authorised the repairers to proceed with the work, on the 28th April 2026, on your behalf subject to the owner being responsible for the VAT.

REPAIR DURATION

We consider that this repair will take some 2 to 3 working days to complete. This would be subject to the availability of parts and any other unforeseeable delays.

ROADWORTHY STATE

In our opinion this vehicle was not roadworthy at the time of our inspection as a result of the damage sustained due to Drivers Door Mirror U/S. We understand that the vehicle is not currently being used by the owner.

In preparing this report I confirm that I understand my overriding duty to the court and confirm I have complied with that duty. I confirm that I have made clear which facts and matters referred to in this report are within my own knowledge and which are not. Those that are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinions on the matters to which they refer.

This report relates to damage sustained by the above vehicle in an RTC. Connexus Hire Solutions commissioned this report in writing on behalf of the client.

We hope that the foregoing is of assistance and please do not hesitate to contact us should you require anything further in this matter.

For & on behalf of



Jeff Parr CAE AMIMI
Exclusive Vehicle Assessors