

FAO The Court
C/o Kerr Brown Partnership
50 Wellington Street
Glasgow
G26HJ

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: Mr Steven Millar: 13/06/2025


In accordance with your instructions received on 20/06/2025 requesting us to provide an independent accident damage report, we assessed the damage on 20/06/2025. Vehicle located at Premier 1 Accident Repair Centre, 45 Boundary Road, Heathfield Industrial Estate, Ayr, KA8 9DJ. Our findings are as detailed below.

Make	AUDI	Registration	GX18XEB
Model	S3 TFSI QUATTRO S-A	Status	T/Loss
Category	S	Salvage Value	£1,628.60
Repair Cost	£17,145.97	Legal Status	Unroadworthy
Engineer Value	£16,286.00	Impact Magnitude	Moderate



Impact Area

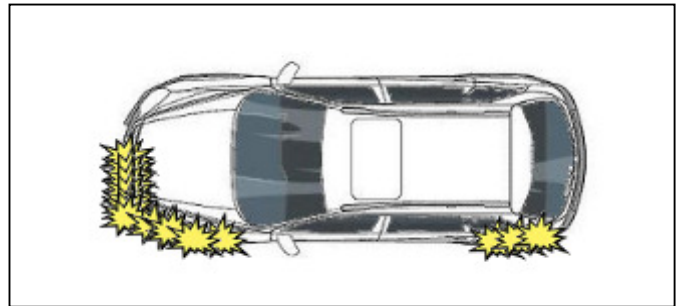

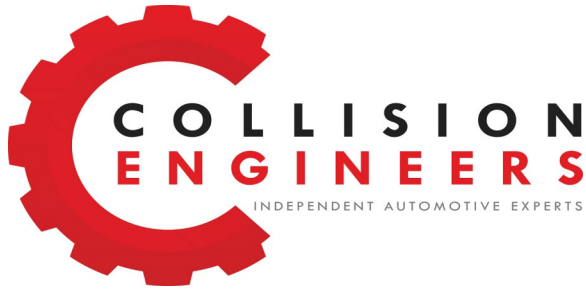

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the front, and moderate to heavy collision/impact to the left hand side.

ENGINEER'S COMMENTS

Valuation based on CAP.

20/06/2025 - Please note the vehicle is unroadworthy due to the extent of panel distortion sustained to the nearside

VEHICLE HISTORY CHECK

According to the Experian database; there is a plate change on record

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT


We consider that an equitable settlement would be £14,657.40 which represents the pre-accident engineer value of the vehicle of £16,286.00 less the value of the salvage of £1,628.60.

SALVAGE

Under the current salvage categorisation matrix, **within the scope of our inspection**, we consider that this is Category S, (Structural damage) and can be sold as repairable salvage. Further information is available www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £1,628.60. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	
Trade Value	
Engineer's Value	£16,286.00
Glass's Code	
VIN	WAUZZZ8V7JA059220
Odometer	61873
Engine	1984
Fuel	Petrol
Extras	
Condition	Good
Unrelated Damage	

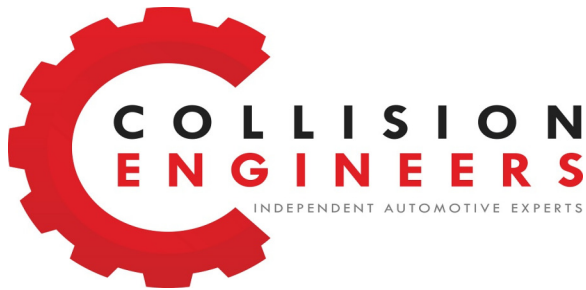

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

Main new parts required

Front Bumper Lining
Front Bumper Reinforcement
Front Bumper Side Rear Bracket (L)
Front Bumper Grille
Xenon Headlamp (with Indicator) (L)
Front Wing (L)
Front Wing Bracket (L)
Front Grille
Front Grille Screw
Front Door Membrane (L)
Rear Lamp LED Outer (L)
Rear Side Panel Bonding Kit (L)
Rear Side Glass Primer (L)
Rear Side Glass Activator (L)
Rear Wheelarch, Outer (R)
Front Suspension Lower Lever Joint (L)
Rear Shock Absorber (L)
Rear Wheel Hub with Bearing (L)
Auxiliary Radiator (L)
Quattro badge

Front Bumper Impact Absorber/Filler
Front Bumper Stoneguard
Front Bumper Auxiliary Lamp Cover (L)
Front Bumper Repair kit
Headlamp Washer Jet (Lifting) (L)
Front Wing Bracket (Front) (L)
Front Wing Repair Kit (L)
Front Grille Repair/Fastening Kit
Front Door Covering Sheet (Skin) (L)
Exterior Mirror Side Repeater Lamp (L)
Rear Side Panel (L)
Side Glass Repair/Bonding Kit (L)
Rear Side Glass Applicator (L)
Side Panel Insulation (L)
Side Panel Liner (L)
Rear Susp Longitudinal Arm with Bearing (L)
Rear Steering Knuckle (L)
Rear Wheel (Aluminium) (L)
Front Auxiliary Radiator Cover (L)

Repairs required

Bonnet
Rear Bumper Lining

Sill Panel Cover (Plastic) (L)

Additional operations

Alloy Wheel Refurbish NSF
Boron Drill
De-nib/ polish Additional work (21.00): ..
Environmental Charge
NSF tyre
Pre repair cleaning charge (including sa
Repair method research charge
Sill dressing (per side) Additional work (7.00): ...
System Diagnostic Check (Post Repair)
Touch up bolts
Wash/Clean
Wheel Alignment (4 wheel)
Paint Front Wing, Complete (L)
Blend A-Post, Upper (L)
Blend Front Door Exterior Mirror Cover (L)
Paint Sill Panel Protective Moulding (L)
Paint Rear Bumper k/e
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)

Assessment Damage Appraisal Charge
Corrosion Protection Additional work (2.00): ...
Energy cost supplement
Jig, clamp and pull
NSR tyre
QC & Road Test
Seam Sealant
Standard shutdown
System Diagnostic Check (Pre Repair)
Vehicle Care Kit
Welded / bonded panel (materials)
Paint Front Bumper k
Paint Bonnet
Paint Front Door, Complete K (L)
Blend Front Door Outer Handle (L)
Paint Rear Side Panel, Complete K (L)
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)


Repair Cost Calculations

Hours	64.62
Hourly Rate	£80.00
Total Labour	£5,169.60
Parts	£6,112.69
Paint/Materials	£1,911.02
Specialist/Other	£1,095.00
Sub total	£14,288.31
Vat	£2,857.66
Total Estimated Cost	£17,145.97







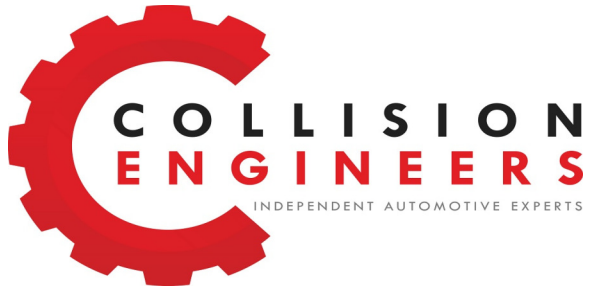

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025



















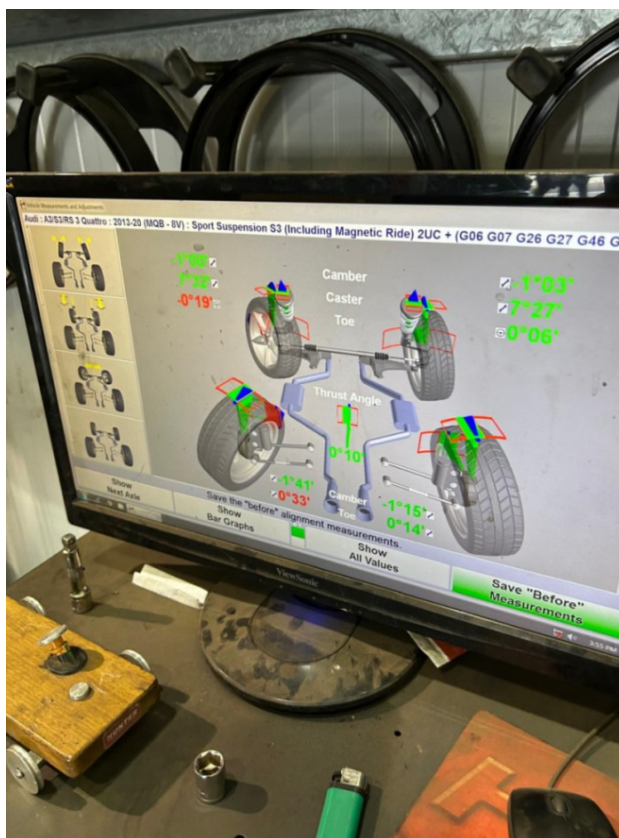



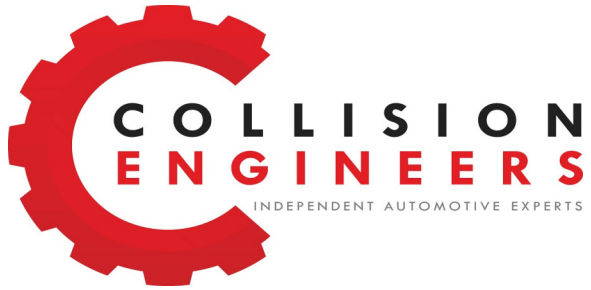

Our Ref: kb25006


Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025







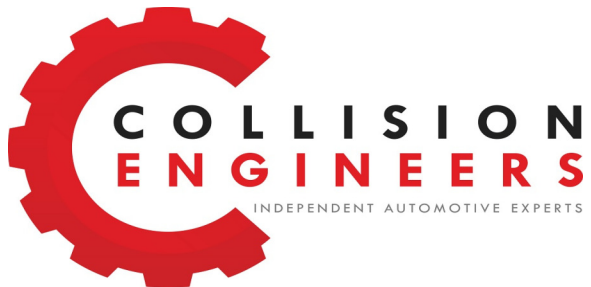


Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025



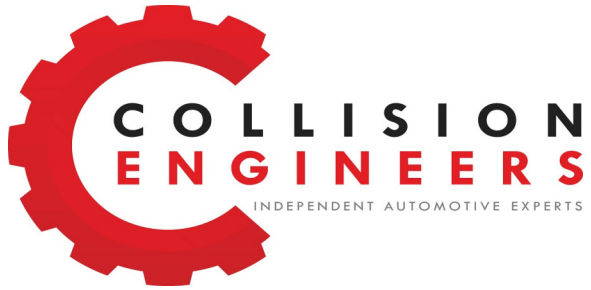


Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025





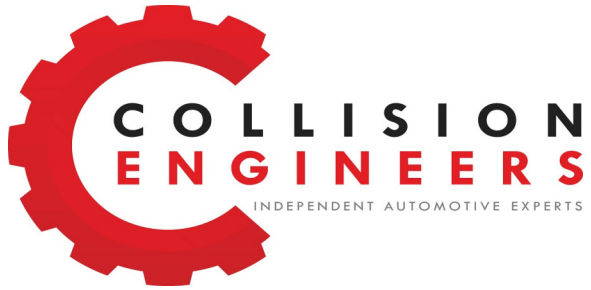


Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025



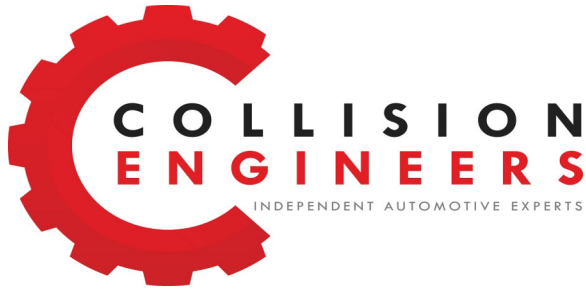

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk

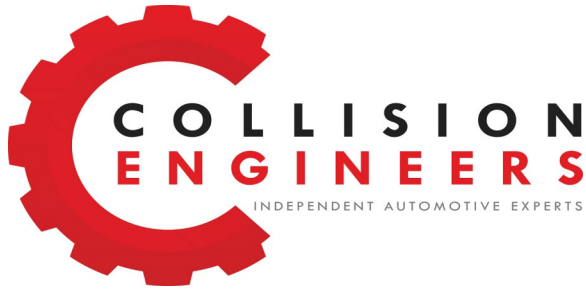

Our Ref: kb25006

Your Ref: AD/SR/VRL/I/494
8

Date: 20/06/2025

FAO The Court
C/o Kerr Brown Partnership
50 Wellington Street
Glasgow
G26HJ

Fee Note

GX18XEB.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference kb25006.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o Kerr Brown Partnership confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10