

Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: Mr Fraser Wallace-Lake: 15/04/2025

In accordance with your instructions received on 16/04/2025 requesting us to provide an independent accident damage report, we assessed the damage on 23/04/2025. Vehicle located at Image Based Assessment. Our findings are as detailed below:


Make	FORD	Registration	MF66EOR
Model	TRANSIT CONNECT 20	Status	T/Loss
Category	N	Salvage Value	£1,729.00
Repair Cost	£10,849.97	Legal Status	Unroadworthy
Engineer Value	£9,100.00	Impact Magnitude	Heavy



Impact Area

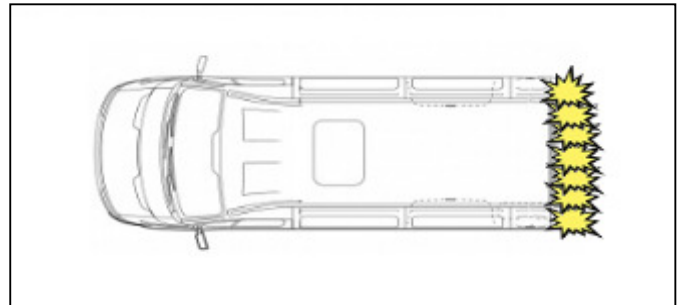

Document produced
using the EVA system

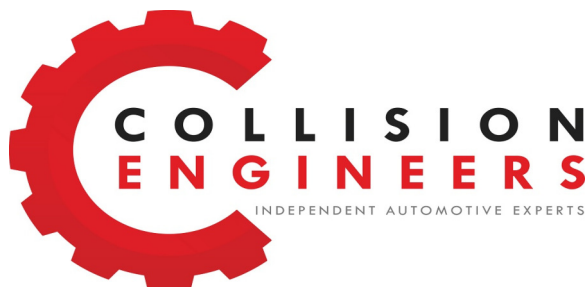

Our Ref: qdos25485

Your Ref: /MR/36390/1

Date: 23/04/2025

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered heavy collision/impact damage to the rear.

ENGINEER'S COMMENTS

23/04/2025 - Please note the vehicle is unroadworthy as the rear body has been compromised.

25/04/2025 - UPDATED REPORT: - The vehicle owner has disputed our valuation and provided some market research as evidence to dispute the same. On review of this and through conducting our own, we feel the value is 9100.

VEHICLE HISTORY CHECK

We confirm having checked this vehicle on the Experian AutoCheck database and there is no record of any adverse history.

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT


We consider that an equitable settlement would be £7,371.00 which represents the pre-accident engineer value of the vehicle of £9,100.00 less the value of the salvage of £1,729.00.

SALVAGE

Under the current salvage categorisation matrix this would be Category 'N' meaning there was no apparent structural damage evident within the scope of our inspection. Further information is available at www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £1,729.00 excluding VAT. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	£5,004.00
Trade Value	£3,853.00
Engineer's Value	£9,100.00
Glass's Code	
VIN	WF0RXXWPGRGK70846
Odometer	122684
Engine	1499
Fuel	Diesel
Extras	
Condition	Good
Unrelated Damage	

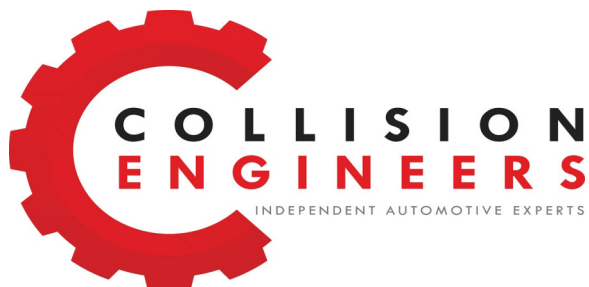

Our Ref: qdos25485

Your Ref: /MR/36390/1

Date: 23/04/2025

Main new parts required

Rear Bumper Lining Lower
Right Rear Bumper Corner
Left Rear Bumper Outer Bracket
Rear Bumper Repair Kit
Rear Bumper Lining Screw
Left Number Plate Lamp
Number Plate Lamp (Both)
Left Back Door
Boot Lid/Tailgate/BDR Lower Weatherstrip
Left B/Lid/Back Door/T/gate Side Lower Latch
Boot Lid/Back Door/Tailgate Striker
Right B/Lid/Back Door/Tailgate Upper Striker
Right Boot Lid/Back Door/Tailgate Side Emblem
Tailgate/Boot Lid Trim Clip
Rear Bumper Diffuser

Left Rear Bumper Corner
Rear Bumper Reinforcement
Right Rear Bumper Outer Bracket
Rear Bumper Lining Clip
Rear bumper lining Nut
Right Number Plate Lamp
Rear Panel
Right Back Door
Latch with Central Locking
Right B/Lid/Back Door/T/gate Side Upper Latch
Left Boot Lid/Back Door/Tailgate Lwr Striker
Left Boot Lid/Back Door/Tailgate Outer Handle
Tailgate/Boot Lid Trim Support Kit
Exhaust Tips


Repairs required

Rear Floor

Additional operations

Door Decals
Boron Drill
Energy cost supplement
Identify the presence of ADAS
Panel Bonding Kit
Repair method research charge
Left Sill dressing (per side)
Standard shutdown
System Diagnostic Check (Post Repair)
Vehicle Care Kit
Paint Left Rear Side Panel, Complete (Glazed)
Paint Left Back Door, Complete (Glazed)
Paint Rear Floor
Paint Rear Bumper, Lower
Paint Right Rear Bumper, Side
Paint Prep. synthetics (combined-operation work)
Paint Sample colour creation (1)

Assessment Damage Appraisal Charge
De-nib/ polish
Environmental Charge
Jig, clamp and pull
QC & Road Test
Seam Sealant
Right Sill dressing (per side)
Sundries
System Diagnostic Check (Pre Repair)
Wash/Clean
Paint Right Rear Side Panel, Complete (Glazed)
Paint Right Back Door, Complete (Glazed)
Paint Rear Panel, Complete
Paint Left Rear Bumper, Side
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)

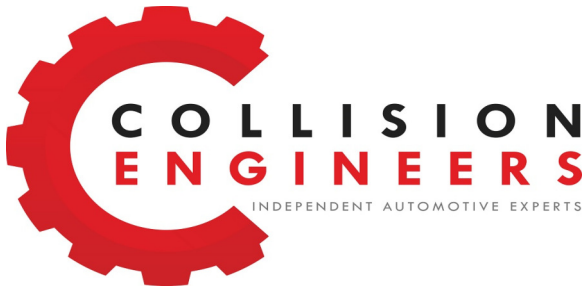


Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025

Repair Cost Calculations

Hours	37.60
Hourly Rate	£80.00
Total Labour	£3,008.00
Parts	£2,926.42
Paint/Materials	£2,332.80
Specialist/Other	£774.42
Sub total	£9,041.64
Vat	£1,808.33
Total Estimated Cost	£10,849.97



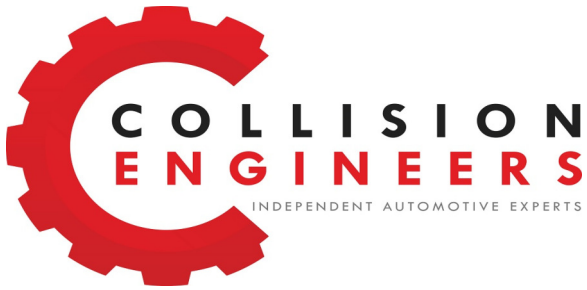


Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025






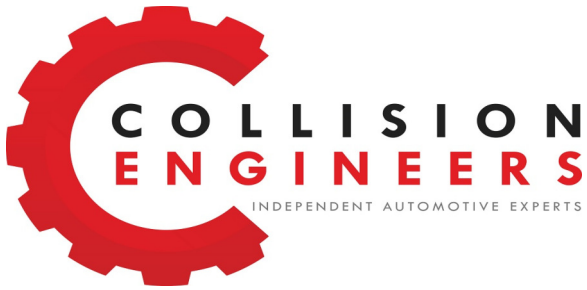

Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025



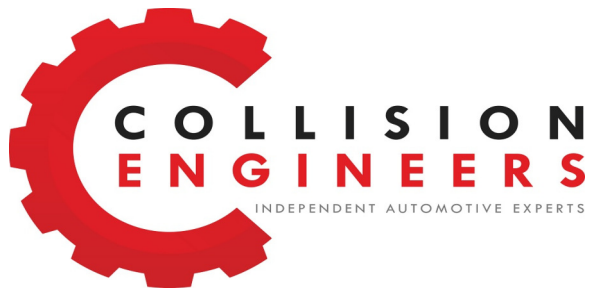

Our Ref: qdos25485


Your Ref: /MR/36390/1

Date: 23/04/2025



Date: 23/04/2025




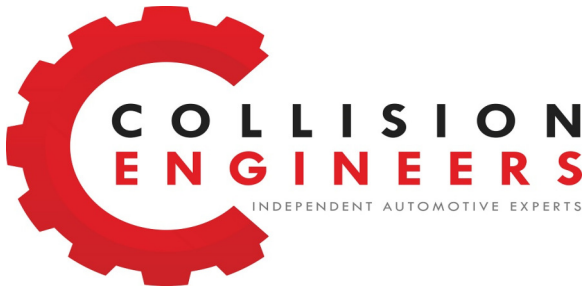

Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025




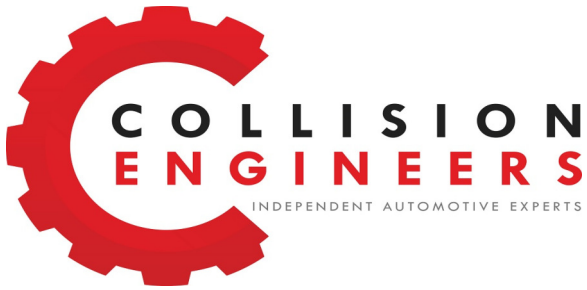

Our Ref: qdos25485
Your Ref: /MR/36390/1

Date: 23/04/2025



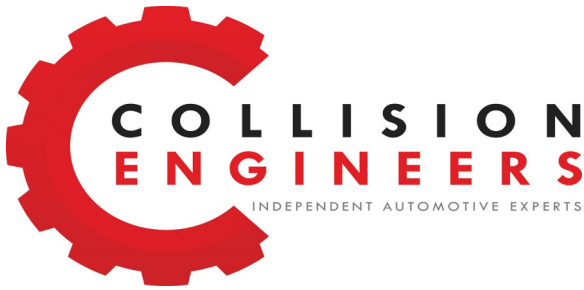

Our Ref: qdos25485

Your Ref: /MR/36390/1

Date: 23/04/2025

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully



A Patterson - A Patterson M.Inst.IAEA
engineers@collisionengineers.co.uk

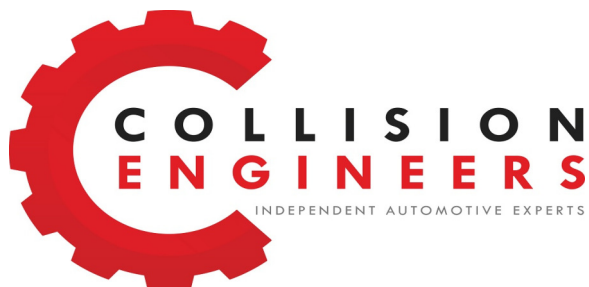

Our Ref: qdos25485

Your Ref: /MR/36390/1

Date: 23/04/2025

FAO The Court
C/o QDOS Assistance
1st Floor, Barfield House
24-28 Alderly Road
SK91PL

Fee Note

MF66EOR.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference qdos25485.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10