

FAO The Court
C/o QDOS Assistance
3rd Floor, Crown House
Manchester Road
Wilmslow
SK91BH

TOTAL LOSS REPORT

Dear Sirs


RE: Road traffic Accident: Mr Matthew Owens: 07/05/2026


In accordance with your instructions received on 29/05/2026 requesting us to provide an independent accident damage report, we assessed the damage on 29/05/2026. Vehicle located at Image Based Assessment. Our findings are as detailed below:

Make	SEAT	Registration	HW60HDX
Model	IBIZA SE TSI	Status	T/Loss
Category	N	Salvage Value	£249.20
Repair Cost	£2,843.04	Legal Status	Roadworthy
Engineer Value	£2,492.00	Impact Magnitude	Moderate



Impact Area

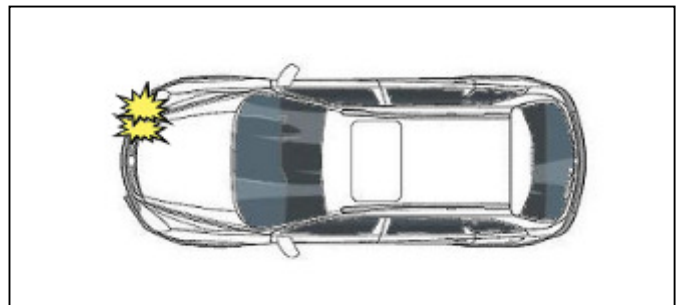

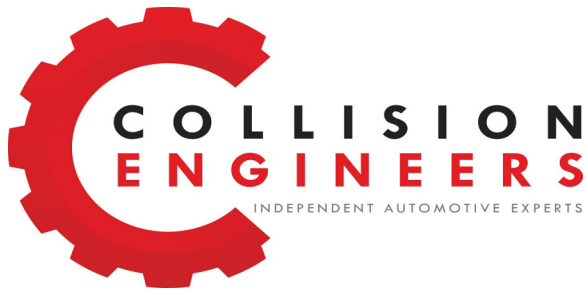

Our Ref: ap.qdos261367

Your Ref: REB/45253/1

Date: 01/06/2026

DESKTOP ASSESSMENT

This report has been compiled from a desktop review of the information available relating to this claim.

NATURE OF INCIDENT

The vehicle has suffered moderate collision/impact damage to the front.

VEHICLE HISTORY CHECK

According to the Experian database; there is a plate change on record

PRE-INCIDENT CONDITION

The vehicle is considered to be in good condition for its age and type.

SETTLEMENT

We consider that an equitable settlement would be £2,242.80 which represents the pre-accident engineer value of the vehicle of £2,492.00 less the value of the salvage of £249.20.

SALVAGE

Under the current salvage categorisation matrix this would be Category 'N' meaning there was no apparent structural damage evident within the scope of our inspection. Further information is available at www.abi.org.uk. We suggest that the sale of the salvage will realise in the order of £249.20. **We have not taken any action towards removal of the salvage at this time.**

Vehicle Data

Retail Value	£2,492.00
Trade Value	£1,570.00
Engineer's Value	£2,492.00
Glass's Code	BNLN
VIN	VSSZZZ6JZBR055912
Odometer	88541
Engine	1197
Fuel	Petrol
Extras	
Condition	Good

Main new parts required

Front Bumper Lining
Front Bumper Lining Screw
Front Grille Repair/Fastening Kit

Front Bumper Repair kit
Front Bumper Lining Nut
Front Grille Clip

Additional operations

.Assessment Damage Appraisal Charge
.Pre repair cleaning charge
.Standard shutdown
.System Diagnostic Check (Post Repair)
.Vehicle Care Kit

De-nib
.Yard Charge
Paint Left Front Wing, Complete
Paint Prep. metal (on vehicle without pre-painting)
Paint Colour mixing (1)

.Environmental Charge

.QC & Road Test

.Sundries

.System Diagnostic Check (Pre Repair)

.Wash/Clean

Older vehicle allowance

Paint Front Bumper k/e

Paint Right Front Wing, Complete


Paint Prep. synthetics (combined-operation work)

Paint Sample colour creation (1)

Repair Cost Calculations

Hours	14.80
Hourly Rate	£83.28
Total Labour	£1,232.54
Parts	£358.34
Paint/Materials	£539.72
Specialist/Other	£238.60
Sub total	£2,369.20
Vat	£473.84
Total Estimated Cost	£2,843.04



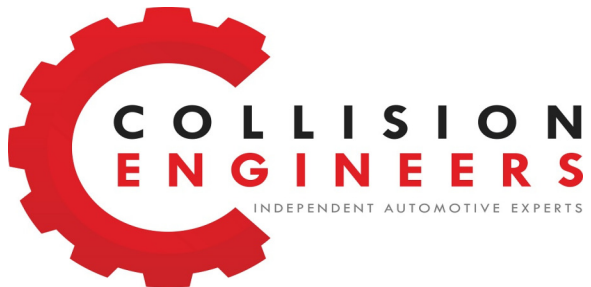


Our Ref: ap.qdos261367

Your Ref: REB/45253/1

Date: 01/06/2026



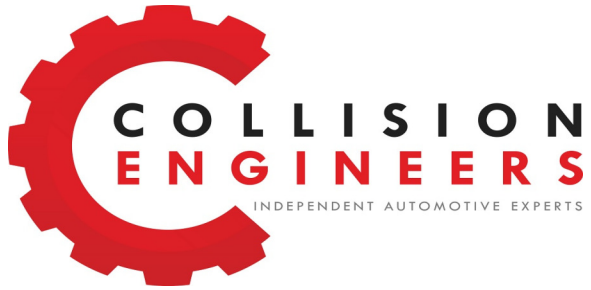


Our Ref: ap.qdos261367

Your Ref: REB/45253/1

Date: 01/06/2026



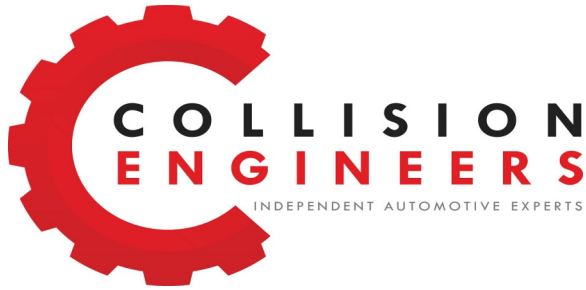

Our Ref: ap.qdos261367

Your Ref: REB/45253/1

Date: 01/06/2026

Statement of Truth

I declare that I understand my duty in providing this report to the court and I confirm that I have complied with that duty. I understand that this duty overrides any other obligation. The report is based upon instructions received.

I confirm that I have made clear facts and matters referred to in this report are within my own knowledge and which are not. Those are within my own knowledge I confirm to be true. The opinions I have expressed represent my true and complete professional opinion on the matters to which they refer.


We have used Glass's Evaluator to assist with the valuation of the vehicle and Thatcham and / or manufactures data to compile the repair specification. Parts prices are subject to fluctuations and further damage may be found upon dismantling the vehicle. Our valuation is based on the mileage information provided and assuming that the vehicle has a valid MOT certificate (where applicable) to support such.

We appreciate your instructions and enclose our fee note for your kind attention, which we confirm remains payable irrespective of the outcome of this case. Please ensure this is passed to your accounts department.

Yours faithfully

A Patterson - M.Inst.IAEA

engineers@collisionengineers.co.uk

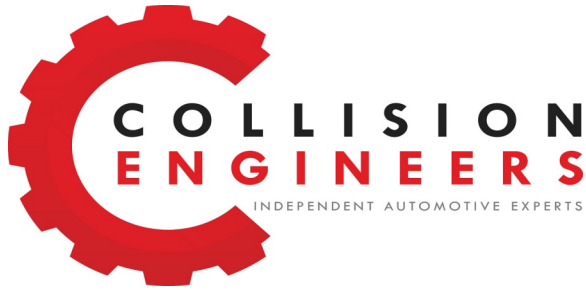

Our Ref: ap.qdos261367

Your Ref: REB/45253/1

Date: 01/06/2026

FAO The Court
C/o QDOS Assistance
3rd Floor, Crown House
Manchester Road
Wilmslow
SK91BH

Fee Note

HW60HDX.

Collate data, compile repair specification, calculate estimate, research valuation.

Produce Vehicle Damage Assessment report.

Storage of all material case files and images.

Agreed Fee: £100.00

Sub Total: £100.00

VAT: £20.00

Total Due: £120.00

Payment

Please make cheques payable to Collision Engineers and quote reference ap.qdos261367.

Collision Engineers, 77-79 Hoylake Road, Moreton, Wirral, CH46 9PY.

This is not a tax invoice – a receipted invoice will follow upon payment. We will not accept any reduction to our fee through the detailed assessment process.

Any requests for addendum reports or letters including those required for clarification, plus Counsel, Court or other meetings will be subject to a further charge & subject to Civil Procedure Rule 35.6.

Terms: As per this agreement, following which we reserve the right to claim statutory interest at 8% above the Bank of England reference rate in force on the date the debt becomes overdue and at any subsequent rate where the reference rate changes and the debt remains unpaid in accordance with the Late Payment of Commercial Debts (Interest) Act 1998 as amended and supplemented by the Late Payment of Commercial Debts Regulations 2002. Payment is due in full within 89 days from the date of this report unless otherwise stated. In addition, for unpaid debts up to £999.99 we are allowed to claim compensation of £40.00.

C/o QDOS Assistance confirm to be liable for the charges of this report and any subsequent addendum reports on acceptance of this report by electronic mail. If you do not so wish to be bound by these terms you must reject the report and confirm so immediately.

Vat number: 262 0937 10