

Assessment Number: A0001302  
Version: vbr000ga/2

Full Report  
Printed: 13/06/2024

## Summary Information

### Claim

|                       |         |                                          |           |
|-----------------------|---------|------------------------------------------|-----------|
| Authorisation Status: | Interim | Date of Incident:                        | Not Known |
| Work Provider:        | OTHER   | Able to Authorise Repairs:               | TBA       |
| Claim Reference:      |         | Repairs Authorised?                      | TBA       |
| Policy Number:        |         | VAT Portion Payable:                     | TBA       |
| Other Reference:      |         | Repairer:                                |           |
|                       |         | Estimated Repair Time<br>(Working Days): | 12.0      |

## Vehicle Details

### Vehicle

|                      |                      |
|----------------------|----------------------|
| Manufacturer:        | BMW                  |
| Model:               | 5-SERIES 530e iPerf  |
| Model Sheet Number:  | 150                  |
| Engine:              | 2.0 LTR 135KW HYBRID |
| Registration Number: | YX68WUW              |
| VIN Number:          | WBAJA92010BN74661    |
| Registration Month:  | September            |
| Registration Year:   | 2018                 |
| Odometer:            | Not Known            |
| Colour:              | Blue                 |
| Paint Code:          | C2Y                  |
| Build Date:          | FROM 07/2018         |
| Selection Type:      | AudaVIN+             |
| Fuel Type:           | Hybrid               |
| Vehicle Imported:    | No                   |

### Model Specs

FROM 07/2018  
SPORT PACKAGE  
AMBIENT LIGHT  
O2 VOLUME  
REFRIGERANT R1234YF  
EMISSION STD RDE  
AIR CON AUTO 2-ZONES  
INTELLIGENT CALL  
REAR SCREEN-SUNBAND  
TELESERVICE  
CD DRIVE  
DAB TUNER  
NAVIG-SYST PROFESS  
ACTIVE GUARD  
LED FOG LAMPS  
PEDESTRIAN PROTECT  
DAKOTA LEATHER TRIM  
HEATED FRONT SEATS  
FRONT COMFORT SEATS  
HEADLINING ANTHRACIT  
ANTI-THEFT ALARM  
FRT/RR PARK DIST CON  
2.0 LTR 135KW HYBRID  
M LEATHER STRG WHEEL  
AUTOMATIC 8-SPEED  
M SPORT BRAKES  
WHEEL BOLT LOCK  
245/40-/275/35 YR 19  
8/9J X 19 ALU  
INSTR PANEL SENSATEC  
HI GLOSS SHADOW LINE  
MULTIFUNCT DISPLAY  
TRIM WALNUT WOOD  
TYRE PRESSURE GAUGE  
AERODYNAMIC PACK  
EU SPECIFIC

Assessment Number: A0001302  
Version: vbr000ga/2

Full Report  
Printed: 13/06/2024

TWO COAT METALLIC  
TYRE W/FLAT RUNNING  
PAINTING OFF VEHICLE  
CLEAR COAT HARD

## Vehicle Condition

### Vehicle Status


Pre-Accident Condition: Excellent  
Steering Rim Ply: Not testable  
Brakes Pedal Travel: Not testable  
Place of Inspection:  
Pre-Accident Damage: No pre acc damage showing

Severity of Impact: Medium  
Vehicle Status on Inspection: Unroadworthy  
Date of Inspection: 06/06/2024


Tyres Condition: Excellent  
Tyres - Tread Depth (MM):

|     |   | Left Tyre | Right Tyre |     |
|-----|---|-----------|------------|-----|
|     |   | Depth     | Depth      |     |
| LHF | 0 | 6.0       | 5.0        | RHF |
| LHR | 1 | 5.0       | 7.0        | RHR |

Damage Areas:

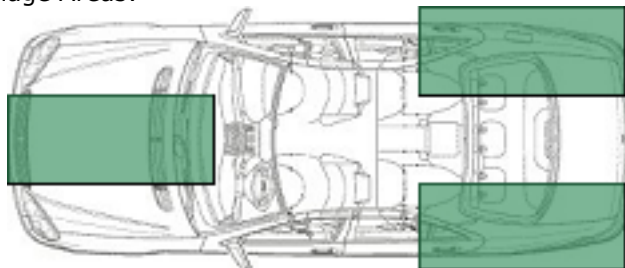

Direction of Impact:

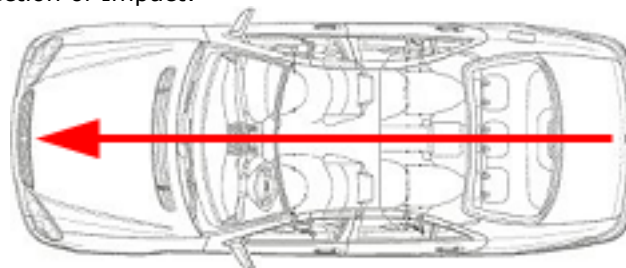

**TEL: ASSURED ACCIDENT REPAIR CENTRE LTD FAX:  
07866 575380 6 LANG HILL DRIVE 01236 729987  
CUMBERNAULD, GLASGOW  
SCOTLAND, G68 9AP**

**Assessment Number: A0001302**  
**Version: vbr000ga/2**

**Full Report**  
**Printed: 13/06/2024**

## Addresses

### Insured

Mr Othman Alothmani

### Repairer

Assured Accident Repair Centre Ltd  
4 Unit 1 Dunns Wood Road  
Cumbernauld  
Glasgow  
G67 3EN  
Mobile Tel : 07866575380

## Cost Summary

|                      |            |
|----------------------|------------|
| Total Labour         | £1,824.67  |
| Total Paint/Material | £2,356.64  |
| Total Parts          | £4,921.98  |
| Additional Costs     | £187.00    |
| Grand Total Exc VAT: | £9,290.29  |
| 20 % VAT:            | £1,858.06  |
| Grand Total Inc VAT: | £11,148.35 |
| Excess:              | TBA        |

## Repair Information

### LABOUR

**Time Basis 12 WU = 1 HR. Price = £68.00/HR**

### Repair / Guide

| Number    | Description                             | Work Units |
|-----------|-----------------------------------------|------------|
| NO NUMBER | ADD/TIME FOR MAIN WORK                  | 2.0        |
| 51 11 656 | R + R FRONT BUMPER COVER                | 10.0       |
| 51 11 592 | RENEW FRONT BUMPER TRIM                 | 11.0       |
|           | (BUMPER TRIM REMOVED)                   |            |
| 66 20 610 | ADD/WORK PARK DISTANCE CONTROL          | 2.0        |
| NO NUMBER | R + R R/AIR GUIDE                       | 1.0        |
| 51 11 658 | R + R NUMBER PLATE BASE                 | 1.0        |
| 51 11 561 | FRT LWR BUMPER CARRIER REMOVE AND REFIT | 6.0        |
|           | (BUMPER TRIM REMOVED)                   |            |
| 51 71 538 | R + R L/F WHEELHOUSE COVER              | 4.0        |
| 51 71 538 | R + R R/F WHEELHOUSE COVER              | 4.0        |
| NO NUMBER | RENEW L/SIDE PANEL BADGE                | 2.0        |
| NO NUMBER | RENEW R/SIDE PANEL BADGE                | 2.0        |
| 41 61 502 | REPLACE BONNET                          | 12.0       |
|           | INCLUDES: REMOVE/REFIT BONNET           |            |
| 41 63 500 | R + R FUEL FLAP                         | 1.0        |
| 63 26 500 | R + R NUMBER PLATE LAMP(S)              | 1.0        |
| 51 14 510 | R + R REAR BMW BADGE                    | 1.0        |
| 51 14 611 | RENEW REAR MODEL BADGE                  | 2.0        |

**TEL: ASSURED ACCIDENT REPAIR CENTRE LTD FAX:**  
**07866 575380 6 LANG HILL DRIVE 01236 729987**  
**CUMBERNAULD, GLASGOW**  
**SCOTLAND, G68 9AP**

**Assessment Number: A0001302**  
**Version: vbr000ga/2**

**Full Report**  
**Printed: 13/06/2024**

|                                        |                                       |                  |
|----------------------------------------|---------------------------------------|------------------|
| 51 99 510                              | R + R REAR NO-PLATE                   | 1.0              |
| NO NUMBER                              | R + R L/R WATER DRIP RAIL COVER       | 1.0              |
| NO NUMBER                              | R + R R/R WATER DRIP RAIL COVER       | 1.0              |
| 51 12 656                              | R + R REAR BUMPER TRIM                | 16.0             |
|                                        | INCLUDES: REAR LAMPS REMOVE AND REFIT |                  |
| 51 12 657                              | RENEW REAR BUMPER TRIM                | 1.0              |
|                                        | (BUMPER TRIM REMOVED)                 |                  |
| 66 20 603                              | ADD/WORK PARK DISTANCE CONTROL        | 1.0              |
| 51 12 815                              | R + R REAR CENTRE DIFFUSER            | 4.0              |
|                                        | SEAM SEALER Renew                     |                  |
| 2931                                   | REPAIR BOOTLID                        | 48.0*            |
| 5311                                   | CHECK BATTERY HOUSING                 | 2.0*             |
| 7761                                   | CHECK RADIATOR                        | *                |
| 1000                                   | CHECK AND QUALITY CONTROL             | 6.0*             |
| 1000                                   | CHECK AND ROAD TEST                   | 4.0*             |
| 1000                                   | CHECK TECHNICAL INFO                  | 6.0*             |
| 1000                                   | Corrosion Prote TO 4 PANELS           | 7.0*             |
| <b>Total Work Units</b>                |                                       | <b>160.0</b>     |
| <b>Total Panel / Mechanical Labour</b> |                                       | <b>13.33 HRS</b> |
|                                        |                                       | <b>£906.67</b>   |

\*NOTE TIME BASIS = 12 WU / HOUR\*

\*OPINION TIMES ENTERED HAVE BEEN CONVERTED TO MATCH MANUFACTURERS TIMES\*

**PAINT WORK**

**Time Basis 10 WU = 1 HR. Price = £68.00/HR**

| Repair /Guide                 | Description                           | Work Units       |
|-------------------------------|---------------------------------------|------------------|
| Number                        |                                       |                  |
| 471                           | BONNET NEW PART PAINTING              | 32.0             |
| 283                           | FRONT BUMPER NEW PART PAINT K1R       | 12.0             |
| 2583                          | REAR BUMPER COVER NEW PART PAINT K1R  | 12.0             |
| 2603                          | REAR BUMPER COVER NEW PART PAINT K1R  | 6.0              |
| 2931                          | BOOTLID REPAIR PAINTING <50%          | 20.0             |
| 741                           | L/F WING SURFACE PAINT                | 6.0              |
| 742                           | R/F WING SURFACE PAINT                | 6.0              |
| 3481                          | L/R SIDE PANEL SURFACE PAINT          | 7.0              |
| 3482                          | R/R SIDE PANEL SURFACE PAINT          | 7.0              |
| 4080                          | FUEL FILLER FLAP SURFACE PAINT PLAST. | 3.0              |
| 1000                          | DE NIB                                | 6.0*             |
|                               | PREPARATION FOR PRE-PAINTING          | 18.0             |
| <b>Total Work Units</b>       |                                       | <b>135.0</b>     |
| <b>Total Paintwork Labour</b> |                                       | <b>13.5 HRS.</b> |
|                               |                                       | <b>£918.00</b>   |

**TEL: ASSURED ACCIDENT REPAIR CENTRE LTD FAX:  
07866 575380 6 LANG HILL DRIVE 01236 729987  
CUMBERNAULD, GLASGOW  
SCOTLAND, G68 9AP**

**Assessment Number: A0001302**  
**Version: vbr000ga/2**

**Full Report**  
**Printed: 13/06/2024**

**MATERIAL COST - PAINT**

**COST**

|                                           |                  |
|-------------------------------------------|------------------|
| <b>Total Paint Cost</b>                   | <b>£2,328.58</b> |
| <b>Sundry Paint Material</b>              | <b>£109.44</b>   |
| <b>Pre-Painting Sundry Materials</b>      | <b>£42.65</b>    |
| <b>Total Excluding Pearlescent Uplift</b> | <b>£2,356.64</b> |
| <b>Pearlescent Uplift @ 0.0%</b>          | <b>£0.00</b>     |
| <b>Discounted by 5%</b>                   | <b>-£124.03</b>  |
| <b>Total Paint And Material Cost</b>      | <b>£2,356.64</b> |

**PARTS**

Price Valid: 09/06/2024

| Guide No. | Description          | Part Number     | Bet. | Held Date | Price           |
|-----------|----------------------|-----------------|------|-----------|-----------------|
| 257       | FRONT NUMBER PLATE   |                 | 0%   |           | <b>£20.00 *</b> |
| 258       | FRT NO PLATE REINF   | KNPLO           | 0%   |           | <b>£0.00</b>    |
| 260       | FRT NO PLATE BRKT    | 51 13 8 070 399 | 0%   |           | <b>£44.08</b>   |
| 283       | FRONT BUMPER         | 51 11 8 069 072 | 0%   |           | <b>£797.97</b>  |
| 301       | FRONT SENSOR PLATE   | 51 75 8 071 012 | 0%   |           | <b>£25.34</b>   |
| 303       | FRT BUMPER AIR GRILL | 51 11 8 064 930 | 0%   |           | <b>£49.71</b>   |
| 315       | L/F WING MOUNT       | 51 11 7 385 349 | 0%   |           | <b>£6.95</b>    |
| 316       | R/F WING MOUNT       | 51 11 7 385 350 | 0%   |           | <b>£6.95</b>    |
| 326       | R/ADD RAD FT AIRDUCT | 51 74 8 059 680 | 0%   |           | <b>£28.01</b>   |
| 327       | L/F LWR DAMPER       | 51 11 7 397 396 | 0%   |           | <b>£2.68</b>    |
| 328       | R/F LWR DAMPER       | 51 11 7 397 396 | 0%   |           | <b>£2.68</b>    |
| 329       | L/LWR RADIATOR BRKT  | 51 64 7 357 221 | 0%   |           | <b>£28.96</b>   |
| 330       | R/LWR RADIATOR BRKT  | 51 64 7 357 222 | 0%   |           | <b>£28.96</b>   |
| 347       | L/OUT U-SONIC SENDER | 66 20 6 819 066 | 0%   |           | <b>£167.57</b>  |
| 348       | R/OUT U-SONIC SENDER | 66 20 6 819 066 | 0%   |           | <b>£167.57</b>  |
| 349       | L/INN U-SONIC SENDER | 66 20 6 819 066 | 0%   |           | <b>£167.57</b>  |
| 350       | R/INN U-SONIC SENDER | 66 20 6 819 066 | 0%   |           | <b>£167.57</b>  |
| 354       | MOUNTING CLAMP       | 51 47 1 911 992 | 0%   |           | <b>£2.82</b>    |
| 371       | FRT UPPER AIR GUIDE  | 51 74 7 383 845 | 0%   |           | <b>£33.61</b>   |
| 387       | L/F SENSOR BRACKET   | 66 20 9 283 203 | 0%   |           | <b>£2.33</b>    |
| 388       | R/F SENSOR BRACKET   | 66 20 9 283 203 | 0%   |           | <b>£2.33</b>    |
| 389       | L/F OUT SENS INN BRK | 66 20 9 283 203 | 0%   |           | <b>£2.33</b>    |
| 390       | R/F OUT SENS INN BRK | 66 20 9 283 203 | 0%   |           | <b>£2.33</b>    |
| 413       | FRT TRIM GRILLE CVR  | 51 13 7 349 586 | 0%   |           | <b>£27.32</b>   |
| 415       | L/F GRILLE           | 51 13 7 390 863 | 0%   |           | <b>£77.67</b>   |
| 416       | R/F GRILLE           | 51 13 7 390 864 | 0%   |           | <b>£77.67</b>   |
| 431       | GRILLE BADGE         | 51 14 7 463 684 | 0%   |           | <b>£39.21</b>   |
| 471       | BONNET               | 41 00 7 440 427 | 0%   |           | <b>£840.16</b>  |
| 815       | L/BADGE              | 51 14 7 491 145 | 0%   |           | <b>£25.49</b>   |

**TEL: ASSURED ACCIDENT REPAIR CENTRE LTD FAX:  
07866 575380 6 LANG HILL DRIVE 01236 729987  
CUMBERNAULD, GLASGOW  
SCOTLAND, G68 9AP**

**Assessment Number: A0001302**  
**Version: vbr000ga/2**

**Full Report**  
**Printed: 13/06/2024**

|      |                      |                 |    |  |                 |
|------|----------------------|-----------------|----|--|-----------------|
| 816  | R/BADGE              | 51 14 7 491 146 | 0% |  | <b>£25.49</b>   |
| 1014 | FRONT UPP AIR FLAPS  | 51 13 7 497 280 | 0% |  | <b>£152.50</b>  |
| 1016 | FRONT LWR AIR FLAPS  | 51 13 7 497 285 | 0% |  | <b>£145.00</b>  |
| 2583 | REAR BUMPER COVER    | 51 12 8 073 725 | 0% |  | <b>£587.36</b>  |
| 2603 | REAR BUMPER COVER    | 51 12 8 064 718 | 0% |  | <b>£162.87</b>  |
| 2611 | L/R REFLECTOR        | 63 14 7 851 577 | 0% |  | <b>£19.75</b>   |
| 2612 | R/R REFLECTOR        | 63 14 7 851 578 | 0% |  | <b>£19.75</b>   |
| 2625 | RR BUMPER ADAPTER    | 51 12 8 064 714 | 0% |  | <b>£54.59</b>   |
| 2626 | REAR UNDERBODY TRIM  | 51 75 7 399 329 | 0% |  | <b>£23.98</b>   |
| 2629 | MOUNTING CLAMP       | 51 47 1 911 992 | 0% |  | <b>£1.88</b>    |
| 2655 | L/R INN SENSOR BRKT  | 66 20 9 283 203 | 0% |  | <b>£2.33</b>    |
| 2656 | R/R INN SENSOR BRKT  | 66 20 9 283 203 | 0% |  | <b>£2.33</b>    |
| 2657 | L/R OUT SENSOR BRKT  | 66 20 9 283 203 | 0% |  | <b>£2.33</b>    |
| 2658 | R/R OUT SENSOR BRKT  | 66 20 9 283 203 | 0% |  | <b>£2.33</b>    |
| 2671 | L/OUT U-SONIC SENDER | 66 20 6 819 066 | 0% |  | <b>£167.57</b>  |
| 2672 | R/OUT U-SONIC SENDER | 66 20 6 819 066 | 0% |  | <b>£167.57</b>  |
| 2673 | L/INN U-SONIC SENDER | 66 20 6 819 066 | 0% |  | <b>£167.57</b>  |
| 2674 | R/INN U-SONIC SENDER | 66 20 6 819 066 | 0% |  | <b>£167.57</b>  |
| 2702 | REAR NUMBER PLATE    |                 | 0% |  | <b>£20.00 *</b> |
| 3011 | REAR BADGE           | 51 14 7 463 715 | 0% |  | <b>£39.21</b>   |
| 3020 | REAR BADGE           | 51 14 7 418 524 | 0% |  | <b>£35.30</b>   |
| 1000 | SEAM SEALER          | Renew           | 0% |  | <b>£12.35 *</b> |

|                           |                |                  |
|---------------------------|----------------|------------------|
| <b>Sub Total</b>          |                | <b>£4,825.47</b> |
| <b>Deduction from RRP</b> | <b>(0.0 %)</b> | <b>£0.00</b>     |
| <b>Sundry Parts</b>       | <b>(2 %)</b>   | <b>£96.51</b>    |
| <b>Total Parts</b>        |                | <b>£4,921.98</b> |

THIS ASSESSMENT CONTAINS UNPRICED PARTS  
NB - COLOUR CODED ITEMS/TRIM - PART NUMBERS MAY DIFFER

| <b>Extras</b>       |            |                   |                |
|---------------------|------------|-------------------|----------------|
| <b>Description</b>  |            | <b>Betterment</b> | <b>Price</b>   |
| CAR CARE KIT        | Specialist | 0%                | £10.00         |
| ESTIMATE FEE        | Specialist | 0%                | £22.00         |
| ENERGY PAYMENT      | Specialist | 0%                | £55.00         |
| RECOVERY            | Specialist | 0%                | £0.00          |
| SYSTEM RESET        | Specialist | 0%                | £85.00         |
| <b>Total Extras</b> |            |                   | <b>£172.00</b> |

**Calculation** **13/06/2024**

**Labour**

Total Panel/Mechanical **£906.67**

TEL: ASSURED ACCIDENT REPAIR CENTRE LTD FAX:  
07866 575380 6 LANG HILL DRIVE 01236 729987  
CUMBERNAULD, GLASGOW  
SCOTLAND, G68 9AP

Assessment Number: A0001302  
Version: vbr000ga/2

Full Report  
Printed: 13/06/2024

|                            |                                         |         |            |
|----------------------------|-----------------------------------------|---------|------------|
|                            | Total Paintwork                         | £918.00 |            |
| Total Labour               |                                         |         | £1,824.67  |
| Total Paint/Material Costs |                                         |         | £2,356.64  |
| Total Parts                |                                         |         | £4,921.98  |
| Additional Costs           |                                         |         |            |
|                            | Corrosion Protection Materials External | £15.00  |            |
|                            | Cost of Specialist                      | £172.00 |            |
| Total Additional Costs     |                                         |         | £187.00    |
| Grand Total Excl VAT       |                                         |         | £9,290.29  |
|                            | VAT @ 20 %                              |         | £1,858.06  |
| Grand Total Incl VAT       |                                         |         | £11,148.35 |
|                            | Excess                                  |         | TBA        |

### Assessment Notes

No assessment notes entered.