


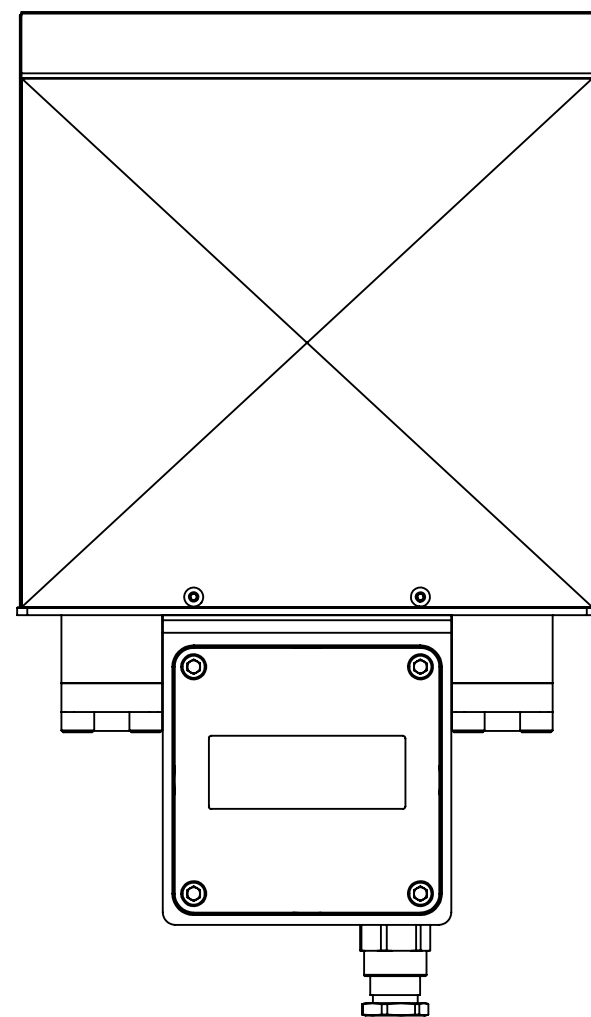


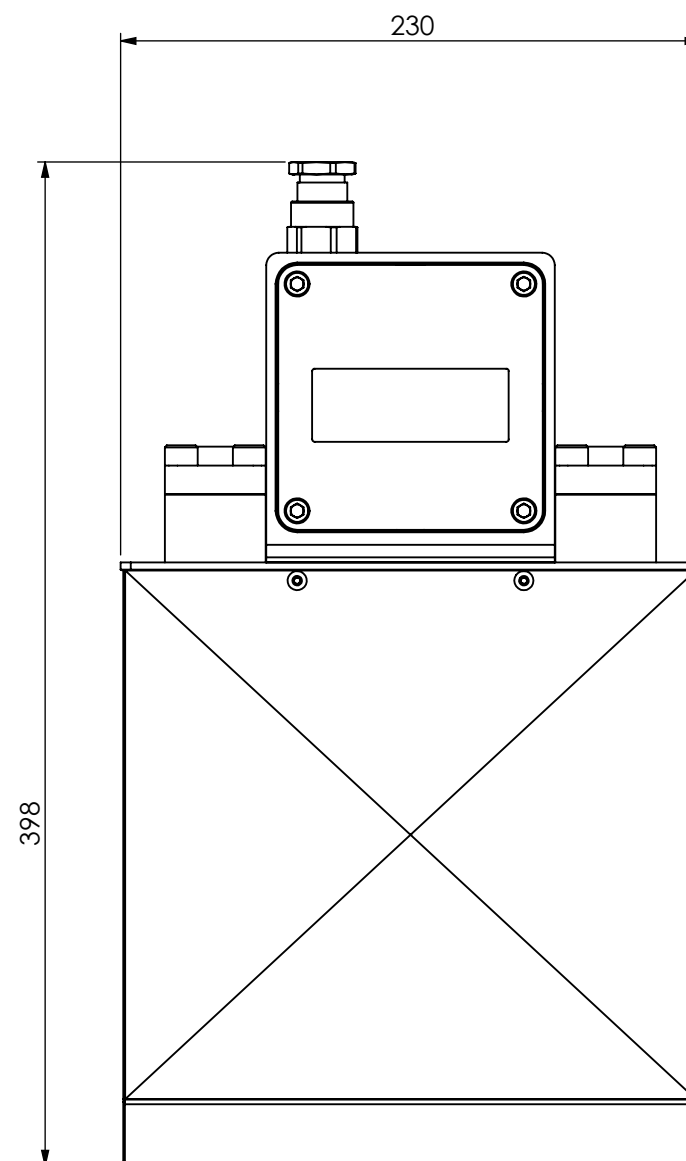

Default display orientation.

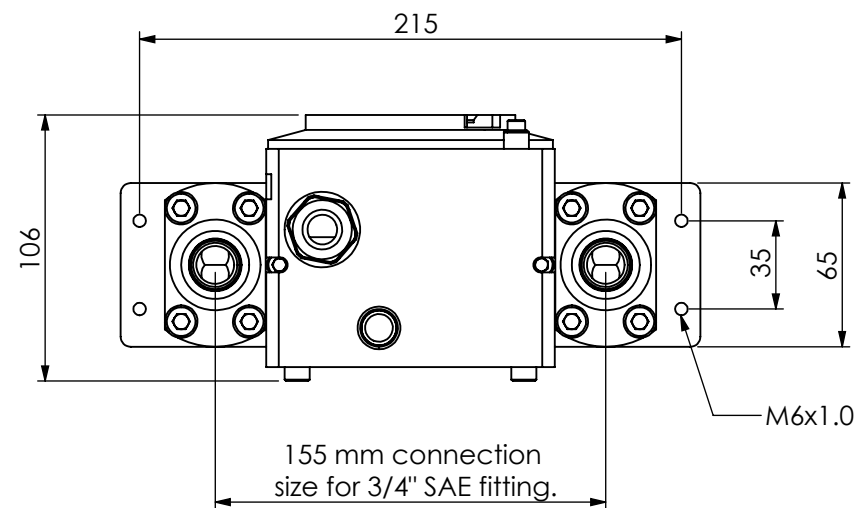

The display can be pulled out and oriented if needed.

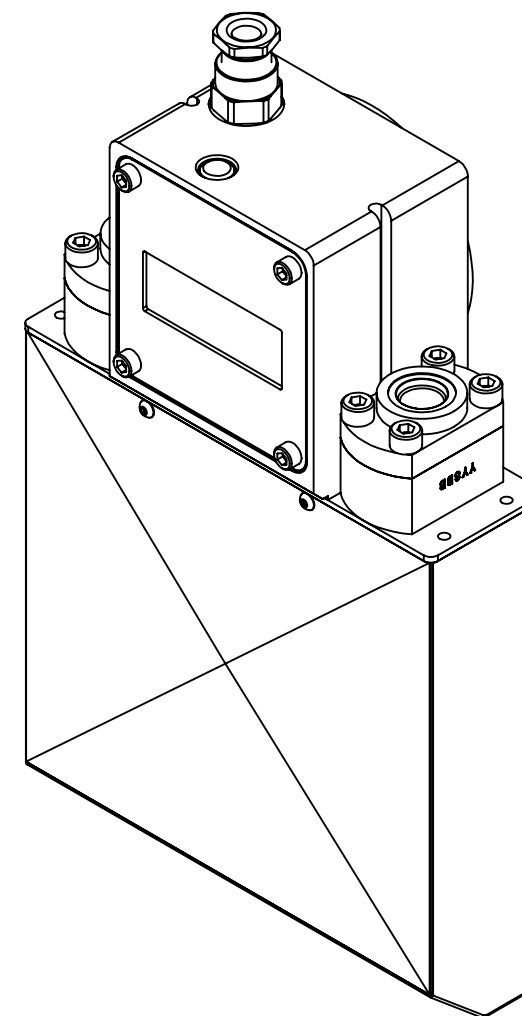

Date: 16/04/2026

Revision Description: update notes on sheet2



© Copyright
Compac Industries Ltd
PO Box 12-417
52 Walls Road
Penrose, Auckland, NZ
Ph 649 5792094
Fax 649 5790635

General Tolerances
All dimensions millimetres

Remove all burrs
and sharp edges.
Original Size A3.
Do not scale
from drawing.




KG100 KG100 Standalone meter assembly

Drawing
MAD0116PRO

Sheet
1/2

Part Revision
A

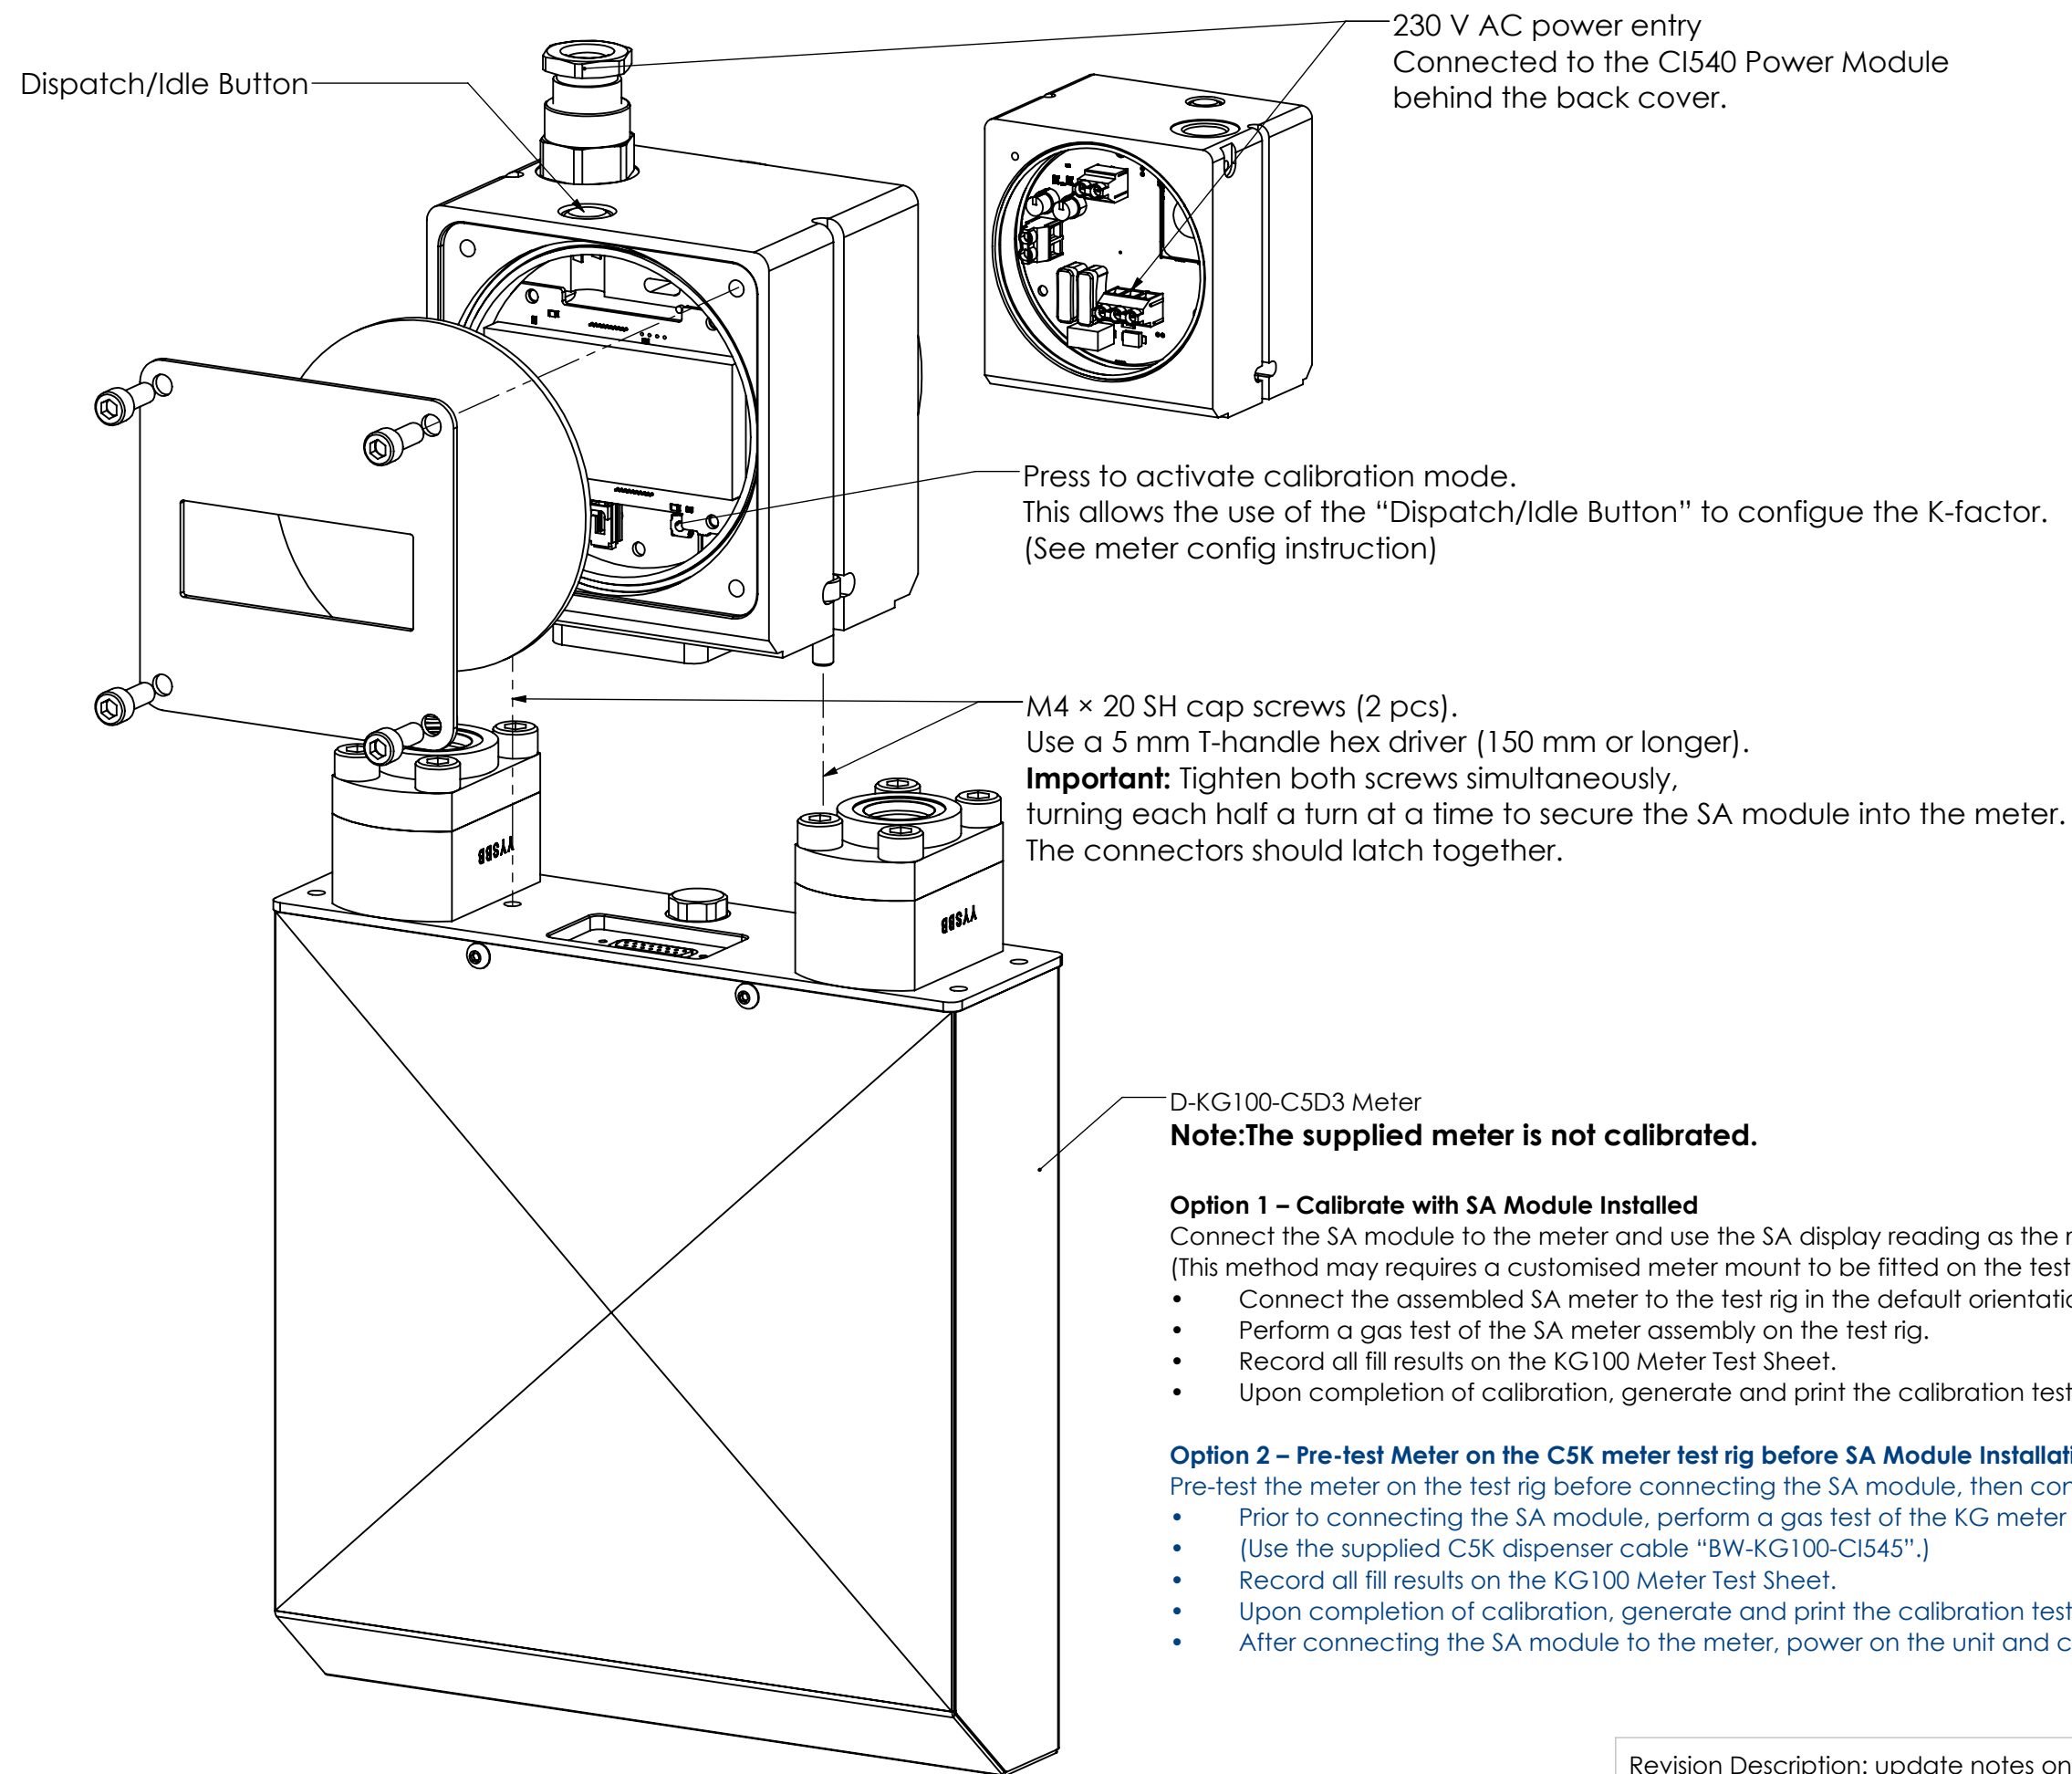

D-KG100-C5D3 Meter

Note: The supplied meter is not calibrated.

Option 1 – Calibrate with SA Module Installed

Connect the SA module to the meter and use the SA display reading as the register value for calibration. (This method may require a customised meter mount to be fitted on the test rig.)

- Connect the assembled SA meter to the test rig in the default orientation.
- Perform a gas test of the SA meter assembly on the test rig.
- Record all fill results on the KG100 Meter Test Sheet.
- Upon completion of calibration, generate and print the calibration test certificate.

Option 2 – Pre-test Meter on the C5K meter test rig before SA Module Installation

Pre-test the meter on the test rig before connecting the SA module, then configure the K-factor.

- Prior to connecting the SA module, perform a gas test of the KG meter on the test rig.
- (Use the supplied C5K dispenser cable "BW-KG100-CI545".)
- Record all fill results on the KG100 Meter Test Sheet.
- Upon completion of calibration, generate and print the calibration test certificate.
- After connecting the SA module to the meter, power on the unit and configure the K-factor.

Date: 16/04/2026

Revision Description: update notes on sheet2



© Copyright
Compac Industries Ltd
PO Box 12-417
52 Walls Road
Penrose, Auckland, NZ
Ph 649 5792094
Fax 649 5790635

General Tolerances
All dimensions millimetres

Remove all burrs
and sharp edges.
Original Size A3.
Do not scale
from drawing.



KG100
KG100 Standalone meter assembly

Drawing
MAD0116PRO

Sheet
2/2

Part Revision
A