


Appendix I: Power Supply test points

Plug AC line and turn ON the main switch from back of the unit and ensure **that you hear the clicking sound of relay within 2 second**. Verify supply voltage on mother board R6703R04 at test point TP1502 =+12Vdc, TP202=+5Vdc, TP204=+3.3Vdc, positive side of capacitor C1546=+12Vdc, negative side of capacitor C1545=-12Vdc, TP1505=+5Vdc and TP301=+3.3Vdc with respect to analog ground TP1513.

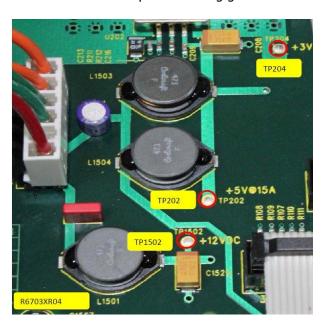

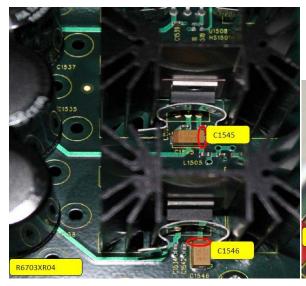

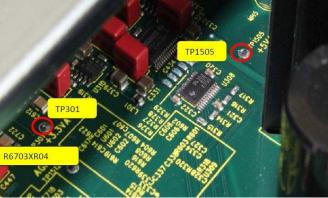

Appendix J: Quick spare parts list