Troubleshooting

If the yellow and green LEDs flash simultaneously, there is an error. Typical problems include:

- Input voltage is too low (<10V).
- Input voltage is too high (>16V).
- Poor input voltage quality.
- Bad connections.

If you encounter an error:

- 1. Check the power supply.
- Check connections.
- 3. Cycle power.
- 4. Try charging again.

If errors continue, contact FMA Customer Service,

Tip: The charger stores error information. If you return the charger for service, FMA can diagnose the problem.

Specifications	
For battery type	FMA BalancePro 2s Lithium Polymer packs only
Input voltage	11 to 15VDC
Nominal output voltage	8.4volts
Output current	Up to 10A

FMA limited warranty

FMA. Inc. warrants this product to be free of manufacturing defects for the term of 90 days from the date of purchase. Should any defects covered by this warranty occur, the product shall be repaired or replaced with a unit of equal performance by FMA or an authorized FMA service station.

Limits and exclusions

This warranty may be enforced only by the original purchaser, who uses this product in its original condition as purchased, in strict accordance with the product's instructions. Units returned for warranty service to an FMA service center will be accepted for service when shipped postpaid, with a copy of the original sales receipt or warranty registration form, to the service station designated by FMA.

This warranty does not apply to:

- Consequential or incidental losses resulting from the use of this product.
- Damage resulting from accident, misuse, abuse, neglect, electrical surges, reversed polarity on connectors, lightning or other acts of God.
- Damage from failure to follow instructions supplied with the product.
- Damage occurring during shipment of the product either to the customer or from the customer for service (claims must be presented to the carrier).
- Damage resulting from repair, adjustment, or any alteration of the product by anyone other than an authorized
- Installation or removal charges, or damage caused by improper installation or removal.

Call (301) 668-7614 for more information about service and warranty repairs.



BalancePro 2s Charger Model LIPOCH2S10-BP charge balancing charger

for FMA BalancePro Lithium Polymer battery packs:

BPKOK1250-15C-1P2S, 18.75A continuous output BPKOK2000-15C-1P2S, 30A continuous output BPKOK3200-20C-1P2S, 60A continuous output BPKOK3200-20C-2P2S, 60A continuous output

Features

- Operates from any 11 to 15VDC power source, such as a power supply or 12V lead acid batterv.
- Charge balancing design assures optimum charging for each cell in pack.
- Charger and pack system maximizes pack operation.
- Data output port for displaying charge curves on your PC.

Precautions

- Follow all instructions in this manual to assure safe operation.
- Never charge the pack through the Run (discharge) connector.
- Always disconnect the Run (discharge) connector before charging.
- Always charge through the Safe Charge (3-pin) connector.
- Always watch LiPo packs while they are charging. Never leave LiPo packs unsupervised during charging.
- Allow packs to cool down before charging them.
- Wiring on the BPKOK3200-20C-1P2S and BPKOK3200-20C-2P2S packs limits continuous output to 60 Amps, even though the cell configurations are rated higher.
- See additional warning sheets provided with this charger and Kokam/FMA LiPo packs.
- Follow all guidelines for charging, discharging, handling and storing LiPo cells.* *For details, see the Kokam/FMA Direct Lithium Polymer Cell application manual, AN000001, available in the Support section of the Web site.

WARNING! The FMA Direct BalancePro 2s Charger is designed to charge only FMA Direct BalancePro lithium polymer battery packs. Using this charger to charge any other manufacturer's battery may result in fire, property damage or bodily injury.


FMA, Inc. • 5716A Industry Lane • Frederick, MD 21704

Sales: (800) 343-2934 • Technical: (301) 668-7614 • www.fmadirect.com



Connecting the pack

Connect your BalancePro Pack's Safe Charge Connector to the Charger's output connector.

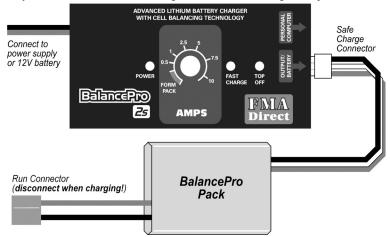

Optional: forming the pack

Laboratory testing indicates that forming a LiPo pack may improve pack capacity by 1% to 2%. The BalancePro 2s Charger includes forming capability, which charges the pack at 500ma, discharges the pack and repeats for a total of 5 cycles. Forming is time consuming and is not required for normal operation.

Note: Forming will not have any effect on pack performance and life after multiple fast charges.

Note: Depending on pack capacity, forming may take as long as several days. Forming is a relatively low current operation, and the BalancePro 2s Charger limits both maximum and minimum voltages during the process. For these reasons, you may choose to form a pack without watching it until forming is complete. However, you must follow all other LiPo safety precautions, including forming the pack in a fireproof container.

- 1. Turn the charger's current control fully counterclockwise to the Form Pack setting.
- 2. Connect the charger to a 11 to 15VDC power source, such as a power supply or 12V lead acid or gel cell battery. The red Power LED will turn on.
- 3. Monitor forming with the LEDs. The yellow and green LEDs will alternately flash:

Charge condition	Fast Charge LED (yellow)	Top Off LED (green)
During forming	Flash on	Flash off
	Flash off	Flash on
Forming complete	Off	On

Note: If you stop forming before it completes, the five-cycle sequence starts over the next time you initiate forming.

- 4. When forming is complete:
 - Disconnect the charger from the power source and
 - Disconnect the pack from the charger (in any order).

Charging the pack

CAUTION: Follow all LiPo charging precautions, including charging packs in a fireproof container and monitoring the entire charging operation.

- 1. Disconnect the Run connector from the ESC!
- 2. Set the Charger's current control:
 - Fast charging (up to 3C) will charge the packs to 90% capacity in as little as 20 minutes. (Charging to 100% capacity requires an additional 1 to 3 hours, depending on battery capacity; this is a characteristic of Lithium Polymer chemistry.)

CAUTION: *NEVER* exceed 3C charge rate for a connected pack. Serious damage to the battery pack may occur including venting with flames in some instances!

BalancePro Pack Part No.	Maximum fast charge current (3C)
BPKOK1250-15C-1P2S	3.75A
BPKOK2000-15C-1P2S	6.0A
BPKOK3200-20C-1P2S	9.6A
BPKOK3200-20C-2P2S	10A (charger maximum)

■ When possible, charge at 1C, which will charge packs to 90% capacity in about 1 hour. (Charging to 100% capacity requires an additional 1 to 3 hours, depending on battery capacity; this is a characteristic of Lithium Polymer chemistry.)

BalancePro Pack Part No.	1C charge current
BPKOK1250-15C-1P2S	1.25A
BPKOK2000-15C-1P2S	2.0A
BPKOK3200-20C-1P2S	3.2A
BPKOK3200-20C-2P2S	6.4A

- 3. Connect the charger to a 11 to 15VDC power source, such as a power supply or 12V lead acid or gel cell battery. The red Power LED will turn on.
- 4. Monitor charging with the LEDs:

Charge step	Fast Charge LED (yellow)	Top Off LED (green)
Fast charge	On	Off
Balancing (80%)	On	Flashing slow
Top off (90%)*	Off	Flashing fast
Done (100%)†	Off	On

^{*}Takes about 1 hour at 1C to reach 90% of capacity.

- 5. When charging is complete:
 - Disconnect the charger from the power source and
 - Disconnect the pack from the charger (in any order).

[†]Takes an additional 1 to 3 hours at 1C to reach 100% capacity.