



JACK BOARD panel jacks under the panel (~24 mm deep); 2x20 IDC ribbon to the main board, pin = conductor

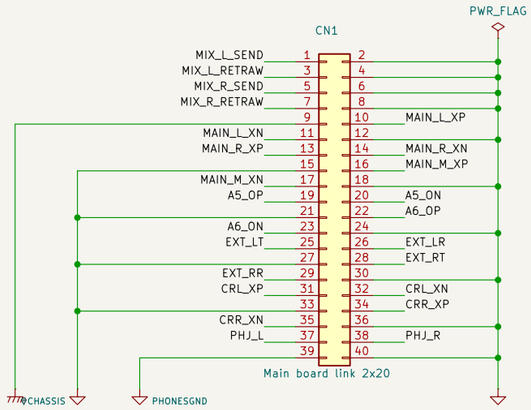






H: plated M3 standoffs, they bond CHASSIS (the sleeves, XLR pin 1 and shell) to the panel.
Insert: tip = send, ring = return; unplugged, the ring normal puts the send on the return.
L in: its normals put tip and ring on GNDA when nothing is plugged in.
R in: its normals take the L jack's tip and ring (R normalled to L).







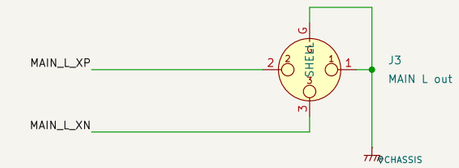


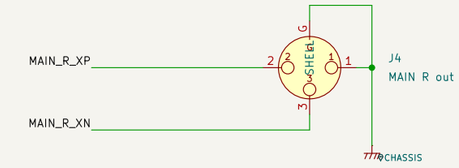


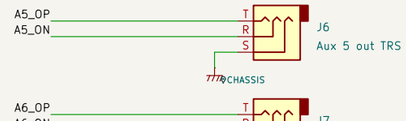


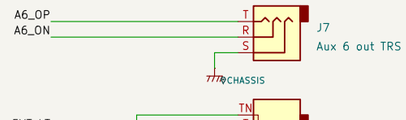


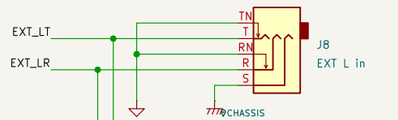

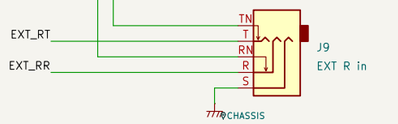

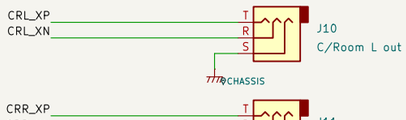

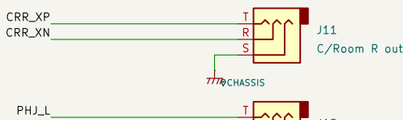



Link pinout = main board CN
Generated with its main board (master_lib.jack_board)

Sheet: /
File: master_jack_board.kicad_sch

Title: Master module jack board — goa console (main XLRs, inserts, EXT, C/

Size: User	Date: 2026-10-19	**Rev: 0.1**
KiCad E.D.A. 10.0.7		Id: 1/1