
Clause 6 Summary — 003


Triax 1 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.094
Max Ccy	0.052
Max Ccz	0.088

Triax 1 — ISO 2631 (metrics)

Metric	Value
Max ax	0.135
Max ay	0.091
Max az	0.114
Max av	0.177

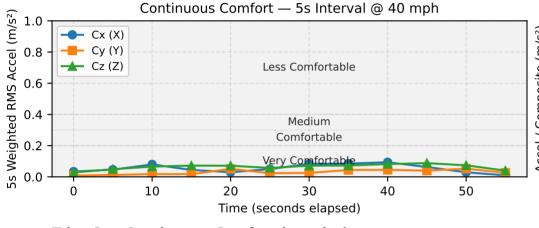

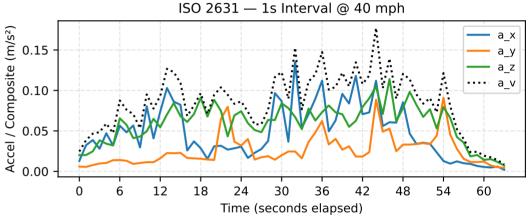



Triax 2 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.096
Max Ccy	0.090
Max Ccz	0.280

Triax 2 — ISO 2631 (metrics)

Metric	Value
Max ax	0.129
Max ay	0.111
Max az	0.388
Max av	0.405

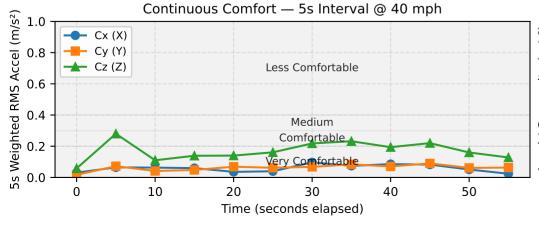

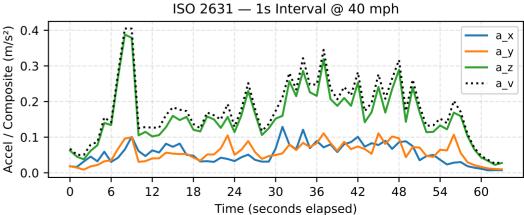


Clause 6 Summary — 003


Triax 3 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.116
Max Ccy	0.052
Max Ccz	0.093

Triax 3 — ISO 2631 (metrics)

Metric	Value
Max ax	0.167
Max ay	0.089
Max az	0.118
Max av	0.196

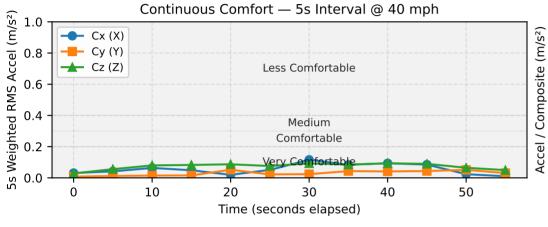

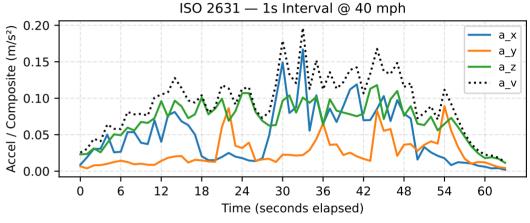



Triax 4 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.102
Max Ccy	0.050
Max Ccz	0.101

Triax 4 — ISO 2631 (metrics)

Metric	Value
Max ax	0.144
Max ay	0.083
Max az	0.125
Max av	0.178

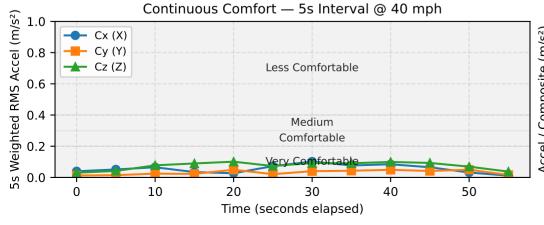

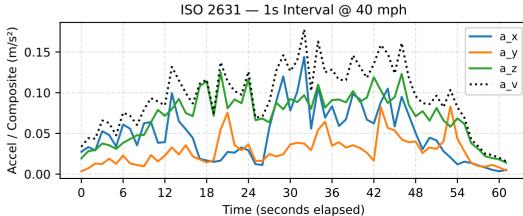


Clause 6 Summary — 003


Triax 5 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.091
Max Ccy	0.053
Max Ccz	0.098

Triax 5 — ISO 2631 (metrics)

Metric	Value
Max ax	0.133
Max ay	0.088
Max az	0.128
Max av	0.158

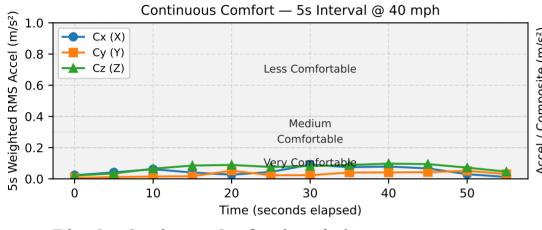

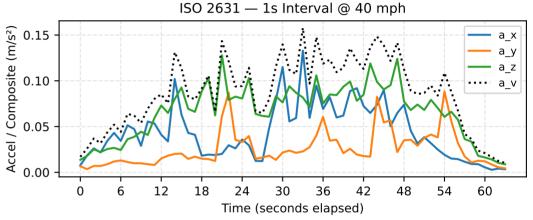



Triax 6 — Continuous Comfort (metrics)

Metric	Value
Max Ccx	0.065
Max Ccy	0.062
Max Ccz	0.134

Triax 6 — ISO 2631 (metrics)

Metric	Value
Max ax	0.099
Max ay	0.086
Max az	0.154
Max av	0.173

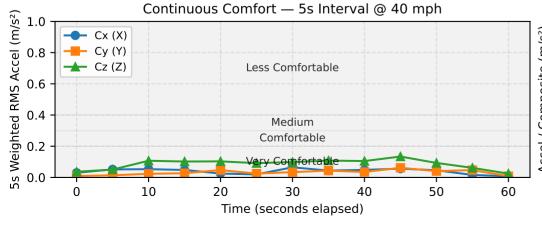

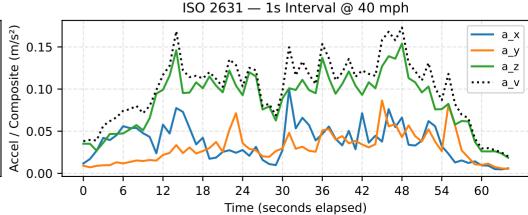

Mean Comfort Summary — Clause 6 Summary — 003


1

0

×

Per-Triax Mean Comfort Metrics

Triax	NMV	NVD	NVA
Т1	0.800	0.891	
Т2	1.697	ı	1.270
Т3	0.892	0.924	_
Т4	0.869	_	0.977
T5	0.828	0.851	_
Т6	0.857	_	0.837

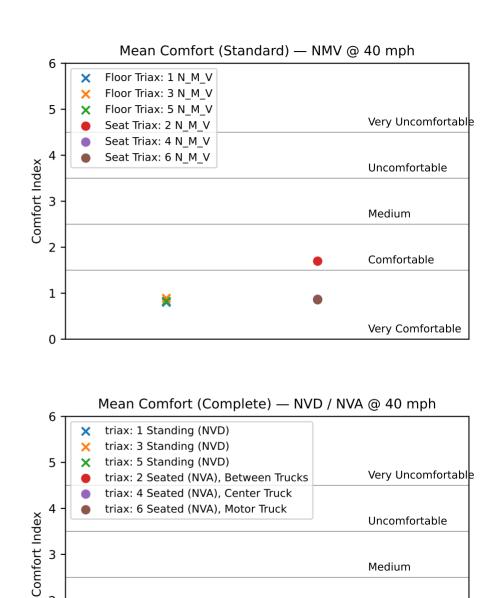

Comfortable

Very Comfortable