PLAN — WICK SIDE UP

SCALE 10:1

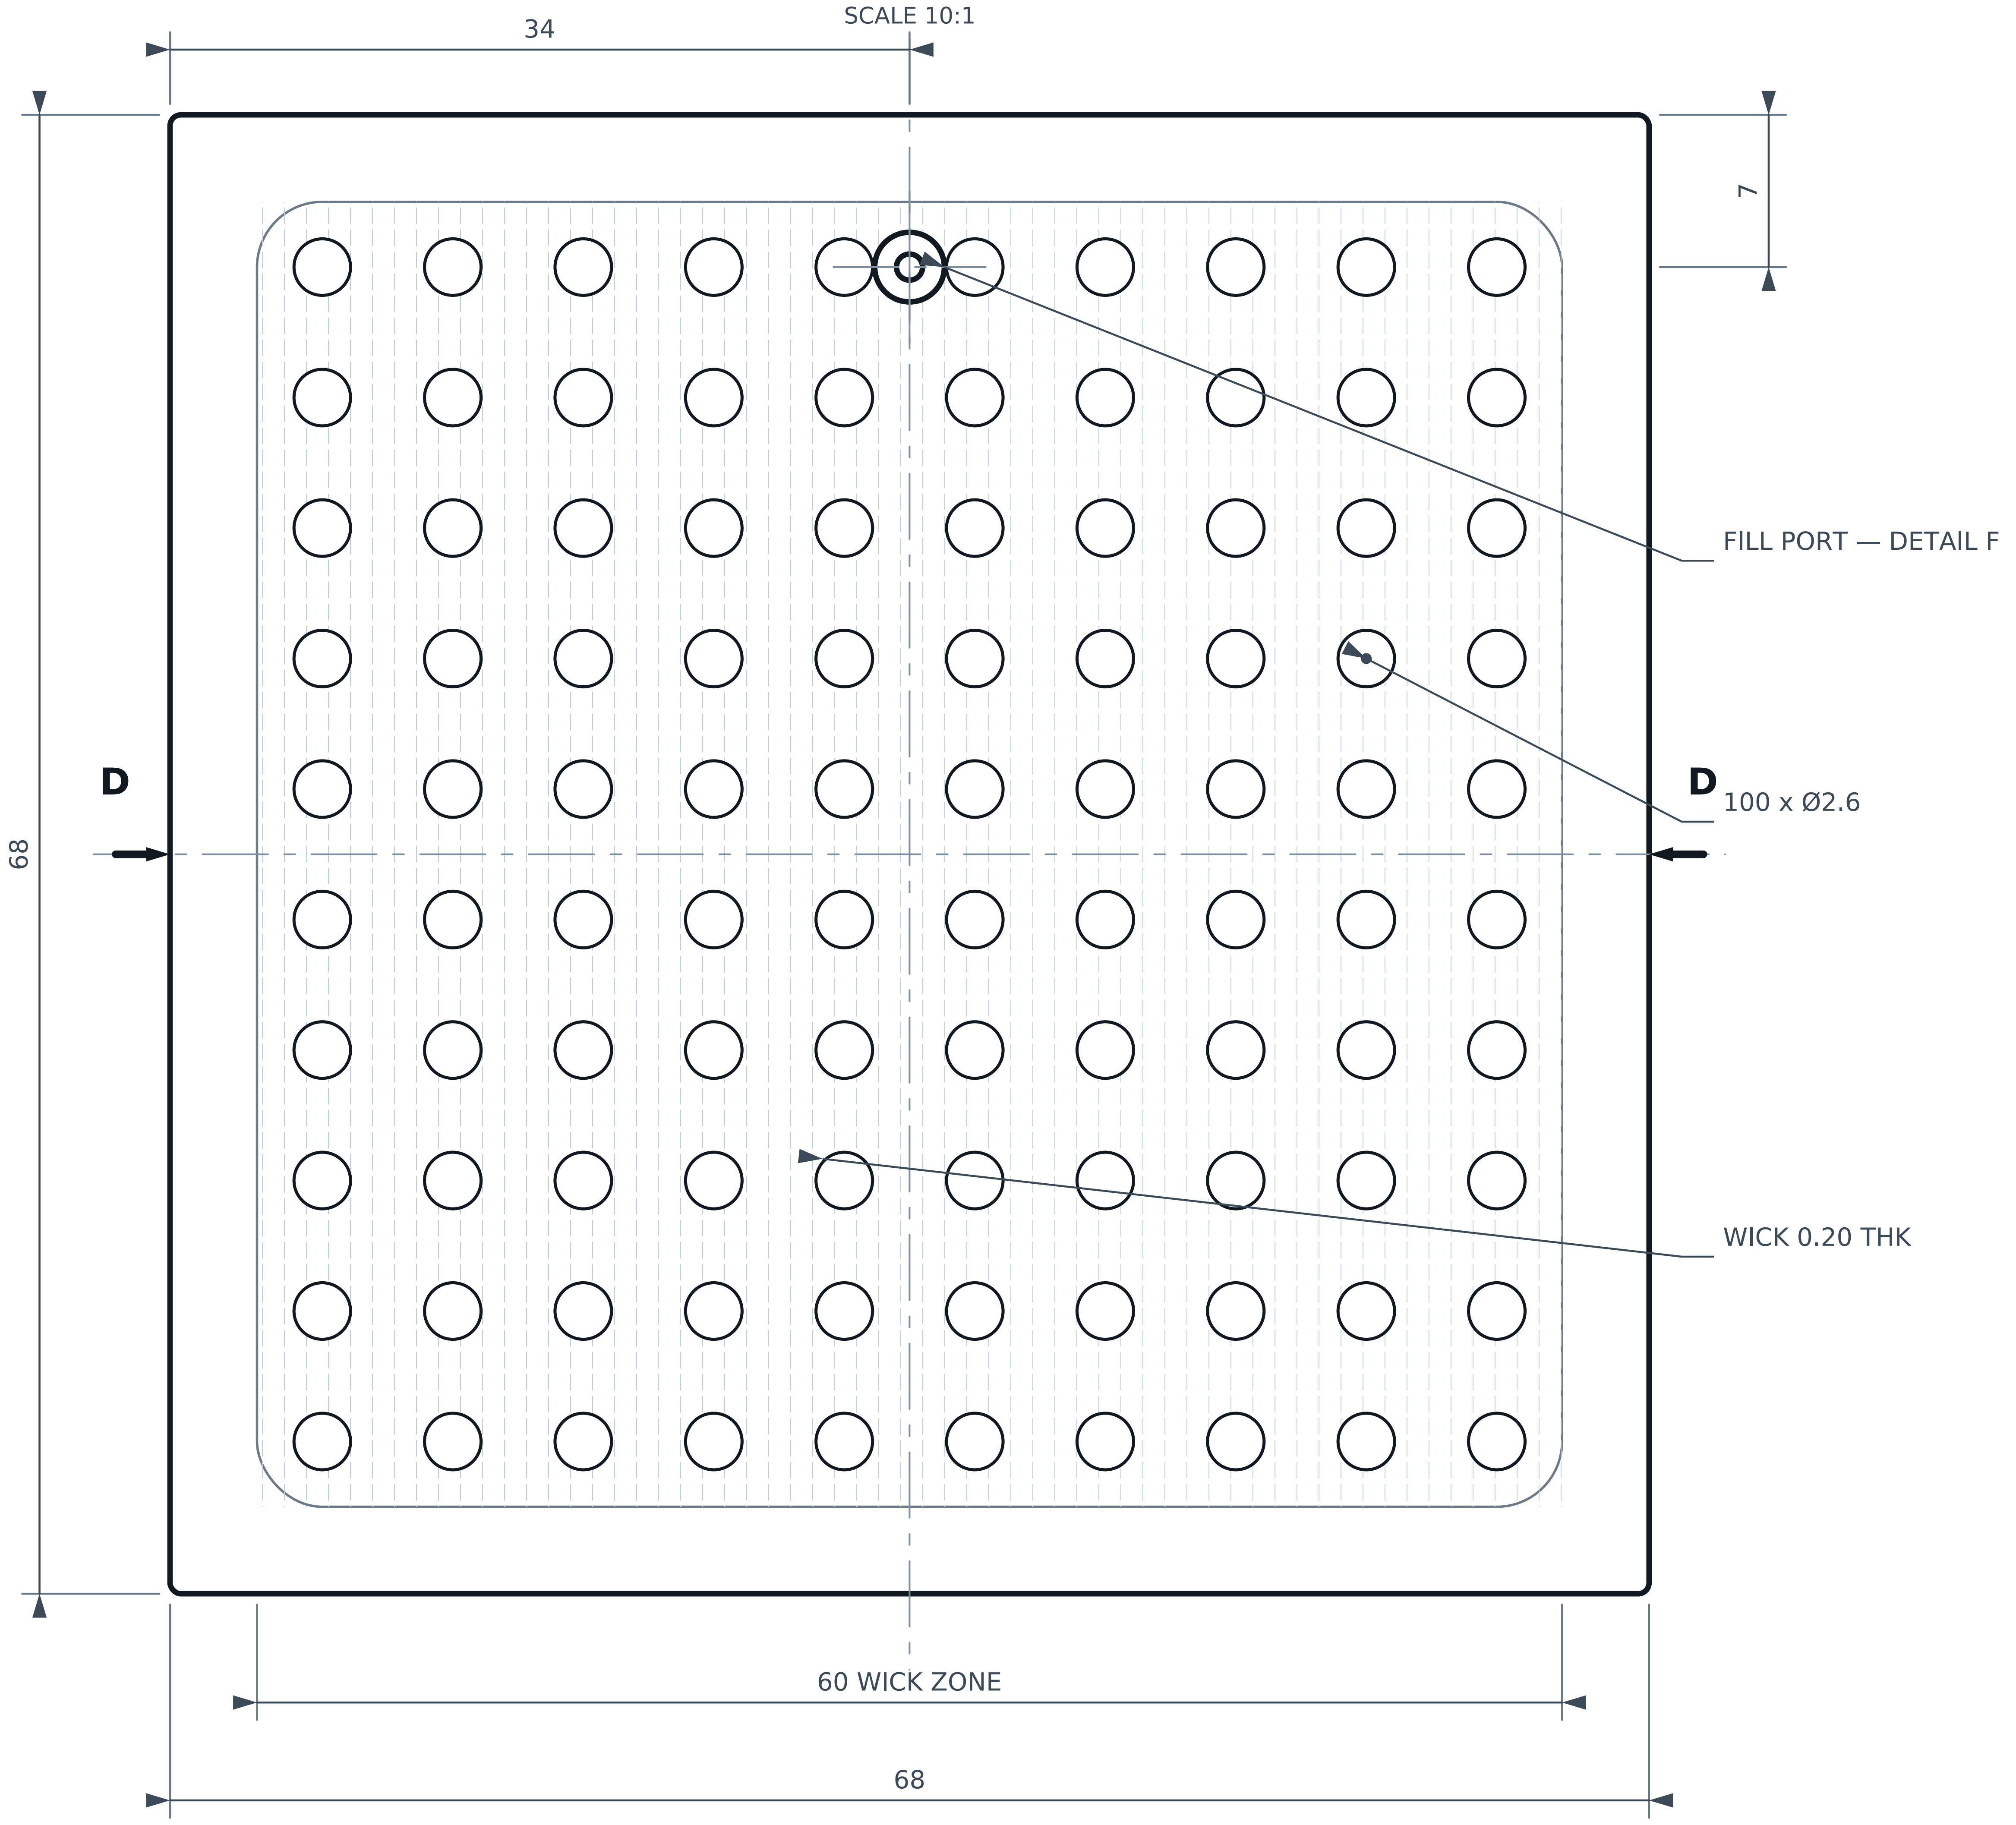
34
7
68
D
D
FILL PORT — DETAIL F
100 x Ø2.6
WICK 0.20 THK
60 WICK ZONE
68

SECTION D—D

SCALE 10:1

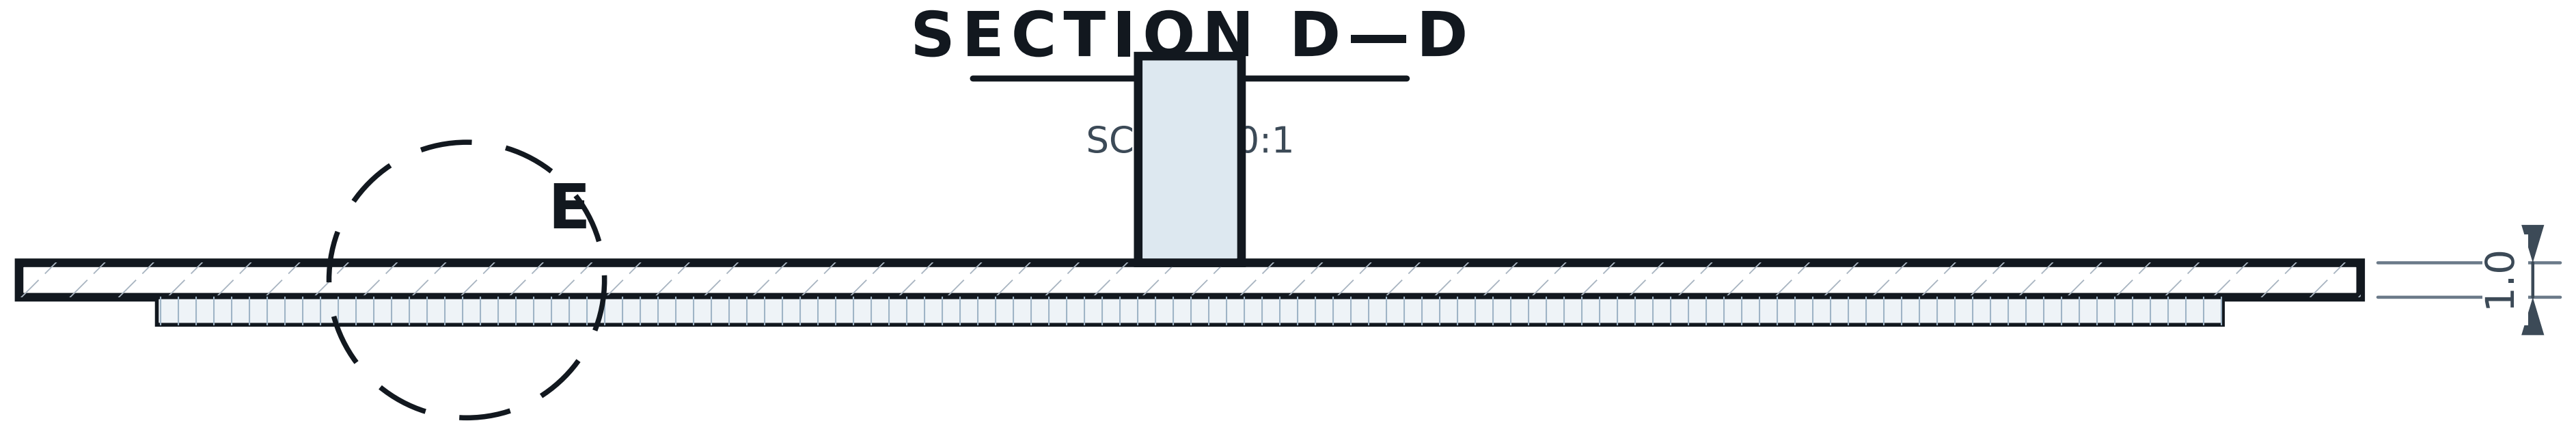

WICK SHOWN x4 THICKNESS FOR CLARITY

DETAIL E — POST LAND

SCALE 100:1

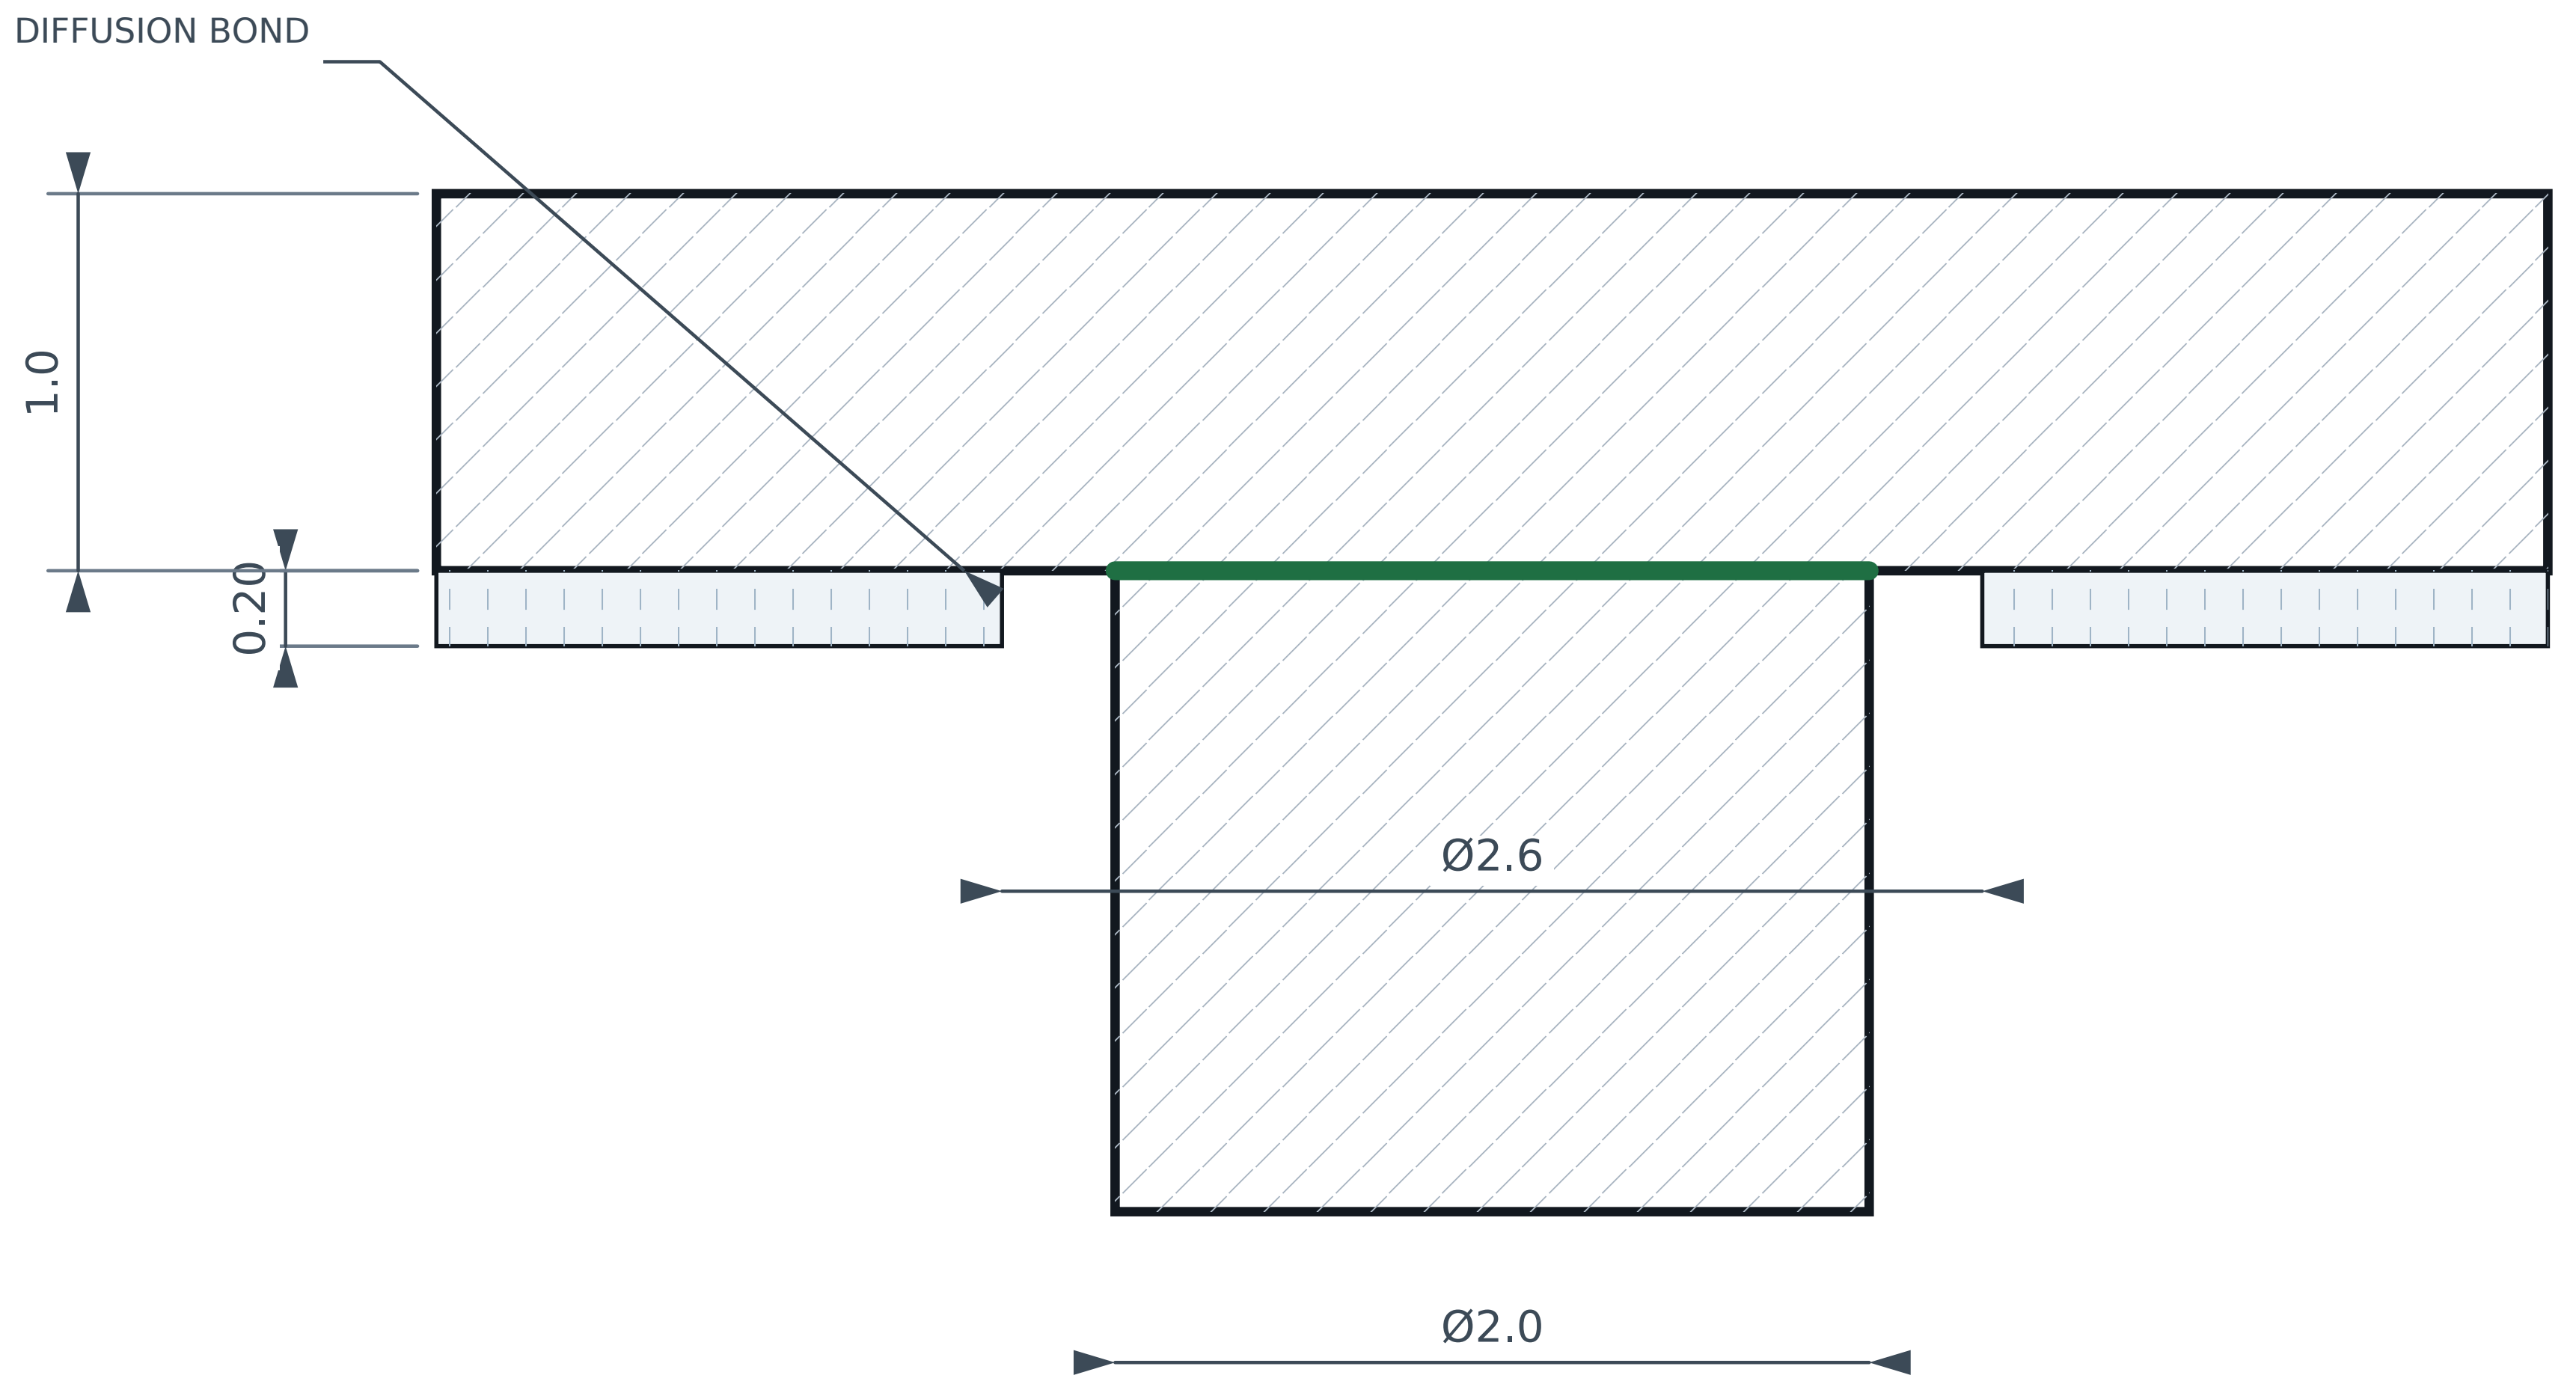
DIFFUSION BOND
1.0
0.20
Ø2.6
Ø2.0

DETAIL F — FILL PORT

SCALE 50:1

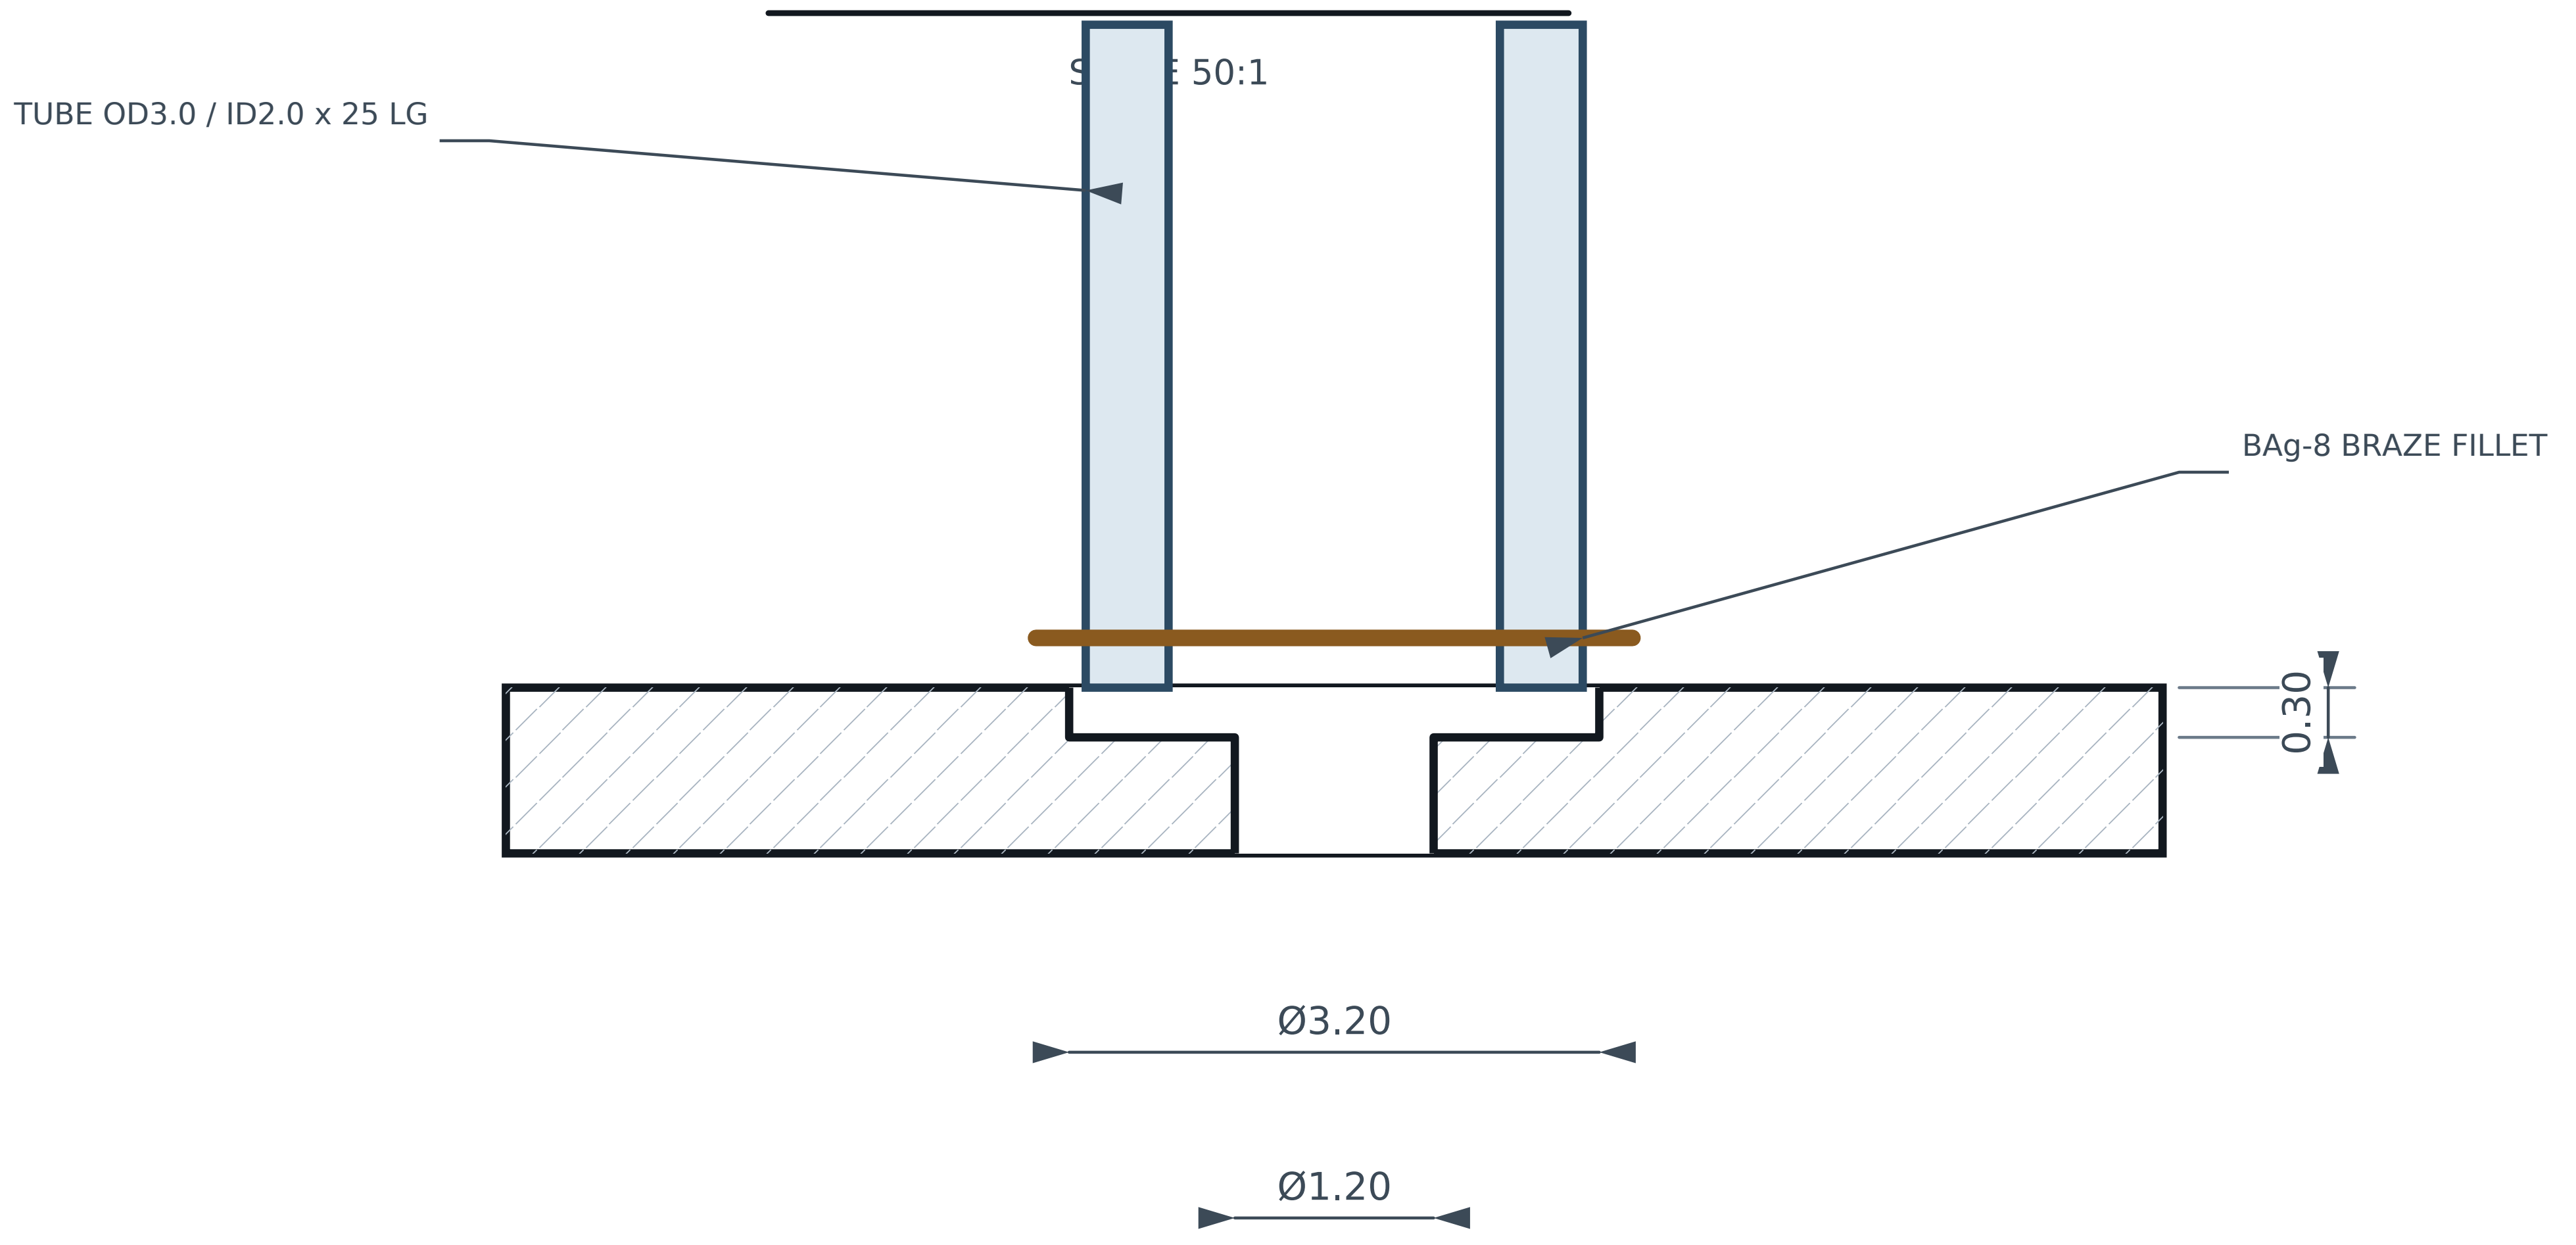
TUBE OD3.0 / ID2.0 x 25 LG
BAg-8 BRAZE FILLET
0.30
Ø3.20
Ø1.20

Port sits inside the pocket footprint, clear of posts by 2.0 min.

Pinch off, cold-weld, then laser seal the tip. Do NOT use a screw seal.

NOTES

1. MATL: OXYGEN-FREE copper C10200 / JIS C1020, annealed, 1.0 sheet
   NOT tough-pitch C1100 - see VC-101 note 1.
2. Flatness 0.02 over 68 x 68 after sintering.
3. Wick clearance holes keep post lands bare for metal-to-metal bond.
4. Braze tube before bake-out, after diffusion bonding.
5. Handle with gloves. No hydrocarbons on bond faces.

INSPECTION

CHECK	REQUIREMENT	METHOD
Flatness after sinter	0.02 max	CMM / optical flat
Wick adhesion	no spall after 3 thermal cycles	visual 10x
Post land bare area	Ø2.6 min clear	optical
Braze joint	He leak < 1e-9 Pa.m3/s	mass spectrometer

FILL P

l port p
earanc
Counterb
ube pro

INDIA-VC THERMAL HARDWARE

ISO 128 / ISO 2768-mK

TITLE
CHAMBER LID
Cu C10200 OFHC (JIS C1020) / 68 x 68 x 1.0 / WICK-LINED, FILL PORT

SCALE **10:1**
UNITS **mm**
THIRD ANGLE PROJECTION

DRAWING No. **VC-102**
REV **A**
SHEET **3 / 7**

DRAWN	CHECKED	MATERIAL	FINISH	DATE
AI-ASSISTED DRAFT	— PENDING —	SEE BOM	SEE NOTES	2026-09-09