PLAN — UNDERSIDE (WETTED FACE)

SCALE 10:1

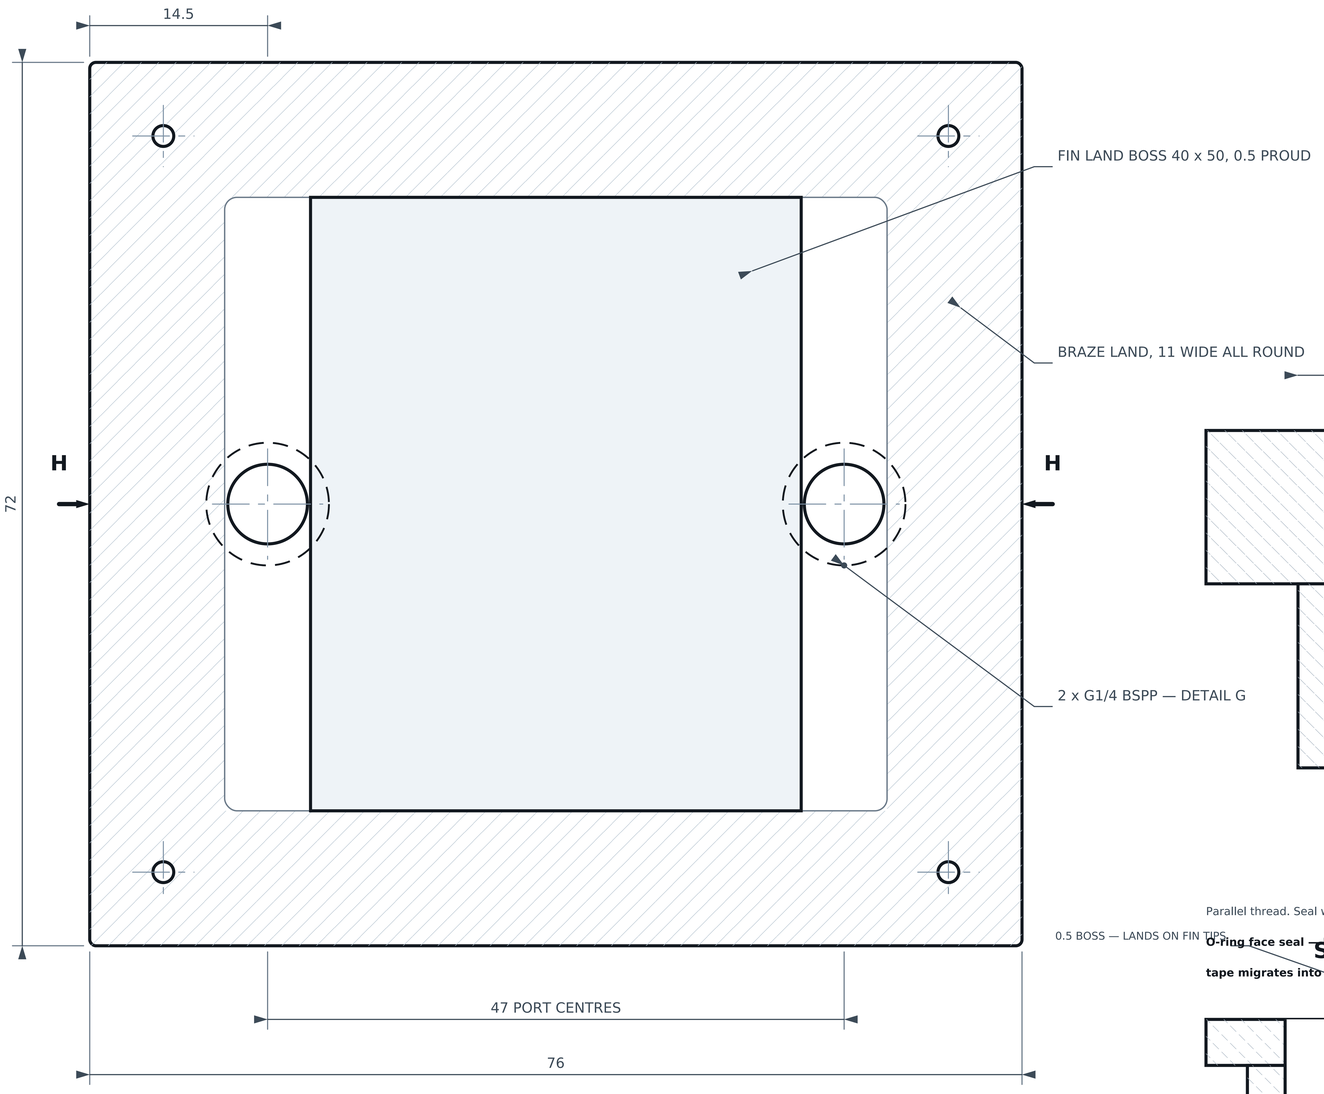

DETAIL G — PORT

SCALE 25:1

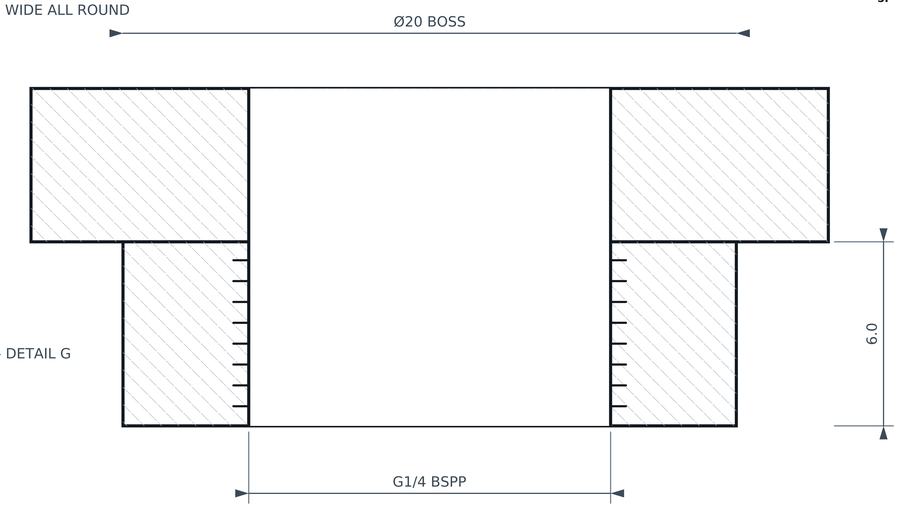

Parallel thread. Seal with a bonded washer or

0.5 BOSS — LANDS ON FIN TIPS. **O-ring face seal — NOT with PTFE tape: shredded**

tape migrates into the 0.25 mm channels.

SECTION H—H (WETTED FACE UP)

SCALE 1.25:1

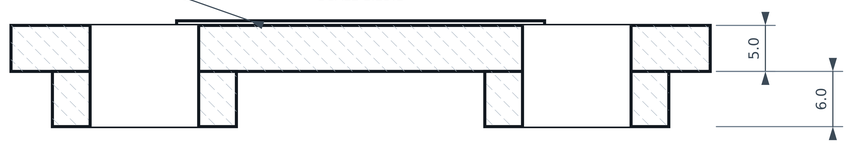

Ports open straight into the plenums; no internal turn.

NOTES

1. MATL: OXYGEN-FREE copper C10200 / JIS C1020.
2. Braze land flat 0.02, Ra 0.8, matched to CP-101.
3. Fin land boss 0.5 proud, flat 0.02 — it seals the fin field against bypass flow.
4. Deburr port bores fully. Any chip ends up in a channel.
5. Do not braze the fin land. Mechanical contact only.

INSPECTION

CHECK	REQUIREMENT	METHOD
Braze land flatness	0.02 max	CMM / optical flat
Fin land boss height	0.50 ± 0.02	height gauge
Port thread	G1/4 BSPP, gauge to BS 2779	ring gauge
Cleanliness	no chips, no cutting fluid	borescope + flush

INDIA-VC THERMAL HARDWARE — ISO 128 / ISO 2768-mK

TITLE: **COVER / MANIFOLD** — Cu C10200 (JIS C1020) / 76 x 72 x 5.0 / 2 x G1/4 BSPP	SCALE: **10:1** THIRD ANGLE PROJECTION	UNITS: **mm**	
DRAWING No.: **CP-102**	REV: **A**	SHEET: **3 / 6**	
DRAWN: AI-ASSISTED DRAFT	CHECKED: — PENDING —	MATERIAL: SEE BOM	FINISH: SEE NOTES
DATE: 2026-09-10			