stud on each end of the grab handle to the instrument panel structural support (Fig. 11). Tighten the nuts to 6 N·m (50 in. lbs.).

(3) Reinstall the glove box into the instrument panel. (Refer to 23 - BODY/INSTRUMENT PANEL/GLOVE BOX - INSTALLATION).

(4) Reconnect the battery negative cable.

GRAB HANDLE BEZEL

REMOVAL

WARNING: ON VEHICLES EQUIPPED WITH AIRBAGS, DISABLE THE AIRBAG SYSTEM BEFORE ATTEMPTING ANY STEERING WHEEL, STEERING COLUMN, OR INSTRUMENT PANEL COMPONENT DIAGNOSIS OR SERVICE. DISCONNECT AND ISOLATE THE BATTERY NEGATIVE (GROUND) CABLE, THEN WAIT TWO MINUTES FOR THE AIRBAG SYSTEM CAPACITOR TO DISCHARGE BEFORE PERFORMING FURTHER DIAGNOSIS OR SERVICE. THIS IS THE ONLY SURE WAY TO DISABLE THE AIRBAG SYSTEM. FAILURE TO TAKE THE PROPER PRECAUTIONS COULD RESULT IN ACCIDENTAL AIRBAG DEPLOYMENT AND POSSIBLE PERSONAL INJURY.

(1) Disconnect and isolate the battery negative cable.

(2) Remove the grab handle from the instrument panel. (Refer to 23 - BODY/INSTRUMENT PANEL/GRAB HANDLE - REMOVAL).

(3) Remove the glove box latch striker from the instrument panel. (Refer to 23 - BODY/INSTRUMENT PANEL/GLOVE BOX LATCH STRIKER - REMOVAL).

(4) Remove the two screws that secure the grab handle bezel to the upper glove box opening reinforcement (Fig. 12).

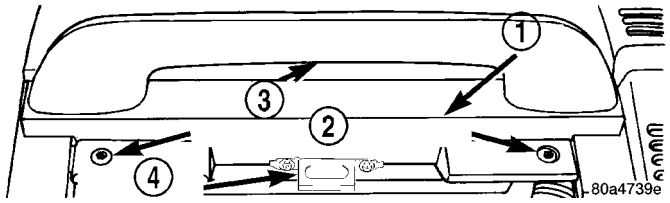

Fig. 12 GRAB HANDLE BEZEL REMOVE/INSTALL

1 - GRAB HANDLE BEZEL
2 - SCREW (2)
3 - GRAB HANDLE
4 - LATCH STRIKER

(5) Remove the grab handle bezel from the instrument panel.

INSTALLATION

WARNING: ON VEHICLES EQUIPPED WITH AIRBAGS, DISABLE THE AIRBAG SYSTEM BEFORE ATTEMPTING ANY STEERING WHEEL, STEERING COLUMN, OR INSTRUMENT PANEL COMPONENT DIAGNOSIS OR SERVICE. DISCONNECT AND ISOLATE THE BATTERY NEGATIVE (GROUND) CABLE, THEN WAIT TWO MINUTES FOR THE AIRBAG SYSTEM CAPACITOR TO DISCHARGE BEFORE PERFORMING FURTHER DIAGNOSIS OR SERVICE. THIS IS THE ONLY SURE WAY TO DISABLE THE AIRBAG SYSTEM. FAILURE TO TAKE THE PROPER PRECAUTIONS COULD RESULT IN ACCIDENTAL AIRBAG DEPLOYMENT AND POSSIBLE PERSONAL INJURY.

(1) Position the grab handle bezel onto the instrument panel (Fig. 12).

(2) Install and tighten the two screws that secure the grab handle bezel to the upper glove box opening reinforcement. Tighten the screws to 2 N·m (20 in. lbs.).

(3) Reinstall the glove box latch striker onto the glove box opening upper reinforcement (Refer to 23 - BODY/INSTRUMENT PANEL/GLOVE BOX LATCH STRIKER - INSTALLATION).

(4) Reinstall the grab handle onto the instrument panel (Refer to 23 - BODY/INSTRUMENT PANEL/GRAB HANDLE - INSTALLATION).

(5) Reconnect the battery negative cable.

INSTRUMENT PANEL ASSEMBLY

REMOVAL

WARNING: ON VEHICLES EQUIPPED WITH AIRBAGS, DISABLE THE AIRBAG SYSTEM BEFORE ATTEMPTING ANY STEERING WHEEL, STEERING COLUMN, OR INSTRUMENT PANEL COMPONENT DIAGNOSIS OR SERVICE. DISCONNECT AND ISOLATE THE BATTERY NEGATIVE (GROUND) CABLE, THEN WAIT TWO MINUTES FOR THE AIRBAG SYSTEM CAPACITOR TO DISCHARGE BEFORE PERFORMING FURTHER DIAGNOSIS OR SERVICE. THIS IS THE ONLY SURE WAY TO DISABLE THE AIRBAG SYSTEM. FAILURE TO TAKE THE PROPER PRECAUTIONS COULD RESULT IN ACCIDENTAL AIRBAG DEPLOYMENT AND POSSIBLE PERSONAL INJURY.

NOTE: Before starting this procedure, be certain to turn the steering wheel until the front wheels are in the straight-ahead position.