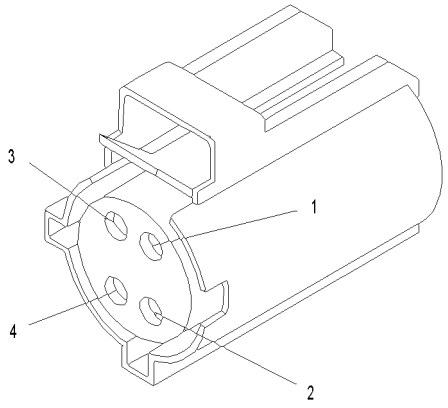

OXYGEN SENSOR (COMPONENT SIDE)

CAV	CIRCUIT	FUNCTION
1	-	GROUND
2	-	AUTOMATIC SHUT DOWN RELAY OUTPUT
3	-	OXYGEN SENSOR GROUND
4	-	OXYGEN SENSOR SIGNAL

OXYGEN SENSOR (COMPONENT SIDE)

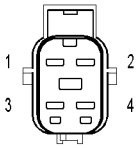

OXYGEN SENSOR 1/1 UPSTREAM (2.4L)

CAV	CIRCUIT	FUNCTION
1	K99 18BR/LG (EXCEPT MAN 6 SPD TRANS)	O2 1/1 HEATER CONTROL
1	K99 20BR/LG (MAN 6 SPD TRANS)	O2 1/1 HEATER CONTROL
2	Z42 18BK/LG (EXCEPT MAN 6 SPD TRANS)	GROUND
2	Z42 20BK/LG (MAN 6 SPD TRANS)	GROUND
3	K902 18BR/DG (EXCEPT MAN 6 SPD TRANS)	O2 RETURN (UPSTREAM)
3	K902 20BR/DG (MAN 6 SPD TRANS)	O2 RETURN (UPSTREAM)
4	K41 18DB/LB (EXCEPT MAN 6 SPD TRANS)	O2 1/1 SIGNAL
4	K41 20DB/LB (MAN 6 SPD TRANS)	O2 1/1 SIGNAL

OXYGEN SENSOR 1/1 UPSTREAM (2.4L)

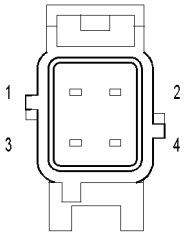

OXYGEN SENSOR 1/1 UPSTREAM (4.0L) - 4 WAY

CAV	CIRCUIT	FUNCTION
1	K99 18BR/LG	O2 1/1 HEATER CONTROL
2	Z42 18BK/LG	GROUND
3	K902 18BR/DG	O2 RETURN (UPSTREAM)
4	K41 18DB/LB	O2 1/1 SIGNAL

OXYGEN SENSOR 1/1 UPSTREAM (4.0L)