
(3) Connect the voltmeter positive terminal to terminal 3 (+1) of the E7 connector and the voltmeter negative terminal to terminal 2 (EW) of the E11 connector. Turn the washer switch on and off, and check the voltage between terminals 3 (+1) of the E7 connector and 2 (EW) of the E11 connector.

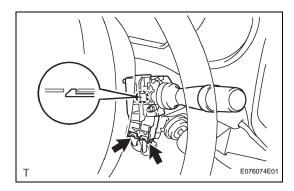

INSTALLATION

- 1. INSTALL WIPER SWITCH
 - (a) Engage the claw and install the windshield wiper switch assembly.
 - (b) Connect the 2 connectors.
- 2. CONNECT CABLE TO NEGATIVE BATTERY TERMINAL

Torque: 3.9 N*m (40 kgf*cm, 35 in.*lbf)

- INSTALL STEERING COLUMN UPPER COVER (See page SR-18)
- 4. INSTALL STEERING COLUMN LOWER COVER (See page SR-18)

