

SAFE WORK METHOD STATEMENT			ABN: 96 151 257 582	SWMS NUMBER	SWMS03
Company Details	Campbell Construction Co, Building B 4-6 Innovation Parkway Birtinya QLD			Contact Number	1300 938 040
Project Address				Project No (CCC)	
Date Prepared		Prepared By: (Supervisor Name)		Review Date	13/9/2022
SWMS Approved by	Ben Campbell CEO Signature: 			Date	13/9/2021
Person Responsible for SWMS (Supervisor Name)				Contact Number	
WORKING WITH ELECTRICAL, AIR AND EXPLOSIVE POWER TOOLS AND EQUIPMENT					
High Risk Construction Work: (HRCW)	Involves a risk of a person falling more than 2m Is carried out on or near energised electrical installations or services				
Implementation, Monitoring and Review of the SWMS:	WHSE Inspections, WHSE Internal Audits, Toolbox Talks				
Action taken prior to work commencing:	Inspection of tools and equipment before work commences ensure safe and not damaged, Manufacturers servicing, 3 monthly test and tag of electrical equipment, Confirm work area / establish exclusion zones if required - Any damaged equipment shall be tagged out and not used				
Worker qualifications /experience required for task:	Trade Certificate (Certificate III in Carpentry), General Construction Induction Card, Apprentices/Young Workers need to be supervised at all times and should not work alone				
Personal Protective Equipment requirements:					

LIKELIHOOD	CONSEQUENCE				
	1 Insignificant	2 Minor	3 Moderate	4 Major	5 Catastrophic
	No Injuries Low financial loss	First Aid, property or environmental damage up to \$2,500	Lost Time Injury, short term temporary disability (< 1 month), property or environmental damage \$2,500 - \$25,000	Lost Time Injury long term temporary disability (>1 month), property or environmental damage \$25,000 - \$250,000	Fatality, permanent disability, property or environmental damage over \$250,000
Almost Certain Expected to occur in most circumstances (<i><monthly</i>)	H	H	E	E	E
Probable Could happen regularly (<i>monthly-yearly</i>)	M	H	H	E	E
Possible Might happen at some time (<i>yearly-3 yearly</i>)	M	M	H	H	E
Unlikely Could happen rarely (<i>3 yearly-10 yearly</i>)	L	M	M	H	H
Very Unlikely Could happen, but probably never will (<i>>10 yearly</i>)	L	L	M	M	H

Risk Action Levels	
EXTREME	Immediately stop the task. Construction and WHS Manager decision required. Inform CEO
HIGH	Task can commence, continually monitor and review controls to ensure ALARP
MEDIUM	Task can commence, controls measures potentially adequate
LOW	Task can commence, controls are adequate

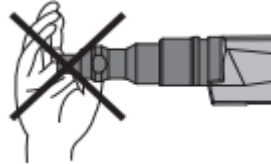
Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
Unload tools and equipment	Potential sprains and strains, cuts	PO	3	H	Ensure clear path of travel to work area Do not carry multiple tools at once Ensure blades are protected so no cuts occur Park trailer/vehicle as close as possible to job site	UN	3	M	Site Supervisor Workers
Working near overhead power lines HRCW	Electrocution, burns from contact with electrical conductors	PR	4	E	Safe approach distances are 3 meters for low voltage (up to 132Kv), 6 meters for high voltage (>132Kv) for operation of plant This is to be determined by the plant operator and Supervisor prior to commencement of works near power lines and approval from energy company required (<i>Ergon or Energex</i>) If less than the exclusion zone an approved Energex spotter will be used and Supervisor to contact the power authority before commencement of works (<i>Electrical Safety Advice</i>) All over head services to be treated as uninsulated until checked by a competent person and documented (<i>Electrical Safety Advice</i>)	PO	4	H	Site Supervisor Workers
Use of temporary site power HRCW	Electrocution, burns from unsafe installation	PR	4	E	Temp power boards installed by licensed electrician Certificate of testing and safety for work on electrical equipment Certificate of testing and compliance for electrical installation work Testing shall be conducted as per current legislative and Australian standards requirements The use of temporary electrical equipment must be in accordance with AS 3012-2010 Electrical wiring on construction and demolition sites	PO	4	H	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
Inspection of power tools	Electrocution from unsafe electrical power tools	PR	3	H	All electrical equipment is to have a current 3 month test and tag All electrical equipment is to be in good condition with no visible damage RCD to have a push button test prior to each shift and be tested for amperage and trip time every 3 months All Electrical leads are to be placed as to not sustain damage and to be kept out of water and not run across the ground or through access ways Any damaged or faulty equipment will be tagged out of service No double adaptors, piggy backing or domestic grade adaptors shall be used All electrical leads shall not exceed 30 metres Double insulated portable electrical equipment fitted with an earth leakage protection device (i.e. RCD), and double insulated electrical leads fitted with a 3-pin plug (non-rewireable moulded or transparent)	UN	3	M	Site Supervisor Workers
Using portable power tools e.g. power saw, grinder, planers, drills, drop saws etc HRCW	Injury from incorrect use	PR	3	H	Any young workers/apprentices shall be shown how to safely setup and operate power tools and must not be left alone All guards and handles to be in place and not removed Ensure all power tools are correctly setup for the task e.g. correct blade is attached to saws and grinders Ensure blades, drill bits etc are attached tightly Ensure no body part is in line of fire e.g. saw blade whilst cutting	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					Ensure electrical leads are not in line of fire (Cutting line/zone) Air powered tools fitted with proprietary whip checks, rated air hoses and quick release connections Handheld drills fitted with manufacturer supplied handles Two hands to be used on power tools at all times (<i>Where applicable</i>)				
	Unsafe work area set-up	PR	3	H	Work benches to be used, ensure they are assembled as per manufacturer's instructions Area free from trip hazards and both feet are on the ground with good footing Work shall not be conducted on the ground e.g. worker bending over whilst cutting timber Ensure electrical cords are not hung over nails, sharp edges etc Ensure the job is stable, use clamps if necessary	UN	3	M	Site Supervisor Workers
	Worker injury from projectiles, dust, noise, cuts, dropped objects	PR	3	H	Eye protection worn and fit for purpose – Medium Impact Rated clear or dark (<i>Prescription glasses and sunglasses are not suitable eye protection</i>) Hearing protection to be worn (plugs or ear muffs) Half-face (class P1 or P2) disposable particulate respirator, in accordance with appropriate AS/NZS Standards – Masks to be fit tested Gloves to be worn if potential cuts are identified e.g. metal, swarf, splinters – Hyflex Nitrile gloves Fully enclosed safety footwear – Type 1 for construction work	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
	Worker fall from height, 2m or more, falling objects	PR	4	E	Refer to SWMS05 Using Ladders, Planks and Trestles Platform ladders to be used, step ladders are not a safe working platform and must have 120kg load rating Only light work from a ladder e.g painting Trestle and plank set up, mobile scaffold or work from scaffold that meets duty requirements for the task Double planks to be used (450mm wide) and clamped Edge protection fitted along the length of the planks Crates, building material, noggins etc are not a working platform Planks, working platform not to be loaded with equipment and exceed SWL Do not leave any tools in an unsafe position on work benches or in an overhead position where there is a chance that it could fall and injure personnel below Set up exclusion zones	PO	4	H	Site Supervisor Workers
Using an Air Compressor	Hit by moving object (uncontrolled movement due to pressure release)	PR	3	H	Use only tools/ fittings appropriate to size, pressure requirements (experienced and trained person only to determine type of connection required.) Air powered tools fitted with proprietary whip checks, rated air hoses and quick release connections Use tools only as per manufacturer's instructions (Do not use for purposes other than that intended) Never exceed recommended pressures	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					Check pressures regularly Avoid bending/kinking hoses Regularly check hoses are not being damaged or getting caught up/ tangled etc. during use Do not drag attached tools by the air hose. If the air hose gets caught on something, don't pull on the hose. Find the problem and release the hose Do not point the air hose at persons, or use to clean clothing, shoes, or any part of the body Take care when discharging air from the tank, i.e. from the safety valve, the drain valve or the air outlet, to ensure that it does not cause dirt, stones, metal swarf or other particles to be blown around				
	Air hoses become a potential trip hazard	PR	3	H	Air hoses are located so they are not across walkways, roadways, thoroughfares etc.	UN	3	M	Site Supervisor Workers
Using a Nail Gun	Injury from incorrect use	PR	3	H	Trade qualified personnel to use equipment Any young workers/apprentices shall be shown how to safely setup and operate power tools and must not be left alone All guards to be in place and not removed Point the nail gun at the work – never at yourself or another worker Keep your fingers off the trigger when just holding or carrying the Nail gun Keep hands/fingers/feet and other body parts at least 10 cm away from gun nose	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					Eye protection worn and fit for purpose – Medium Impact Rated Hearing protection, ear muffs or plugs to be worn Disconnect nail gun from the air supply hose before unloading fasteners, performing maintenance, clearing a jammed fastener, leaving work area, moving to another location, or handing the nail gun to another person.  Automatic Powder Actuated Fastener Gun Check that no cartridge strip is loaded in the tool. If there is a cartridge strip in the tool, pull it up out of the tool by hand from above. Check all external parts of the tool for damage and check that all controls operate faultlessly. Check the piston and spring clip for wear and ensure that the parts have been fitted correctly. WARNING The tool can be made ready to fire by pressing the nosepiece against a part of the body (e.g. a hand). When the tool is ready to fire, fasteners or the piston could be driven inadvertently into parts of the body. Never press the tool against parts of the body. WARNING The material may splinter or fragments of the magazine strip may fly off when the fastener is driven. The user of the				

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					tool and other persons in the immediate vicinity must wear suitable eye protection and a hard hat. Splintering material presents a risk of injury to the eyes and body. CAUTION The fastener driving action is initiated by ignition of a propellant charge. The user of the tool and other persons in the immediate vicinity must wear ear protectors. Exposure to noise can cause hearing loss. WARNING Never redrive a fastener. This may cause the fastener to break and the tool may jam. WARNING Never drive fasteners into existing holes unless this is recommended by Hilti (e.g. DX-Kwik). CAUTION If the tool has overheated, allow it to cool down. Do not exceed the recommended fastener driving rate. When working with bump-fire nail gun, DO NOT USE: Where the user is required to climb ladders or other elevated areas with a loaded gun In restricted and tight spaced areas where the gun's actuation muzzle is at high risk of being bumped Where other people are likely to come within the firing path of the nail gun or there is a foreseeable risk of them being struck by a flying nail (e.g. by ricochet or deflection)				
	Worker injury from projectiles, dust, noise	PR	3	H	Eye protection worn and fit for purpose – Medium Impact Rated	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					Prescription glasses and sunglasses are not suitable eye protection Hearing protection to be worn (plugs, or ear muffs) Half-face (class P1 or P2) disposable particulate respirator, in accordance with appropriate AS/NZS Standards – Ensure masks fit tested				
Using explosive Power Tools	Injury from incorrect use	PR	3	H	Any young workers/apprentices shall be shown how to safely setup and operate power tools and must not be left alone Ensure you have the correct charge for the job Ensure you have the correct length of fastener and the correct material for receiving the fastener Ensure you have considered the thickness of the member being fixed and the hardness of the receiving material Ensure you have positioned yourself firmly and correctly for the task, if the tool is not held at right angles to the base material a ricochet can occur Ensure the work area is marked out correctly, if fasteners are fired too close to a corner or masonry etc the material can break up or blow apart Ensure no one is working on the other side of the material, potential blow-through could occur	UN	3	M	Site Supervisor Workers
	Worker hearing, ear, body injuries from projectiles, noise	PR	3	H	Appropriate barricading including a No Go Zone Signage identifying Explosive Powered Tool in Use Eye protection Medium Impact Rated (sunglasses and prescription glasses are not adequate eye protection)	UN	3	M	Site Supervisor Workers

Job Steps	Hazards	L	C	R	Controls	L	C	R	Person Responsible
					Hearing protection to be worn (plugs, or ear muffs)				
Emergency or first aid scenario	Workers unsure of response protocols delaying medical attention	PR	4	E	First aid kit available either onsite or in work vehicle Emergency contact list onsite (<i>where applicable</i>) and all workers understand emergency response process through inductions All workers to know site location/address through inductions for directing emergency services Call 000 or 112 for medical emergencies Emergency evac drills are undertaken	PO	4	H	Site Supervisor Workers
<i>If the job is stopped/or further hazards identified – Document these here</i>									Site Supervisor Workers
									Site Supervisor Workers
									Site Supervisor Workers
									Site Supervisor Workers
									Site Supervisor Workers

SWMS Sign Off – To be signed by each worker undertaking the task outlined in this SWMS.

I declare that:

1. I have been consulted regarding the content and development of this SWMS
2. I have received all necessary training, instruction and information regarding the contents of this SWMS
3. I have reviewed the task, job steps, hazards and controls and verify I will not carry out the task until all control measures are in place
4. I will stop work and amend the SWMS if any further hazards are identified whilst conducting the task

NAME	POSITION	SIGNATURE	DATE
