




www.vitrox.com

V810i S2EX Power and Pneumatic Subsystem



ABI Power Configuration

Automated Board Inspection

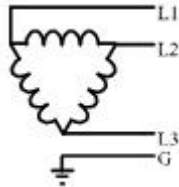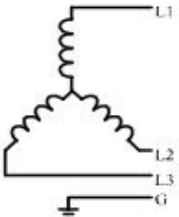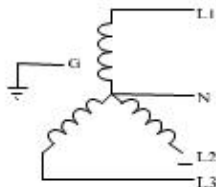
Power Source and Loading	Input Configuration, Input Wiring & Terminal Block Wiring	Description	VAC
3-Phase Delta Load: (3PD) L1-L2 L1-L3 L2-L3 (17 A)	Input and Terminal Block Wiring 	200 - 240V Three Phase	200V
			220V
			230V
			240V
3-Phase Wye Load: (3PY) L1-L2 L1-L3 L2-L3 (17 A)	Input and Terminal Block Wiring 	208 - 220V Three Phase Wye	208V
			220V
3-Phase Wye with Neutral :(3PN) Load: L1-N L2-N L3-N (10 A)	Input and Terminal Block Wiring 	380- 415V Three Phase Wye w/Neutral	220/380V
			230/400V
			240/415V

ABI PDU Configuration

Automated Board Inspection



415vAC configuration PDU

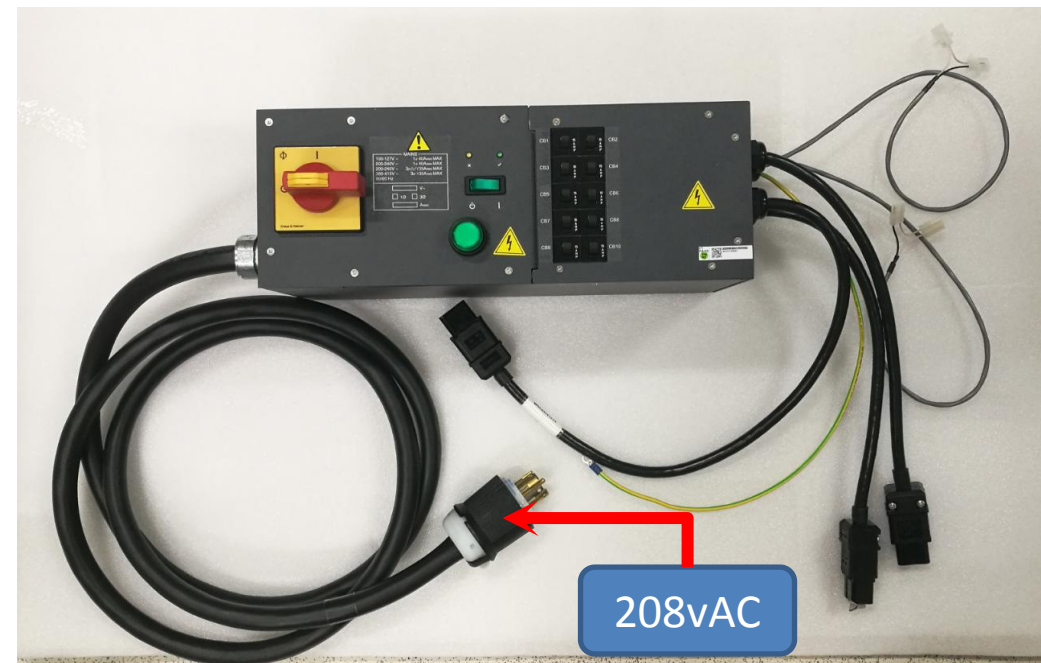


208vAC configuration PDU

- V810i machine PDU configurable according to customer need with option 3 phase 5 cores, incoming 415vAC or 208vAC. Output of PDU will be 240vAC.
- Difference between both configuration will be the internal connectivity and the bulb head connector
- All shipped machine completed with pre-configure PDU and fully tested.
- If PDU configuration change needed, to have ViTrox Service team consult before proceed any changes.




Hardware Overview - Power Distribution Unit (PDU)


Automated Board Inspection

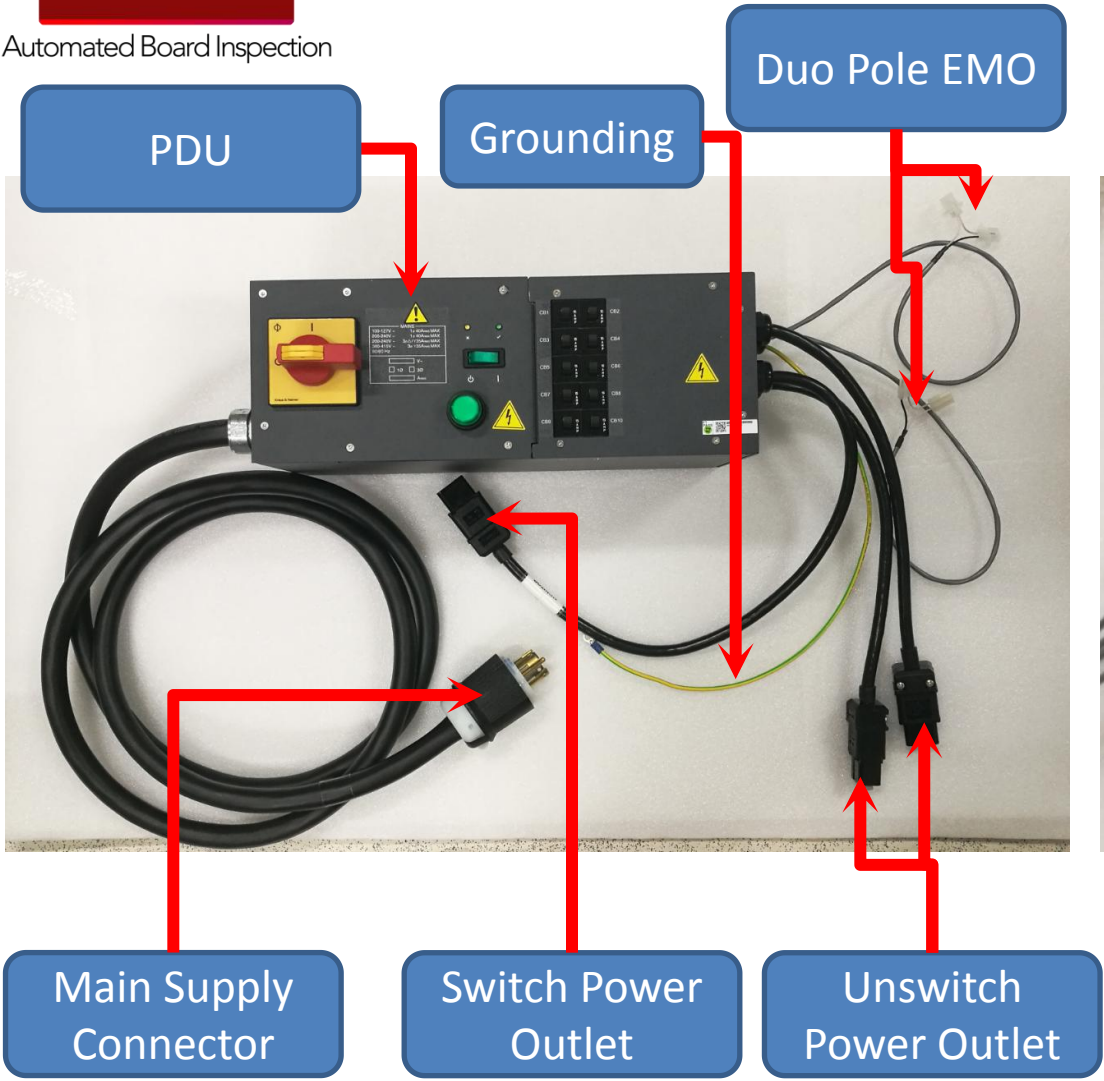


Back Panel Power Outlet

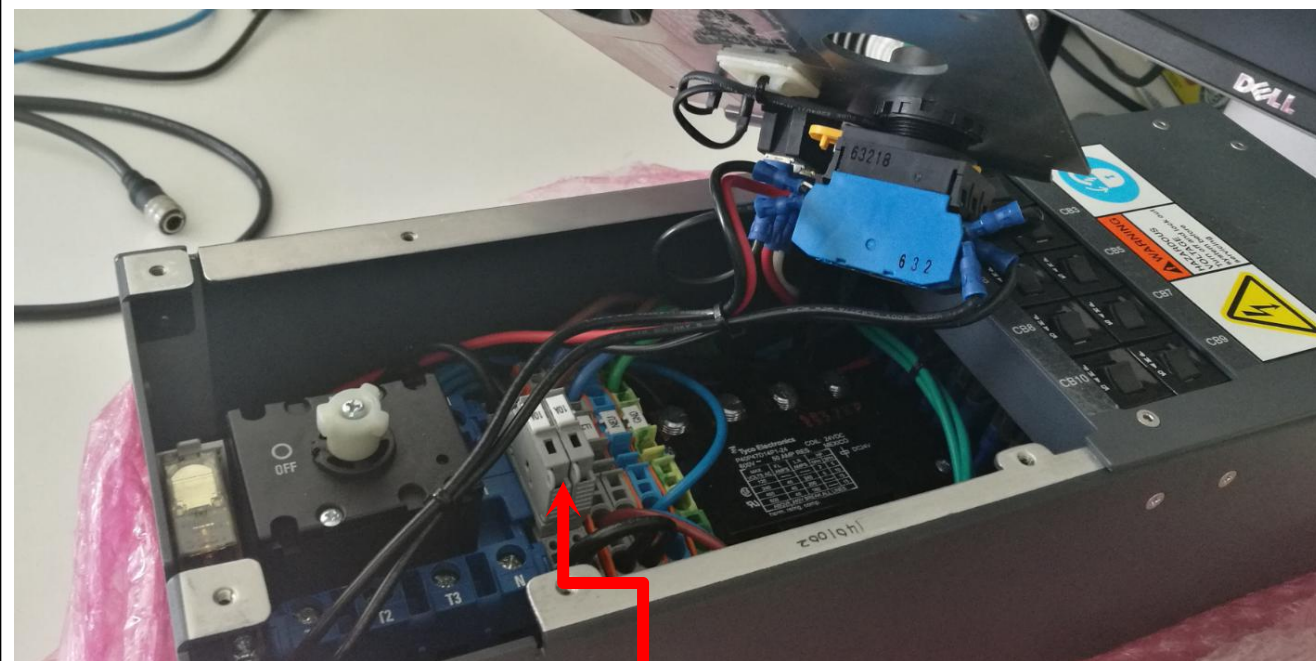

Fuse, 250vAC,
10Amp

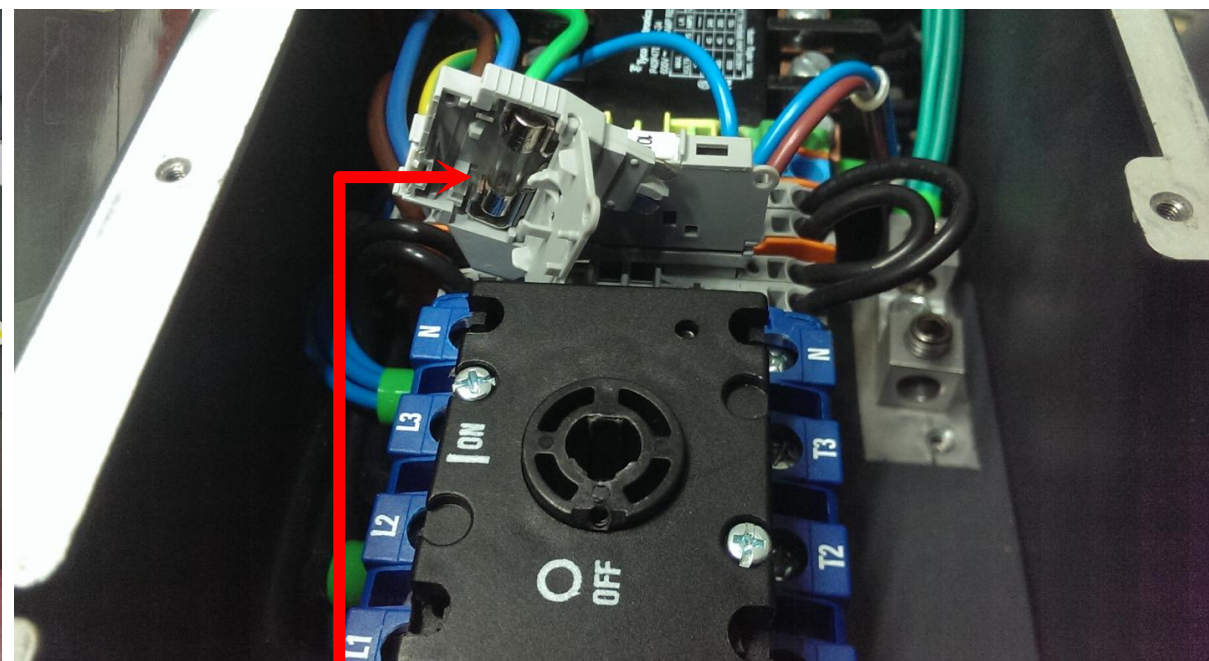

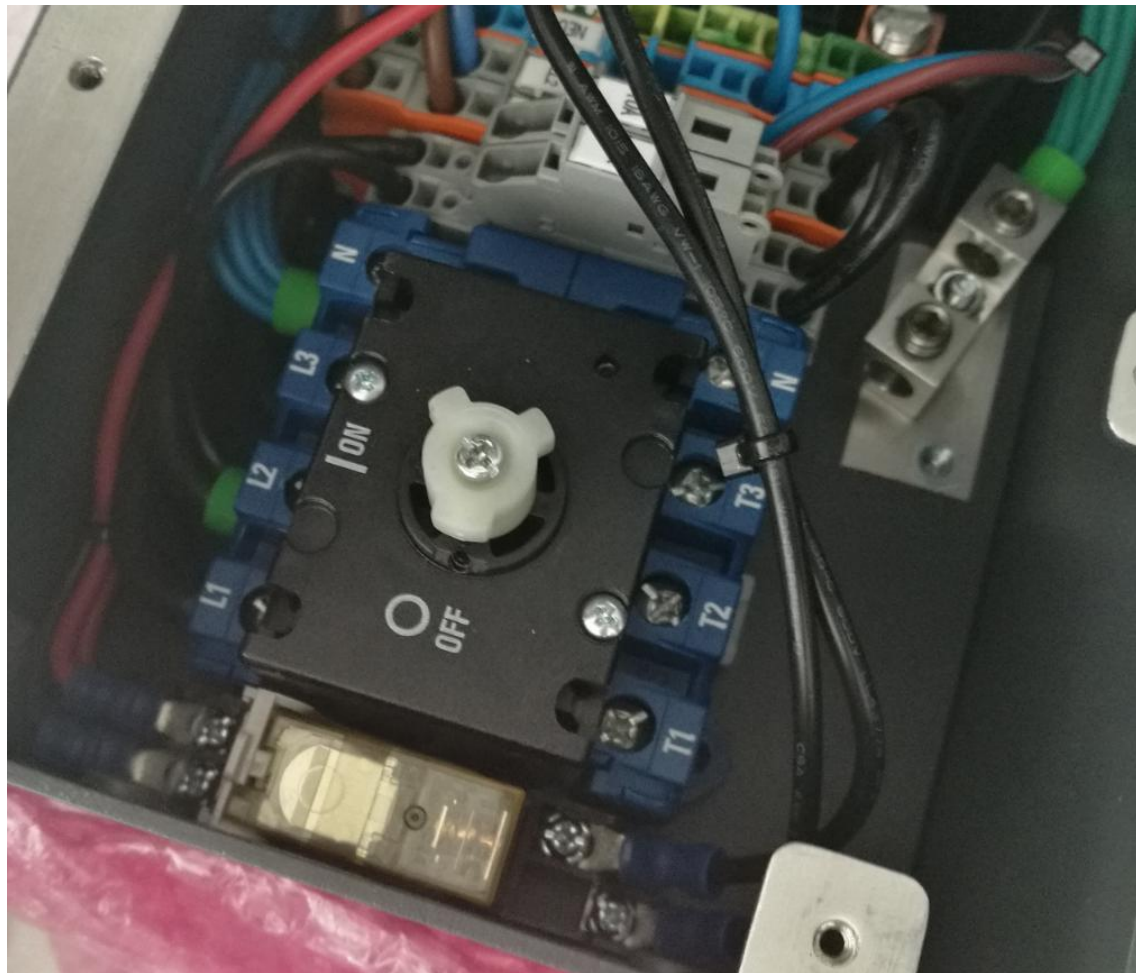


Criteria	Expected Reading
T1 + T2	380vAC ~420vAC
T2 + T3	380vAC ~420vAC
T1 + T3	380vAC ~420vAC
T1 + N	215vAC~ 230vAC
T2 + N	215vAC~ 230vAC
T3 + N	215vAC~ 230vAC



Power Verification - 208vAC, 3 Phase 5 cores


Automated Board Inspection

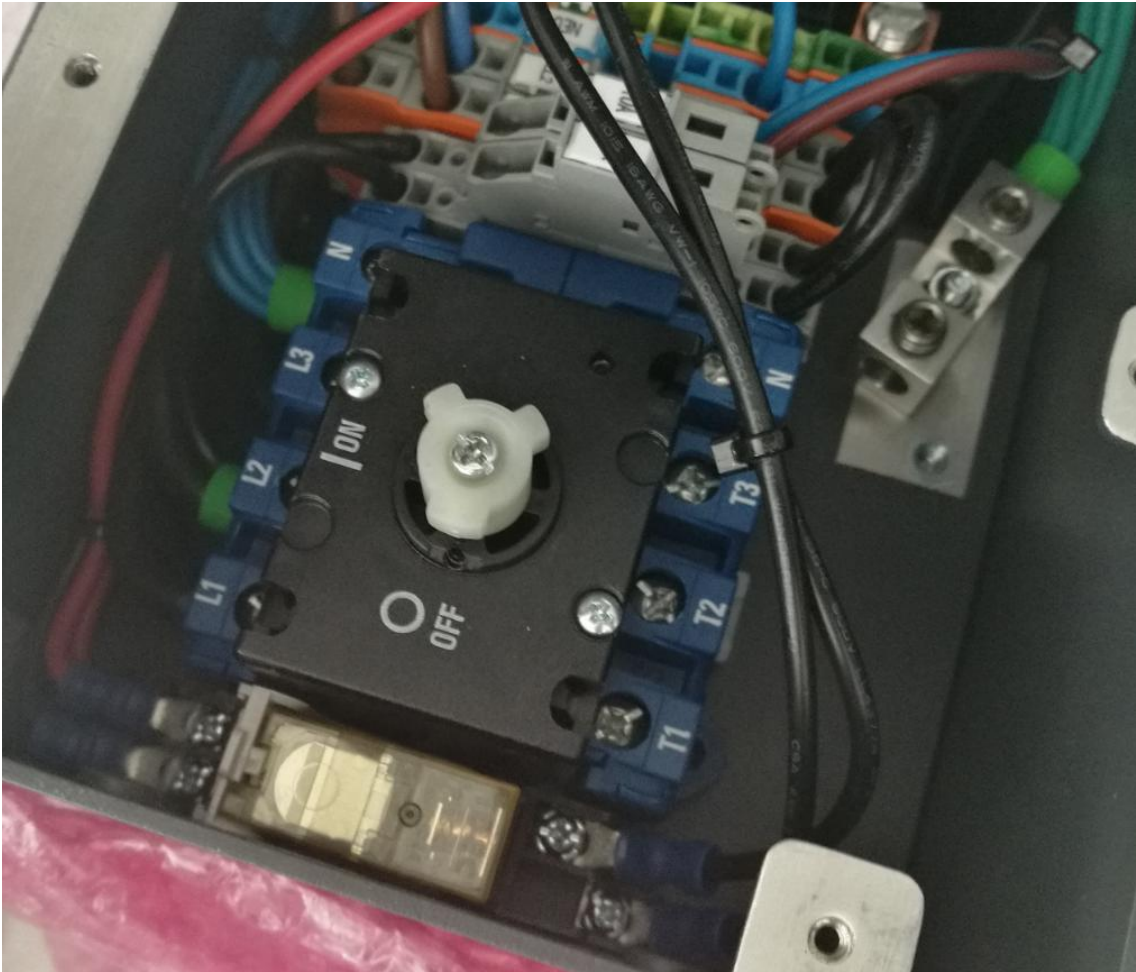

Criteria	Expected Reading
T1 + T2	200vAC~215vAC
T2 + T3	200vAC~215vAC
T1 + T3	200vAC~215vAC
T1 + N	115vAC~125vAC
T2 + N	115vAC~125vAC
T3 + N	115vAC~125vAC

ABI Un-Switched & Switched Block Diagram


Automated Board Inspection

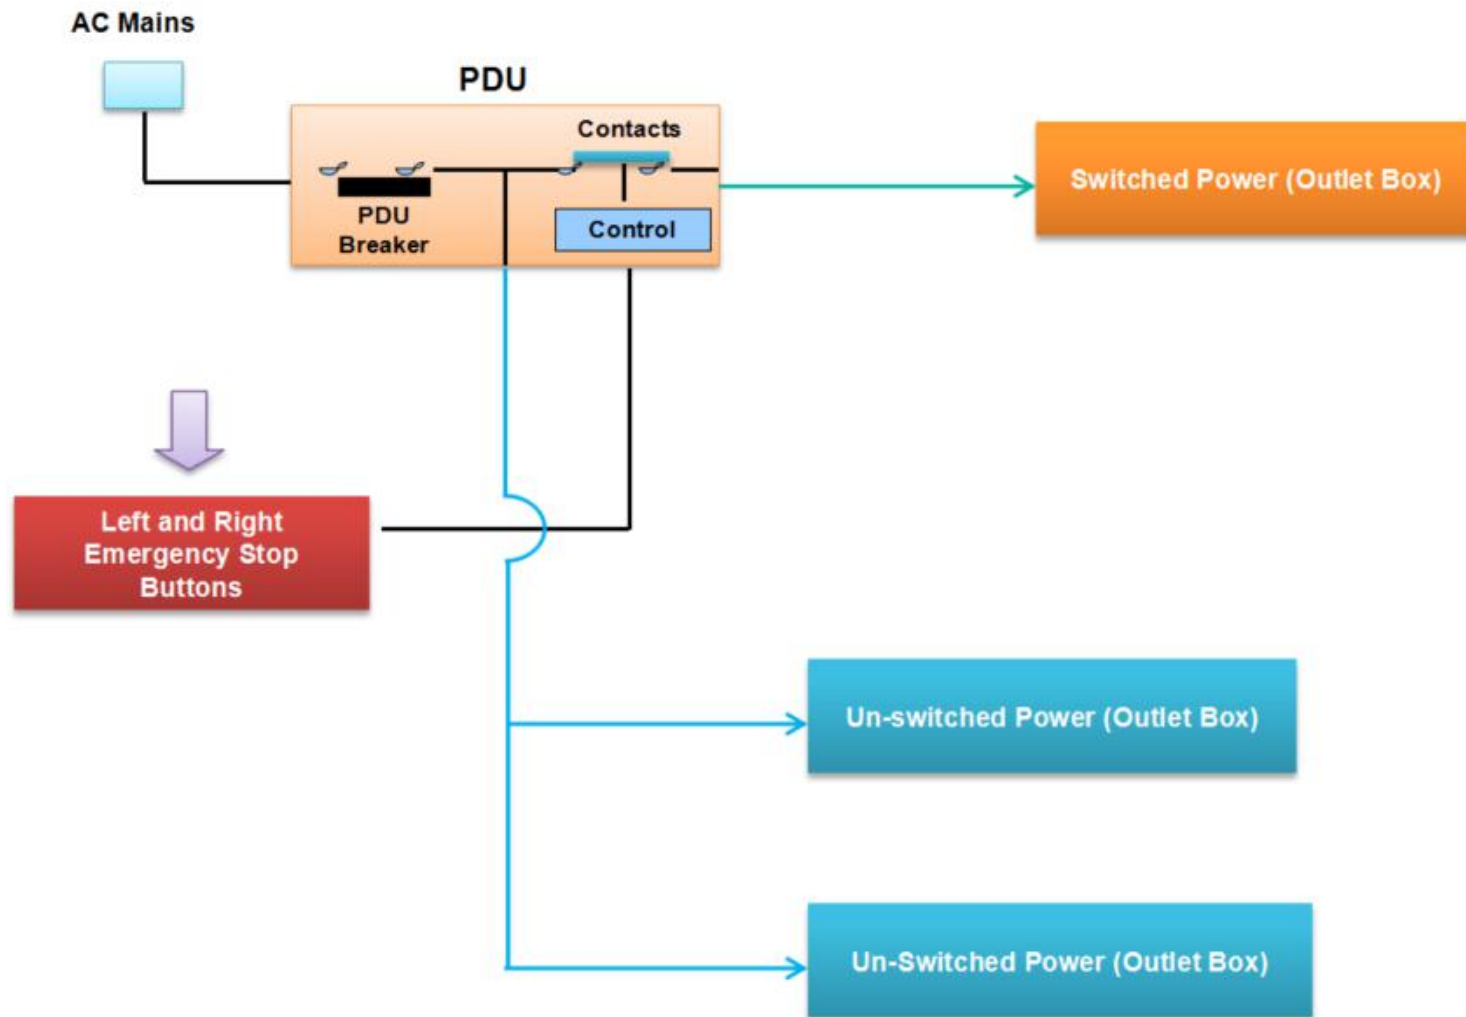



Hardware Overview - Outlet Box

Automated Board Inspection

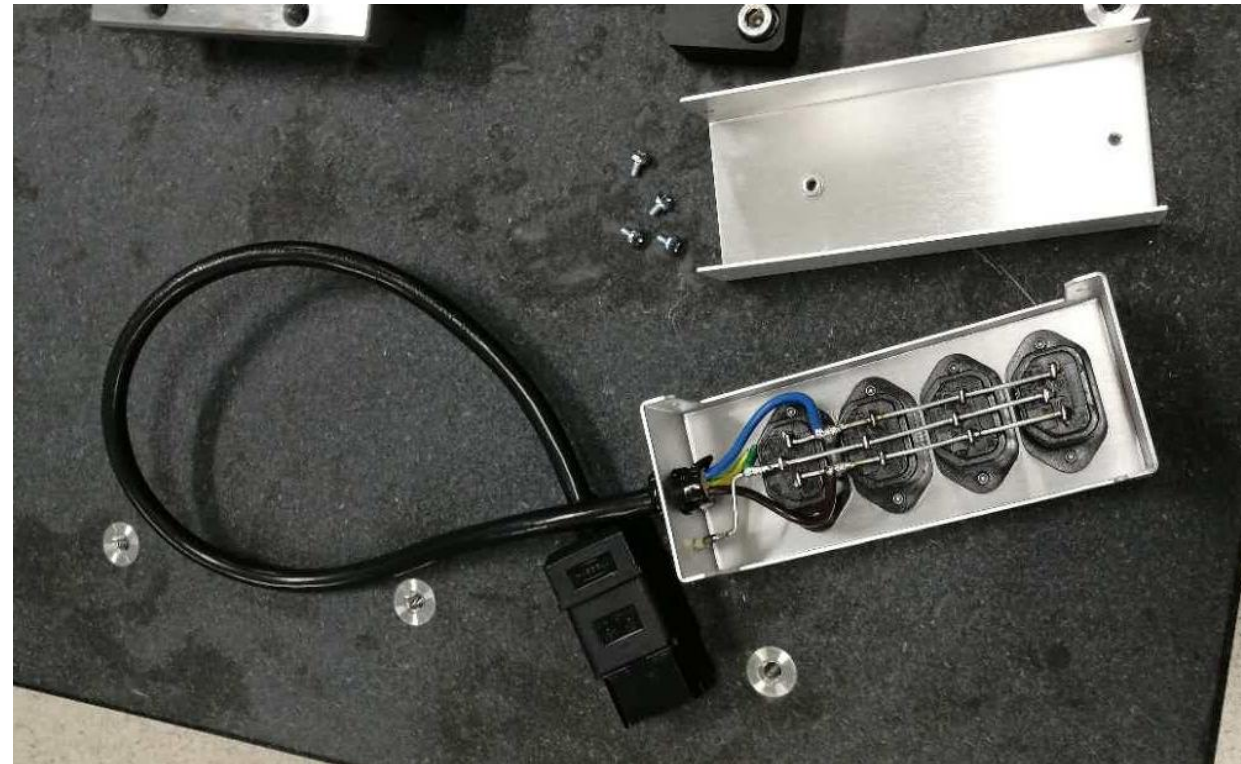




Automated Board Inspection

Switched Power Outlet Box Location



Center Rack

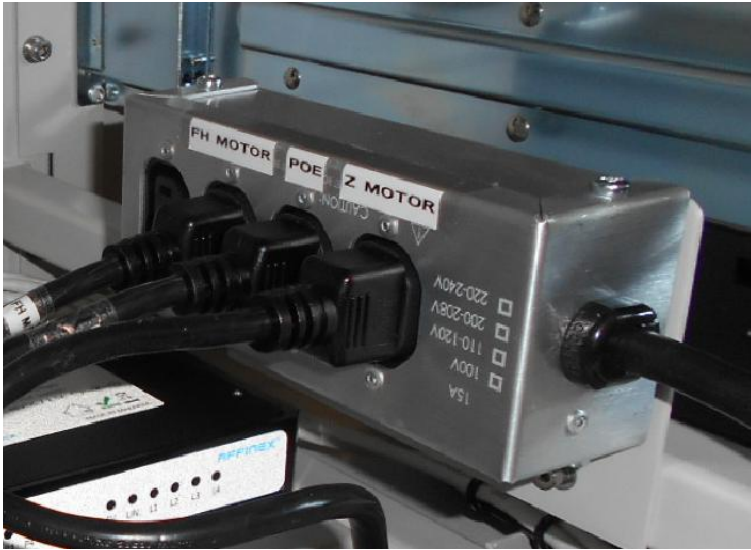

Switched Power Outlet Box

Location	Device
Switched Power Outlet Box	Filter Height Motor
Switched Power Outlet Box	POE Switch (PSP 2 Ethernet Switch)
Switched Power Outlet Box	Z Axis Power Supply



Un-switched Power Outlet Box

Automated Board Inspection



Left Server Rack



Un-switched Power Outlet Box

Location	Device
Un-Switched Power Outlet Box	Atom PC (Remote Motion Server)
Un-Switched Power Outlet Box	Gigabit Switch
Un-Switched Power Outlet Box	Cabinet Service Lamp
Un-Switched Power Outlet Box	Left & Right Server Fan




Un-switched Power Outlet Box

Automated Board Inspection



Right Server Rack

Location	Device
Un-Switched Power Outlet Box	Super Micro Server Primary Power Supply
Un-Switched Power Outlet Box	Super Micro Server Secondary Power Supply
Un-Switched Power Outlet Box	Monitor

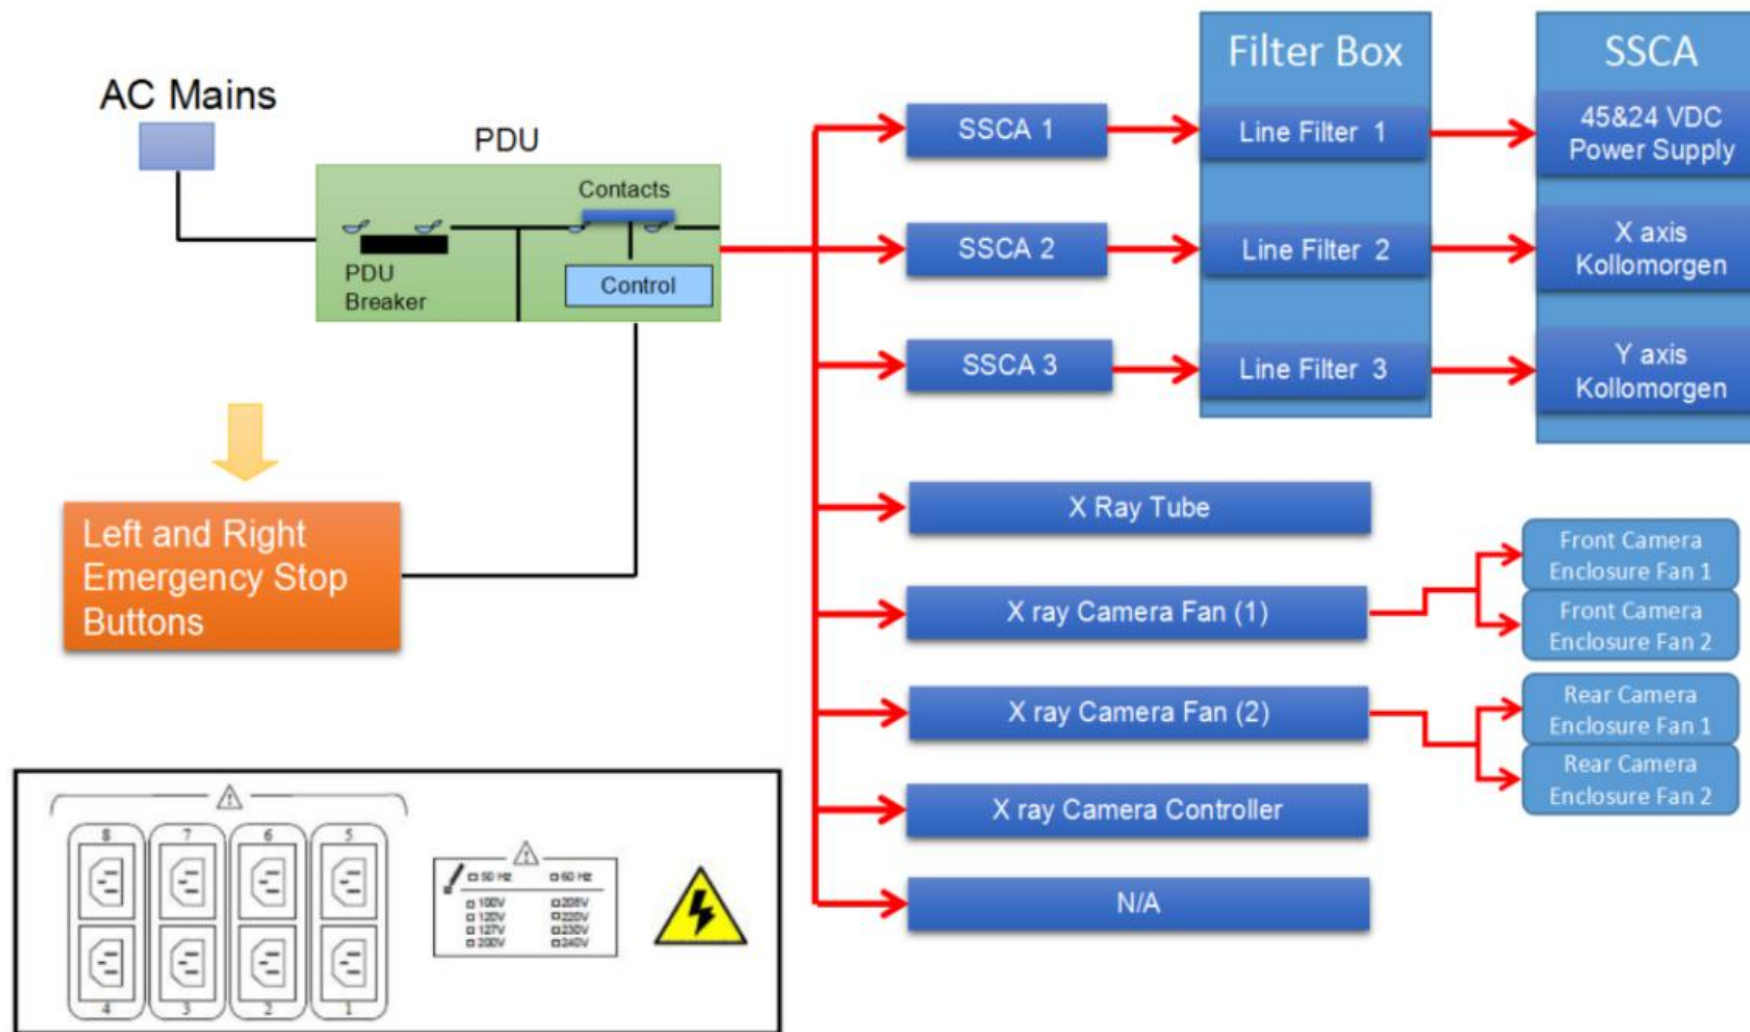


Switched Power (PDU Rear Outlet Number)
PDU Rear Pole do not have orientation, refer to cable label

ABI Line Filter Box

Automated Board Inspection



PDU Rear Pole do not have orientation, refer to cable label

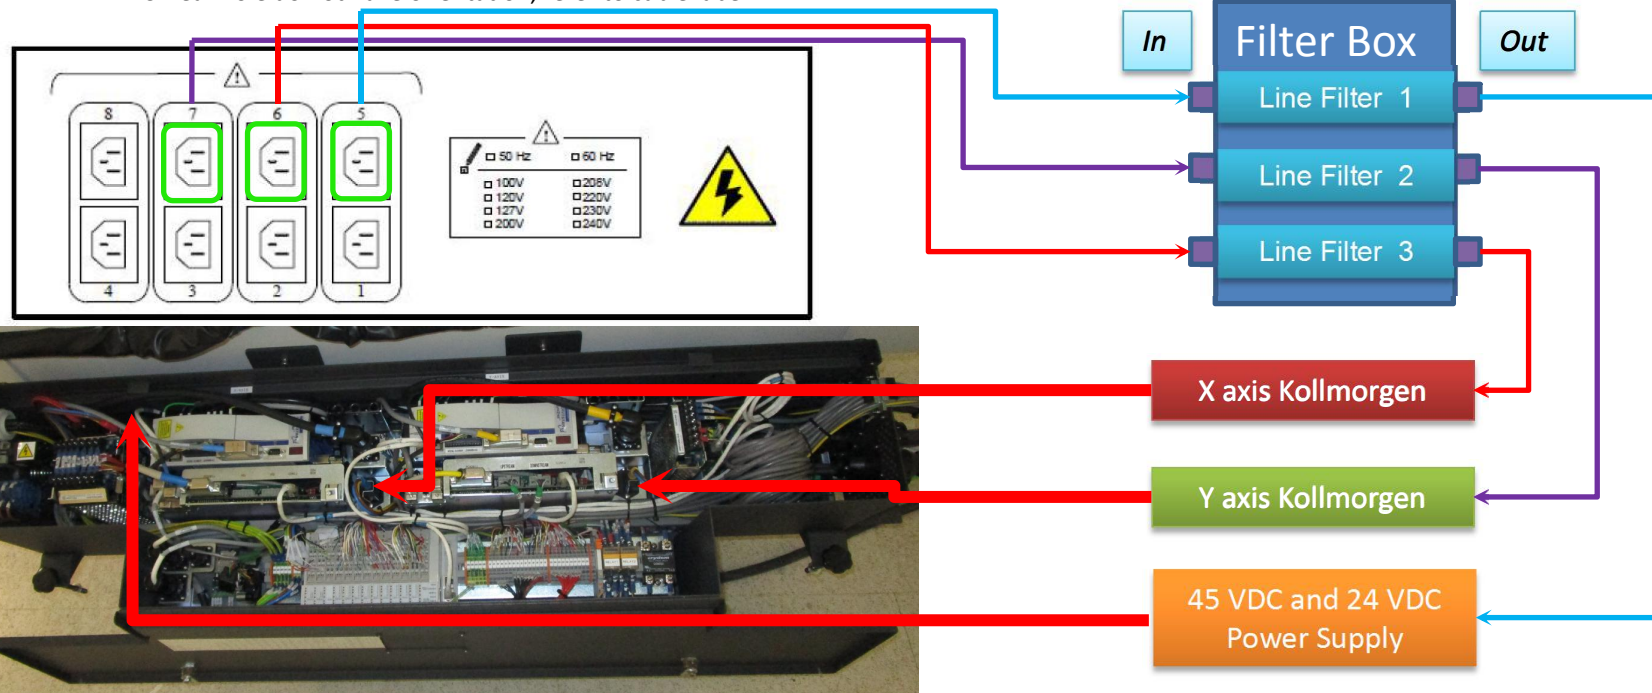



Line Filter Box

Automated Board Inspection




Side View



Internal View

ABI X ray Tube Power Supply

Automated Board Inspection

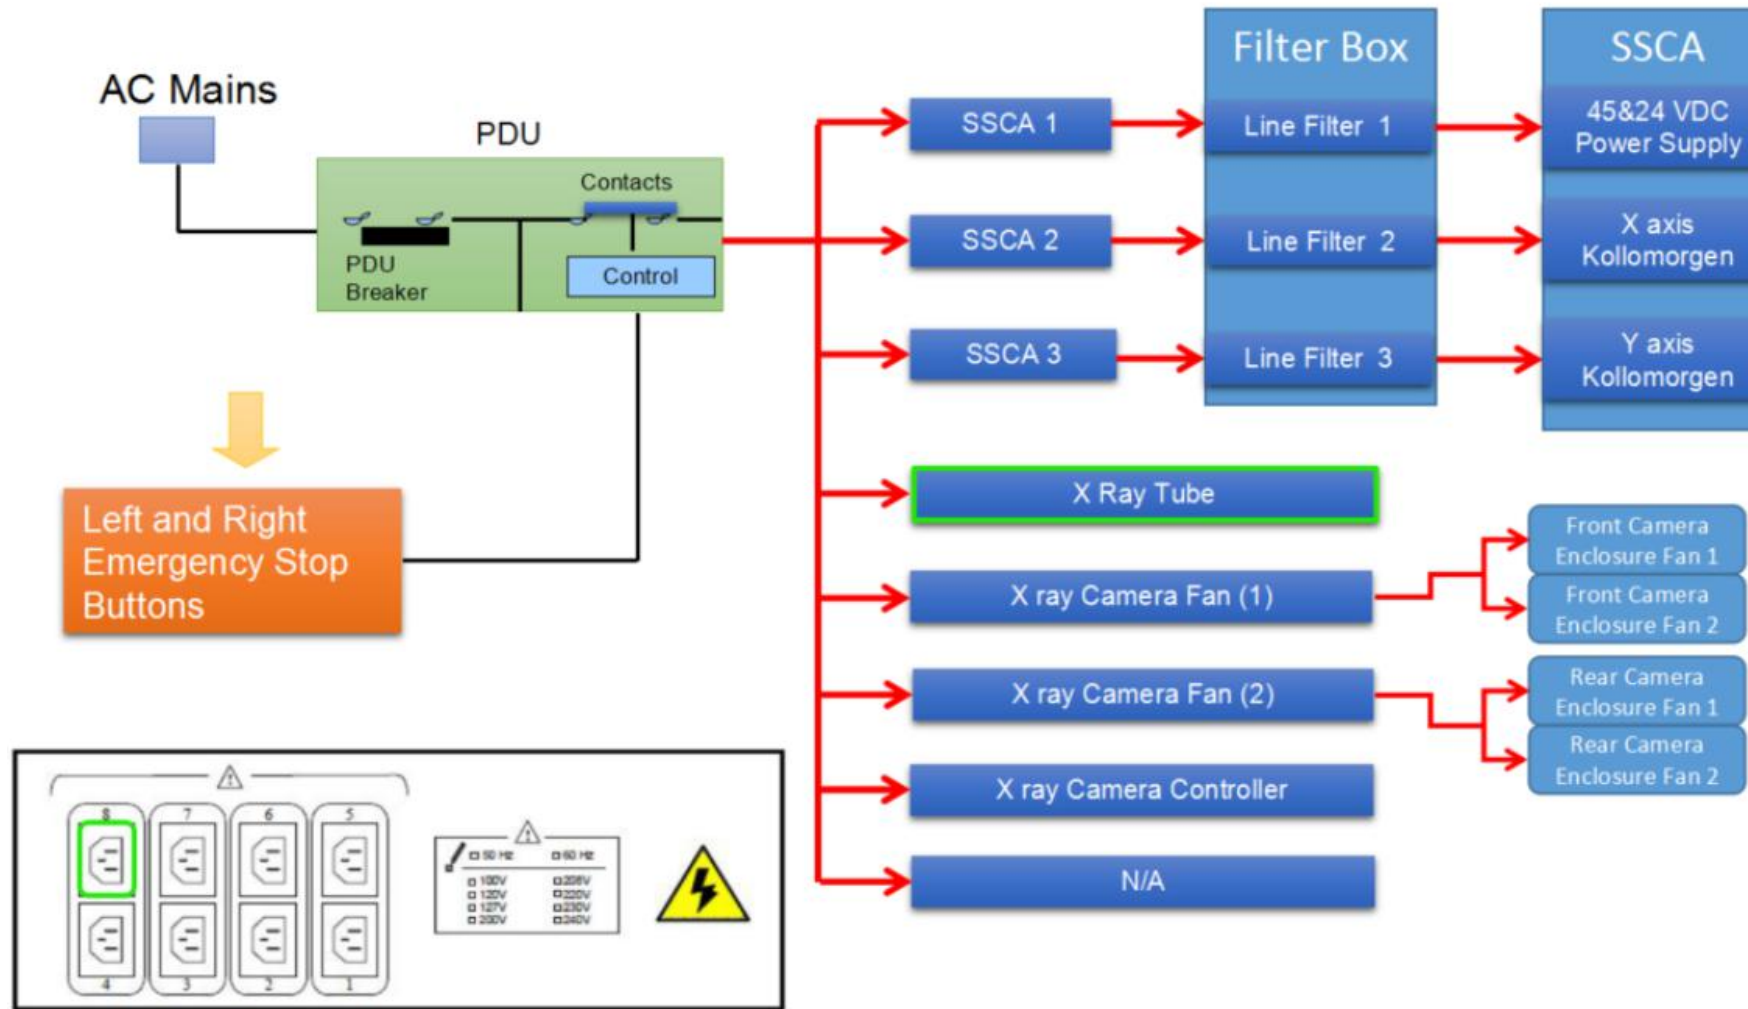

Switched Power (PDU Rear Outlet Number)


PDU Rear Pole do not have orientation, refer to cable label

ABI X ray Tube Power Supply

Automated Board Inspection

24 VDC Power Supply




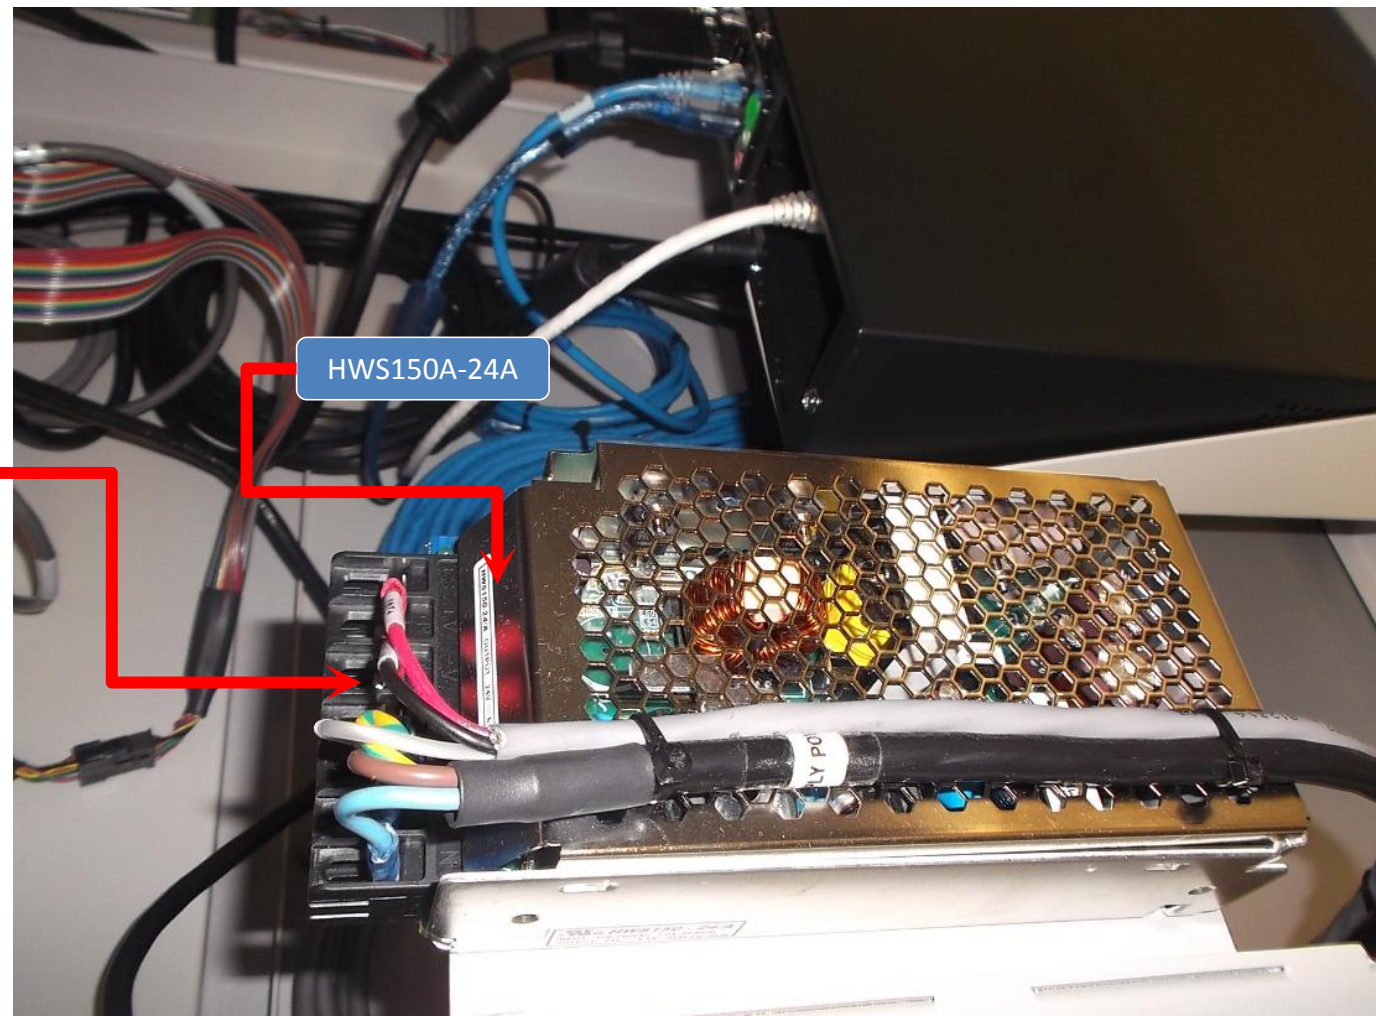

HWS150A-24A

ABI X ray Camera Controller

Automated Board Inspection

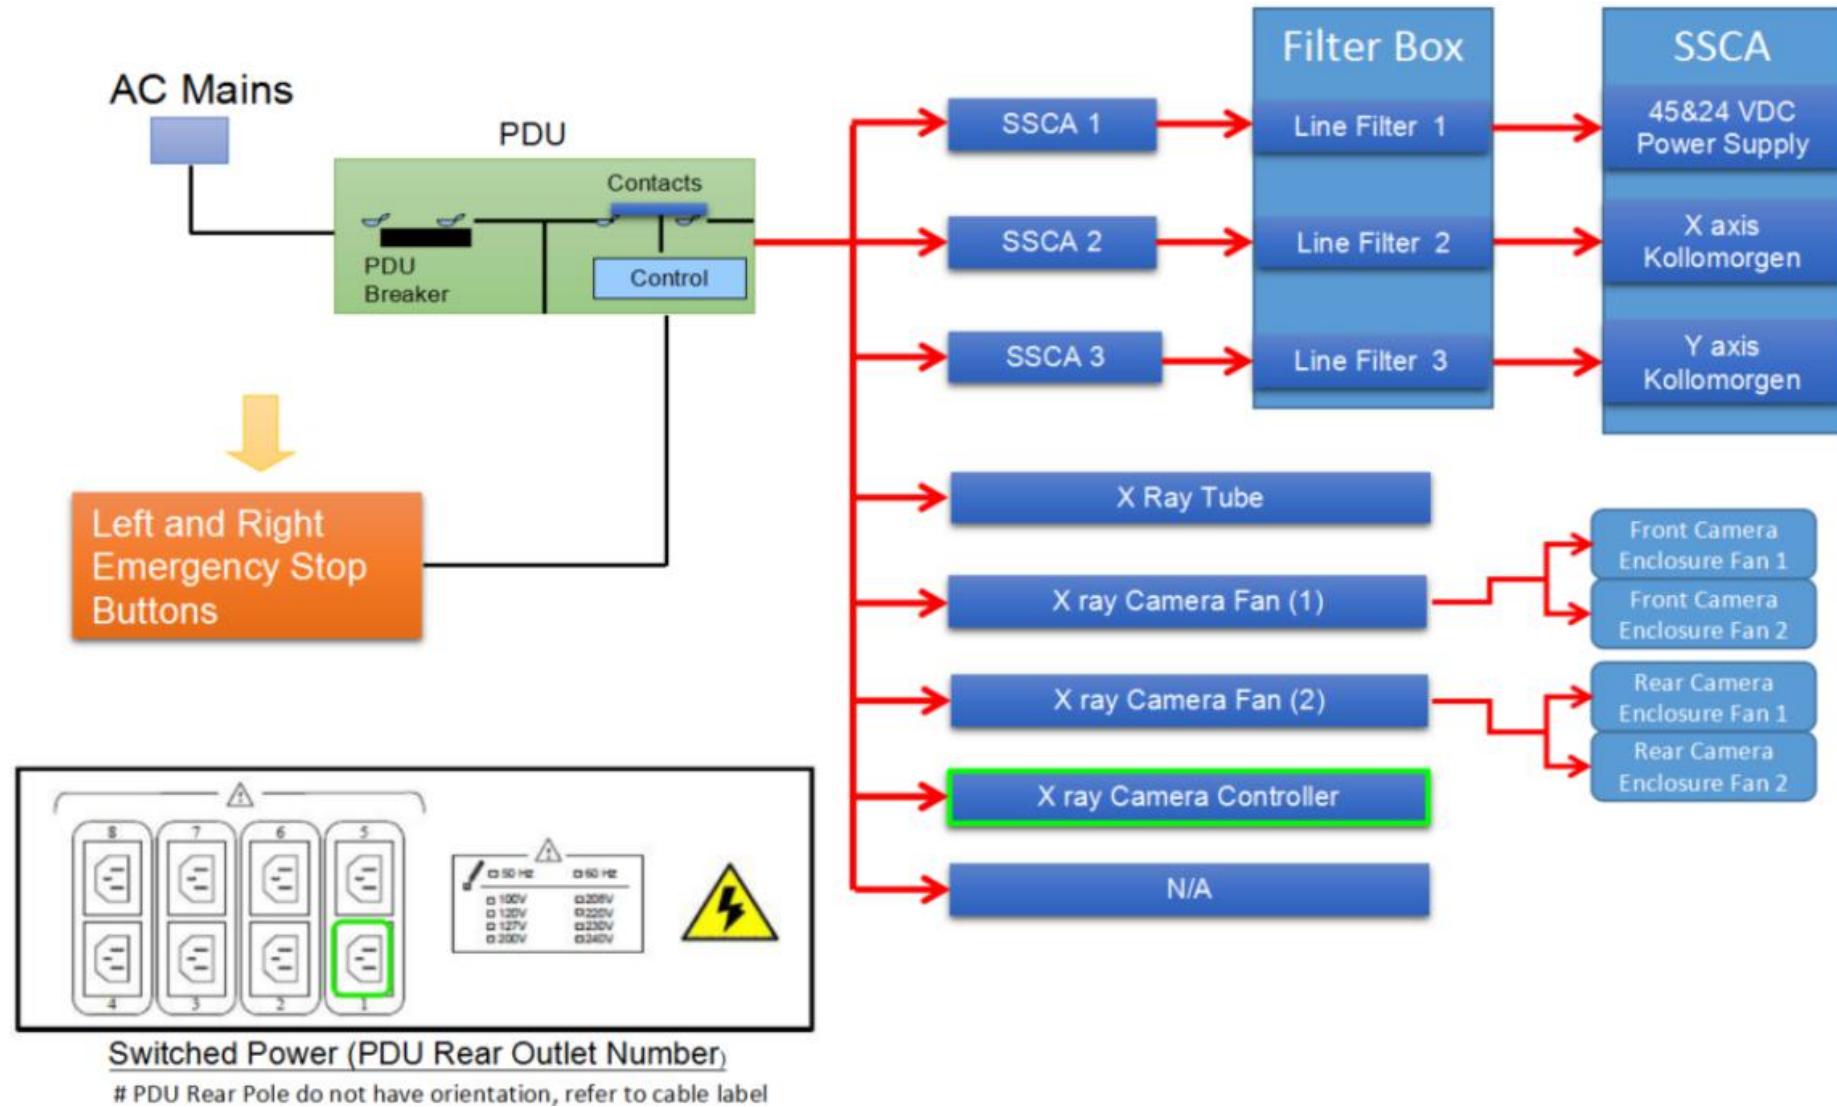



X ray Camera Controller

Automated Board Inspection




Fuse, 250vAC , 3A

ABI X ray Camera Controller


Automated Board Inspection

24 VDC Power Supply

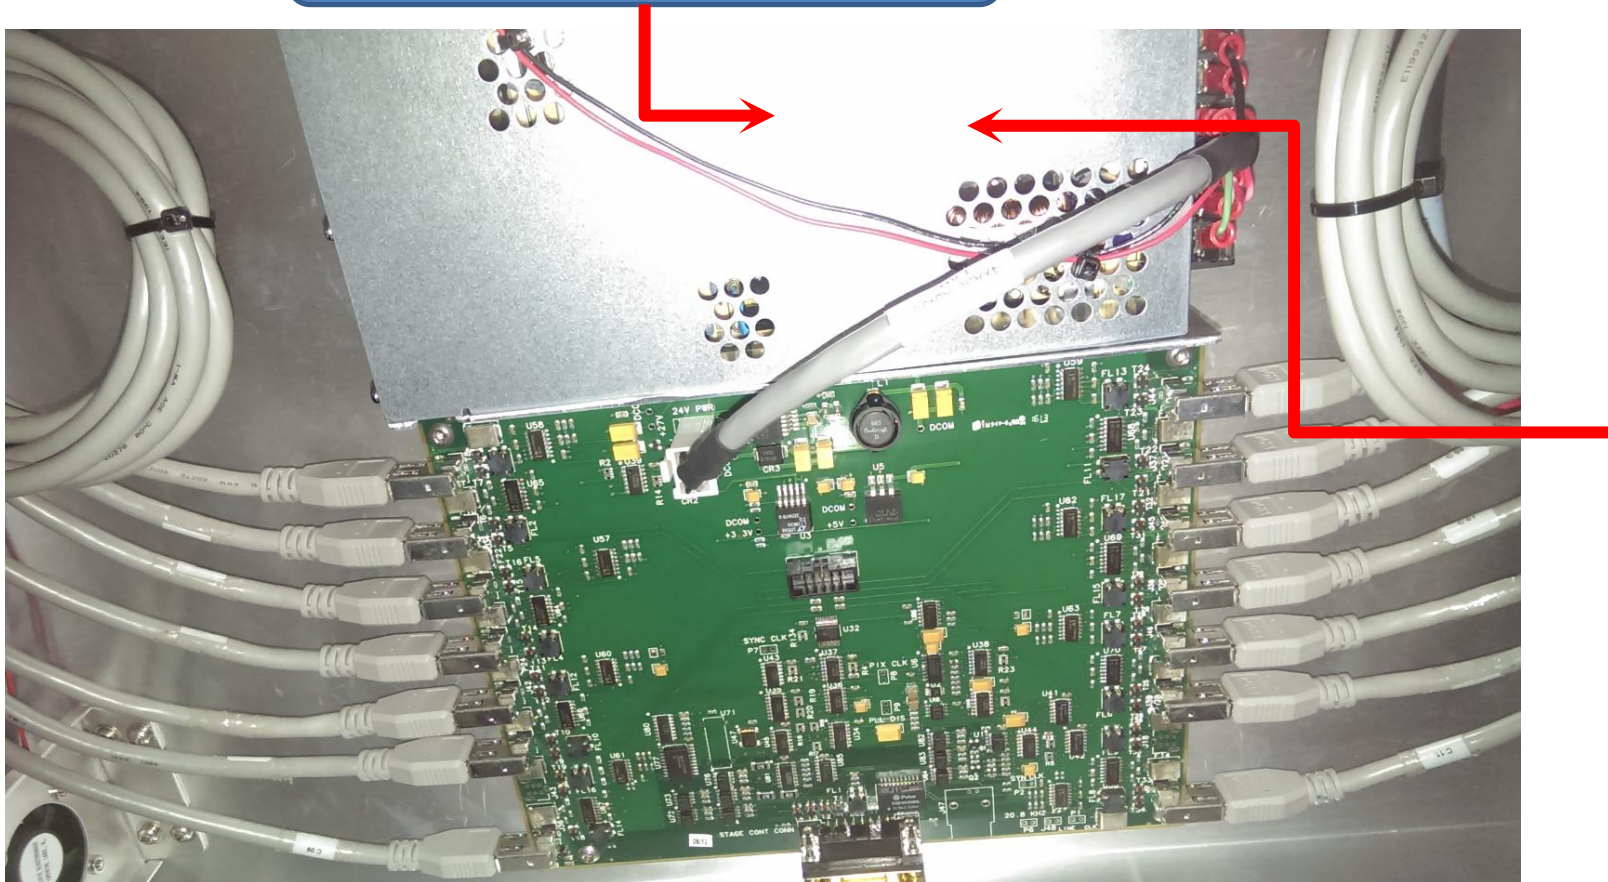


ABI X ray Camera Controller

Automated Board Inspection

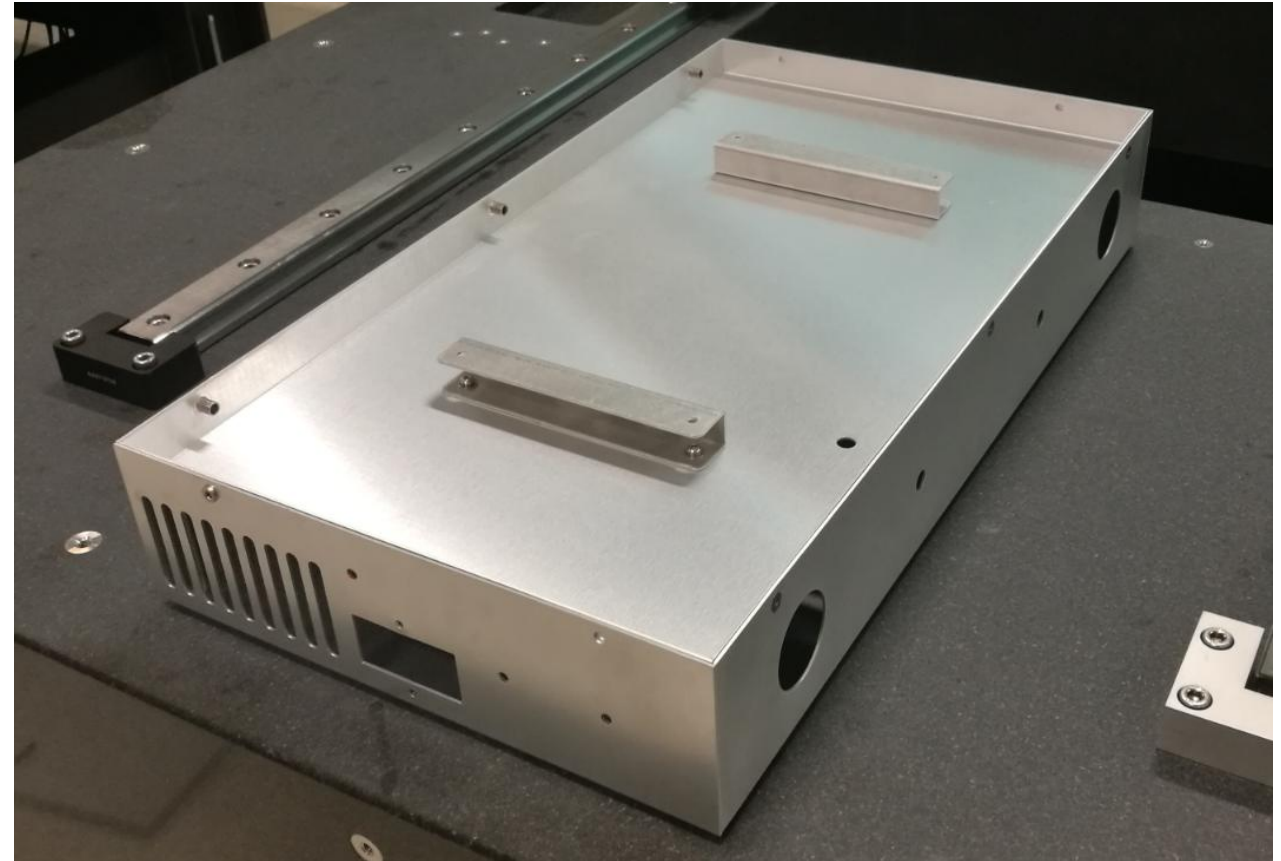

ABI X ray Camera Cooling Fan


Automated Board Inspection

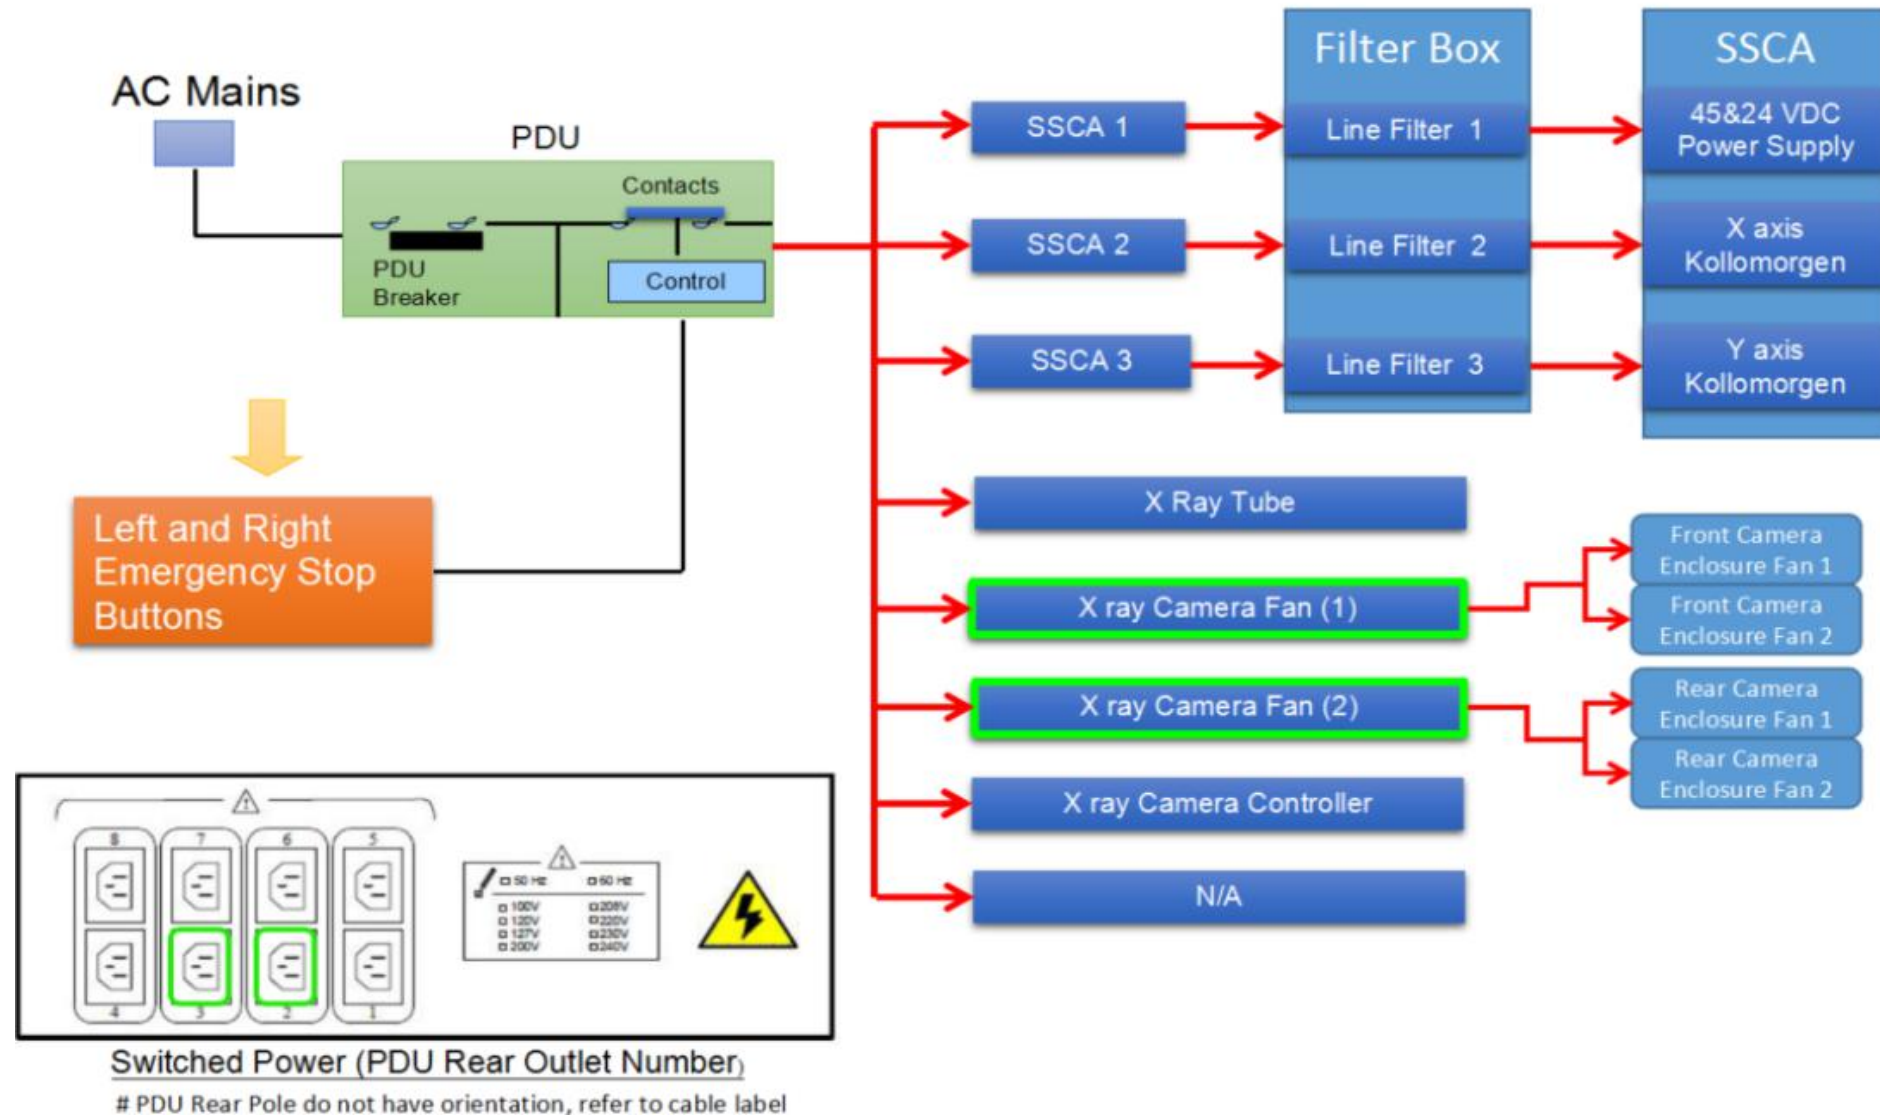






X ray Camera Cooling Fan


Automated Board Inspection


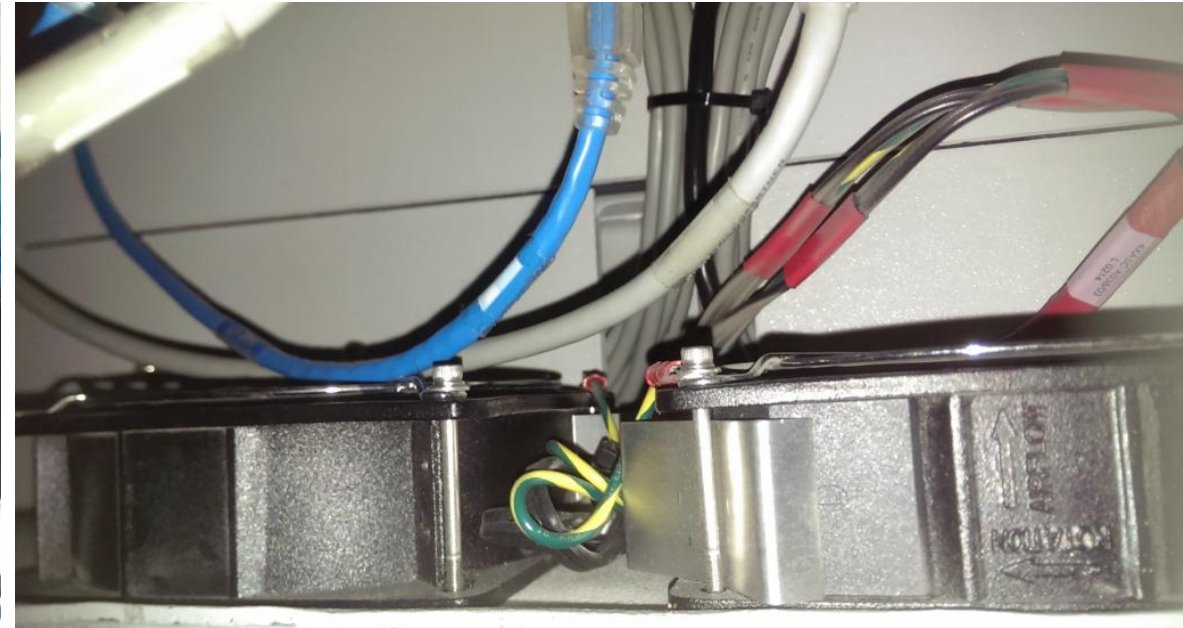


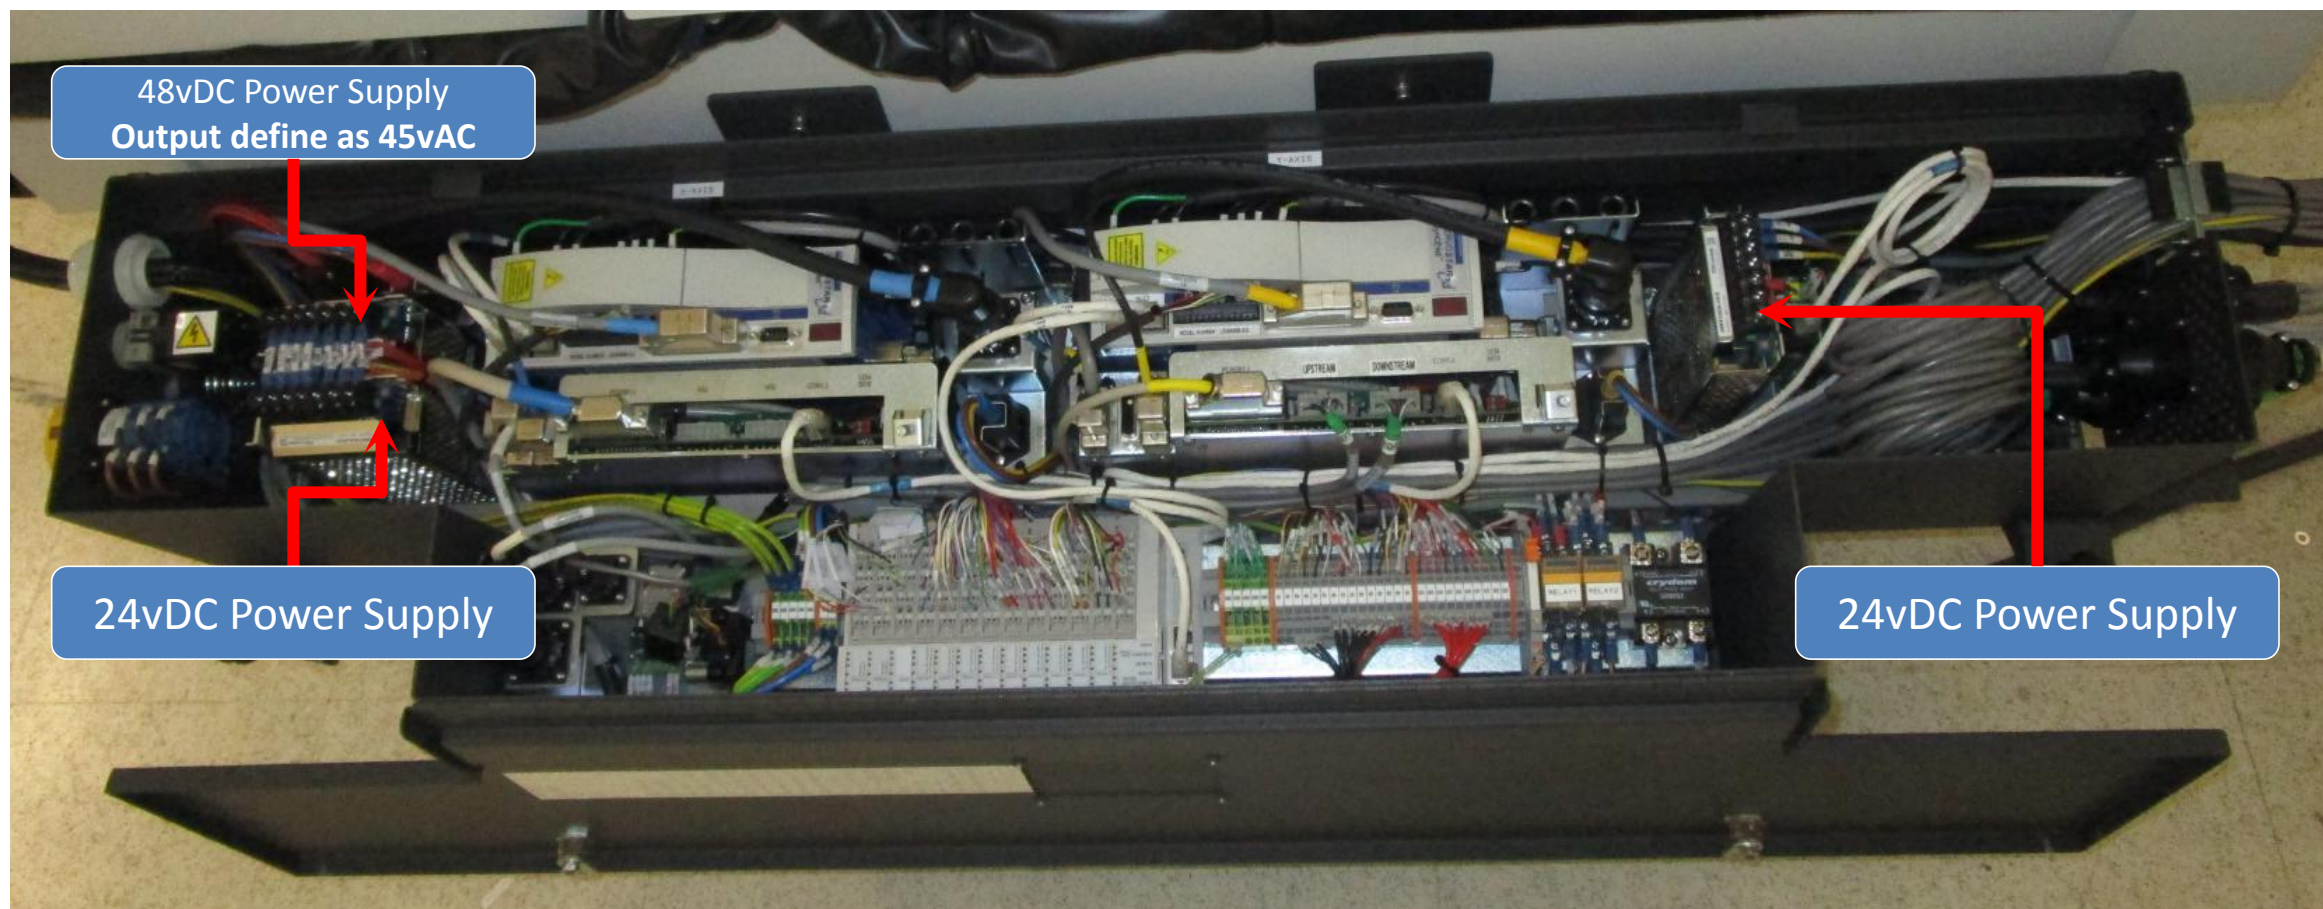

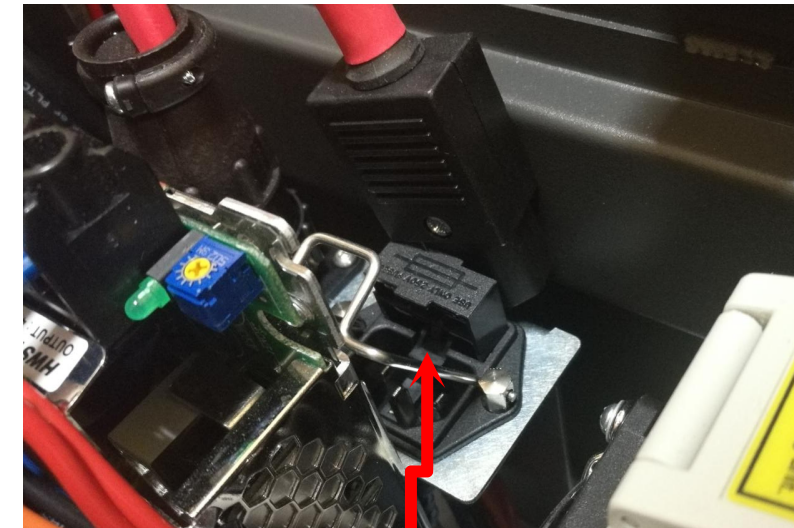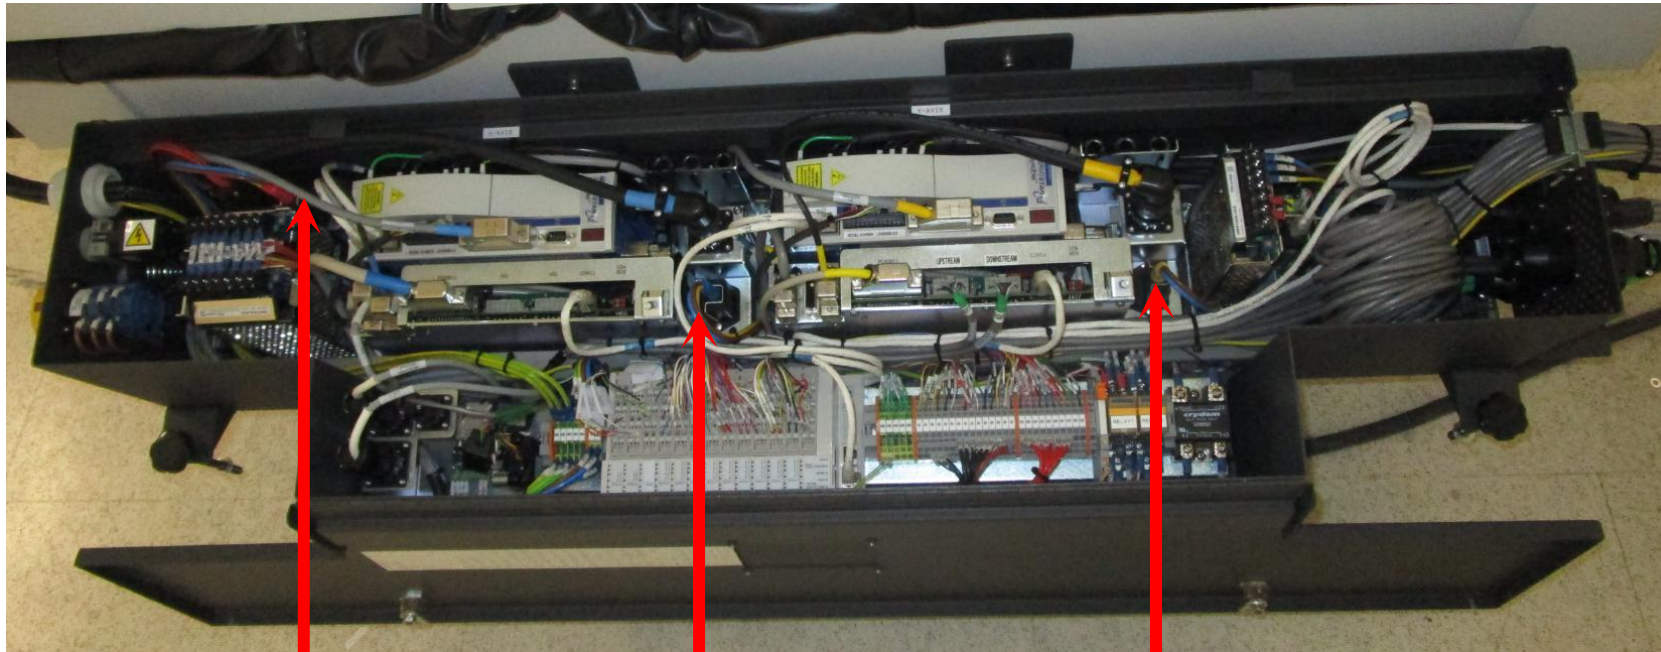

Fuse, 250vAC , 10Amp

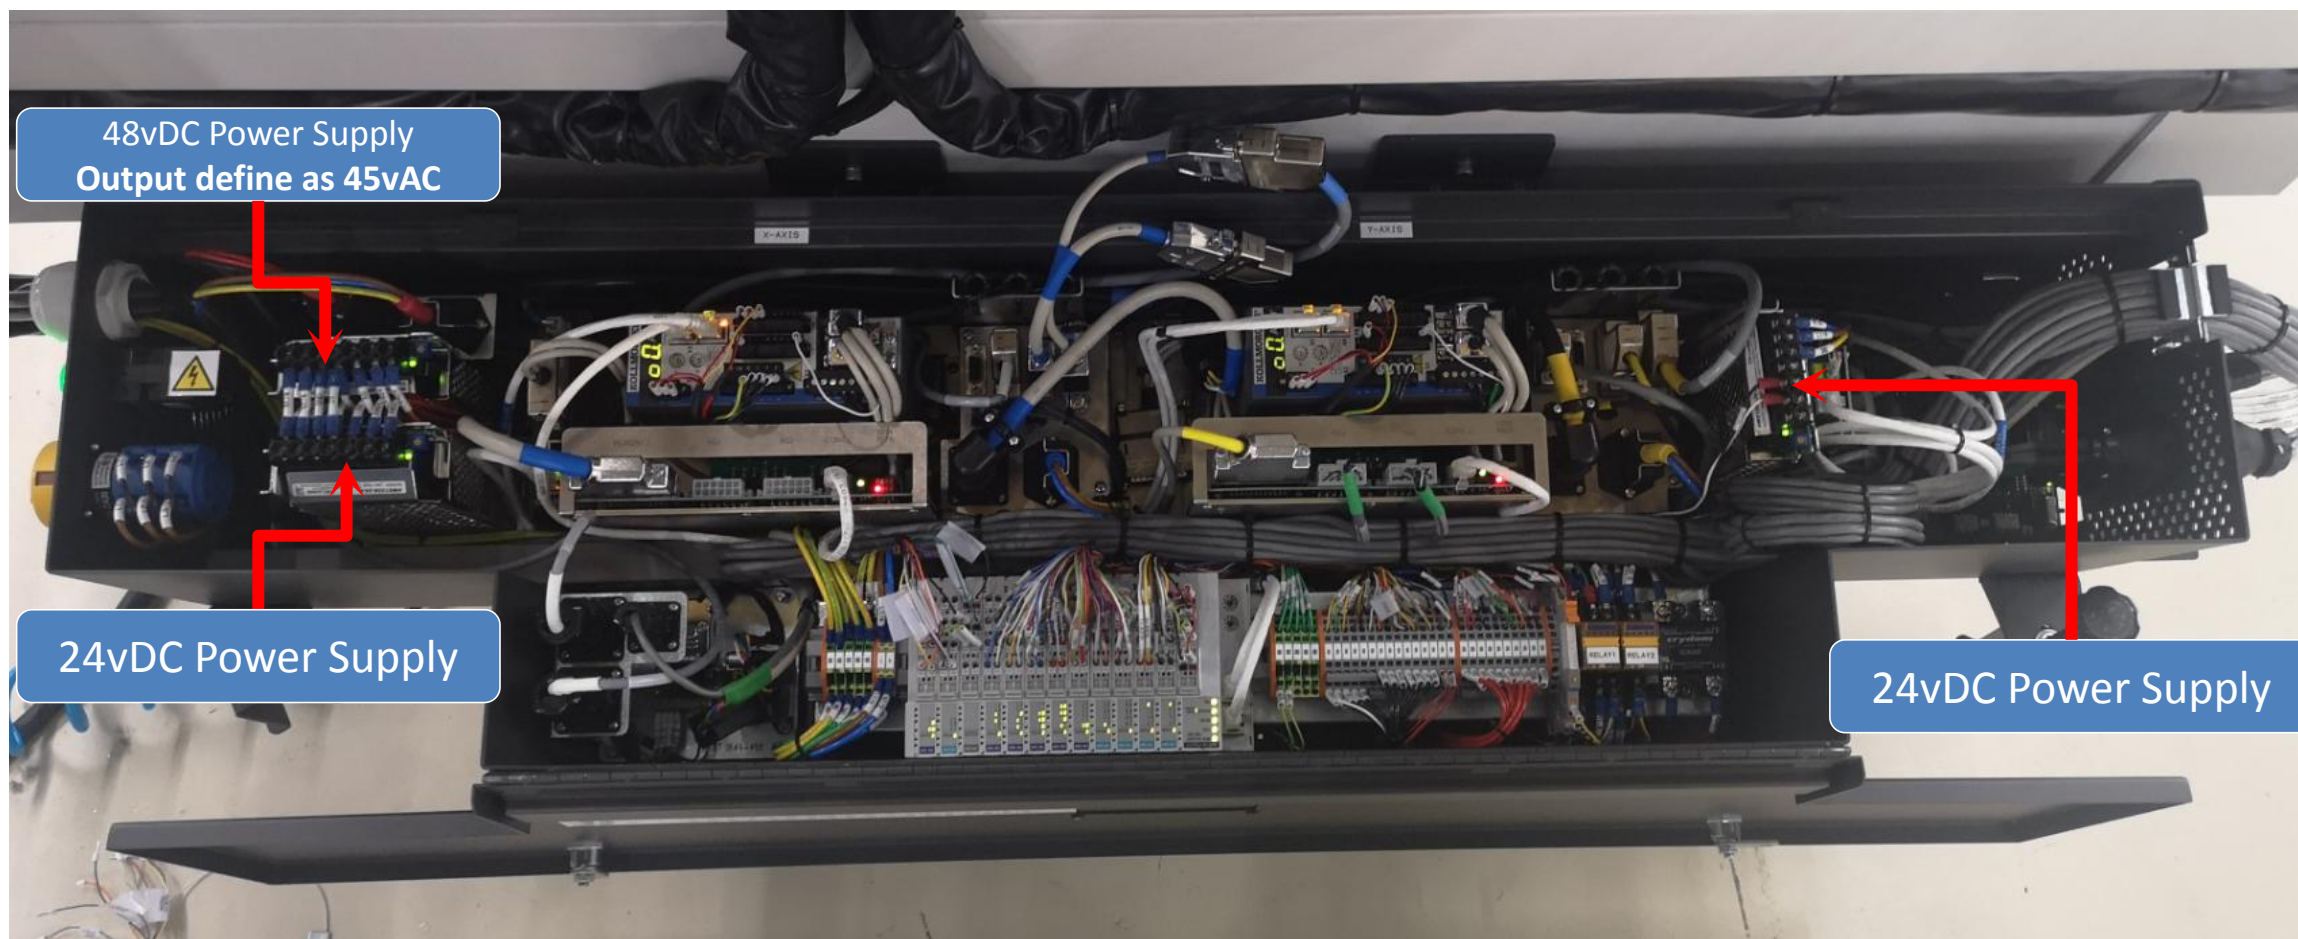

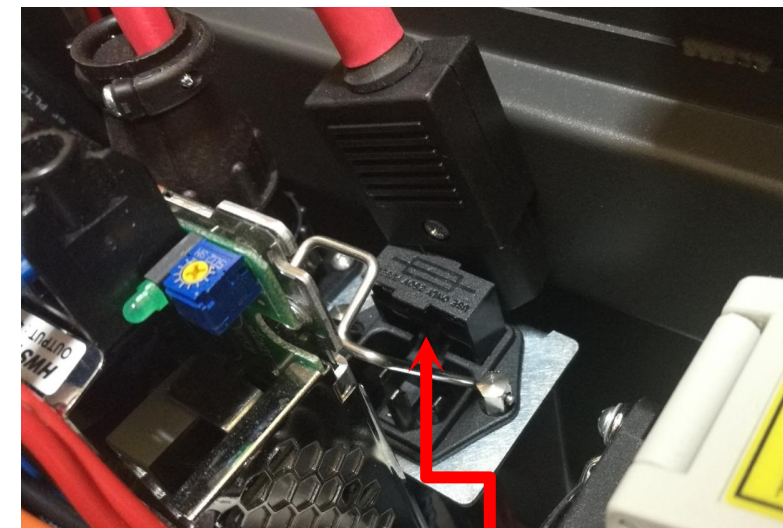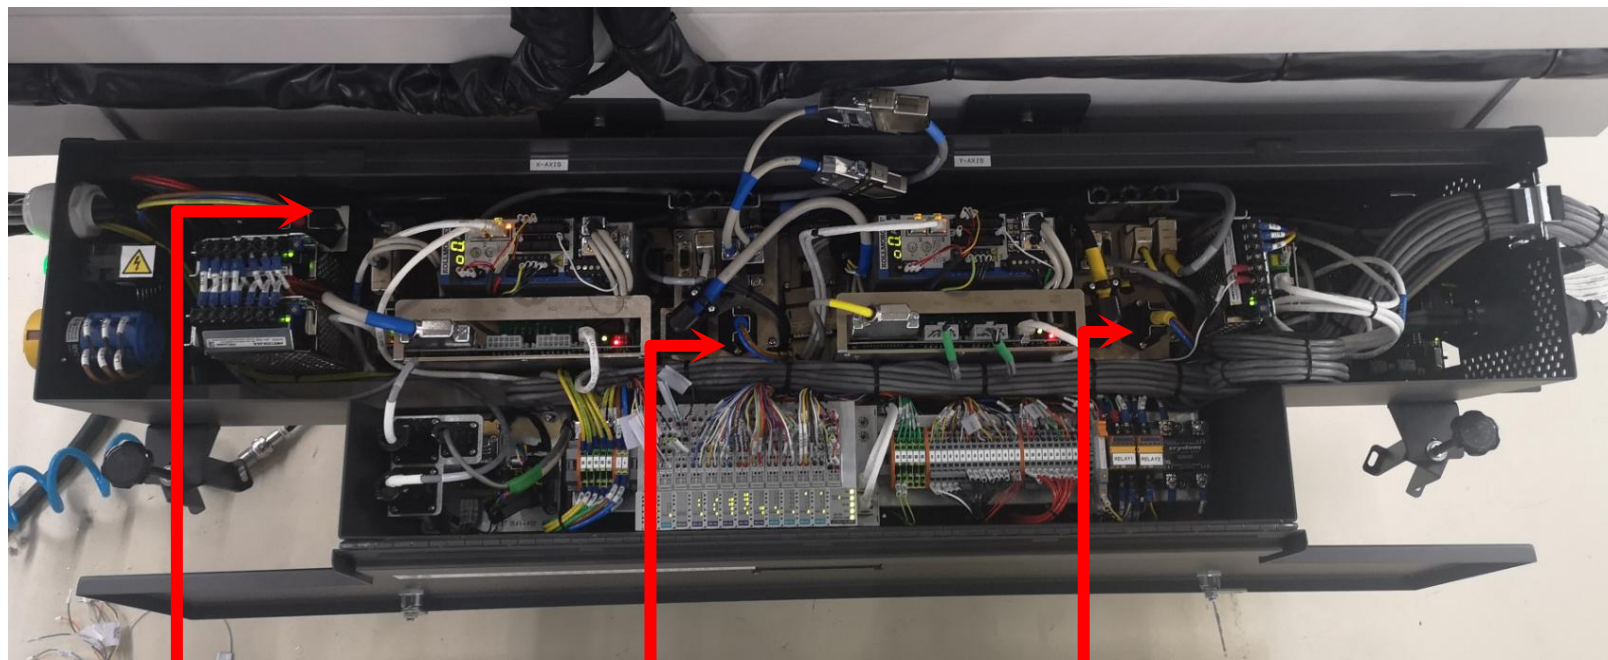


Fuse, 250vAC , 10Amp

ABI Hardware Overview - SSCA Power Supply

Automated Board Inspection


48vDC Power Supply
Output define as 45vAC

24vDC
Power
Supply

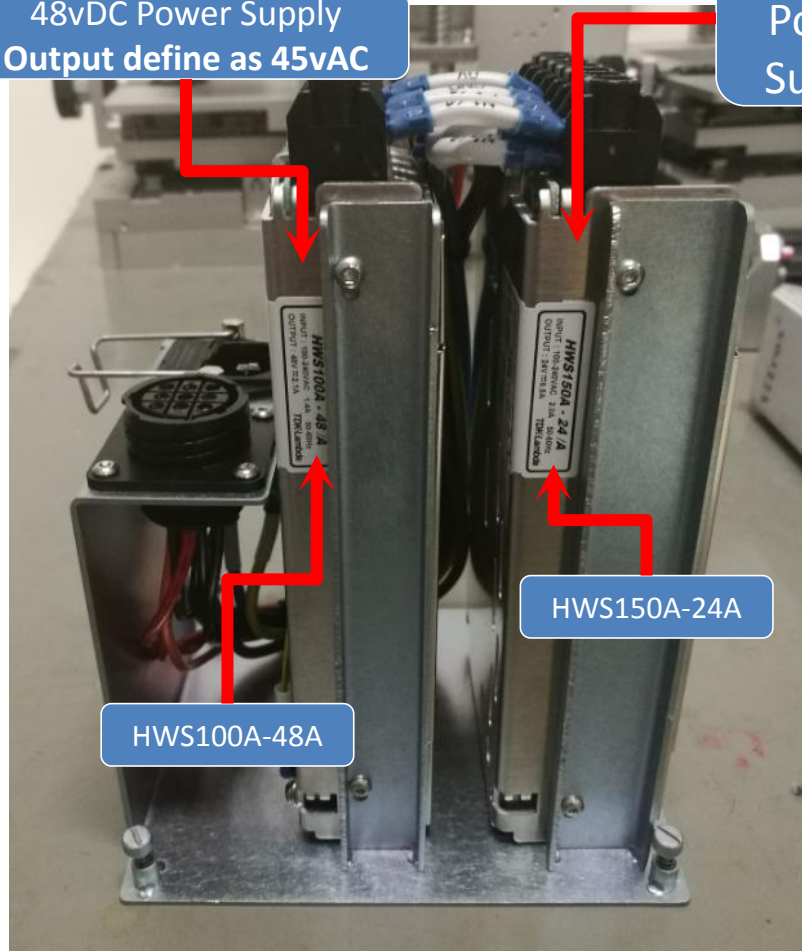

Side View


Fuse
250vAC,
10amp

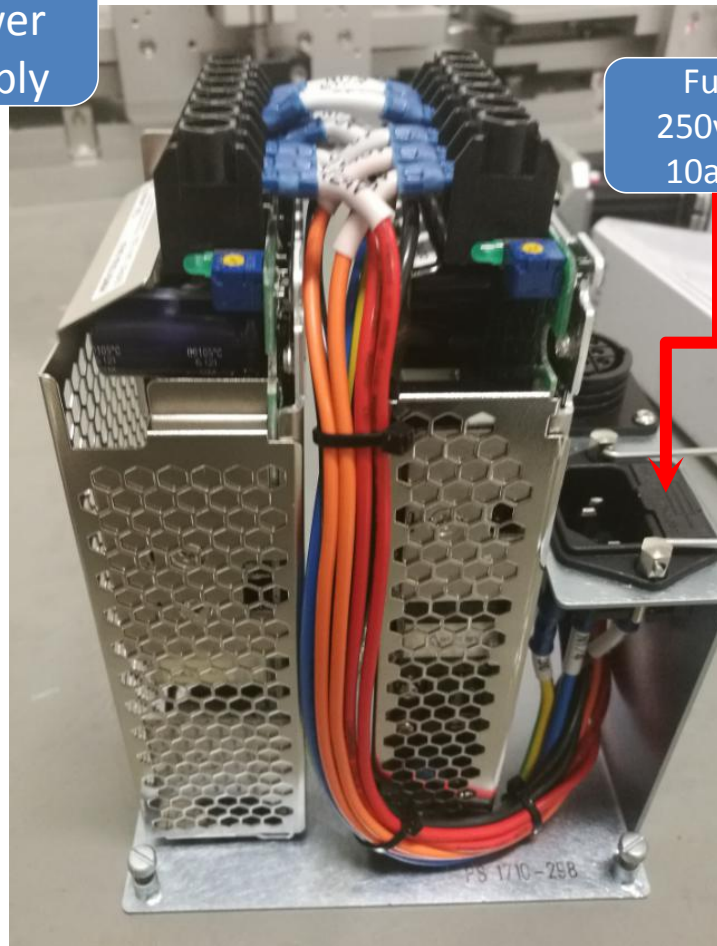

Top View





Conveyor belt motor
24vDC Power Supply

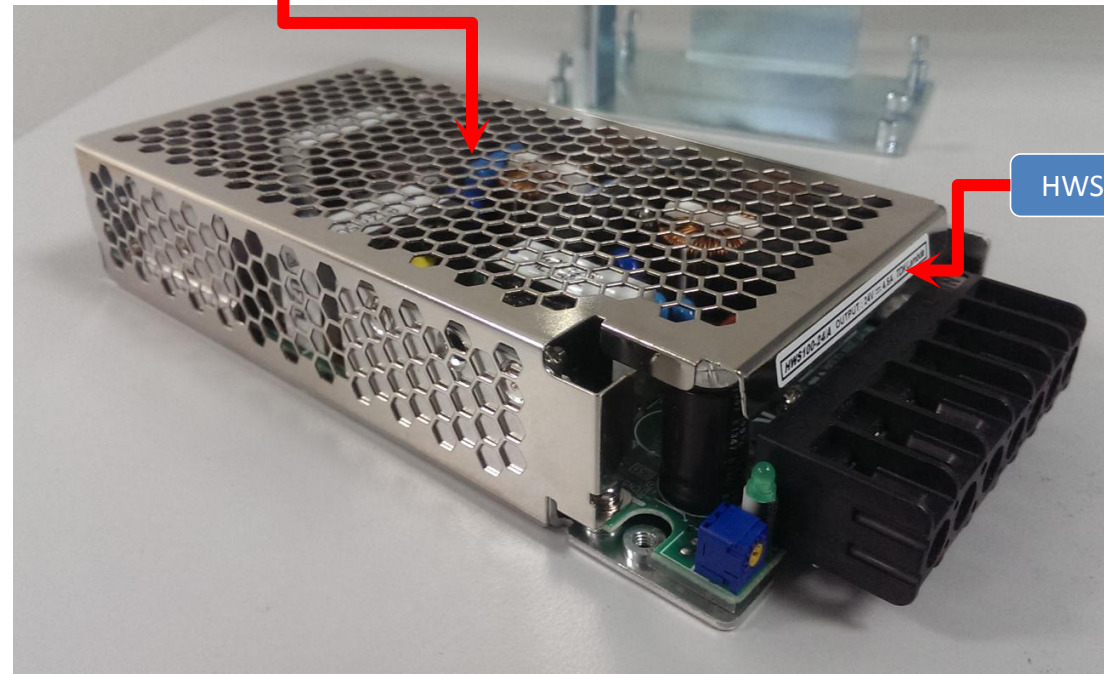


HWS100A-24A

Automated Board Inspection

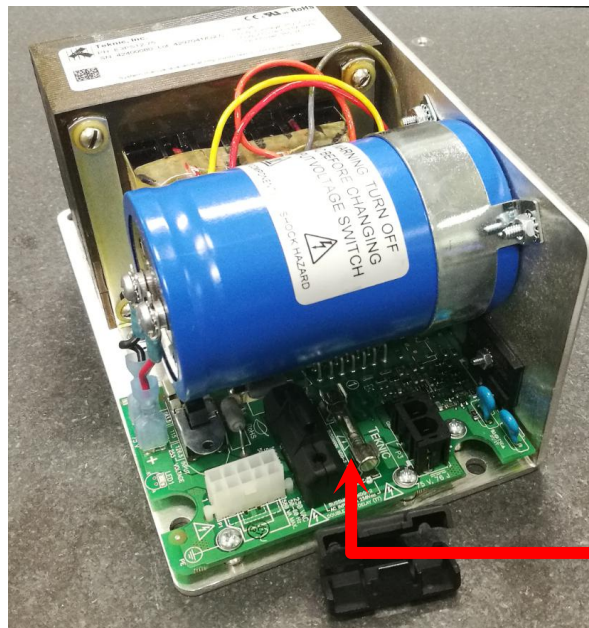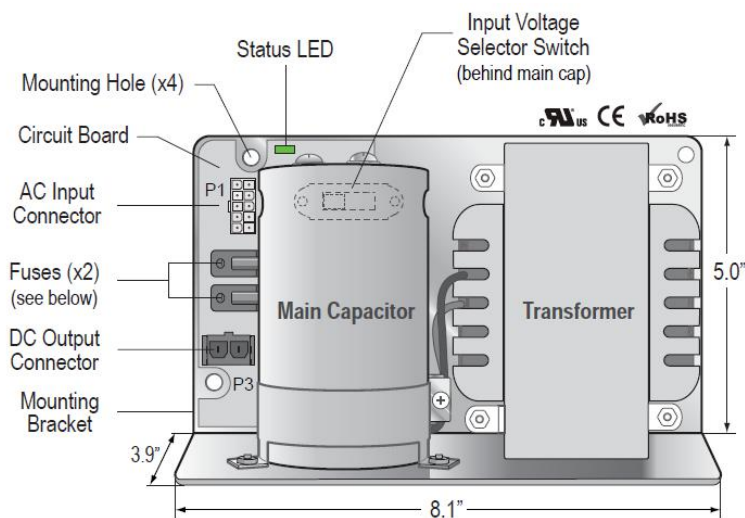


FUSE, 3AB, 2A, SLOW BLOW,
250VAC

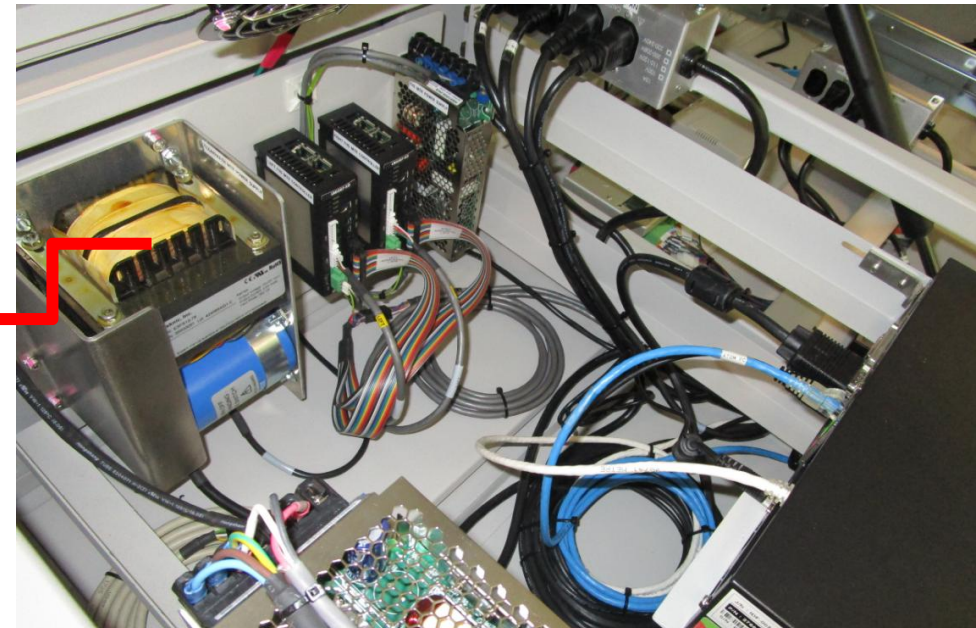

Setting The Input Voltage Selector Switch

The Input Voltage Selector Switch is a 3-position slide switch located behind the supply's main capacitor. It is used to select one of three tap points on the main transformer, providing a convenient way to adjust for low, medium, or high local line voltage.

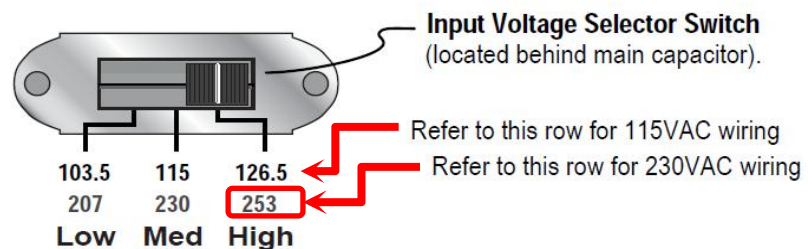

Procedure: Setting The Input Voltage Selector Switch



Note: Remove AC power and discharge supply before adjusting.

1. Initially set switch to **High** voltage setting as shown above.
2. Turn on AC line power to supply.
3. Status LED should blink rapidly (16 Hz).
4. Move switch to progressively lower settings until Status LED turns on solid.
5. Back up one position until Status LED blinks rapidly.
(Most applications use the center (Med) position.)




LED Blink Codes (Note: LED is off when DC voltage < 25 VDC)

Condition	LED Behavior	User Action	LED Blink Frequency	Duty Cycle (% on)
On-Normal	Rapid Blink: Normal operating mode.	No action required.	16 Hz	50%
Input Voltage Switch set incorrectly.	On Solid: DC output voltage is set too high! Remove power and adjust Voltage Selector Switch as described at right.	Move Input Voltage Selector Switch to higher setting. Rapid blink will occur when the Voltage Selector Switch is set correctly.	—	100%
Regen Event Occurred	Blink: Normal operating mode. A regen event occurred at least once since AC power was last applied.	No action required. This is an informational code that will not affect power supply operation. Note: blink code will persist until AC power is cycled.	3 Hz	50%
Regen Capacity Exceeded	Strobe: Continuous regen capacity was exceeded since AC power was last applied.	Upgrade to higher regen capacity supply. Note: blink code will persist until AC power is cycled.	0.5 Hz	2.5%

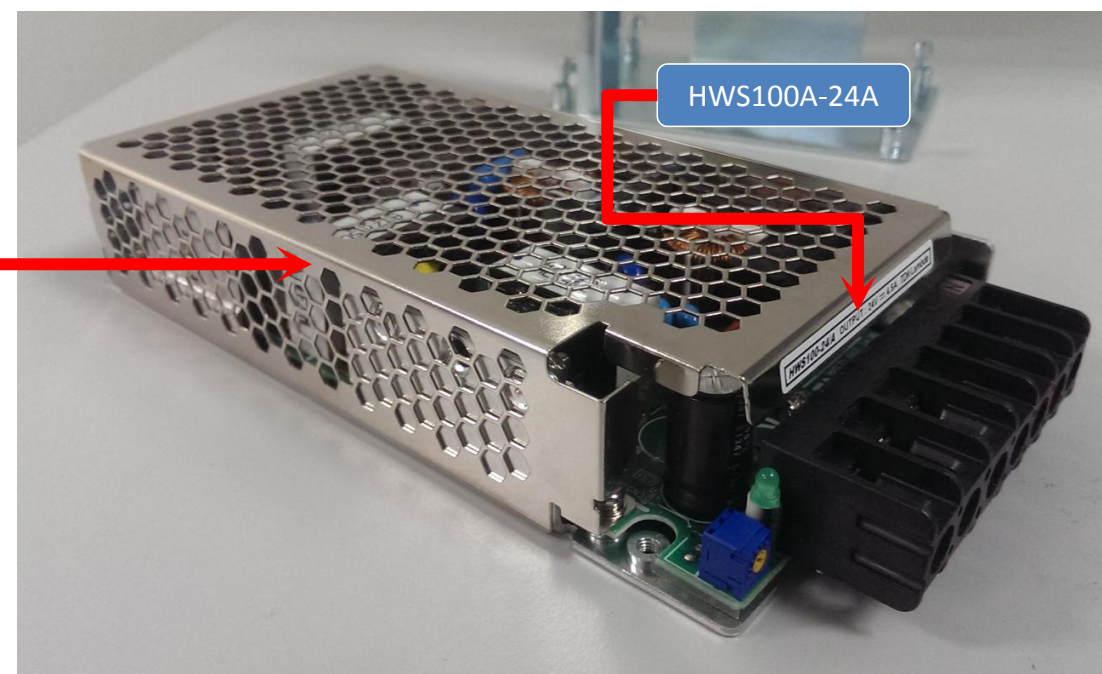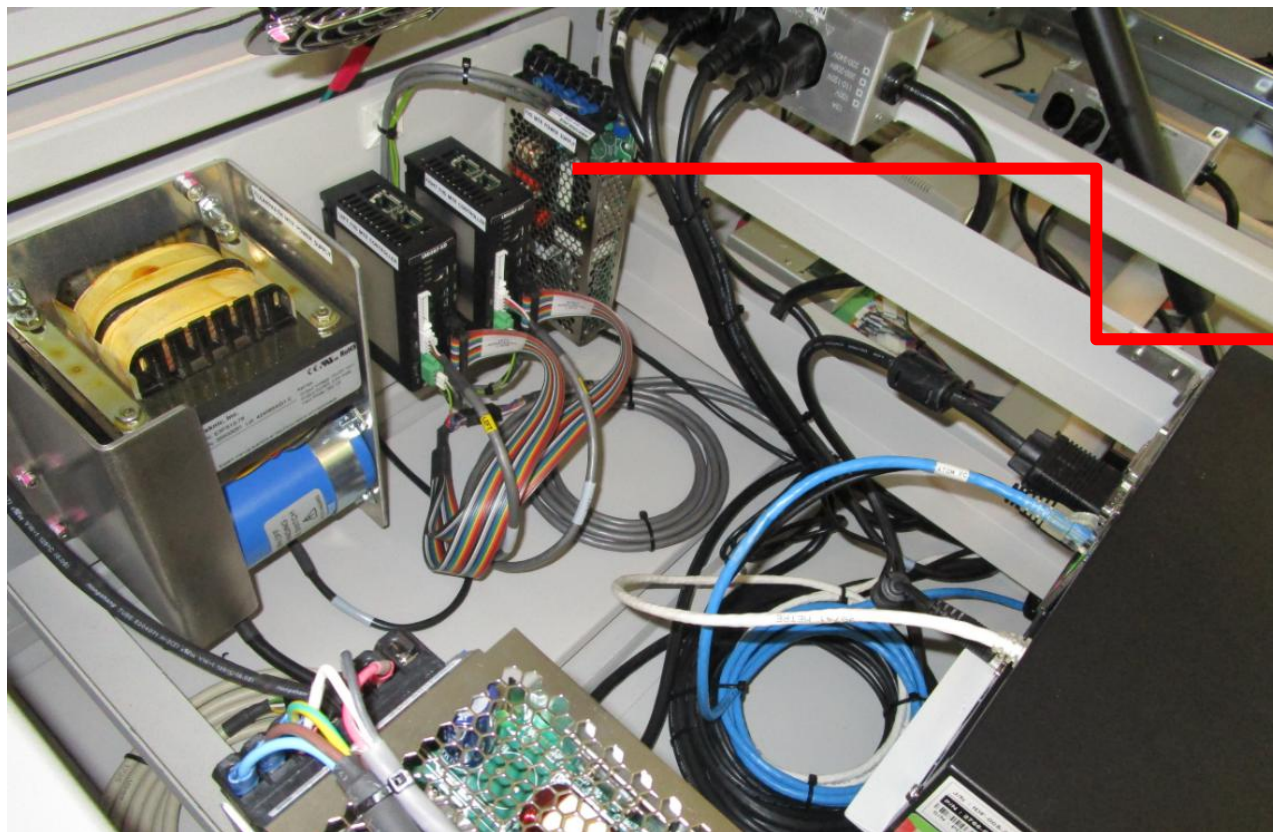



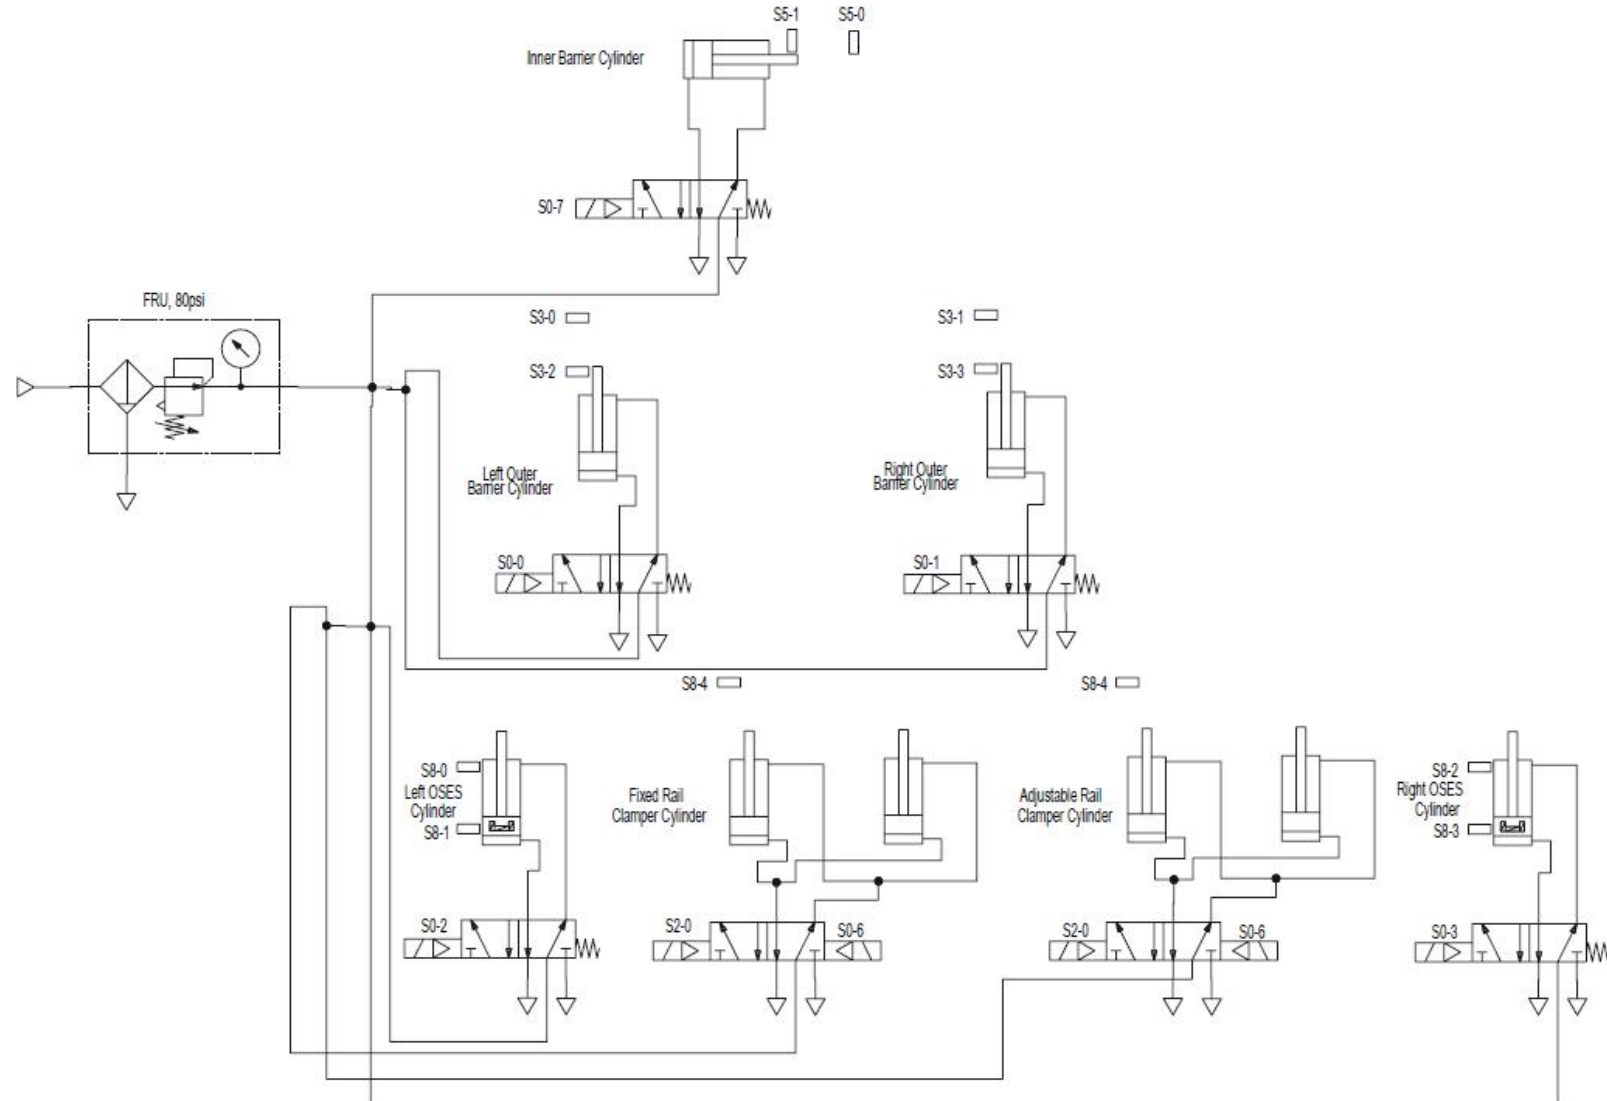




Hardware Overview - Pneumatic Subsystem - Main Air Regulator

Automated Board Inspection



Automated Board Inspection

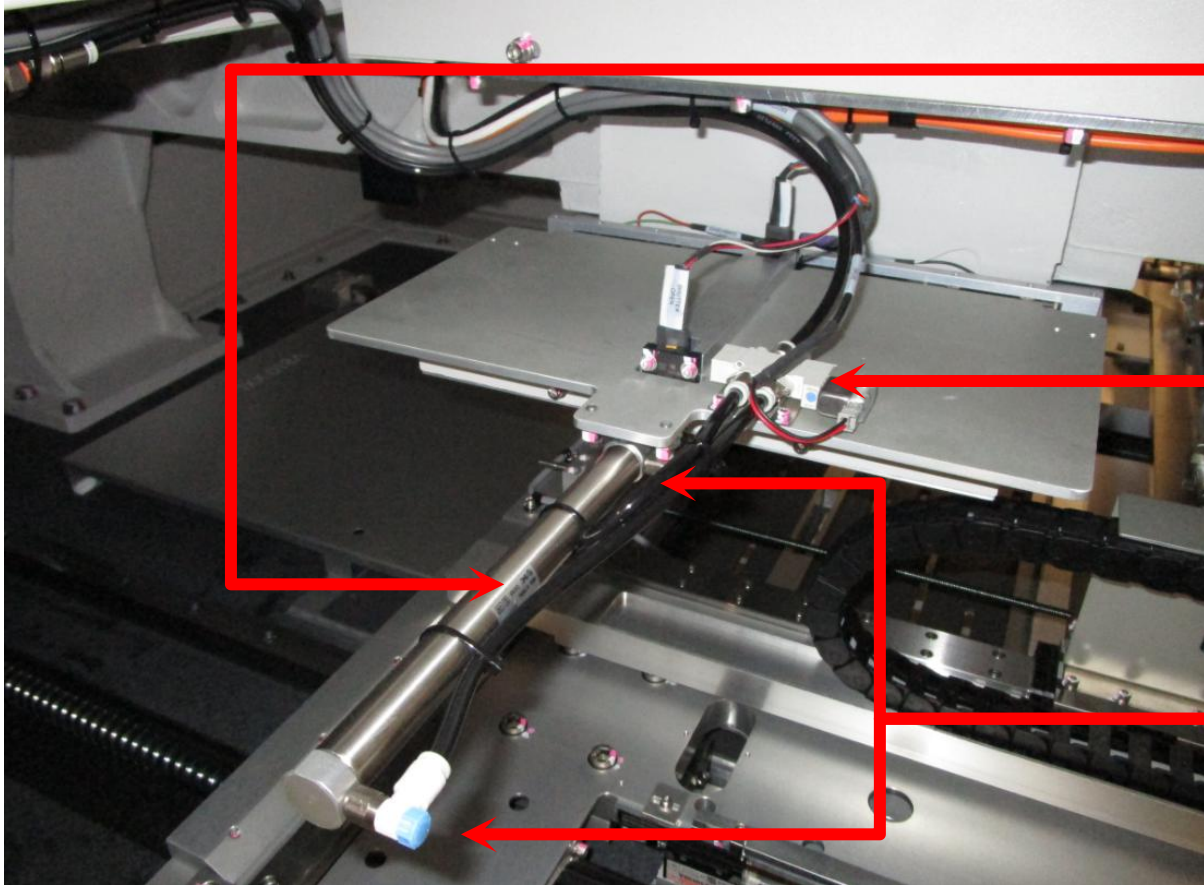


CYLINDER, DOUBLE ACTING, SINGLE ROD



SMC SOLENOID VALVE



FITTING, SPEED CONTROLLER, ELBOW TYPE

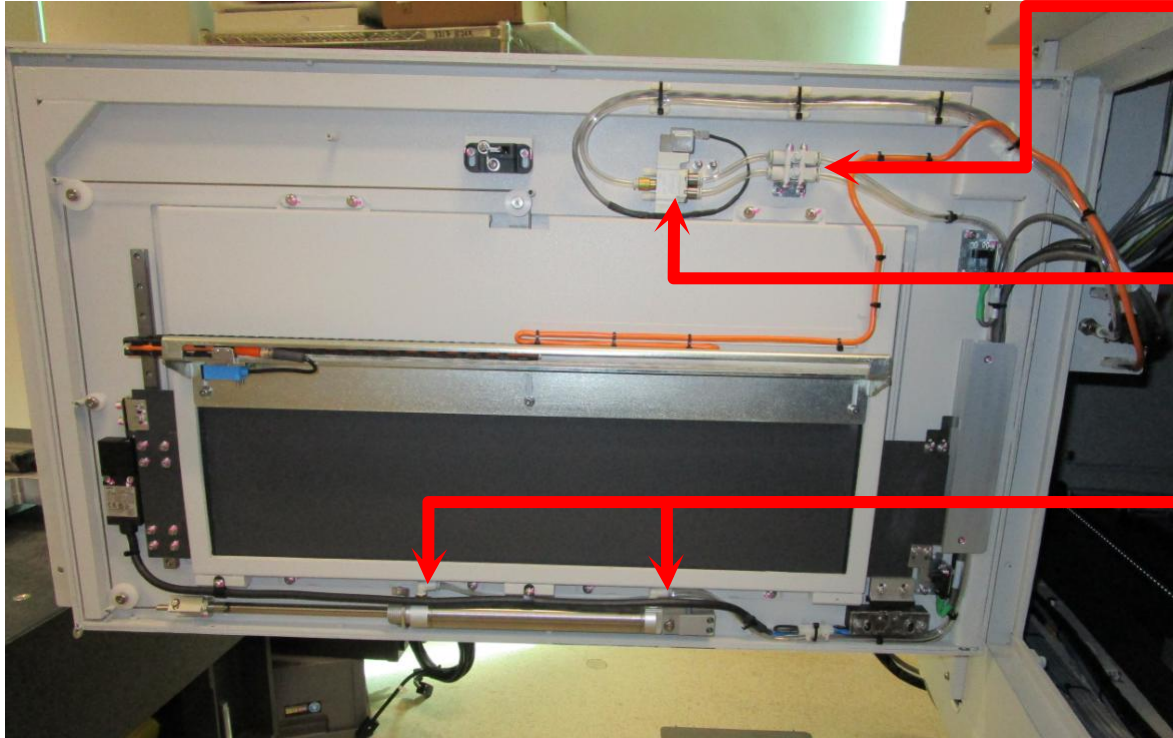

SMC FITTING SPEED
CONTROLLER IN LINE TYPE




SMC SOLENOID VALVE




MALE ELBOW, KQ2
FITTING



CYLINDER, DOUBLE ACTING, SINGLE ROD

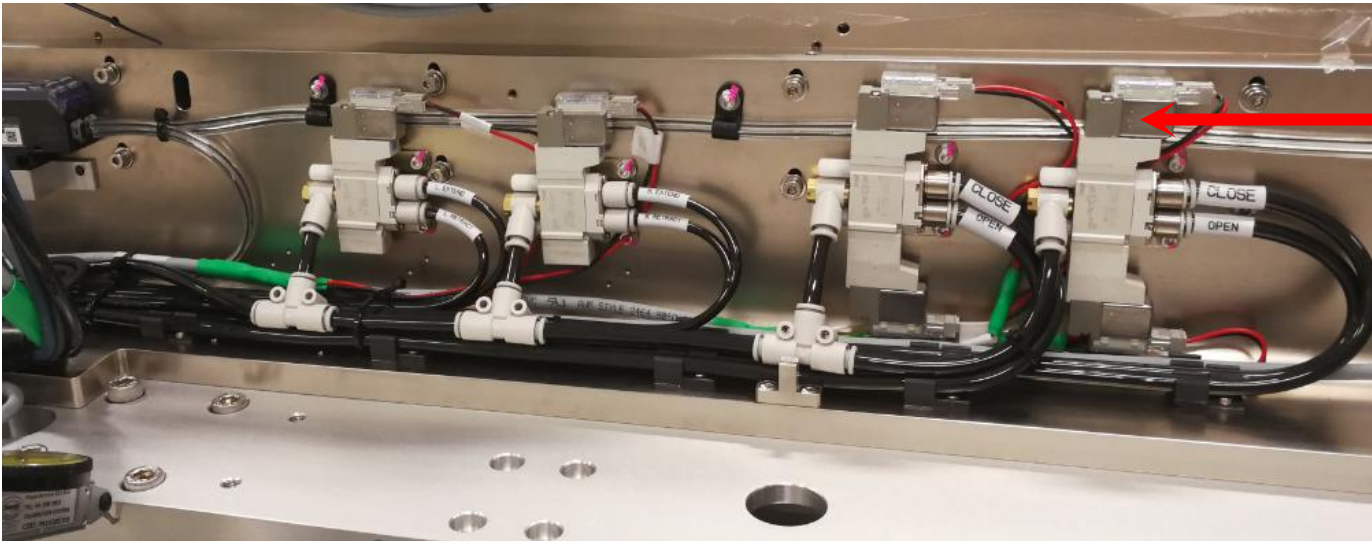

SMC SOLENOID VALVE

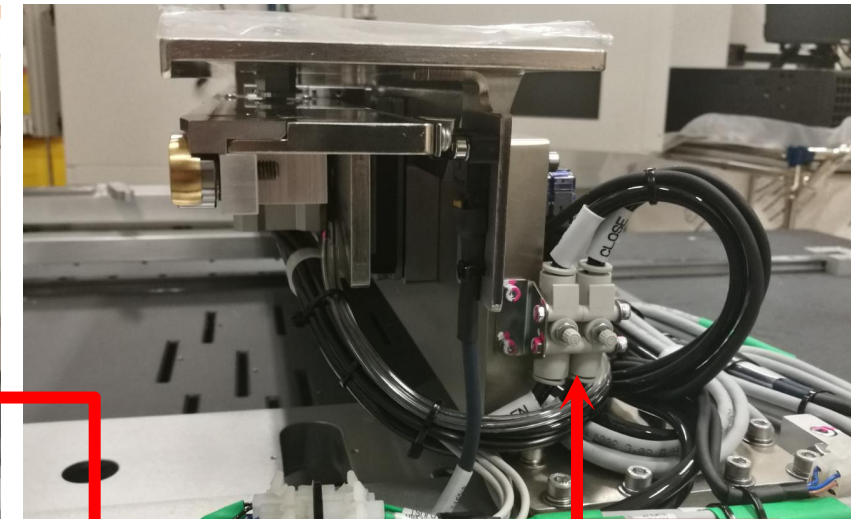


Fitting_One-Touch Fitting
Different Diameter Union Y





Cylinder_Compact Cylinder Double Acting
Single Rod_CQS Series



SMC FITTING SPEED
CONTROLLER IN LINE TYPE

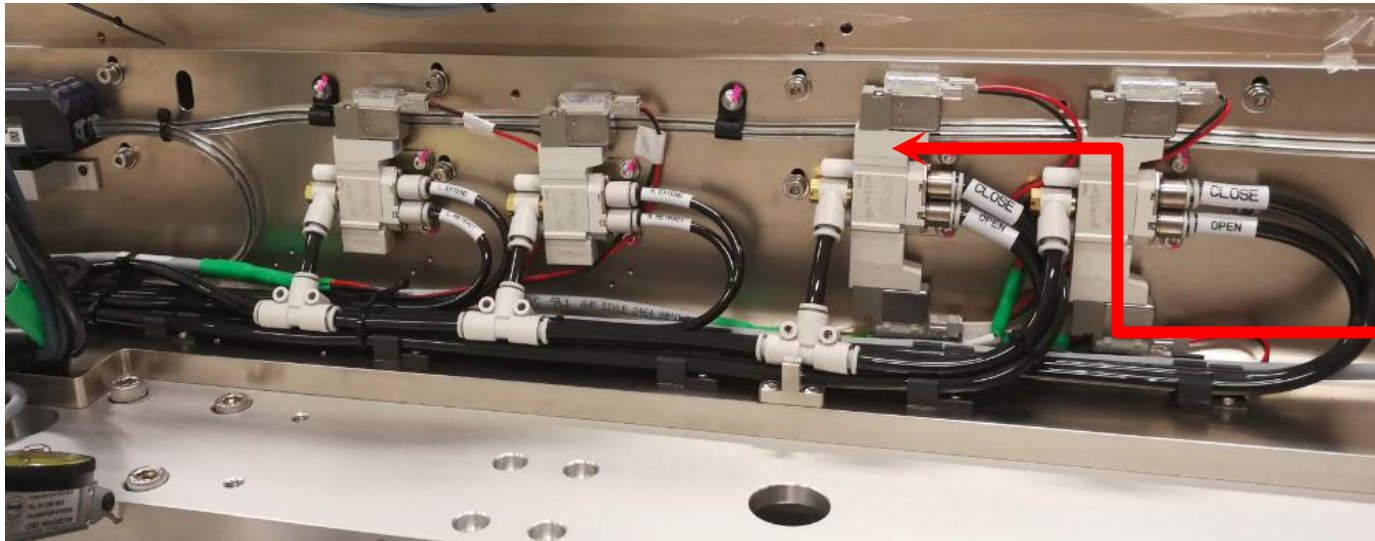

SMC SOLENOID VALVE

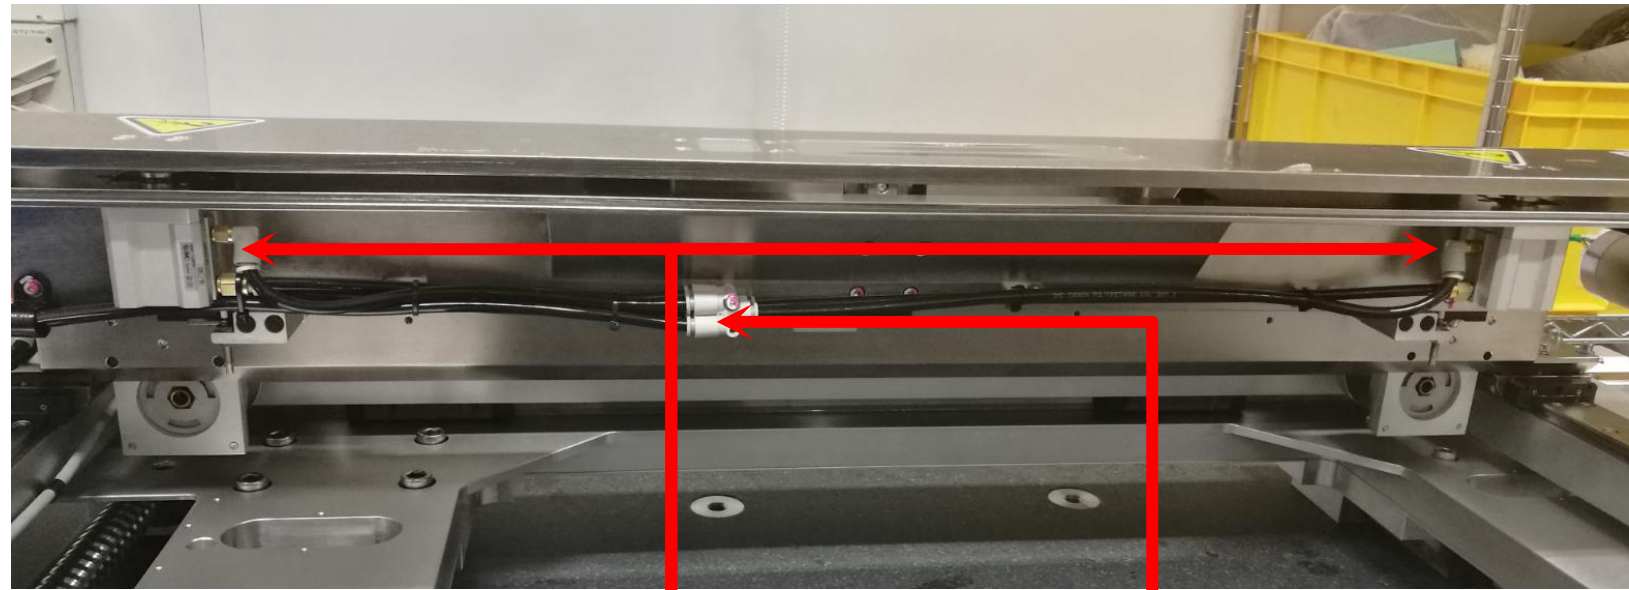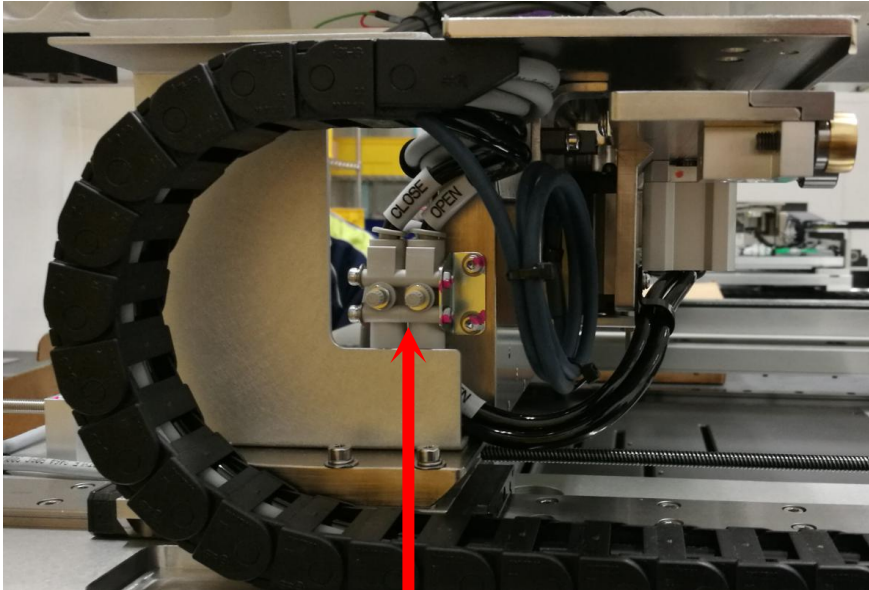


SMC FITTING SPEED
CONTROLLER IN LINE TYPE





Cylinder_Compact Cylinder Double Acting
Single Rod_CQS Series




Fitting_One-Touch Fitting
Different Diameter Union Y

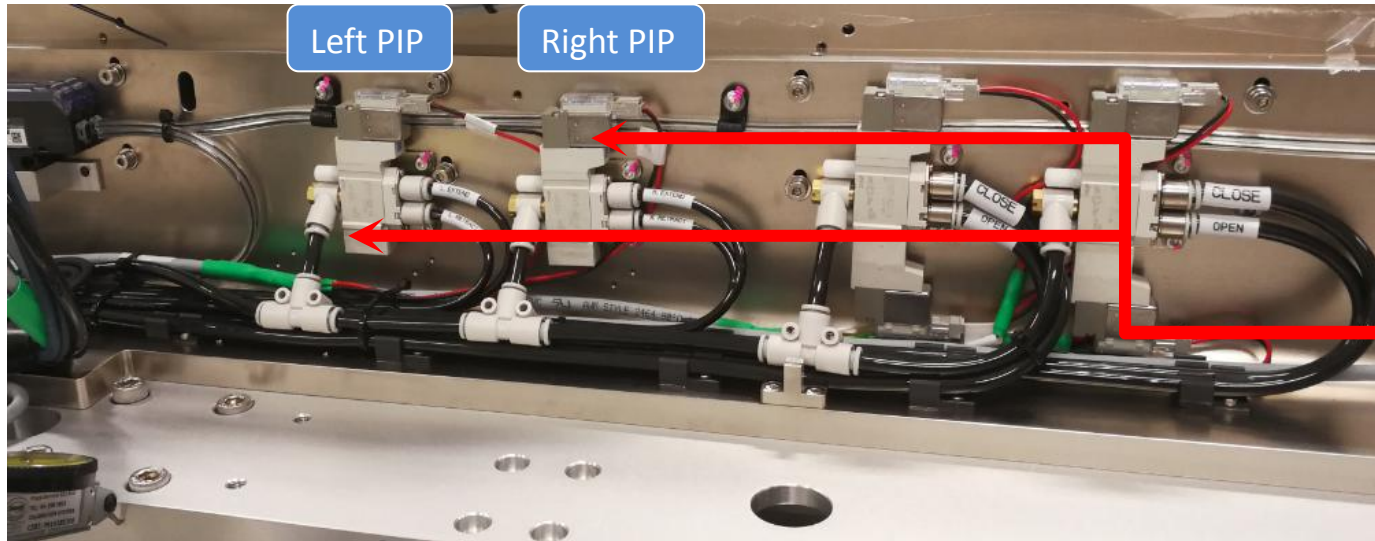

SMC SOLENOID VALVE

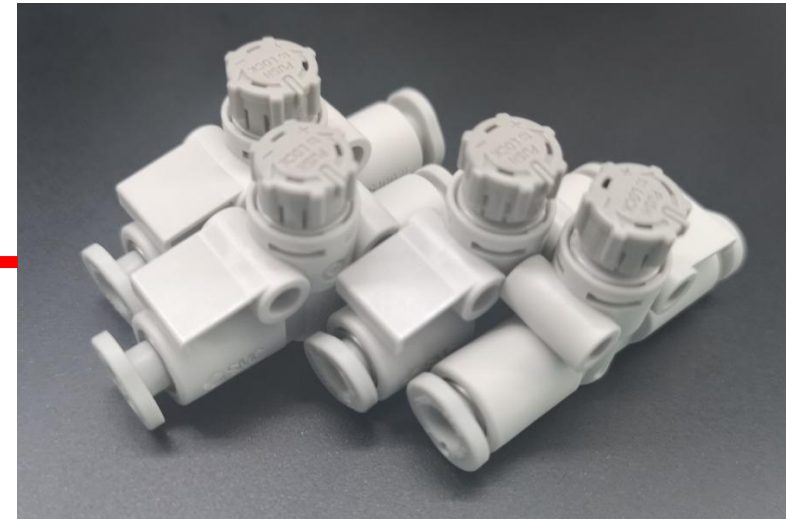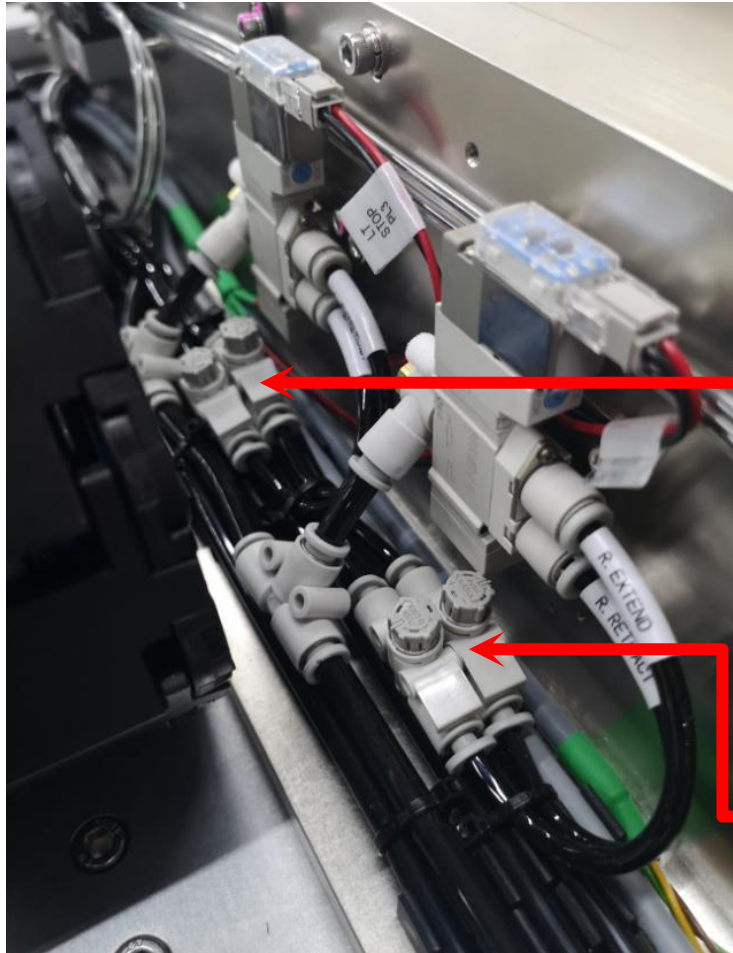

Automated Process Line

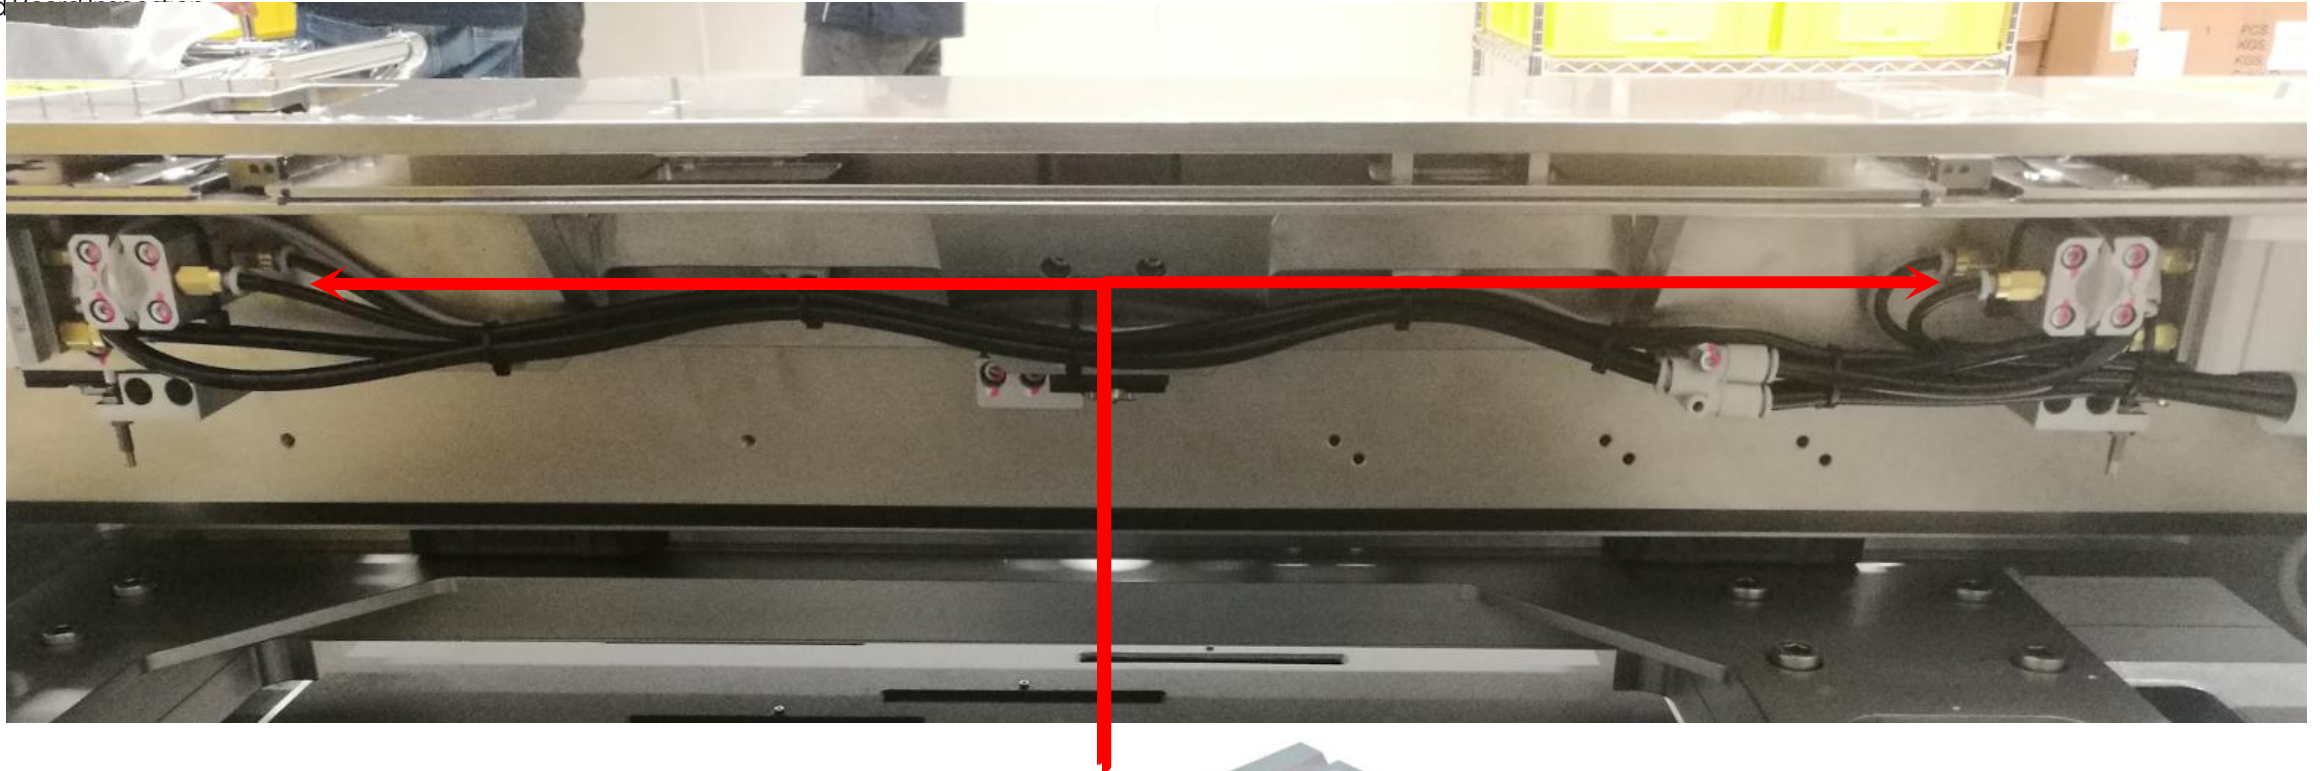


Cylinder_Double Acting_Single Rod



WEE KAH KHIM
Vice President & General Manager



GARY LEONG
Sales Director



周道南
Sales General Manager
(China & Taiwan)



SEOW ZI YANG
Business Development
Manager



FAHMI HELMI
Business Development
Manager