

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☐	S1	☐	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	28 Apr 2015	First Release	CHIN CHEE YAN
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

Content

X-Ray Tube Removal and Replacement Steps:.....	3
--	---

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

X-Ray Tube Removal and Replacement Steps:

1. Shutdown and completely power off machine. Turn off the air inlet main valve also.
2. Ensure the MCA box main power is switch off and green indicator light goes off as image below.

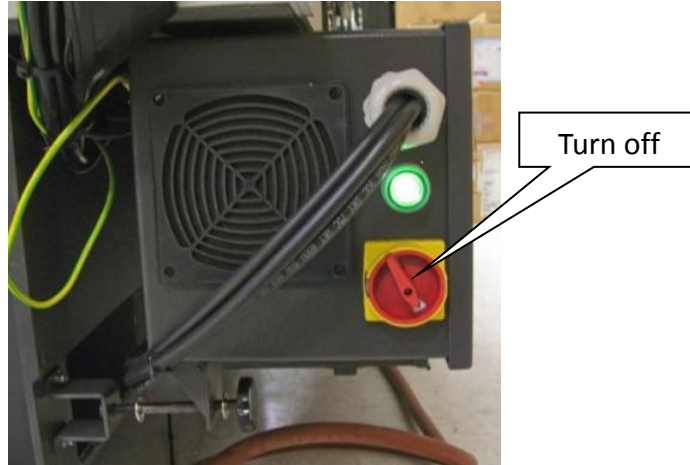


Figure 1

3. Open the front access door and manually open the inner barrier shutter plate to “Open” position.

Avoid tube bottom target scratches



Figure 2

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

4. Open the top access door as shown in Figure 3.



Figure 3

5. Cut the cable tie and unscrew and remove the SHCS M6×60 (4x) as Figure 4.

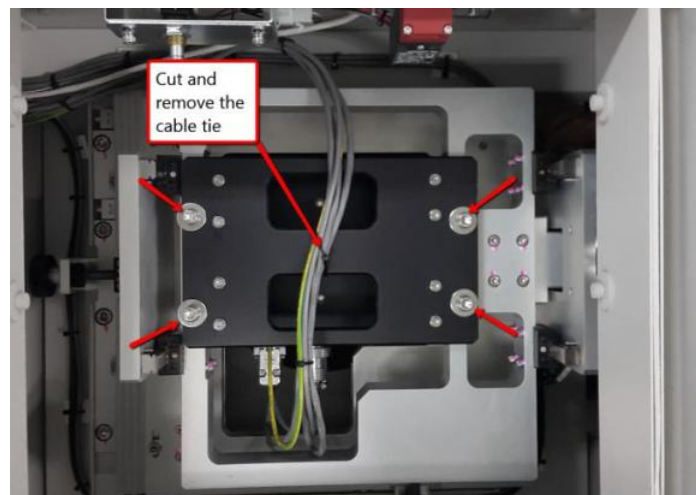


Figure 4

6. Lift the tube and place on top of the machine as shown in Figure 5.

Remarks: Caution on cable assembly



Figure 5

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

7. Remove the following cables from the X-ray tube.

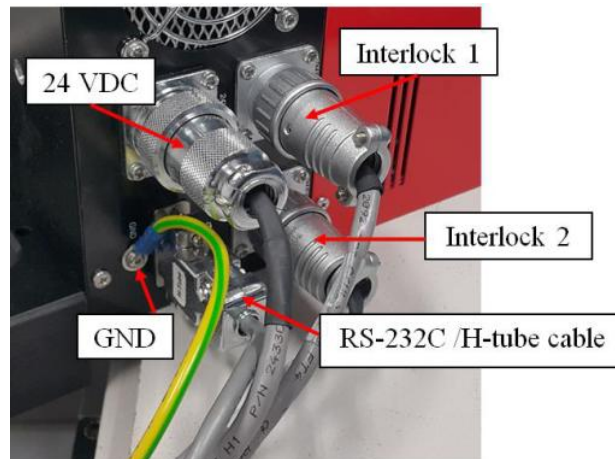


Figure 6

8. Unscrew 4 pcs of M6 X 12MM as shown. Slightly slice the bracket and remove the origin tube from X-ray tube base support bracket assembly.



Figure 7

9. Prepare new X-Ray tube (P/N, 2370-0003) and **record down the old and new tube SN** for record and tracking purpose. Unscrew and transfer the irradiation window cover from new tube to old tube.

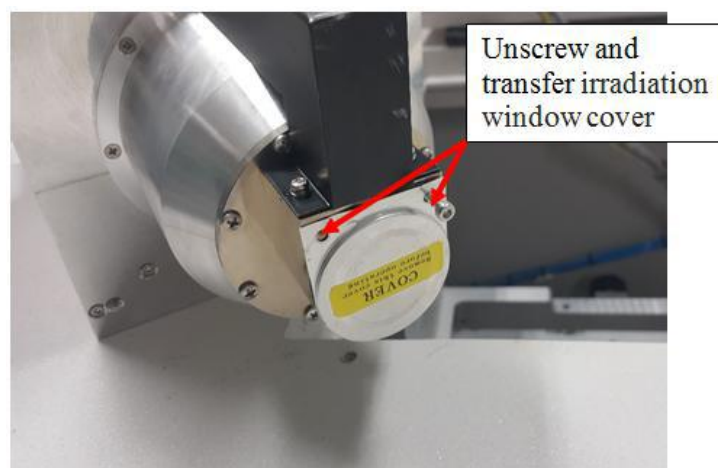


Figure 8

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

10. Place the new tube into X-ray tube base support bracket assembly and screw and tighten 4 pcs of M6 X 12MM as shown.

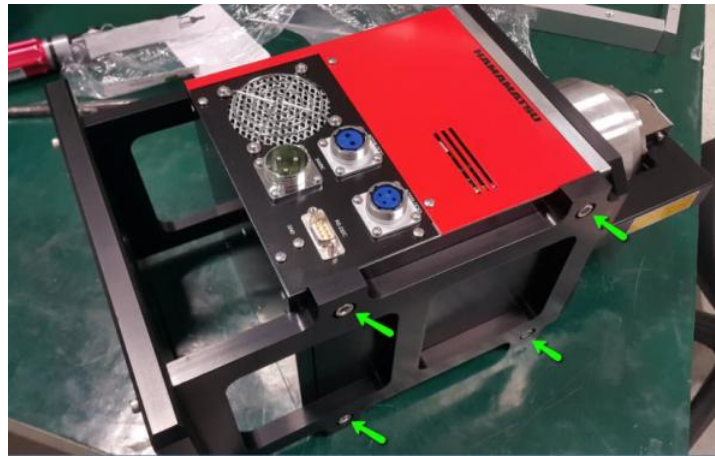


Figure 9

11. Visual check any foreign material at inner X ray chamber.
E.g. Screws, Nut and etc.

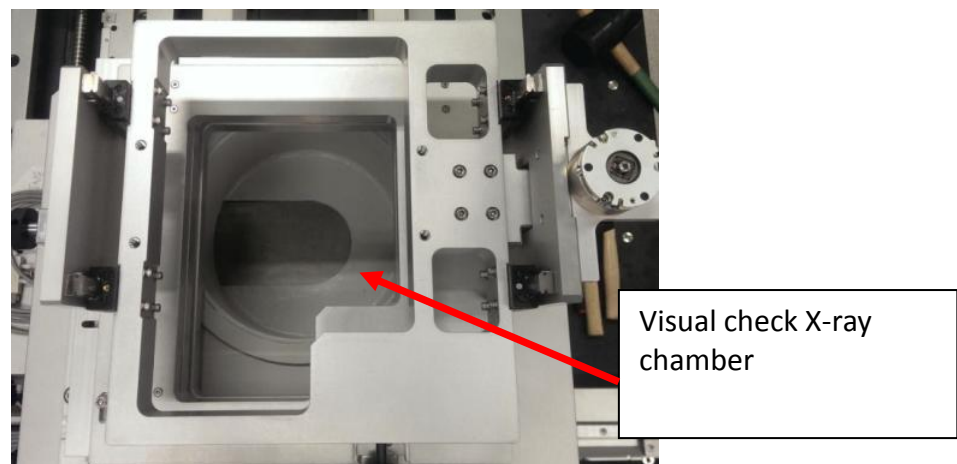


Figure 10

12. Connect all the cables to the X-ray tube panel as shown in Figure 11.

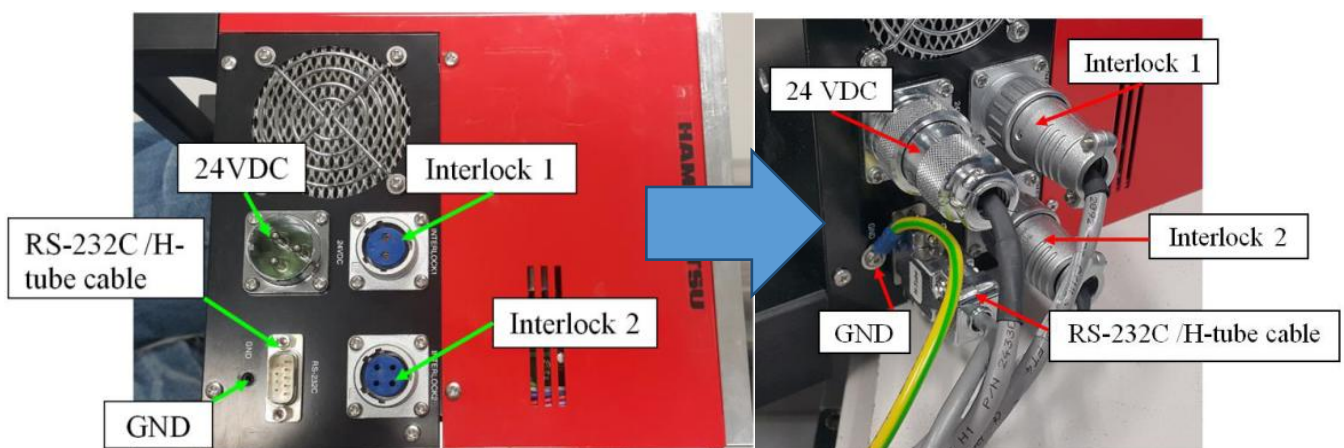


Figure 11

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

13. Assemble tube into machine and tighten the SHCS M6×60 (4x) as shown in Figure 12.

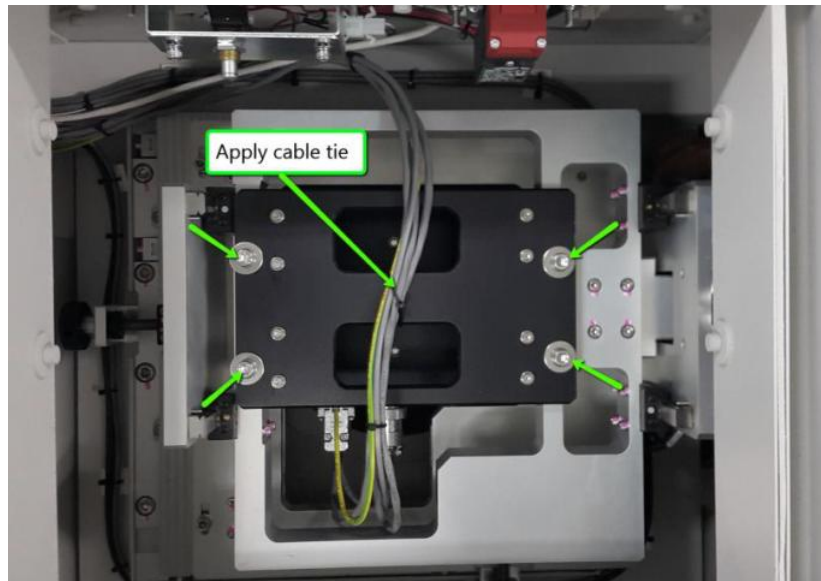


Figure 12

14. Manually push and pull the inner barrier shutter plate, ensure the shuttle plate do not contain friction with tube bottom target as Figure 13

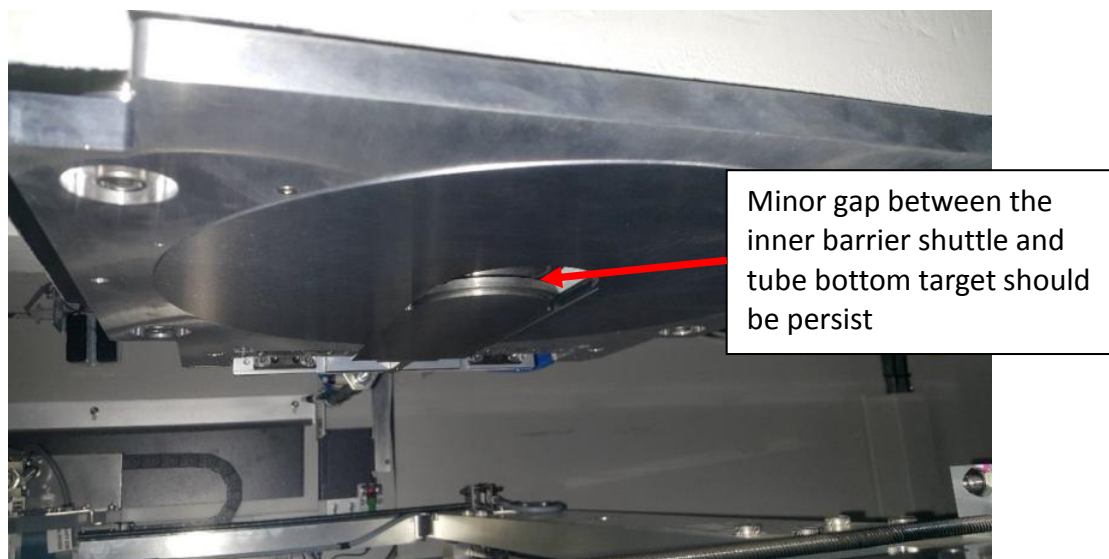


Figure 13

15. Once complete, close all the access door and power up machine as usual. Soft remind to turn on the main air inlet and ensure it is set to 80 PSI.

	Work Instruction	Doc. Revision	01
	AXI V810 S2EX X-Ray Tube Replacement Procedure	Effective Date	2 Oct 2016

16. Open V810 Software and initialize at X ray source tab.

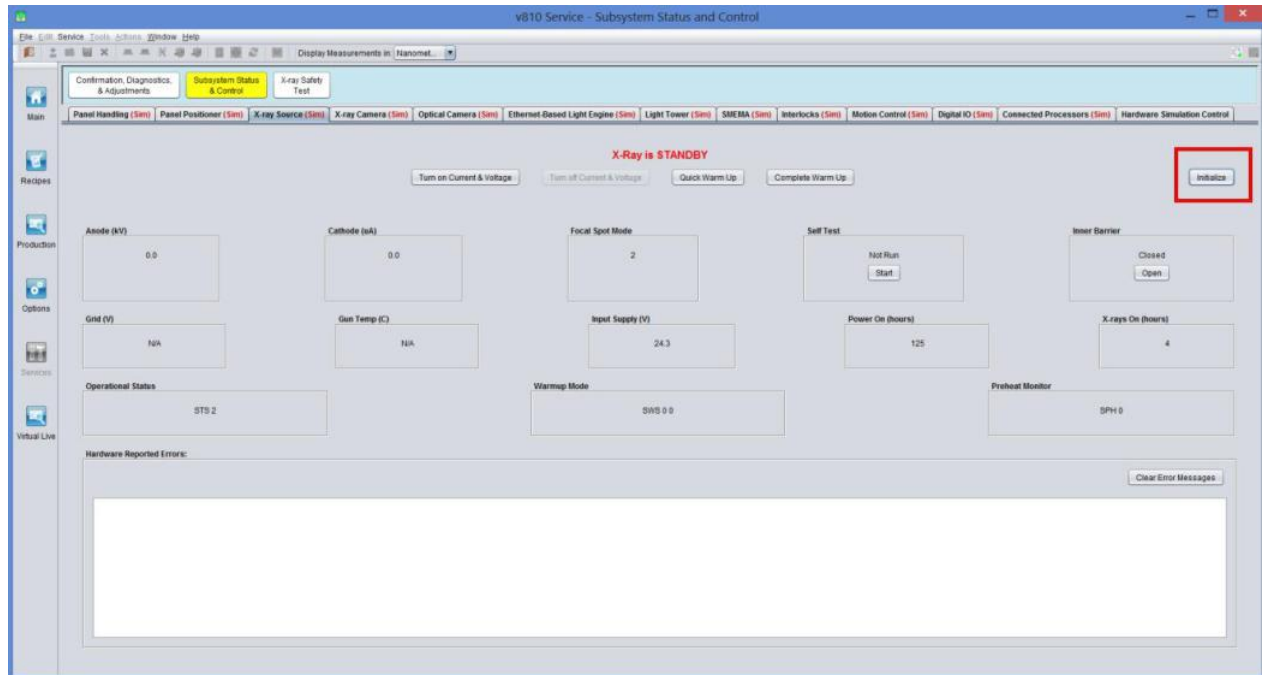


Figure 14

Remarks : Tube ramp will last for 90 Min (approximately)

17. Open the V810 software and run X-ray Self-Test as shown in Figure 15. Print Screen entire page and provide to ViTrox AXI Support team

Services → Subsystem Status & Control → X-Ray Source → Initialize → Turn off Current & Voltage → Self test → Start

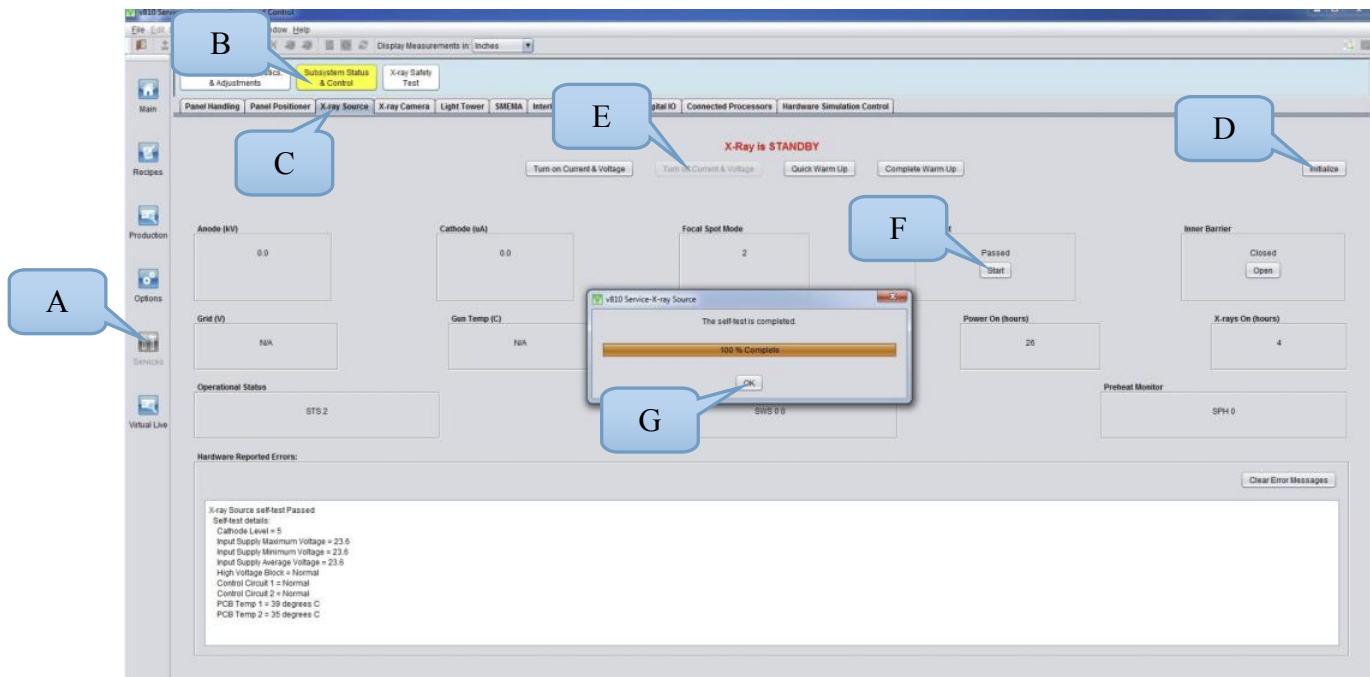


Figure 15

18. Perform tube alignment optimization by refer to **AXI V810 S2EX X-Ray Tube Alignment Procedure.**