

	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

This procedure is applicable to below models:

V810 STD	☒	S1	☒	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☒			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	1 May 2017	First Release	Tan Liang Kai

	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

Content

A. X-ray camera Fan.....	3
I. X-ray camera fan removal.....	3
II. X-ray camera fan replacement.....	5

	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

A. X-ray camera Fan

I. X-ray camera fan removal

1. Close X-ray source .May refer to “**AXI V810 Machine Shut Down Procedure**” for equipment shutdown
2. Loosen 2 x Thumb screws at Camera Enclosure as shown in Figure 1.

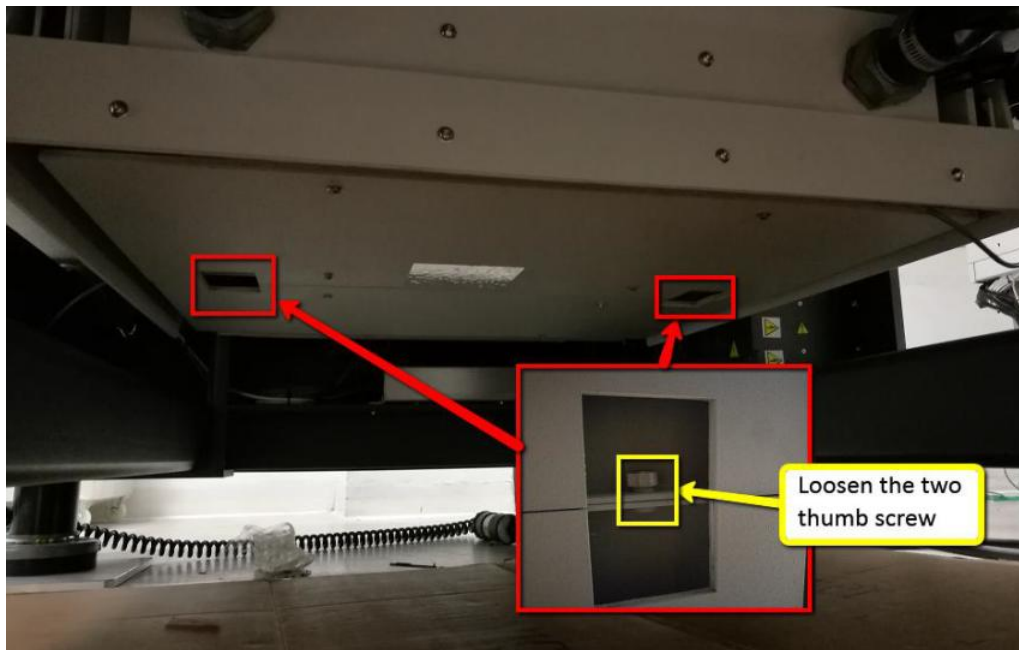


Figure 1 Camera enclosure

3. Open Camera Enclosure.
4. Identify defective fan location. Loosen 4 x Screw. Remove 1 x Grounding wire from particular fan as shown in Figure 2.



Figure 2 X-ray camera fan (Top view)

ViTrox 	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

5. Remove Metal Frame as shown in Figure 3.

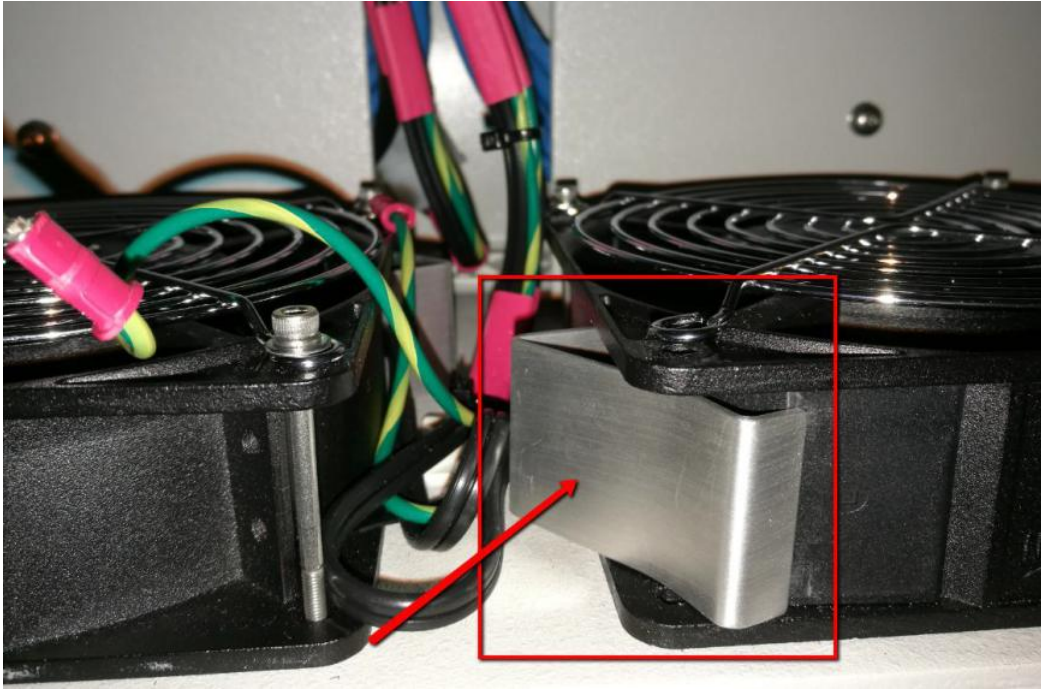


Figure 3 Metal frame removal

6. Unplug Power cable & remove X-ray Camera Fan as shown in Figure 4.

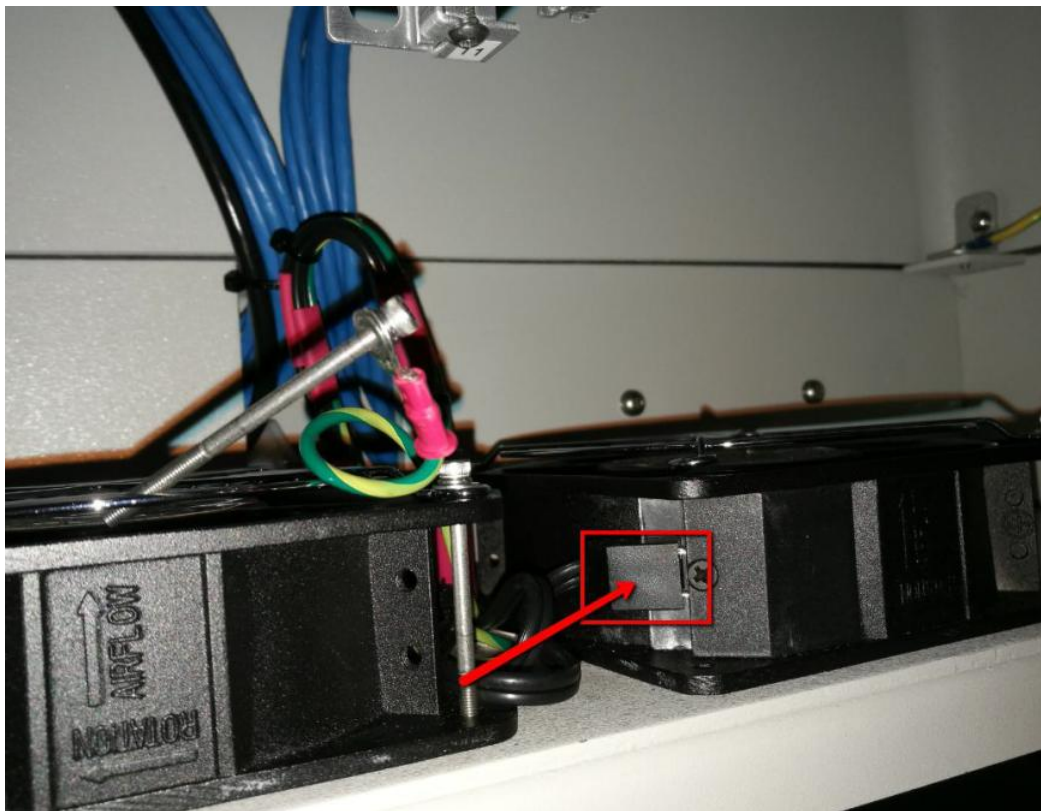


Figure 4 Power cable removal

	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

II. X-ray camera fan replacement

1. Prepare 1 x 4XASP-A004 (X ray Camera Fan Kit)
2. Assemble New X-ray Camera Fan by refer to below Orientation

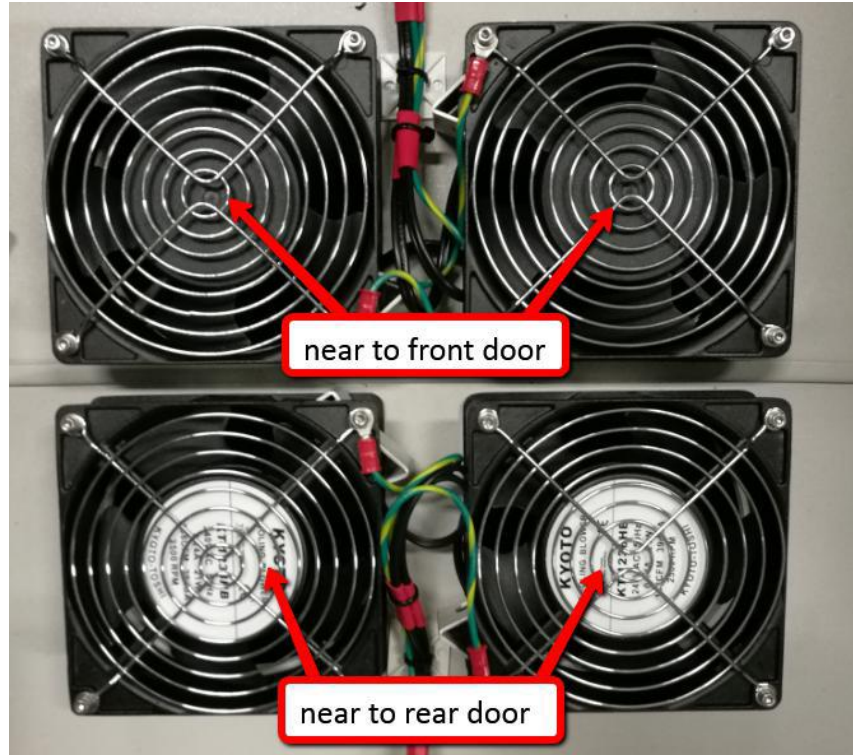


Figure 5 X-ray camera fan (top view)

3. Plug Power Cable as shown in Figure 7.

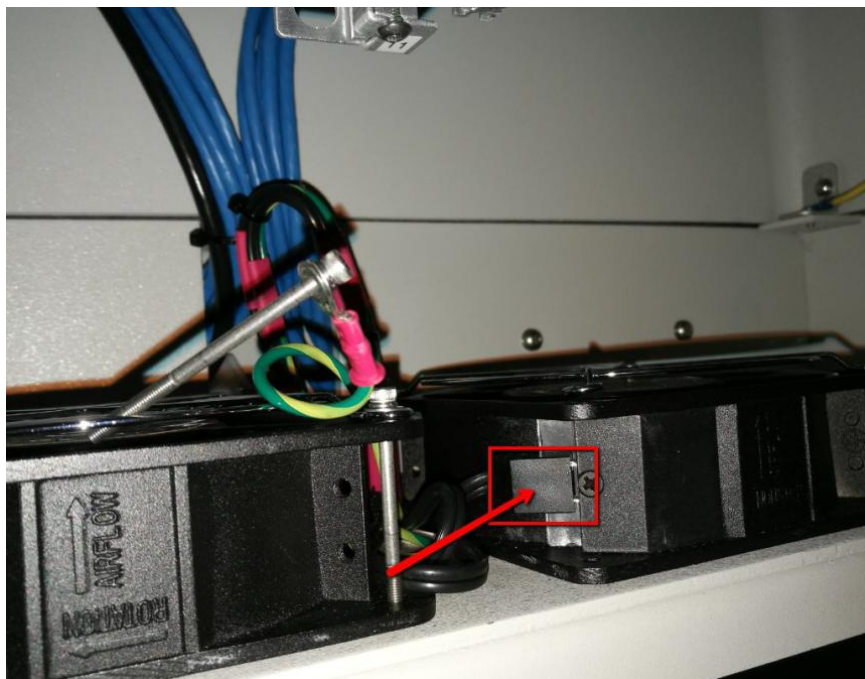


Figure 6 Cable assembly

	Work Instruction	Doc. Revision	00
	AXI V810 X-ray Camera Fan Removal & Replacement Procedure	Effective Date	1 May 2017

4. Assemble Metal Frame as shown in Figure 7.

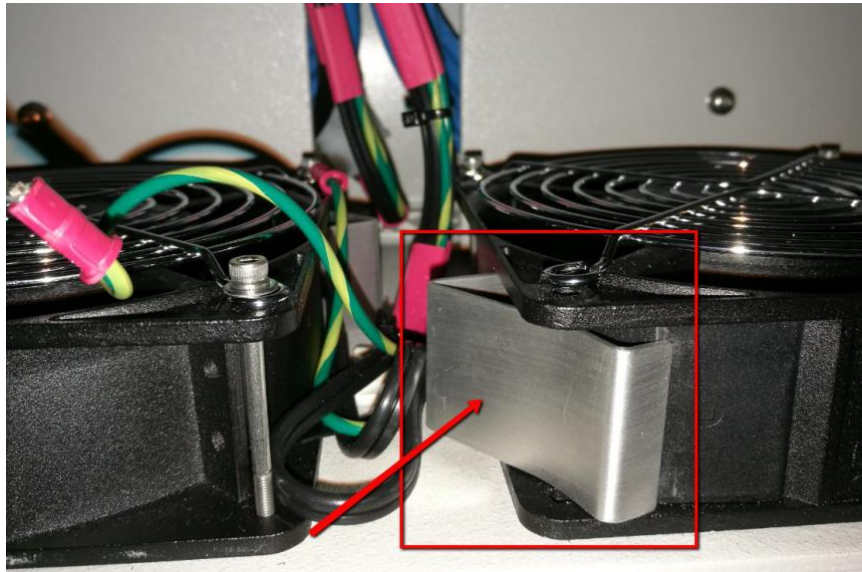


Figure 7 Metal frame assembly

5. Tighten 4 x Screws as shown in Figure 8.

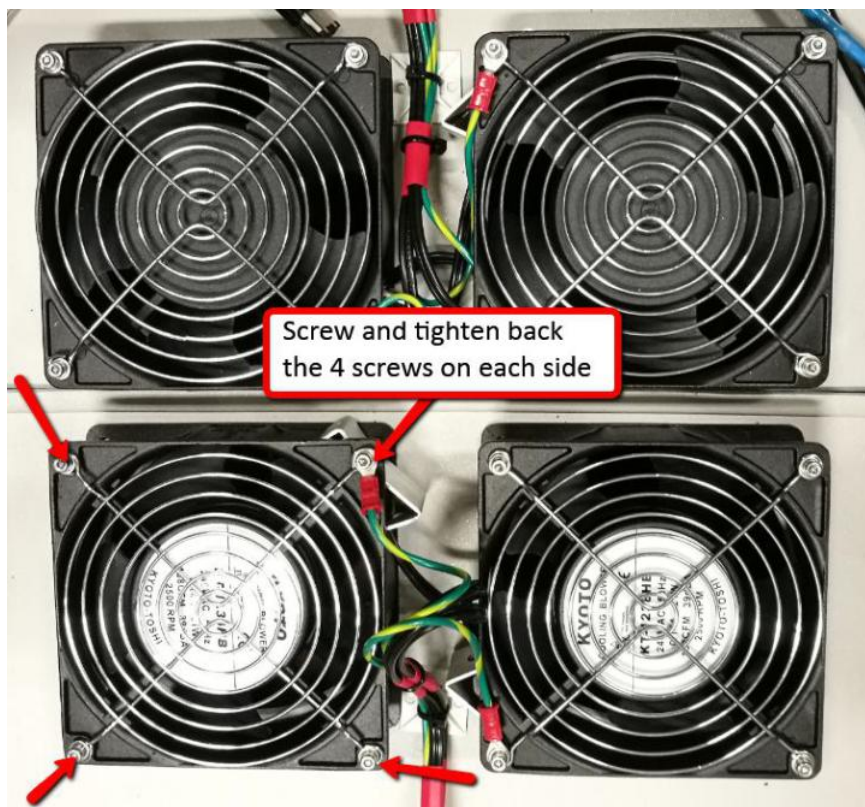


Figure 8 X-ray camera fan replacement

6. Gently close Camera Enclosure & tighten-up 2 x Thumb screws.
Remarks : Gap between both side of Camera Enclosure should not persist.
7. Start up machine by refer to “AXI V810 Machine Start Up Procedure”.