

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	S1	☒	S2	☒
V810 XXL	S1	☒	S2	☒
V810 S2EX		☒		
V810 Mini		☐		

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	23 Jun 2015	First Release	CHIN CHEE YAN
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

Content

XMP to ZMP Lite Conversion (Using ZMP type MEI Card, P/N, 2670-0043).....	7
ZMP Lite to XMP Conversion (Using XMP type MEI Card, P/N, 2670-0032).....	10

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

1. Launch Remote Desktop application at Master Computer (Below is the sample login into Atom PC) May refer to table 1.



Figure 1 Remote desktop connection

Series Type	Computer Devices	IP Address	User Account	Password
Series 1	Atom PC (RMS)	10.1.1.55	Administrator	Please!
Series 2	Atom PC (RMS)	192.168.128.70		

Table 1

2. Security certification window will prompt, click “Yes” continue remote session.



Figure 3 Remote desktop connection

3. Open “CMD” window at Start icon tray.

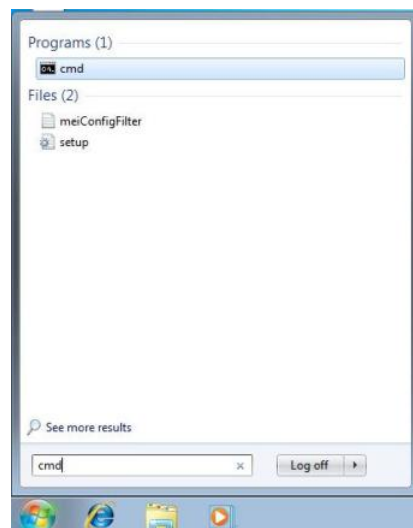


Figure 4 CMD

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

4. Key-in command “shutdown -s” then press “Enter”, Dialog will prompt showing “Windows will shut down in less than a minute”.

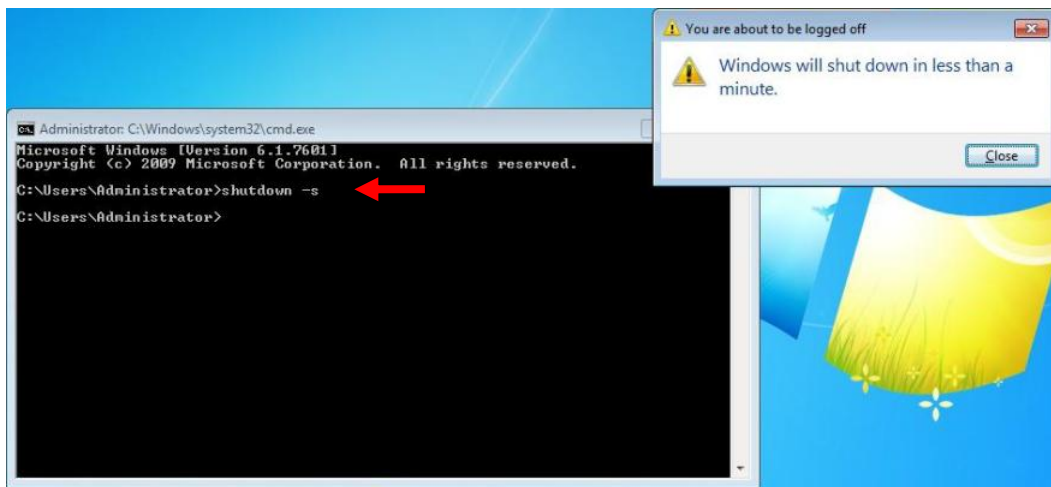


Figure 5 CMD

5. At the machine rear side, left partition, open the top cover. Remove the cables (LAN and power cable) and unscrews as shown. Open the Atom PC top cover.

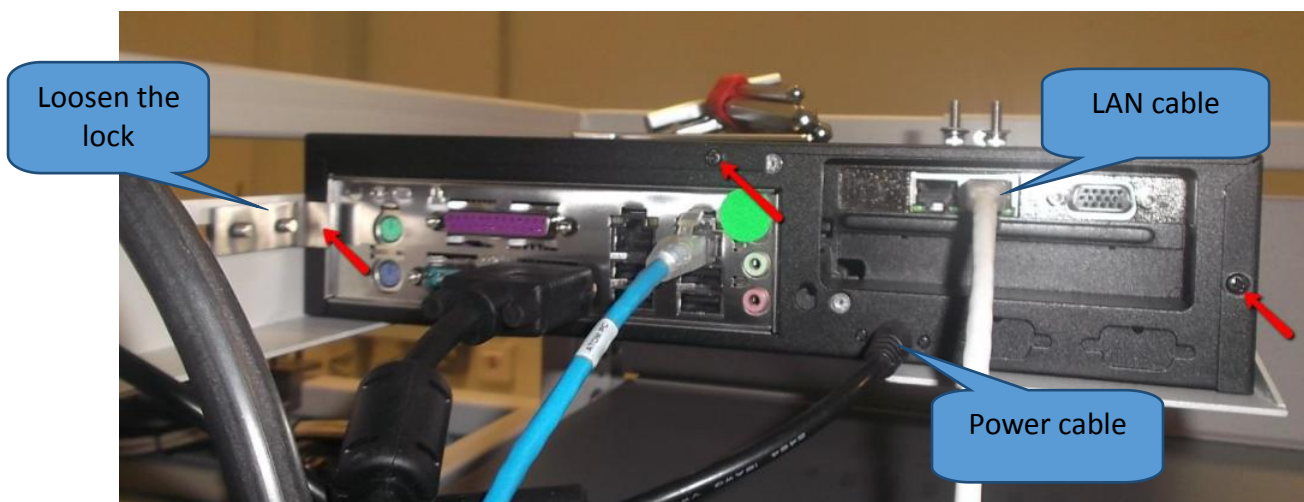


Figure 6 Atom pc (Rear view)

6. Remove the defective MEI card from Atom PC.

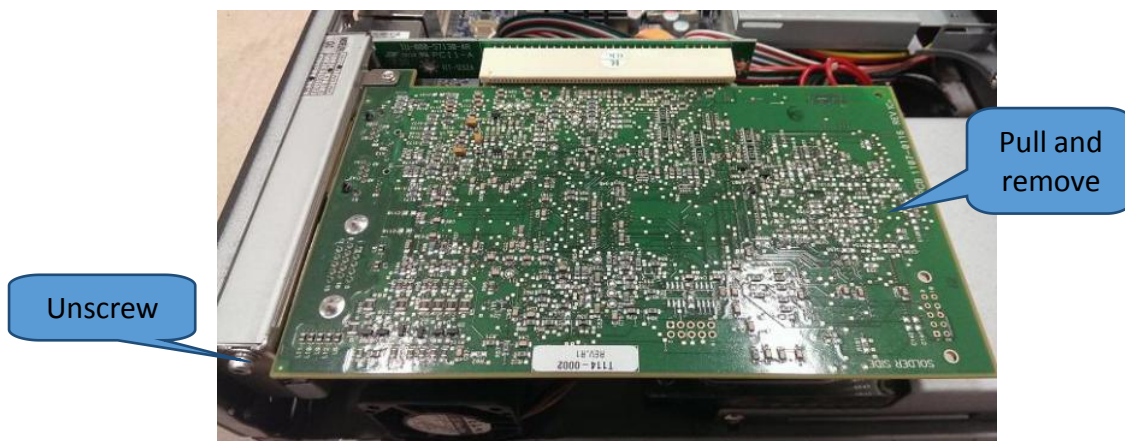


Figure 7 MEI card removal

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

7. Prepare a new MEI card (2 type of MEI Card with difference motion profile, refer to body marking at physical part)

XMP MEI Motion Control Card, (P/N, 2670-0032)#old type, obsolete



ZMP-SynqNet-PCI Controller-RJ-LT (P/N,2670-0043)



Figure 8 ZMP MEI Card

8. Replace the new MEI card to Atom PC. Caution if atom pc is equipped with Flex Cable type, ensure the Flex cable seat firmly with mother board PCI slot.

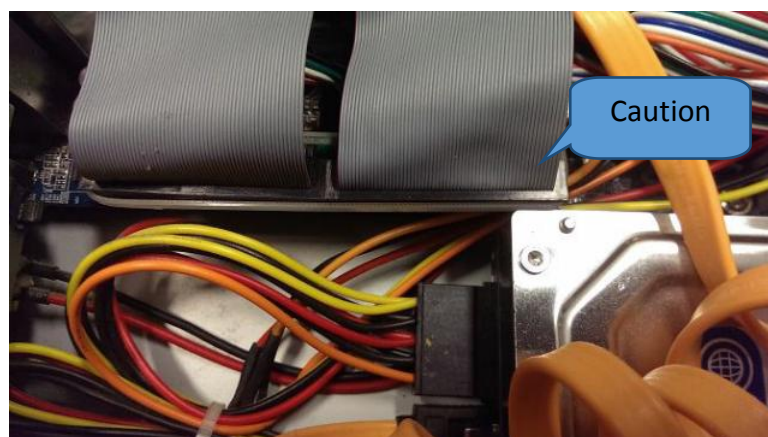


Figure 9 Flex cable

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

9. Close the top cover, connect the cable back to origin and screw the cover and turn on the Atom PC.
 # LAN cable must connected to ""Out" port at MEI card.

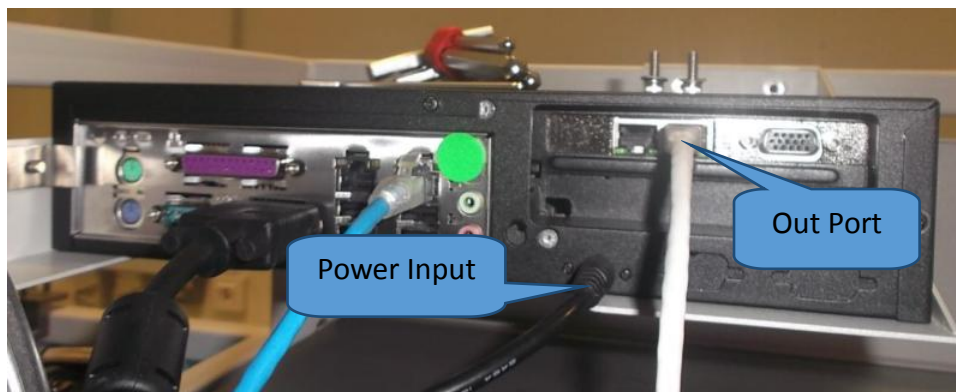


Figure 10 Atom PC (Rear view)

10. Once Atom PC done boot, remote desktop to Atom PC as step 1 ~ 2. Go to device manager, expand the Motion Controller tab and ensure the MEI card is connected as shown.
 # If consist "!" mark, try reseal the MEI card.

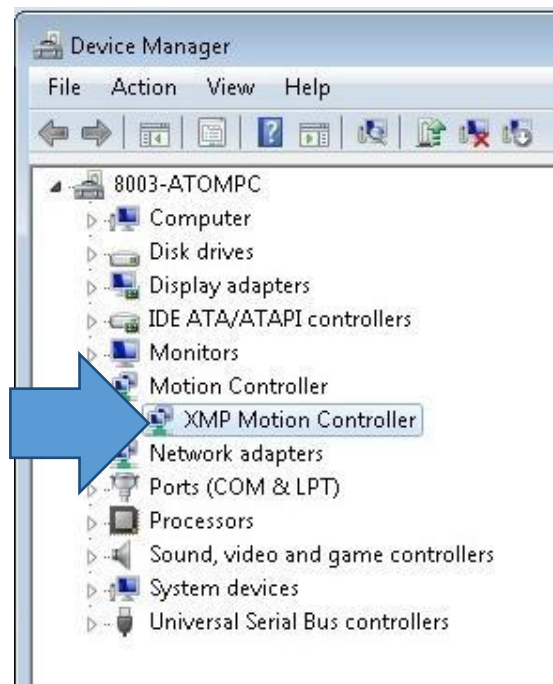


Figure 11 Device manager

- If replace MEI card same type as origin (**XMP to XMP**) or (**ZMP lite to ZMP Lite**), continues with **page 13**.
 If replace MEI card origin from **XMP to ZMPLite**, continues with **page 7 ~ 9**.
 If replace MEI card origin from **ZMP Lite to XMP**, continues with **page 10 ~ 13**.

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

XMP to ZMP Lite Conversion (Using ZMP type MEI Card, P/N, 2670-0043)

11. At Master Controller, may refer to below table for desire model to copy and back-up the origin config folder.

Model	Path
Strd Series One & Series 2	C:\Program Files\AXI System\v810\5.0\config
XXL Series One & Series 2	C:\Program Files\AXI System\v810\5.0\XXLconfig
S2EX	C:\Program Files\AXI System\v810\5.0\s2exconfig

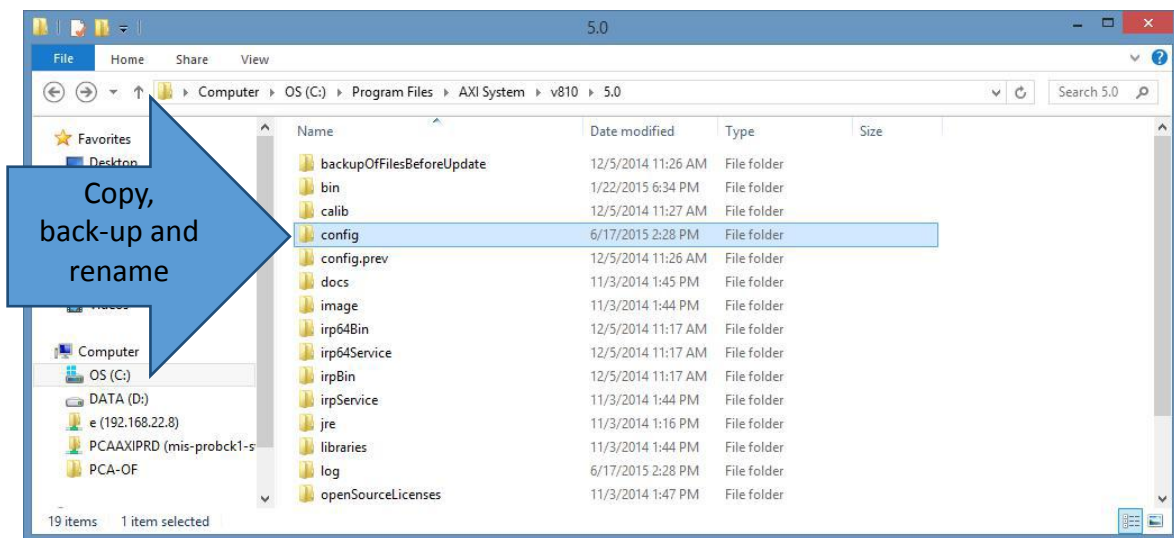


Figure 12 config(Reference Only)

12. Unzip and paste the “Swap-XMP-ZMP-Config-Script” folder and paste into the desktop as shown. Folder content with 4 scripts and 3 motion configure files.

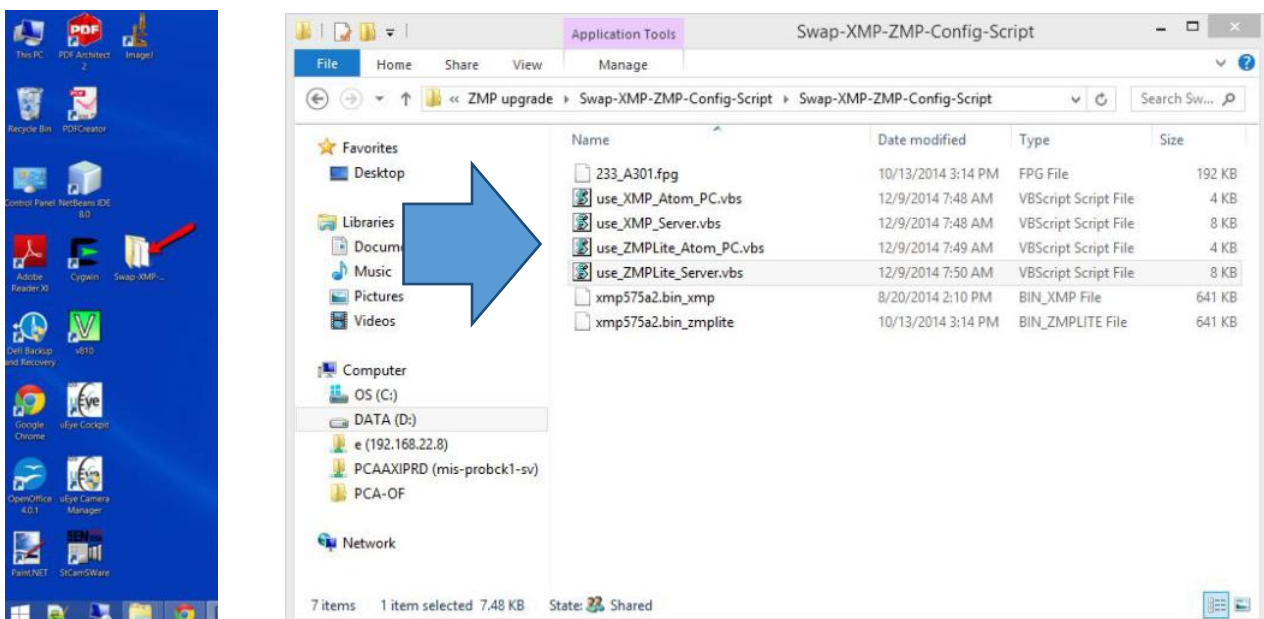


Figure 13 Script folder

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

13. Inside this folder, double click the “use_ZMPLite_Server.vbs” file. Once system done update the correct motion configure files, message box as shown in Figure 13 will pop out, click ok.

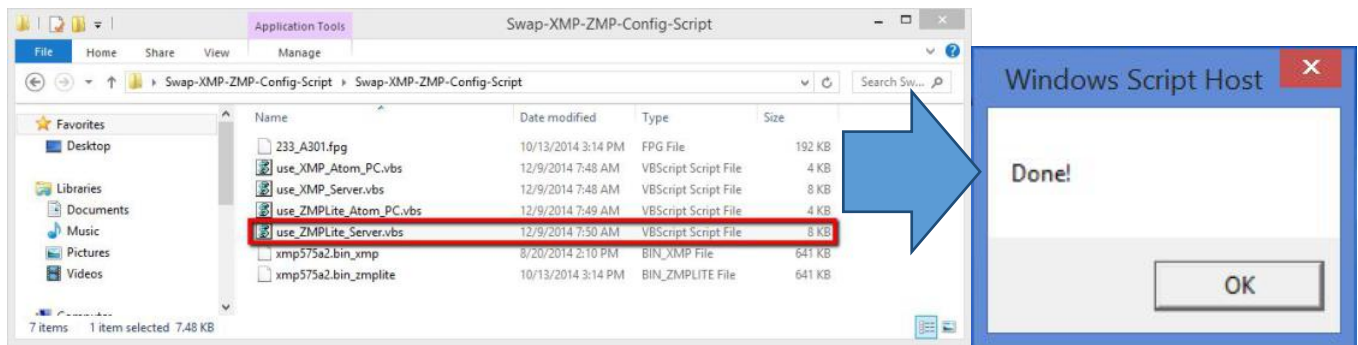


Figure 14 Script folder

14. After complete, delete the “Swap-XMP-ZMP-Config-Script” folder in the desktop. (Avoid any wrong update). Once finish this step, server PC MEI Card configuration file will be updated.

Origin hardware.config file will be back-up with the file name according to the date and time as shown.

Name	Date modified	Type	Size
hardware.config	10/17/2014 9:42 A...	CONFIG File	29 KB
hardware.config.bak	10/15/2014 9:18 A...	BAK File	29 KB
hardware.config_	9/2/2014 2:45 PM	CONFIG_ File	30 KB
hardware.config_20141017-094257	10/17/2014 8:53 A...	CONFIG_20141017...	29 KB
hardware.config_s3	10/9/2014 2:48 PM	CONFIG_S3 File	30 KB

Figure 15 Config backup

15. Repeat step 1 ~ 2 and remote desktop into Atom PC. At Atom PC, may refer to below table for desire model to copy and back-up the origin config folder.

Model	Path
Strd Series One & Series 2	C:\Program Files\AXI System\v810\5.0\config
XXL Series One & Series 2	C:\Program Files\AXI System\v810\5.0\XXLconfig
S2EX	C:\Program Files\AXI System\v810\5.0\s2exconfig

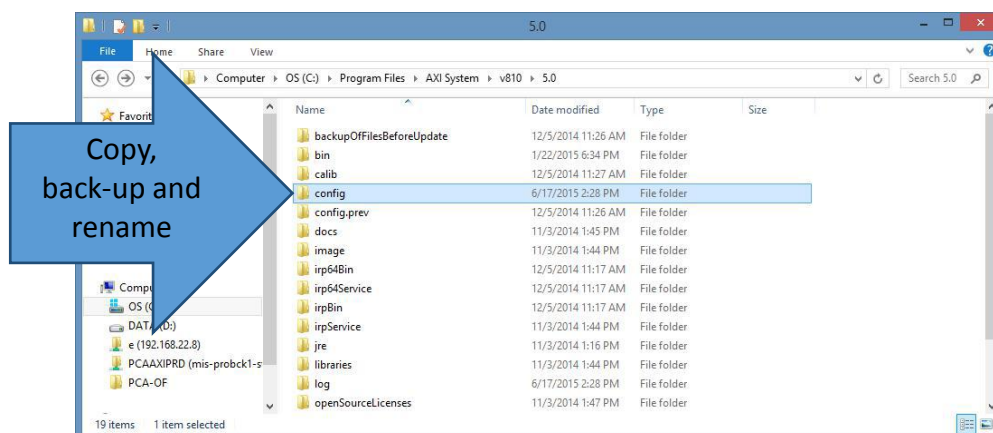


Figure 16 Config (Reference Only)

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

16. Repeat step 12 ~ 14 by select the “use_ZMPLite_Atom_PC.vbs” to update Atom PC MEI card configuration files. Once complete, power cycle SSCA.

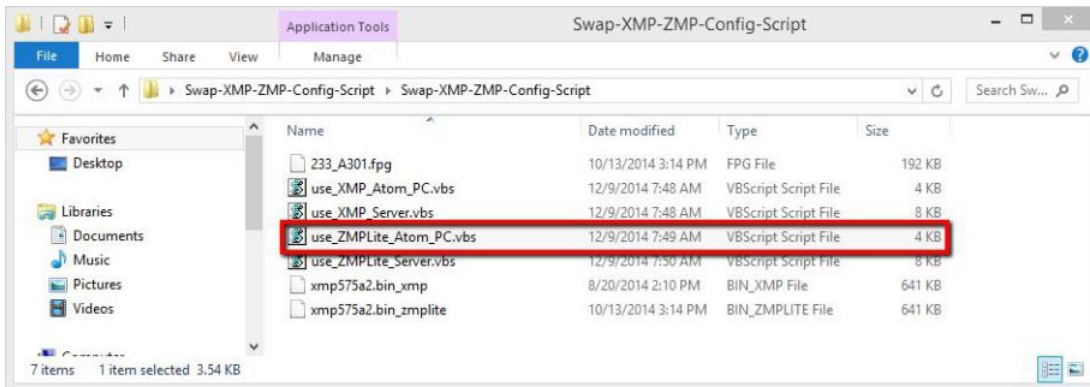


Figure 17 Script folder

17. At V810 GUI, go to “Connected Processor” and upgrade the RMS.
Services → Subsystem Status & Control → Connected Processor → Stop RMS → Upgrade RMS
→Restart RMS

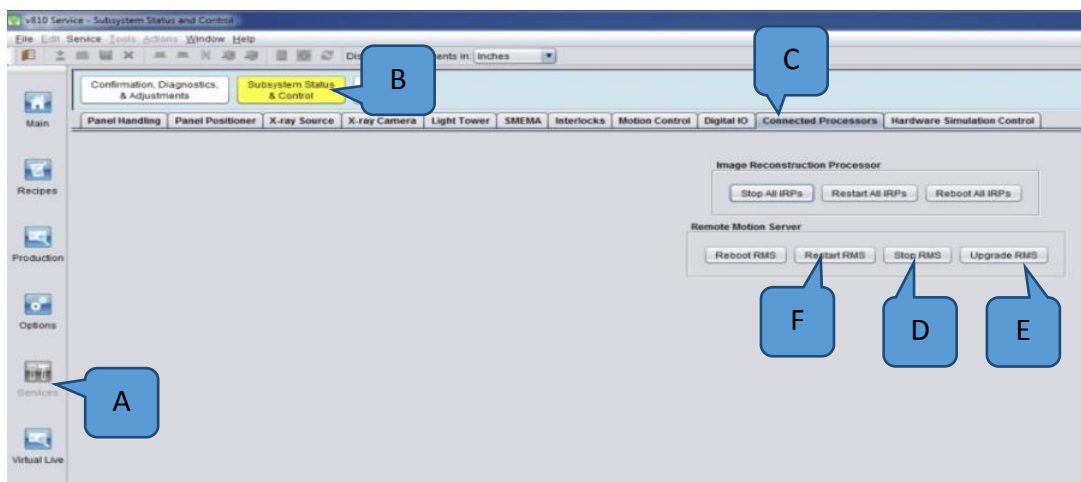


Figure 18 Connector Processor

18. Go to Motion Controller tab and upgrade the motion firmware. Approximately take 15 min to complete upgrade.
Services → Subsystem Status & Control → Motion Controller → Upgrade Firmware → Initialize

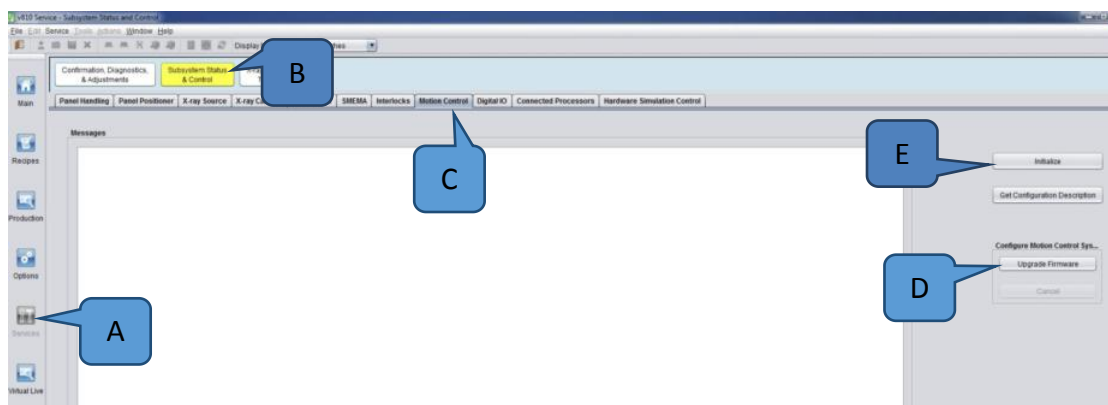


Figure 19 Motion controller

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

ZMP Lite to XMP Conversion (Using XMP type MEI Card, P/N, 2670-0032)

19. At Master Controller, may refer to below table for desire model to copy and back-up the origin config folder.

Model	Path
Strd Series One & Series 2	C:\Program Files\AXI System\v810\5.0\config
XXL Series One & Series 2	C:\Program Files\AXI System\v810\5.0\XXLconfig
S2EX	C:\Program Files\AXI System\v810\5.0\s2exconfig

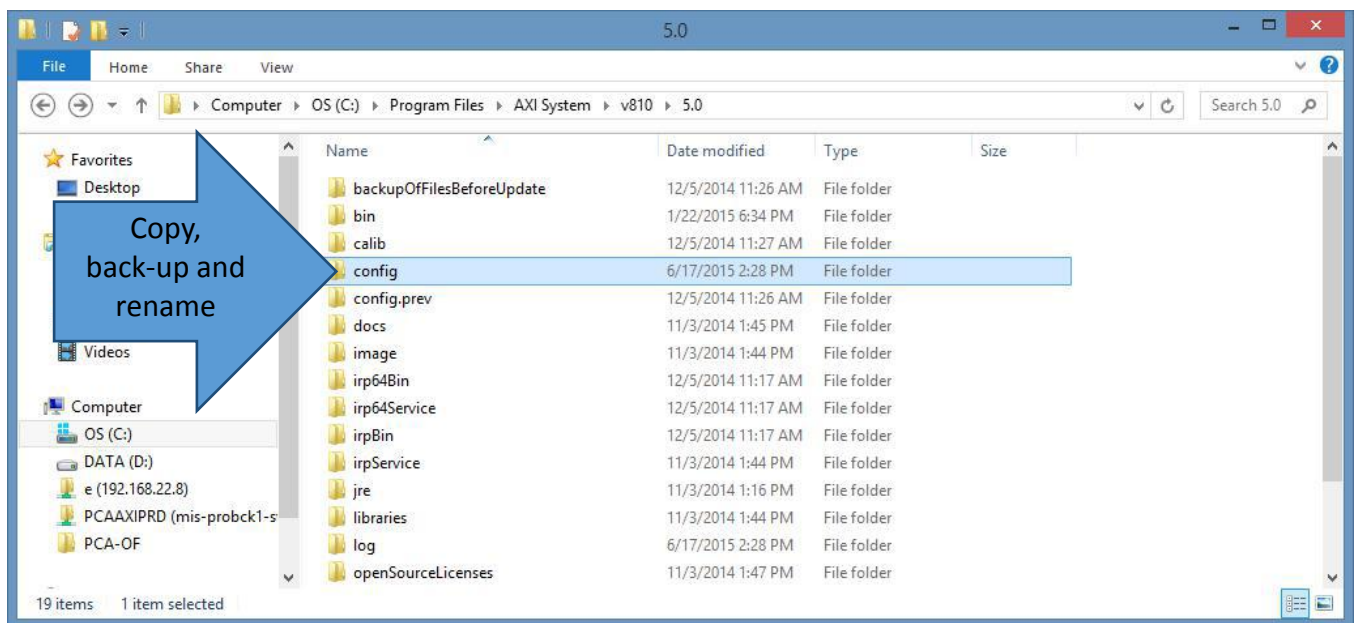


Figure 20 Config (Reference Only)

20. Unzip and paste the “Swap-XMP-ZMP-Config-Script” folder and paste into the desktop as shown.

Folder including with 4 scripts and 3 motions configure files.

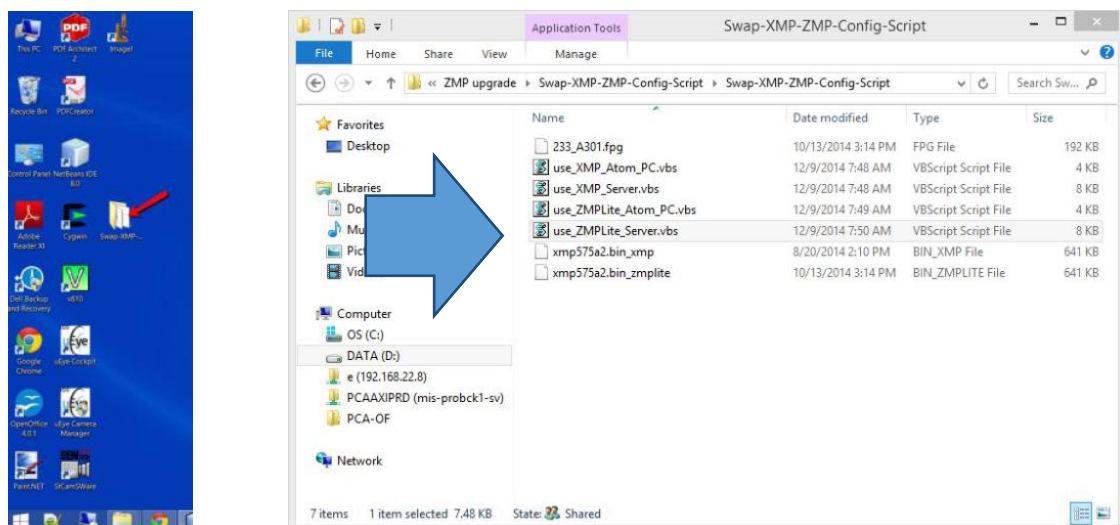


Figure 21 Script folder

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

21. Inside this folder, double click the “use_XMP_Server.vbs” file. Once system done update the correct motion configure files, message box as shown in Figure21 will pop out, click ok.

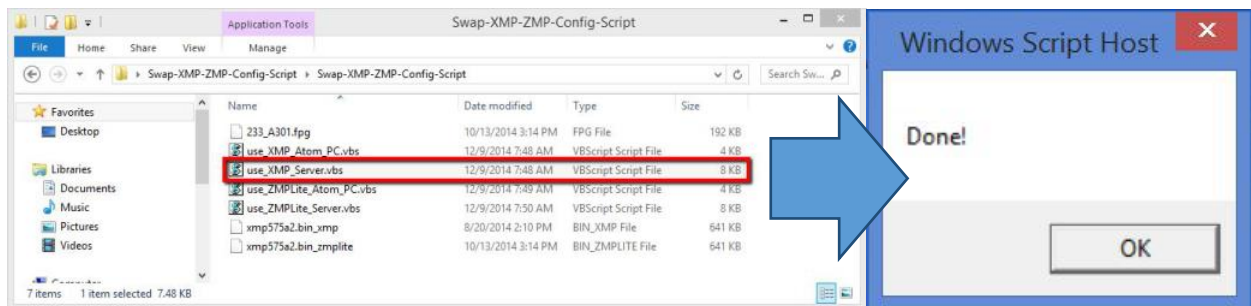


Figure 22 Script folder

22. After done, delete the “Swap-XMP-ZMP-Config-Script” folder in the desktop. (Avoid any wrong update). Once finish this step, server P, MEI Card configuration file will be updated. Origin hardware.config file will be back-up with the file name according to the date and time as shown.

Name	Date modified	Type	Size
hardware.config	10/17/2014 9:42 A...	CONFIG File	29 KB
hardware.config.bak	10/15/2014 9:18 A...	BAK File	29 KB
hardware.config_	9/2/2014 2:45 PM	CONFIG_ File	30 KB
hardware.config_20141017-094257	10/17/2014 8:53 A...	CONFIG_20141017...	29 KB
hardware.config_s3	10/9/2014 2:48 PM	CONFIG_S3 File	30 KB

Figure 23 Config backup

	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

23. Repeat step 1 ~ 2 and remote desktop into Atom PC. At Atom PC, may refer to below table for desire model to copy and back-up the origin config folder.

Model	Path
Strd Series One & Series 2	C:\Program Files\AXI System\v810\5.0\config
XXL Series One & Series 2	C:\Program Files\AXI System\v810\5.0\XXLconfig
S2EX	C:\Program Files\AXI System\v810\5.0\s2exconfig

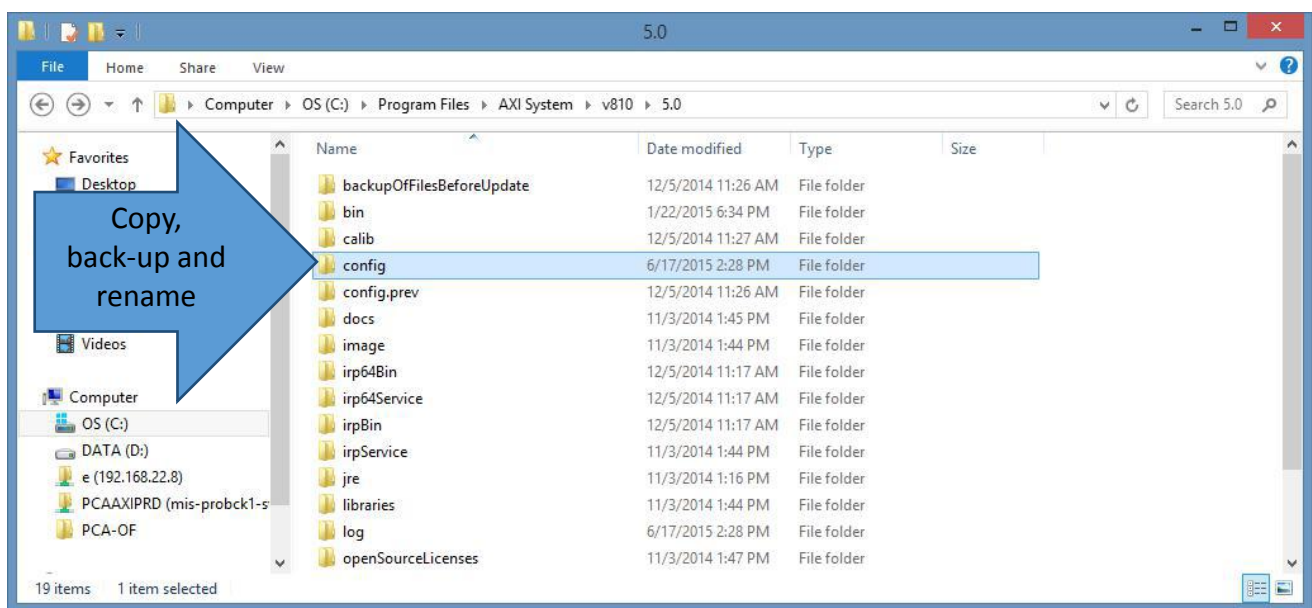


Figure 24 Config (Reference Only)

24. Repeat step 20~ 22 with select the “use_XMP_Atom_PC.vbs” to update Atom PC MEI card configuration files. Once done, power cycle SSCA.

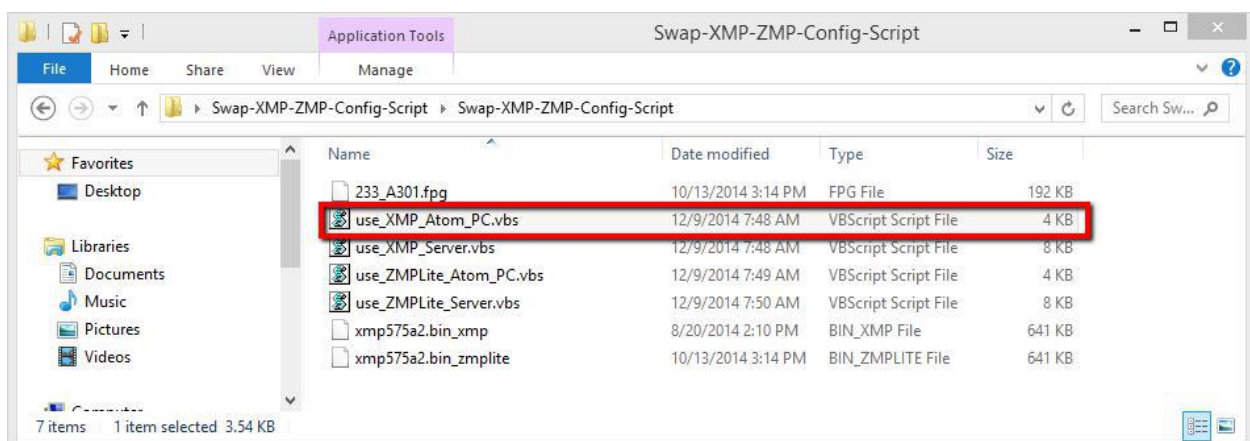


Figure 25 Script folder

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 MEI Card Removal and Replacement Procedure	Effective Date	2 Oct 2016

25. At V810 GUI, go to “Connected Processor” and upgrade the RMS.

Services → Subsystem Status & Control → Connected Processor → Stop RMS → Upgrade RMS
→Restart RMS

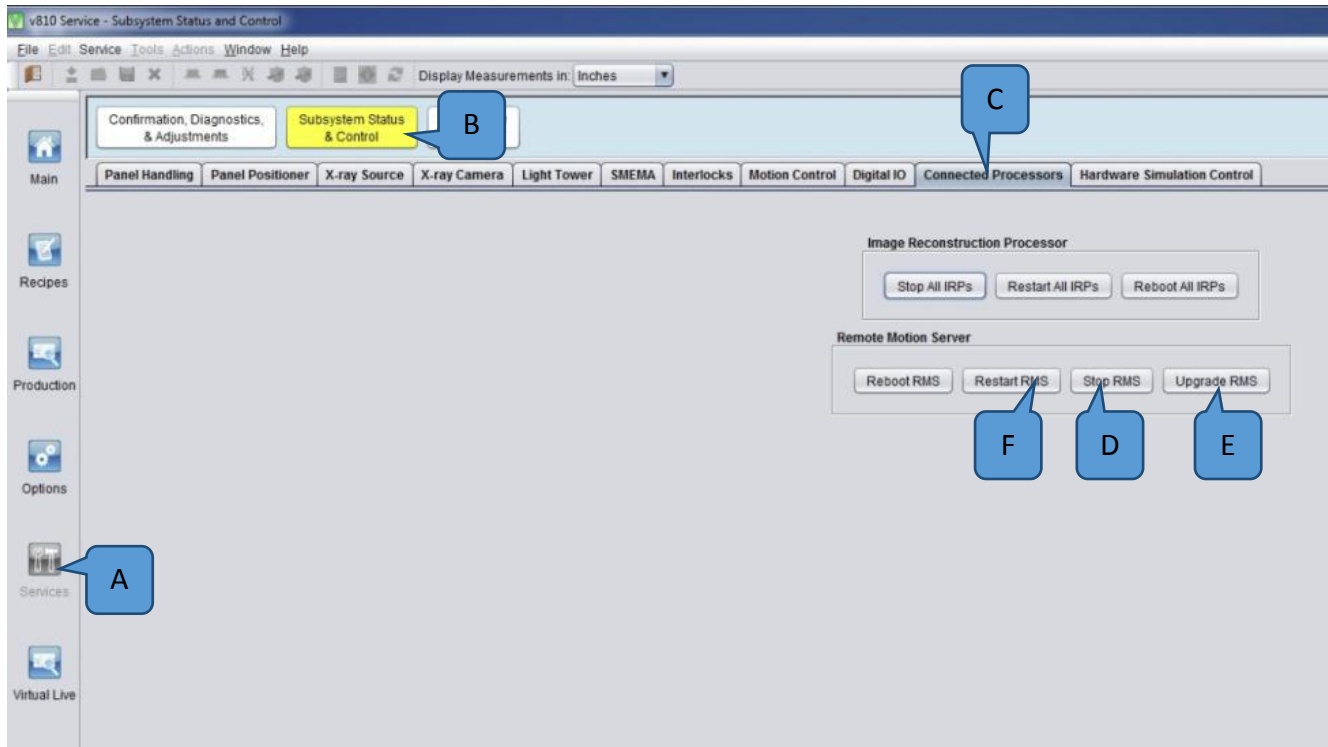


Figure 26 Connector processor

26. Go to Motion Controller tab and upgrade the motion firmware. Approximately take 15 min to complete upgrade.

Services → Subsystem Status & Control → Motion Controller → Upgrade Firmware →Initialize

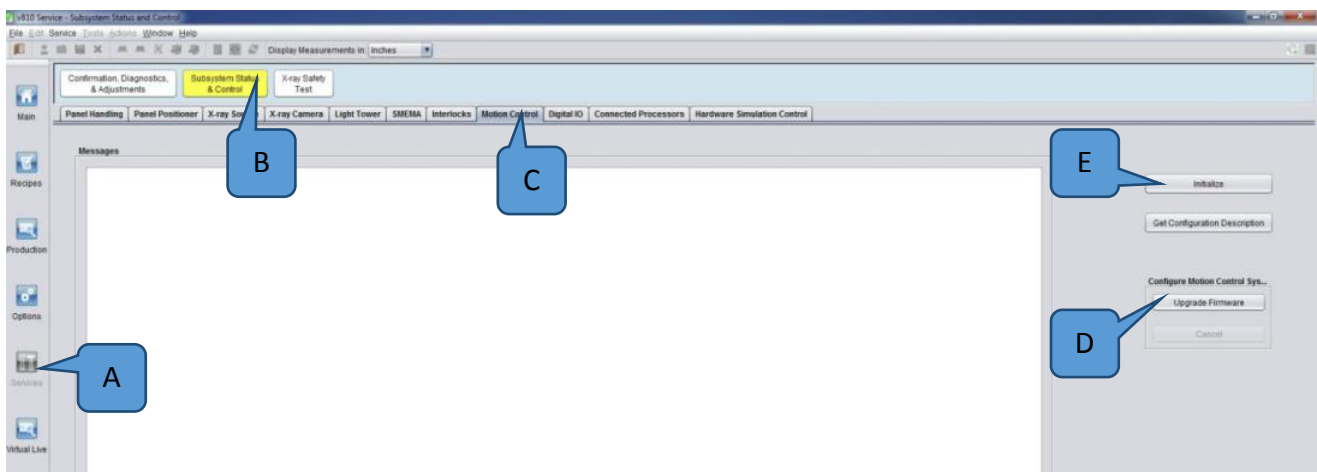


Figure 27 Motion control