

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

This procedure is applicable to below models:

V810 STD	☐	S1	☐	S2
V810 XXL	☒	S1	☒	S2
V810 S2EX	☐			
V810 Mini	☐			

REVISION HISTORY

Rev	Effective Date	Description	Doc Originator
00	01/11/2016	First Release	CHIN CHEE YAN
01	2 Oct 2016	Template Changes & Content Update	ONG KEAN SHENG

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

Content

X Ray Tube Removal	3
X Ray Tube Replacement.....	5

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

X Ray Tube Removal

1. Shutdown and completely power off machine. Turn off the air inlet main valve also.
2. Ensure the MCA box main power is switch off and green indicator light goes off as image below.

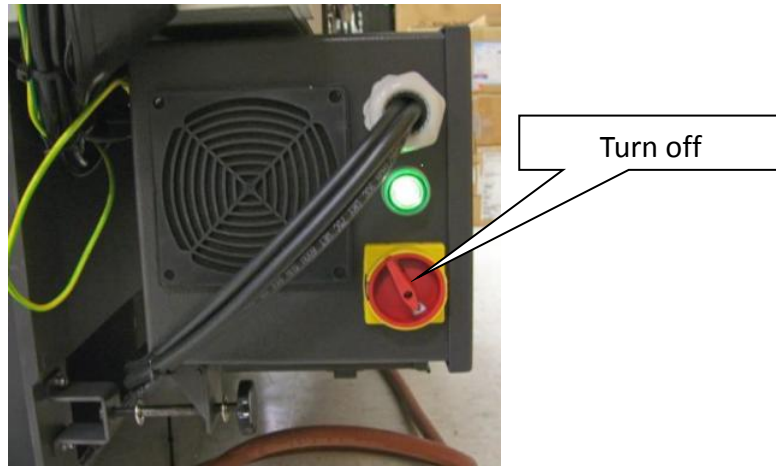


Figure 1

3. Open front access door and manually open inner barrier shutter plate to "Open" position.

Caution on tube bottom target



Figure 2

4. Unscrew and open the top access door as shown Figure 3.

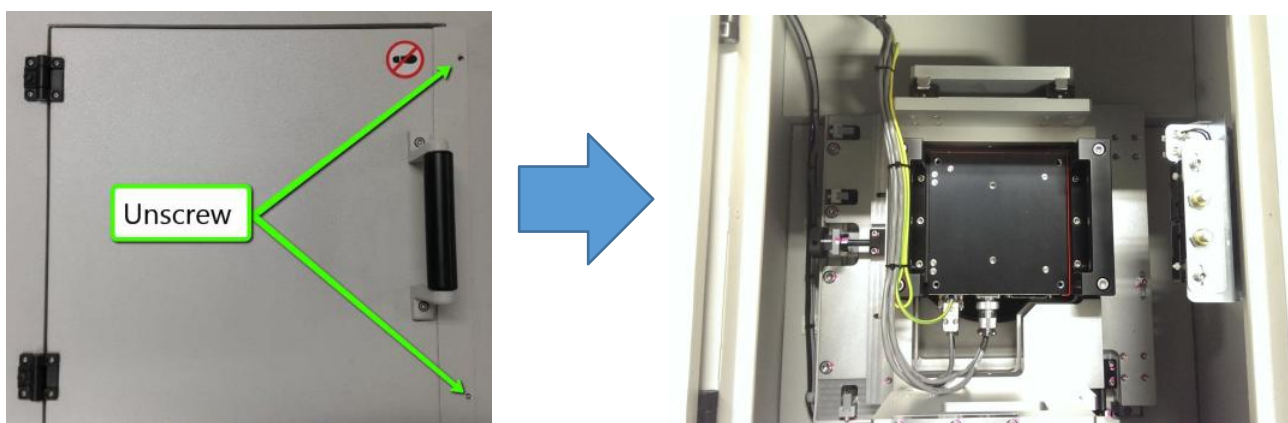


Figure 3

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

5. Remove cable ties and unscrew and remove SHCS M6×60 (4x) as Figure 4.

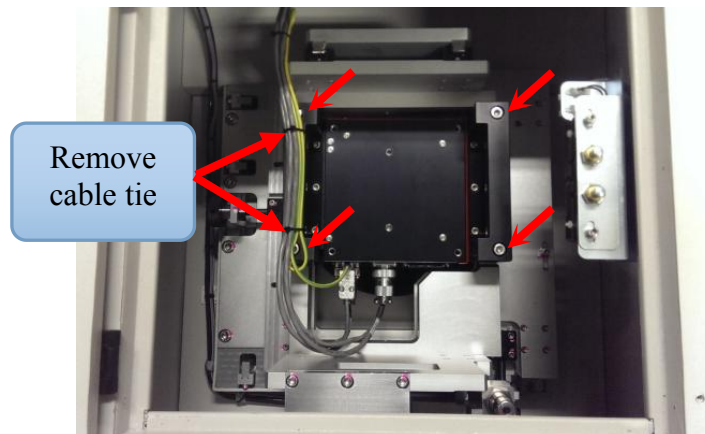


Figure 4

6. Gently lift the tube and place on top of the machine as Figure 5.

Remarks: Caution on cable assembly at X ray tube



Figure 5

7. Remove following cables from X-ray tube.

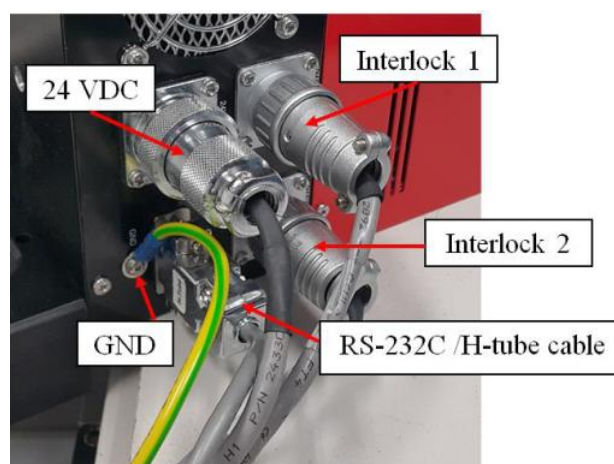


Figure 6

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

8. Unscrew 4 pcs of M6 X 12MMs as shown. Slightly slice the bracket and remove the origin tube from X-ray tube base support bracket assembly.

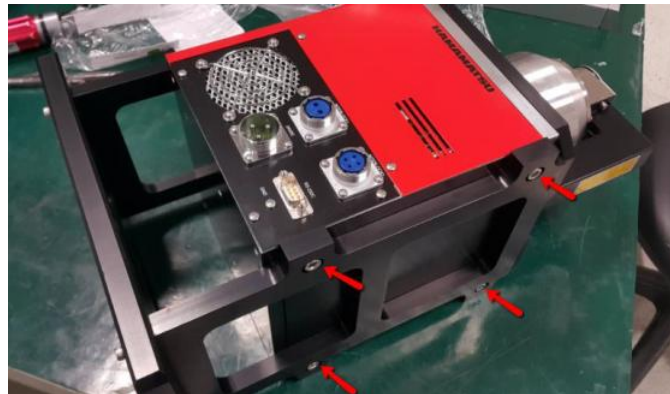


Figure 7

X Ray Tube Replacement

9. Prepare a new X-Ray tube (P/N, 2370-0003) and **record down the old and new tube SN** for record and tracking purpose. Unscrew and transfer the irradiation window cover from new tube to old tube.

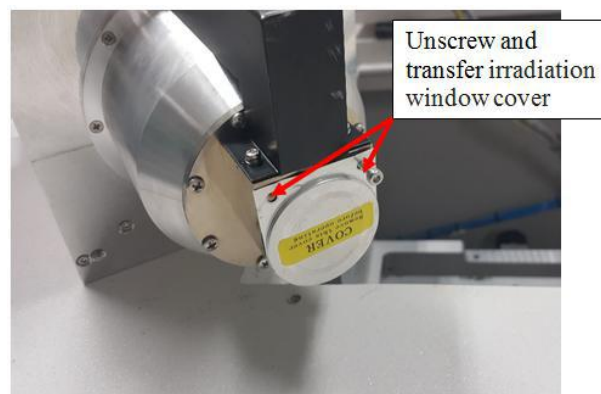


Figure 8

10. Assemble new tube into X-ray tube base support bracket assembly and tighten 4 pcs of M6 X 12MM) as shown.

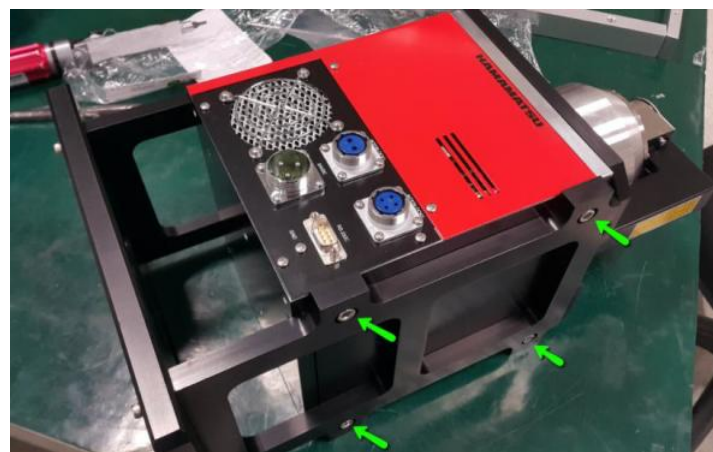


Figure 9

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

11. Check internal X-ray chamber whether contain any foreign material.

E.g. Screws, Nut and etc.

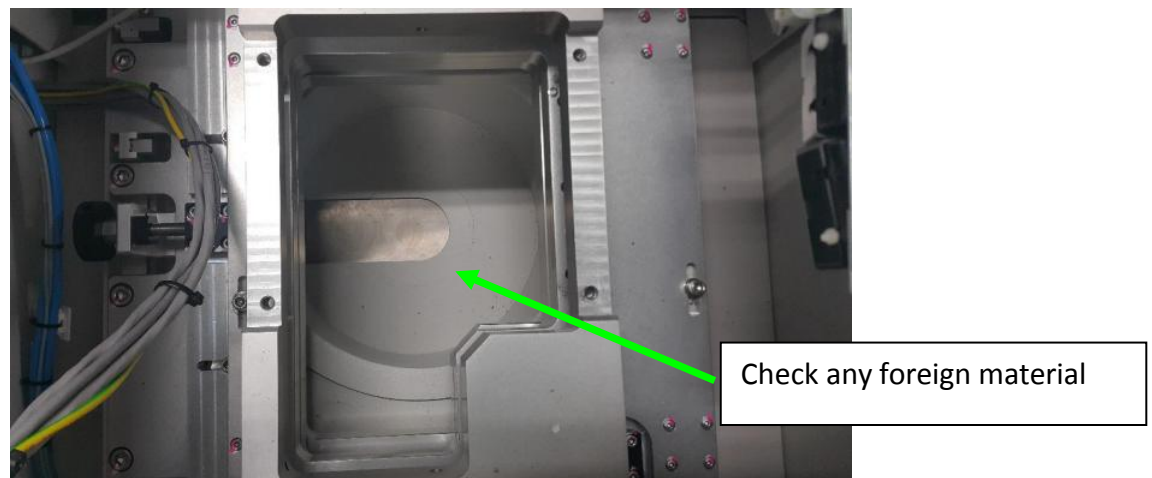


Figure 10

12. Connect all cables to X-ray tube panel as Figure 11.

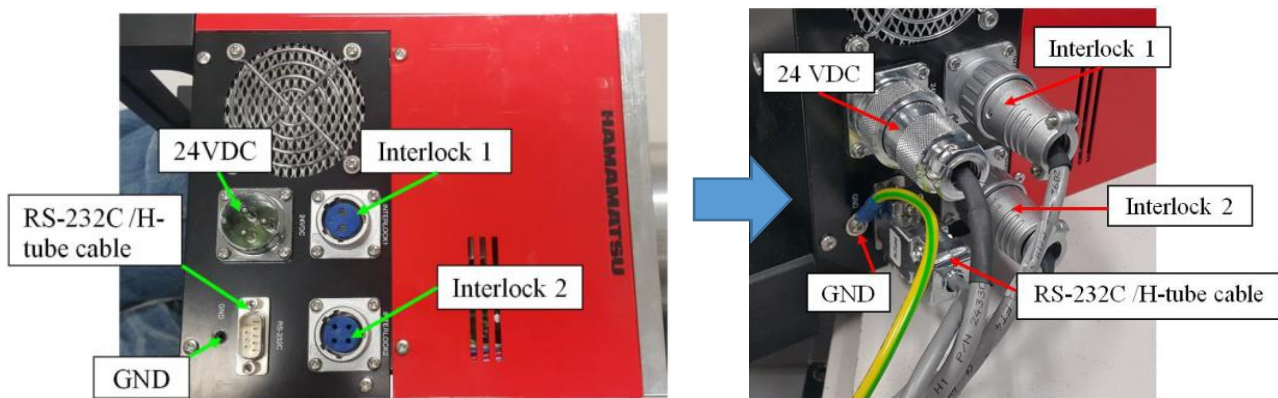


Figure 11

	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

13. Assemble new tube into machine and tighten 4 pcs of SHCS M6×60 as Figure 12.

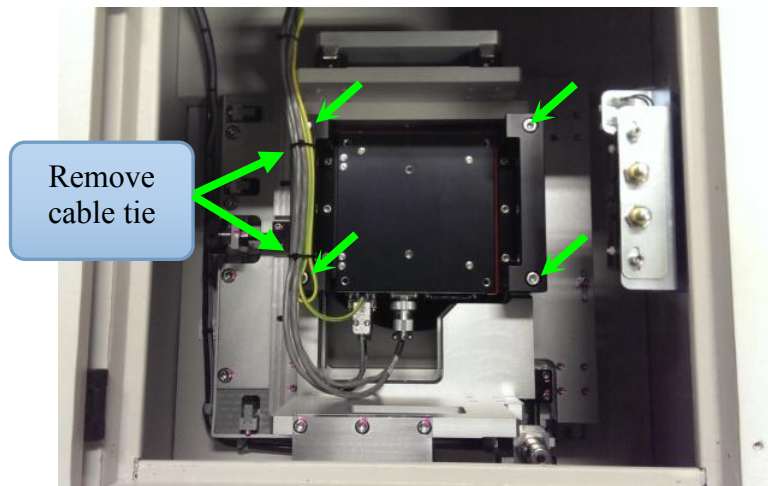


Figure 12

14. Manually push and pull the inner barrier shutter plate. Visual Check whether tube bottom target contain any friction with shuttle plate.



Figure 13

15. Once complete, close all the access door and power up machine as usual. Soft remind to turn on the main air inlet and ensure it is set to 80 PSI.

ViTrox	Work Instruction	Doc. Revision	01
	AXI V810 XXL X-Ray tube Replacement Procedure	Effective Date	2 Oct 2016

16. Open V810 Software and initialize at X ray source tab.

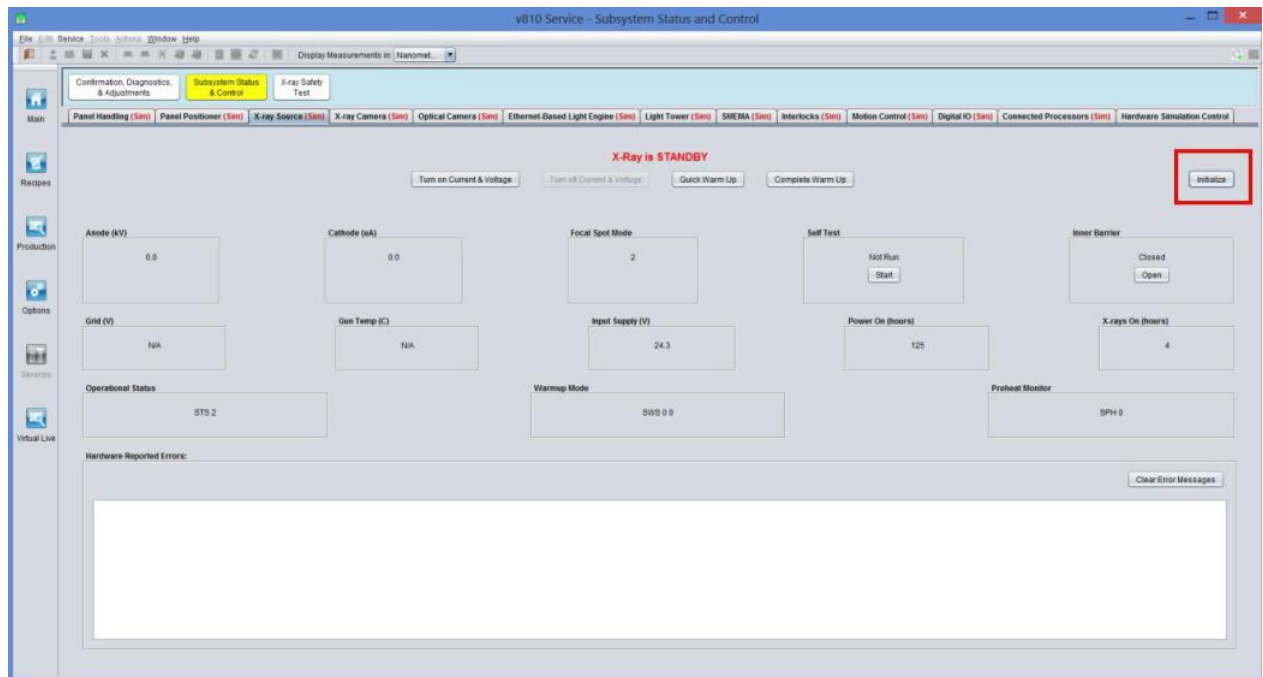


Figure 14

Remarks : Tube ramp will last for 90 Min (approximately)

17. Open the V810 software and run X-ray Self-Test as shown in Figure 15. Print Screen entire page and provide to ViTrox AXI Support team

Services → Subsystem Status & Control → X-Ray Source → Initialize → Turn off Current & Voltage → Self test → Start

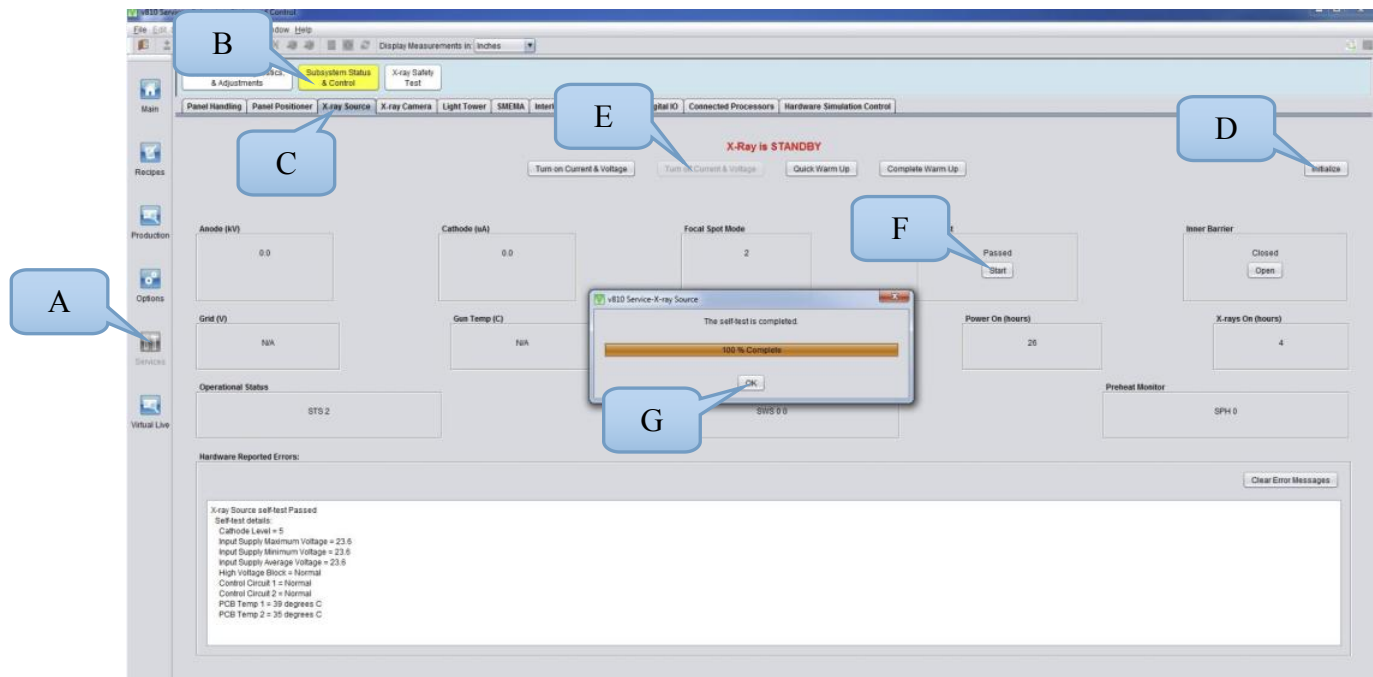


Figure 15

18. Perform tube alignment optimization by refer to **AXI V810 XXL X-Ray Tube Alignment Procedure.**