



PCB parts placement diagram:

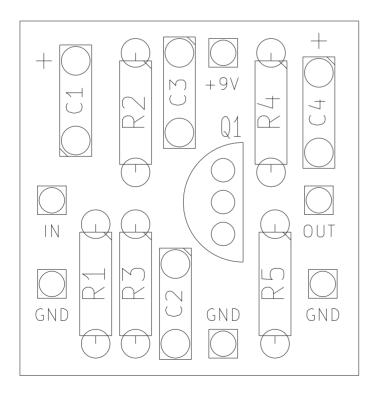

ΚI	TM
R2	430k
R3	43k
R4	10k
R5	390R
C1	2n2
C2	empty
C3	empty
C4	2n2
Q1	2N5088

Wiring (bottom view):

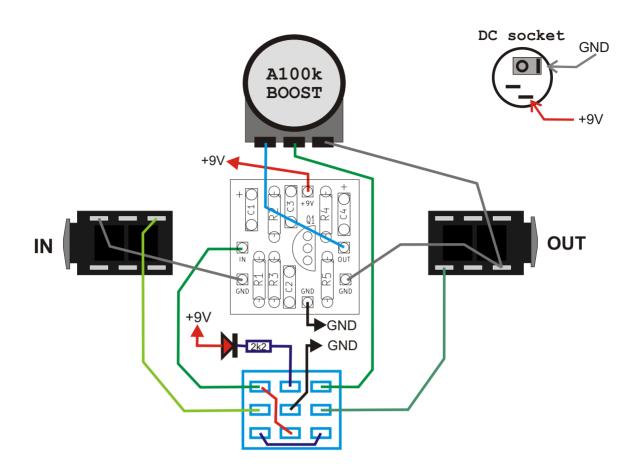

Use metal enclosure connected to ground. Power supply: 9V DC

Bill of materials:

Resistors: Capacitors:
2k2 1pcs. "LED" 2n2 2pcs. "C1 C4"
390R 1pcs. "R5"

10k 1pcs. "R4" Semiconductors:
43k 1pcs. "R3" 2N5088 1pcs. "Q1"
430k 1pcs. "R2" LED 1pcs.

1M 1pcs. "R1"

Potentiometers: A100k 1pcs.

Other:

Knob 1pcs.
Footswitch 3PDT 1pcs.
DC socket 5.5/2.1 1pcs.
JACK socket 2pcs.

Resistor color code:



 $= 390 \times 10\Omega = 3.9k\Omega$

Color	Band 1	Band 2	Band 3	Multiplier	Tolerance
Black	0	0	0	1 Ω	
Brown	1	1	1	10 Ω	1%
Red	2	2	2	100 Ω	2%
Orange	3	3	3	1k Ω	
Yellow	4	4	4	10 kΩ	
Green	5	5	5	100 kΩ	0,5%
Blue	6	6	6	1 ΜΩ	0,25%
Purple	7	7	7	10 MΩ	0,1%
Gray	8	8	8	100 ΜΩ	0,05%
White	9	9	9	1 GΩ	
Gold				0,1 Ω	5%
Silver				0,01 Ω	10%

Capacitors markings:

```
471 = 47 \times 10^{1} pF = 470pF
 472 = 47 \times 10^2 \text{ pF} = 4700 \text{pF} = 4,7 \text{nF}
 473 = 47 \times 10^{3} \text{ pF} = 47000 \text{ pF} = 47 \text{ nF}
 474 = 47 \times 10^4 \, \text{pF} = 470000 \, \text{pF} = 470 \, \text{nF}
 100pF =
               100p
                              100
                                     = 101
 220pF = 220p =
                              220
                                     = 221
 4,7nF = 4n7 = 0.0047

10nF = 10n = 0.01
                                     = 472
                                     = 103
 100nF = 100n = 0.1
220nF = 220n = 0.22
                                    = 104
= 224
 470nF = 470n = 0.47 = 474
1000nF = 1uF = 1u
                                     =
                                         105
```