


Revision 05.29.20

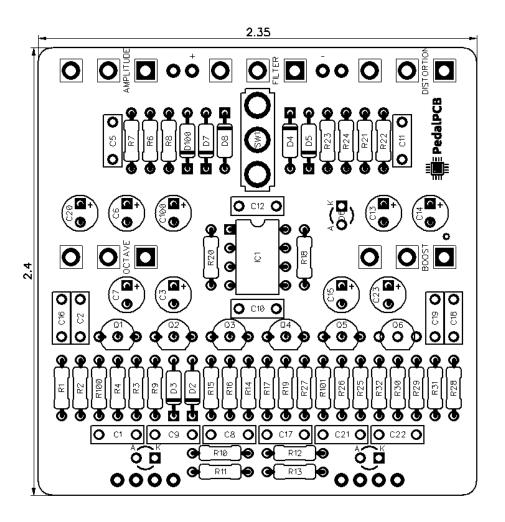

Controls

- Distortion
- Filter
- Amplitude
- Clipping (Toggle Switch)
- Octave Blend
- Boost

- Active/Bypass (Footswitch)
- Boost (Footswitch)

All trademarks and registered trademarks are the property of their respective owners. The company, product, and service names used in this web site are for identification purposes only. Use of these names, logos, and brands does not imply endorsement.



Parts List

RESISTORS (1/4W)		CAPACITORS		INTEGRATED CIRCUITS		
R1	1M	C1	100p	IC1	LM308	
R2	1K	C2	100n			
R3	1M	C3	1u	TRANSISTORS		
R4	10K	C5	22n	Q1	PF5102	2
R6	1M	C6	10u	Q2	2N508	9
R7	10K	C7	1u	Q3	2N508	
R8	10K	C8	100n	Q4	2N508	9
R9	10K	C9	100n	Q5	PF5102	
R10	100K	C10	100n	Q6	BS170	
R11	100K	C11	100p	Č		
R12	47K	C12	30p	DIODES		
R13	47K	C13	4u7	D2	GE	
R14	10K	C14	2u2	D3	GE	
R15	10K	C15	4u7	D4	1N414	8
R16	22K	C16	1n	D5	1N414	8
R17	2K2	C17	100n	D7	1N414	8
R18	47K	C18	3n3	D8	1N414	8
R19	470K	C19	22n	D100	1N581	7
R20	1K	C20	1u			
R21	560R	C21	100p	LEDS		
R22	47R	C22	1u	D6		Red 3mm LED
R23	1K	C23	10u	LED_D	IST	Red 3mm LED
R24	1K5	C100	100u	LED_B	OOST	Red 3mm LED
R25	1M					
R26	10K	POTENTIOMETERS				
R27	1M	TOGG	LE SWITCHES	DISTORTION		A100K
R28	1K	SW1	SPDT ON/OFF/ON	FILTER	}	A100K
R29	470K			AMPLI'	TUDE	A100K
R30	470K			OCTAV	Έ	B50K
R31	470R			BOOST		A100K
R32	10K					
R100	4K7					
R101	4K7					

LM308 Substitutions

IC1 can be substituted with other similar single-channel opamps.

The following have been tested:

LM308 - Confirmed working

OP07 - Confirmed working


LM741 - Confirmed working (omit C12)

NE5534 - Not a suitable replacement, causes oscillation

A100K



Wiring Diagram

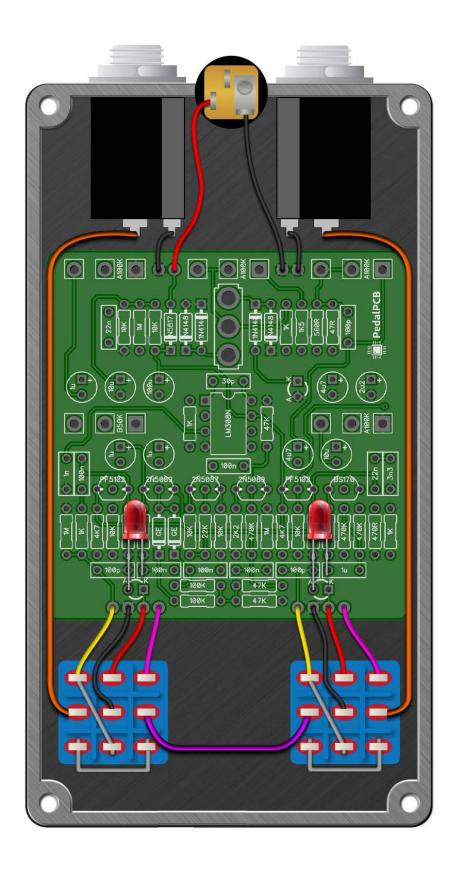



Drill Template 125B Enclosure

