M2-RESOLVER			
Lynxeo: 10168665			
0.5 mm² (21 AWG)	+ S	25.0 ft	BK

+DP-X4			+AJB-X4
1	+DP-X4:1	BK:PR1 (A+)	+AJB-X4:1
2	+DP-X4:2	WH:PR1 (A-)	+AJB-X4:2
3	+DP-X4:3	SHIELD (PAIR 1)	+AJB-X4:3
4	+DP-X4:4	BK:PR2 (B+)	+AJB-X4:4
5	+DP-X4:5	WH:PR2 (B-)	+AJB-X4:5
6	+DP-X4:6	SHIELD (PAIR 2)	+AJB-X4:6
7	+DP-X4:7	BK:PR3 (V+)	+AJB-X4:7
8	+DP-X4:8	WH:PR3 (V-)	+AJB-X4:8
9	+DP-X4:9	SHIELD (PAIR 3)	+AJB-X4:9
10	+DP-X4:10	BK:PR4 (SPARE)	+AJB-X4:10
11	+DP-X4:11	WH:PR4 (SPARE)	+AJB-X4:11
12	+DP-X4:12	SHIELD (PAIR 4)	+AJB-X4:12
13	+DP-X4:13	BK:PR5 (SPARE)	+AJB-X4:13
14	+DP-X4:14	WH:PR5 (SPARE)	+AJB-X4:14
15	+DP-X4:15	SHIELD (PAIR 5)	+AJB-X4:15
16	+DP-X4:16	Shield	+AJB-X4:16


EN 50288-7 XLPE IOS Armoured 5 x 2 x 0,5

MEA INC
www.meaincorporated.com

TITLE:
FIELD WIRING DRAWING

DWG NO.
2275-200

REV.
A

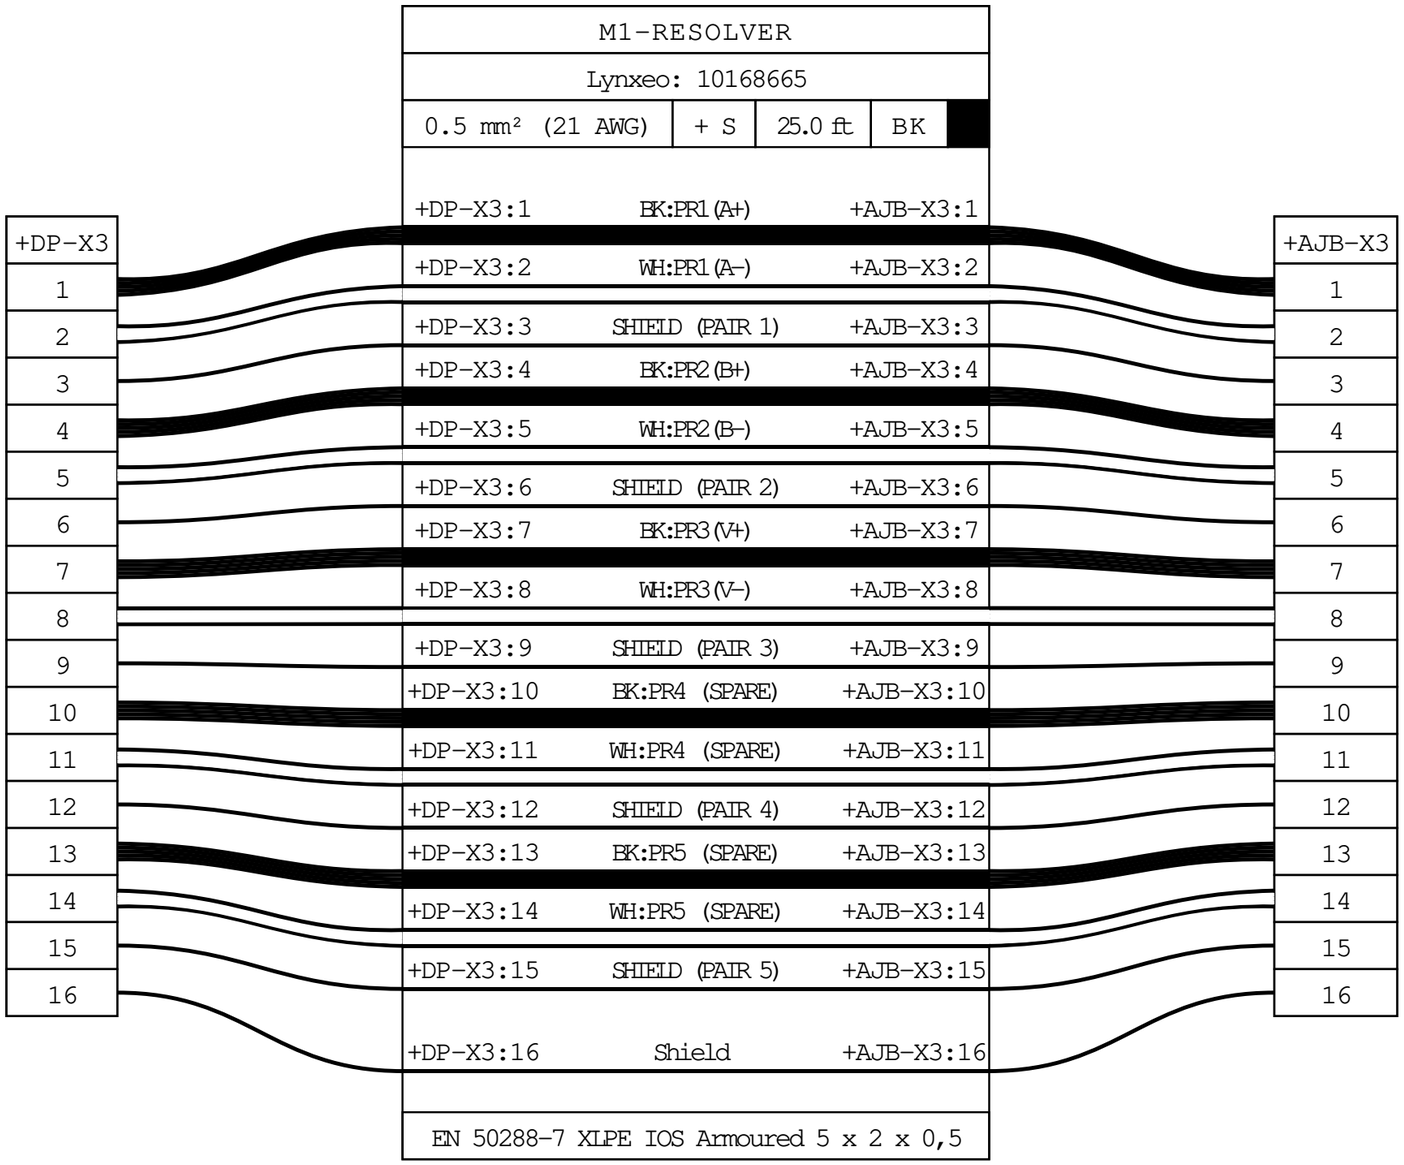


MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A

M2-POWER			
ELAND: A7HSWA04040LS			
4 mm² (12 AWG)	+ S	25.0 ft	BK

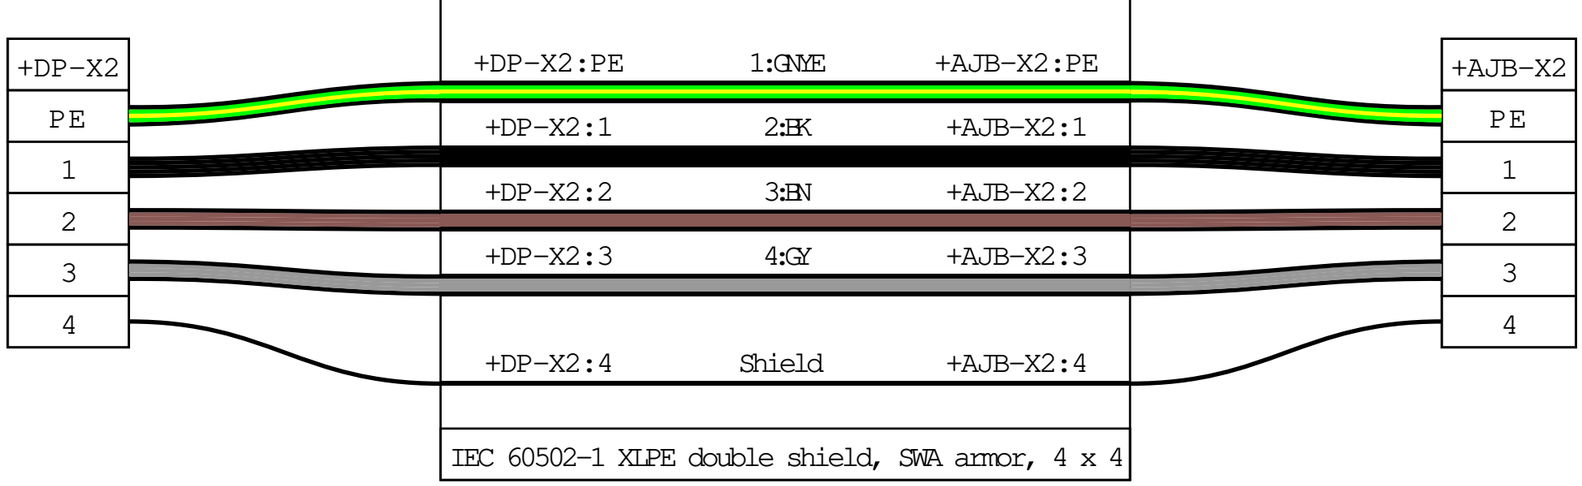

IEC 60502-1 XLPE double shield, SWA armor, 4 x 4


MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A

M1-POWER			
ELAND: A7HSWA04040LS			
4 mm² (12 AWG)	+ S	25.0 ft	BK

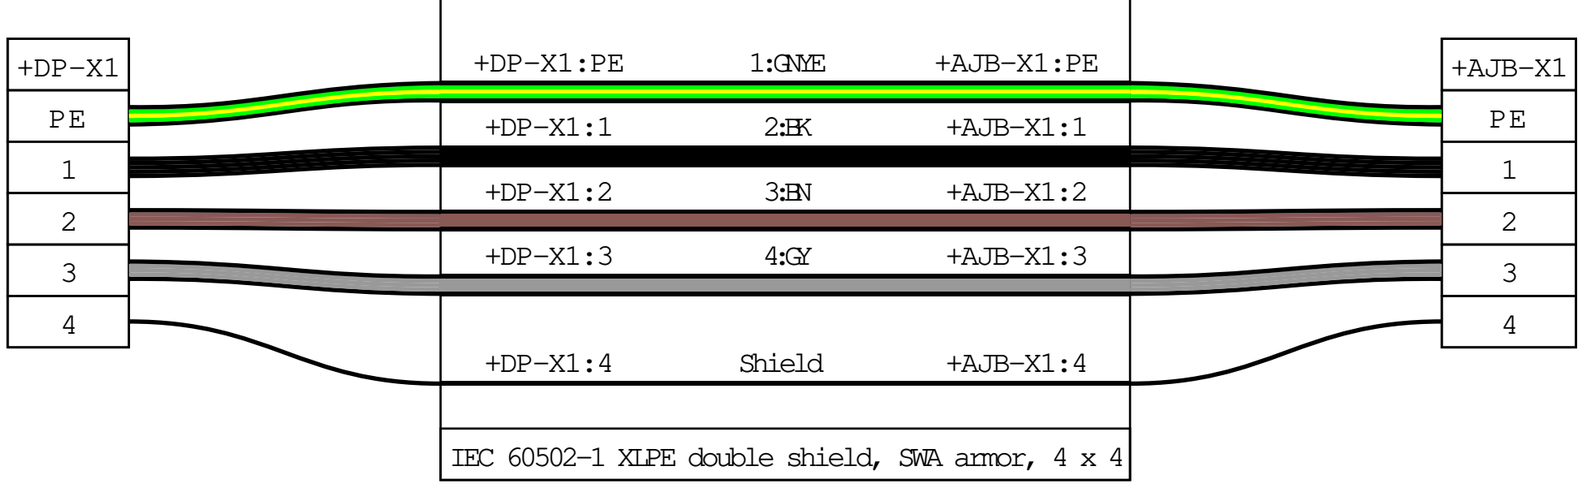

IEC 60502-1 XLPE double shield, SWA armor, 4 x 4

MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A

+MCP-X4
1U
1M
1L
2U
2M
2L
3U
3M
3L
4U
4M
4L
5U
5M
5L
SHIELD



3-deck fuse terminal block with shield to rail.

ACTUATOR-ANALOG

Lynxeo: 10168748

0.75 mm² (20 AWG)	+ S	25.0 ft	BK

+MCP-X4:1U	BK:1(BK)	+AJB-X4-MCP:1U
+MCP-X4:1M	WH:1(WH)	+AJB-X4-MCP:1M
+MCP-X4:1L	SHIELD (PAIR 1)	+AJB-X4-MCP:1L
+MCP-X4:2U	BK:2(BK)	+AJB-X4-MCP:2U
+MCP-X4:2M	WH:2(WH)	+AJB-X4-MCP:2M
+MCP-X4:2L	SHIELD (PAIR 2)	+AJB-X4-MCP:2L
+MCP-X4:3U	BK:3(BK)	+AJB-X4-MCP:3U
+MCP-X4:3M	WH:3(WH)	+AJB-X4-MCP:3M
+MCP-X4:3L	SHIELD (PAIR 3)	+AJB-X4-MCP:3L
+MCP-X4:4U	BK:4(BK)	+AJB-X4-MCP:4U
+MCP-X4:4M	WH:4(WH)	+AJB-X4-MCP:4M
+MCP-X4:4L	SHIELD (PAIR 4)	+AJB-X4-MCP:4L
+MCP-X4:5U	BK:5(BK)	+AJB-X4-MCP:5U
+MCP-X4:5M	WH:5(WH)	+AJB-X4-MCP:5M
+MCP-X4:5L	SHIELD (PAIR 5)	+AJB-X4-MCP:5L
+MCP-X4:SHIELD	Shield	+AJB-X4-MCP:SHIELD

EN 50288-7 XLPE IOS Armoured 5 x 2 x 0,75
Pair 5 spare

+AJB-X4-MCP
1U
1M
1L
2U
2M
2L
3U
3M
3L
4U
4M
4L
5U
5M
5L
SHIELD



3-deck through terminal block.

MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A

ACTUATOR-DISCRETE		
Lynxeo: 10108697		
1.5 mm² (16 AWG)	25.0 ft	BK

+MCP-X2			+AJB-X2-MCP
1	+MCP-X2:1	1:BK +AJB-X2-MCP:1U	
2	+MCP-X2:2	2:BK +AJB-X2-MCP:2L	
3	+MCP-X2:3	3:BK +AJB-X2-MCP:3L	
4	+MCP-X2:4	4:BK +AJB-X2-MCP:4L	
5	+MCP-X2:5	5:BK +AJB-X2-MCP:5L	
6	+MCP-X2:6	6:BK +AJB-X2-MCP:6L	
7	+MCP-X2:7	7:BK +AJB-X2-MCP:7	

IEC 60502-1 Armoured (SWA) 7 x 1,5
Core 7 spare

+AJB-X2-MCP		
1U	BU	
2L	BU	
3L	BU	
4L	BU	
5L	BU	
6L	BU	
7		



Use the terminal that is marked blue.
(Upper for T1, lower for 2-6.)

* Terminal 3U means land the wire on the upper deck of the block.
* Note that there are two of each block 3-6.
* (Terminals for field wiring marked BU for clarity.)

MEA INC
www.meaincorporated.com

TITLE:
FIELD WIRING DRAWING

DWG NO.
2275-200


REV.
A

ACTUATOR-DC-POWER			
Lynxeo: 10108697			
1.5 mm² (16 AWG)	25.0 ft	BK	

+MCP-X1			+AJB-X1-MCP
1	+MCP-X1:1	1:BK	+AJB-X1-MCP:1
2	+MCP-X1:2	2:BK	+AJB-X1-MCP:2L
3	+MCP-X1:3	3:BK	+AJB-X1-MCP:3U
4	+MCP-X1:4	4:BK	+AJB-X1-MCP:4U
5	+MCP-X1:5	5:BK	+AJB-X1-MCP:5U
6	+MCP-X1:6	6:BK	+AJB-X1-MCP:6U
7	+MCP-X1:7	7:BK	+AJB-X1-MCP:7

IEC 60502-1 Armoured (SWA) 7 x 1,5
Core 1 and core 7 spare

+AJB-X1-MCP	
1	
2L	BU
3U	BU
4U	BU
5U	BU
6U	BU
7	

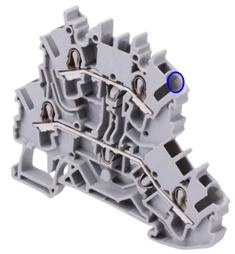

Use the upper terminal that is marked blue.

* Terminal 3U means land the wire on the upper deck of the block.
* Note that there are two of each block 3-6.
* (Terminals for field wiring marked BU for clarity.)

MEA INC
www.meaincorporated.com

TITLE:
FIELD WIRING DRAWING

DWG NO.
2275-200

REV.
A

+MCP-XESD
1
2

ESD-STATUS		
Lynxeo: 1030279		
1 mm² (18 AWG)	25.0 ft	BK
+MCP-XESD:1	1:BK	+AJB-XESD:1L
+MCP-XESD:2	2:WH	+AJB-XESD:2L
EN 50288-7 XLPE OS Armoured 1x2x1		

+AJB-XESD	
1L	1L
1U	1U
2L	2L
2U	2U
3L	3L
3U	3U
Upper terminals for solenoid connections.	

SIS-ESD			
Sermes: 12251154			
By others	2.5 mm² (14 AWG)	BK	
+AJB-XESD:1L	BN	+SIS-XESD:+	
+AJB-XESD:2L	IB	+SIS-XESD:-	
+AJB-XESD:3L	GNYE	+SIS-XESD:PE	
U 1000 RVFV RH 3G2,5 TGL			


+SIS-XESD
By others
+
-
PE
48 VDC ESD Power

MEA INC
www.meaincorporated.com

TITLE:
FIELD WIRING DRAWING

DWG NO.
2275-200

REV.
A

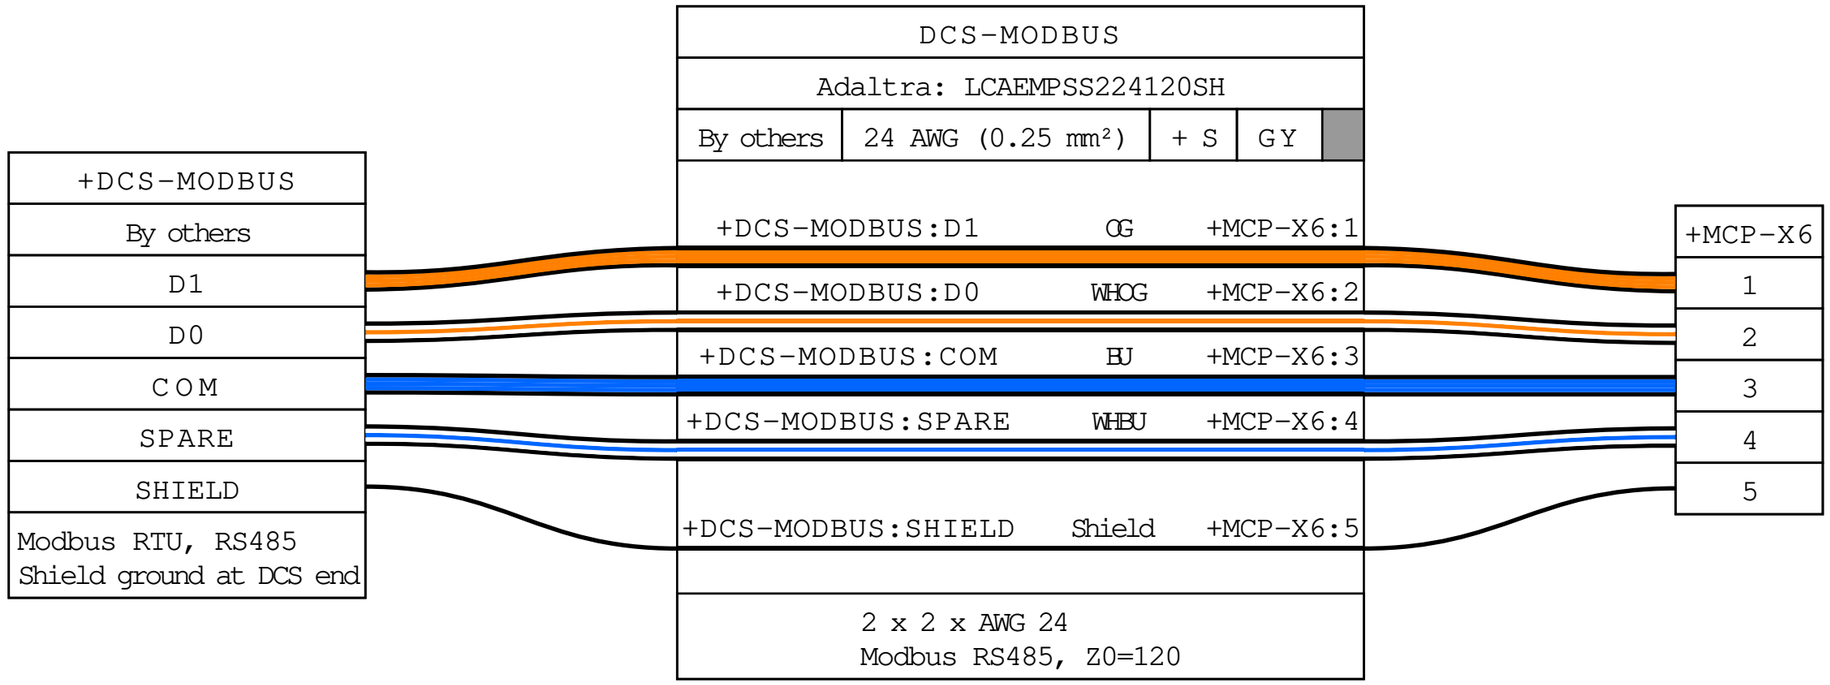

MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A

+DCS-INSTRUMENT	
By others	
ZC +	1
ZC –	2
ZI +	3
ZI –	4
PT ACC +	5
PT ACC –	6
PT A +	7
PT A –	8
PT B +	9
PT B –	10
ESD Alarm +	11
ESD Alarm –	12
Auto Alarm +	13
Auto Alarm –	14
Trouble Alarm +	15
Trouble Alarm –	16
Mode Bit 0 +	17
Mode Bit 0 –	18
Mode Bit 1 +	19
Mode Bit 1 –	20
Mode Bit 2 +	21
Mode Bit 2 –	22
SHIELD	23

Shield grounded at DCS end only
Unused cores terminated and earthed at DCS end per 60079-14 8.2.3.2

DCS-INSTRUMENT				
Sermes: 14483064				
By others	0.88 mm² (Unknown AWG)		+ S	BU
+DCS-INSTRUMENT:1:ZC +		RD:PR1		+MCP-X5:1U
+DCS-INSTRUMENT:2:ZC –		WH:PR1		+MCP-X5:1M
+DCS-INSTRUMENT:3:ZI +		RD:PR2		+MCP-X5:2U
+DCS-INSTRUMENT:4:ZI –		WH:PR2		+MCP-X5:2M
+DCS-INSTRUMENT:5:PT ACC +		RD:PR3		+MCP-X5:3U
+DCS-INSTRUMENT:6:PT ACC –		WH:PR3		+MCP-X5:3M
+DCS-INSTRUMENT:7:PT A +		RD:PR4		+MCP-X5:4U
+DCS-INSTRUMENT:8:PT A –		WH:PR4		+MCP-X5:4M
+DCS-INSTRUMENT:9:PT B +		RD:PR5		+MCP-X5:5U
+DCS-INSTRUMENT:10:PT B –		WH:PR5		+MCP-X5:5M
+DCS-INSTRUMENT:11:ESD Alarm +		RD:PR6		+MCP-X3:1
+DCS-INSTRUMENT:12:ESD Alarm –		WH:PR6		+MCP-X3:2
+DCS-INSTRUMENT:13:Auto Alarm +		RD:PR7		+MCP-X3:3
+DCS-INSTRUMENT:14:Auto Alarm –		WH:PR7		+MCP-X3:4
+DCS-INSTRUMENT:15:Trouble Alarm +		RD:PR8		+MCP-X3:5
+DCS-INSTRUMENT:16:Trouble Alarm –		WH:PR8		+MCP-X3:6
+DCS-INSTRUMENT:17:Mode Bit 0 +		RD:PR9		+MCP-X3:7
+DCS-INSTRUMENT:18:Mode Bit 0 –		WH:PR9		+MCP-X3:8
+DCS-INSTRUMENT:19:Mode Bit 1 +		RD:PR10		+MCP-X3:9
+DCS-INSTRUMENT:20:Mode Bit 1 –		WH:PR10		+MCP-X3:10
+DCS-INSTRUMENT:21:Mode Bit 2 +		RD:PR11		+MCP-X3:11
+DCS-INSTRUMENT:22:Mode Bit 2 –		WH:PR11		+MCP-X3:12
+DCS-INSTRUMENT:23:SHIELD		Shield		+MCP-X3:13

19IP09EGFA – BLEU19IP09EGFA – BLEU
Pairs 12 – 19 unused

+MCP-X5
1U
1M
2U
2M
3U
3M
4U
4M
5U
5M

+MCP-X3
1
2
3
4
5
6
7
8
9
10
11
12
13

Terminate unused cores per IEC 60079-14 8.2.3.2.

MEA INC
www.meaincorporated.com

TITLE:
FIELD WIRING DRAWING

DWG NO.
2275-200

REV.
A

+SUPPLY-X400
By others
L1
L2
L3
N
PE

SUPPLY-400V		
Sermes: U 1000 RVFV RH 5G4 TGL		
By others	4 mm² (12 AWG)	BK

+SUPPLY-X400:L1	BKBN	+MCP/6Q1:1
+SUPPLY-X400:L2	BK	+MCP/6Q1:3
+SUPPLY-X400:L3	BKGY	+MCP/6Q1:5
+SUPPLY-X400:N	LB	+MCP/6Q1:N
+SUPPLY-X400:PE	GNYE	+MCP-XEA:1:PE

+MCP/6Q1
Circuit breaker
1
3
5
N

+SUPPLY-X230
By others
L
N

SUPPLY-230V		
Sermes: U 1000 RVFV RH 3G25 TGL		
By others	25 mm² (4 AWG)	BK

+SUPPLY-X230:L	BN	+MCP/6Q2:1
+SUPPLY-X230:N	LB	+MCP/6Q2:3
	GNYE	+MCP-XEA:2:PE

+MCP/6Q2
Circuit breaker
1
3

By others
Local Earth

+MCP-XEA	
1	PE
2	PE

MEA INC
www.meaincorporated.com

TITLE: FIELD WIRING DRAWING

DWG NO. 2275-200

REV. A