



FIG. A


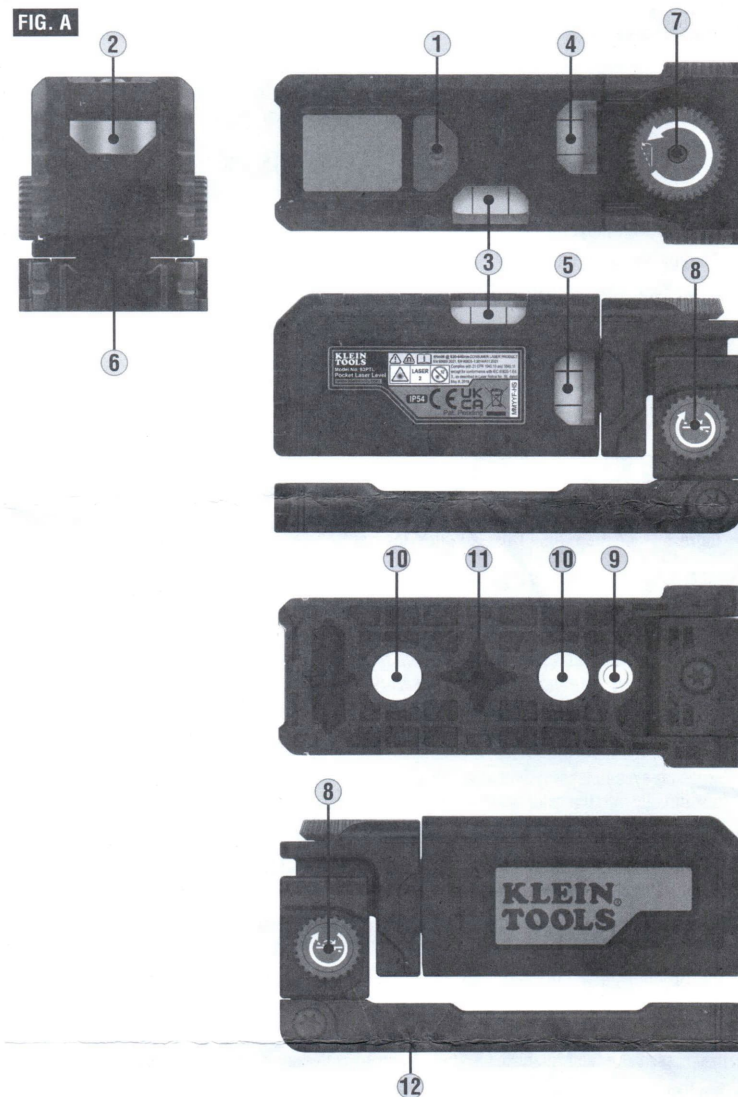


FIG. B

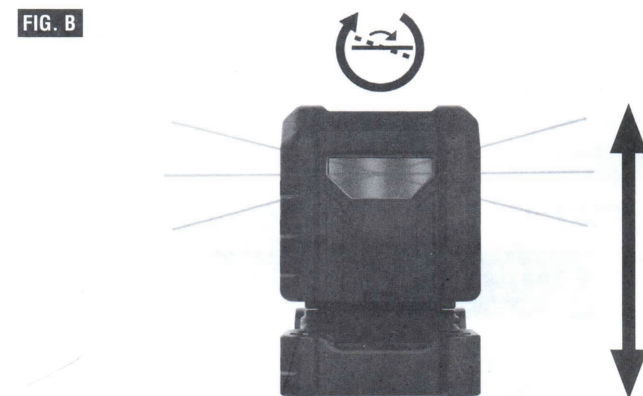

ENGLISH

The 93PTL is a laser level that can adjust in 3 axis by both adjusting the housing, and by a built-in fine adjust system. Alongside the 3 axis orthogonal illuminated bubble vials, the 93PTL can deliver level lines, plumb lines, and lines at custom angles.

GENERAL SPECIFICATIONS

- **Operating Temp:** 14°F to 122°F (-10°C to 50°C)
- **Relative Humidity:** 85%
- **Storage Temp:** -5°F to 140°F (-20°C to 60°C)
- **Laser Type:** Class 2 (630 to 640nm, <1mW)
- **Line Accuracy:** Horizontal, Vertical: $\pm .37"$ per 32' (9.5 mm per 10 m)
- **Battery Type:** 2x AAA, 1.5V
- **Dimensions:** 4.28" x 1.75" x 2.27" (10.8 cm x 4.4 cm x 5.7 cm)
- **Weight:** 0.41 lbs (187 g) without batteries
- **Standards:** CE, UKCA, EN 50689:2021, IEC 60825-1:2014
- **Complies with:** 21 CFR 1040.10 and 1040.11 except for conformance with IEC 60825-1 Ed. 3., as described in Laser Notice No. 56, dated May 8, 2019
- **Ingress Protection:** IP54 Dust & Water Resistant

Specifications subject to change.

⚠ WARNINGS

To ensure safe operation and service of the instrument, follow these instructions. Failure to observe these warnings can result in serious personal injury, fire, or electrical shock. Retain these instructions for future reference.

⚠ WARNING: LASER RADIATION. DO NOT STARE INTO BEAM. Class II Laser.

- Exposing eyes to laser radiation can result in severe and permanent eye injuries. **NEVER** look directly into the laser beam emitted by this instrument.
- Do not use the instrument if it appears to be damaged.
- Do not modify the instrument in any way, as to do so could result in emission of hazardous laser radiation than could result in severe eye injuries.
- Do not use optical equipment such as lenses, prisms, optical scopes, etc. to transmit, retransmit, or view the laser beam as this could result in severe eye injuries.
- This product should not be used by untrained operators or operators who have not read and fully understood the instructions.
- This product should not be used in any location that could result in somebody looking at or having their eyes inadvertently irradiated by the laser beam as this could result in severe eye injuries.
- The instrument should be powered off following use to minimize the risks of inadvertently exposure to hazardous laser radiation that could result in severe eye injuries.
- Do not remove warning labels from this instrument as this could result in serious personal injury and increases the risk of exposure to hazardous laser irradiation.
- The instrument should be securely located in a tidy work environment prior to operation as unexpected drops or movement of the instrument may result in damage to the instrument and increases the risk of inadvertent exposure to laser radiation that could result in severe eye injuries.
- This instrument is IP54 dust & water resistant. Following any contact with water, thoroughly dry the instrument with a dry, lint-free cloth.
- There are no user serviceable parts in this instrument.

Warning label
on side of
93PTL



FCC and IC COMPLIANCE

See this product's page at www.kleintools.com for FCC compliance information.
Canada ICES-003 (B) / NMB-003 (B)

WARRANTY

www.kleintools.com/warranty

DISPOSAL / RECYCLE



Do not place equipment and its accessories in the trash. Items must be properly disposed of in accordance with local regulations. Please see www.epa.gov/recycle for additional information.

CUSTOMER SERVICE

KLEIN TOOLS, INC.
450 Bond Street Lincolnshire, IL 60069 1-800-553-4676
customerservice@kleintools.com www.kleintools.com

ENGLISH

FEATURE DETAILS (FIG. A)

- | | |
|-----------------------------|---------------------------|
| 1. On/Off Button | 7. Elevation Control Knob |
| 2. Laser Aperture | 8. Tilt Control Knob |
| 3. X Plane Bubble Vial | 9. 1/4-20 Tripod Mount |
| 4. Y Plane Bubble Vial | 10. Magnets |
| 5. Z Plane Bubble Vial | 11. Hang Hole |
| 6. Battery Compartment Door | 12. Kickstand |

SYMBOLS ON PRODUCT

⚠ Warning or Caution

i Read instructions

LASER 2 Laser Class 2

CE **Conformité Européenne:** Conforms with European Economic Area directives

WEEE: Electronics disposal

⚠ Strong Magnetic Field

⚠ Hazardous laser radiation

⚠ **DO NOT** stare into beam or view directly with optical instruments

UKCA **UKCA:** UK Conformity Assessment

OPERATING INSTRUCTIONS

To turn the laser & illuminated bubble vials, press the on/off button. ①

Adjusting the laser line:

- The laser line can be adjusted by moving the 93PTL up and down, side-to-side, and by rotating the housing relative to the kickstand. ⑫
- The laser line position can be further adjusted by turning each of the fine adjust knobs. The elevation knob ⑦ will adjust the height of the laser line, and tilt control knobs ⑧ will adjust the angle of the laser line relative to the X plane. (FIG. B)
- To cast a level line, ensure that both top X ③, Y ④ vials of the 93PTL indicate level. For plumb lines, ensure that the side Z ⑤ vial is levelled.

NOTE: The fine adjust knobs have a limited range of adjustment. Do not use the fine adjust knobs beyond their adjustment range. Instead rotate the housing relative to the kickstand to bring the vials close to a level position (with the bubble close to be centered to vial).

MAINTENANCE

Battery replacement:

- Low Battery Indicator: When the batteries drop low enough, the laser line will blink 3 times every 30 seconds until the unit shuts off. When the device starts blinking, the user is advised to change the batteries.
- Open battery door ⑥
- Remove & recycle spent AAA batteries
- Install new batteries (be mindful of correct polarity)
- Close door and screw shut

CLEANING

Be sure laser level is turned off and wipe with a clean, dry lint-free cloth.
Do not use abrasive cleaners or solvents.

STORAGE

Remove the batteries when the instrument is not in use for a prolonged period of time. Do not expose to high temperatures or humidity. After a period of storage in extreme conditions exceeding the limits mentioned in the General Specifications section, allow the laser level to return to normal operating conditions before using.