# Lab 0: Getting Started

18-349, 14-642 Introduction to Embedded Real-Time Systems

Due: September 14, 2017

# Contents

| 1  | Introd  | luction  | 3  |  |
|----|---|--|----|--|
|    | 1.1   | Overview   | 3  |  |
|    | 1.2   | Grading  | 3  |  |
|    | 1.3   | Getting your hardware and turning the lab in                   | 3  |  |
| 2  | Development Board                               |  |    |  |
|    | 2.1   | Raspberry Pi Hardware Overview                                 | 3  |  |
| 3  | VM and Toolchain                                |  |    |  |
|    | 3.1   | Virtual Machine  | 5  |  |
| 4  | Starte  | ercode   | 7  |  |
| 5  | Raspl   | perry Pi Boot Process  | 7  |  |
| 6  | Running Code and Debugging with JTAG and GDB    |  |    |  |
|    | 6.1   | What is JTAG   | 8  |  |
|    | 6.2   | Setting Up Your SD Card  | 8  |  |
|    | 6.3   | How to Start GDB Debugging                                     | 9  |  |
| 7  | Checking Your Breakout Board and Using FTDITerm |  |    |  |
|    | 7.1   | Note: tmux   | 10 |  |
| 8  | Demo  | oing GDB to TAs  | 10 |  |
| 9  | GDB ARM Challenge                               |  |    |  |
|    | 9.1   | Starting the challenge   | 11 |  |
|    | 9.2   | Hints and Suggestions  | 12 |  |
| 10 | FAQ and Errors                                  |  |    |  |
|    | 10.1  | Warn: Invalid ACK 0x7 in JTAG-DP transaction                   | 12 |  |
|    | 10.2  | Program received signal SIGINT, Interrupt. 0x000000c4 in ?? () | 12 |  |
| 11 | Task  | List   | 12 |  |

## 1 Introduction

#### 1.1 Overview

The goal of this lab is to set up the environment for the class and ensure that you can compile, load and debug code for the Raspberry Pi. You will learn about the Raspberry Pi boot sequence, runtime and how to cross compile and develop with a standard GNU GCC toolchain.

## 1.2 Grading

The points breakdown for your responsibilities in this lab are as follows:

- 10 points for demoing GDB (Section 8)
- 5 points for showing boardcheck (Section 7)
- 35 points for the GDB ARM Challenge. Use this as an opportunity to refresh your gdb debugging skills. (Section 9)

## 1.3 Getting your hardware and turning the lab in

You will need to go to the ECE Course Hub to pick up the raspberry pi and accompanying equipment.

We have created a GitHub Classroom at https://github.com/18349-14642. If you do not already have a GitHub account, please visit https://github.com/ and create a free account. More instructions for GitHub can be found in the accompanying document github.pdf.

For this lab, you will demo your ability to use the hardware and GDB to a TA during office hours before midnight on the due date in order to get checked off. Also, write a step-by-step list of GDB commands required to complete the GDB ARM Challenge into a textfile called lab0\_solution.txt in your base directory (with code, docs, etc.). In order to learn the submission process, we want you to add this file to your repository, commit it and then tag that commit as your handin. Instructions for this can be found in the github.pdf handout.

You should tag your final commit with lab0-submit.

# 2 Development Board


For the course, you will be using a lab kit containing a Raspberry Pi 2 and two custom add-on boards. The programming board provides a JTAG debugging interface and a serial terminal interface. The I/O expansion board provides an ADC, light sensors, status LEDs (x10), speaker, microphone, servo outputs (x4), an Audio Codec (192 Khz), keypad input buttons, audio input/headphone output, a two channel H-bridge, encoder input (x2), an onboard rotary encoder, EEPROM, camera interface, 9D0F IMU with an Accelerometer, Rate Gyro, Magnetometer, and Air pressure sensor. The schematic for this board is available docs/Raspberry-Pi-B-Plus-V1.2-Schematics.pdf. You will use this hardware platform for the rest of the labs in this course.

### 2.1 Raspberry Pi Hardware Overview

Before you run the code baremetal, you should understand the nuances of your hardware. The chip is a Broadcom BCM2836 system on-chip (SoC), which contains the following:

- CPU: 700 MHz quad-core ARM Cortex A7 (ARMv7 instruction set)
- GPU: 250 MHz Broadcom VideoCore IV


• Memory: 1 GB (shared with GPU)

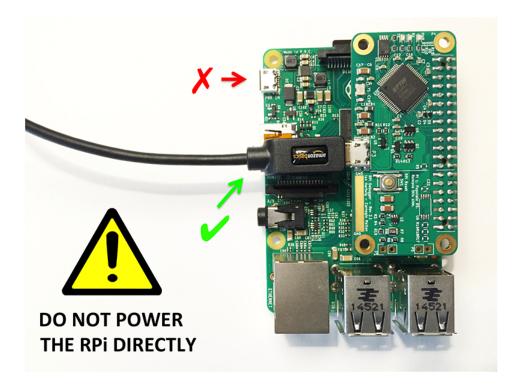

The Raspberry Pi also has the following hardware peripherals:

- 4 USB 2.0 ports (via the on-board 5-port USB hub)
- 1 15-pin MIPI camera interface (CSI) connector
- 10/100 Mbit/s Ethernet USB adapter on the third/fifth port of the USB hub
- 3.5mm phone jack for analog audio output
- 1 HDMI port with resolutions from 640350 to 19201200 and digital audio out
- 1 MicroSD slot

The Raspberry Pi also contains a General Purpose IO (GPIO) header which our breakout board exposes. This breakout deals with ensuring that the communication peripherals from the ARM cores (SPI, UART, and I2C you will learn about these later!) are broken out easily and connected to the correct sensors/pins for you.

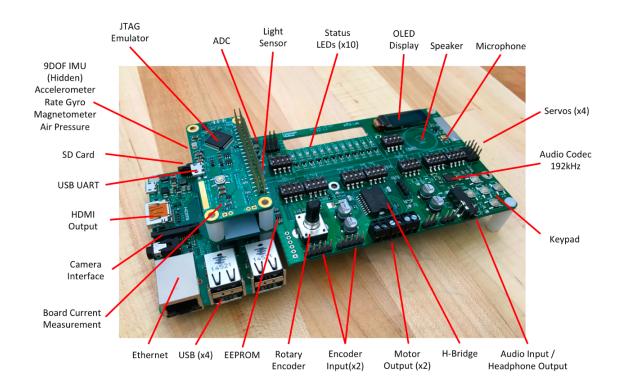

## 3 VM and Toolchain

To build programs for this class you will need an ARM cross-compiling toolchain. This will allow you to build machine code for ARM from an x86 machine. You will need to install GCC, GDB, OpenOCD, and a serial terminal emulator.

| Tool             | Purpose                                |
|------------------|--|
| GCC              | Compiler, assembler, & linker          |
| GDB              | Interactive debugger                   |
| OpenOCD          | GDB server & JTAG on FTDI interface A  |
| ${\rm FTDITerm}$ | Access to RPi UART on FTDI interface B |

To simplify setup, we have prepared a Linux VM with the tools you'll need that can be run in VMWare Workstation 11 (Windows) or Fusion 7 (Mac). This software is available through the CMU license program to you for free. We suggest using VMware because we have seen issues with the JTAG interface on VirtualBox. We have also verified that Parallels works.

If you are using a Linux host or interested in installing the toolchain natively on your machine, it is available for Mac, and Linux. Please see Appendix A. If you have trouble with the native toolchain, use the VM.

#### 3.1 Virtual Machine

Download and install VMWare Workstation 11 (Windows) or Fusion 7 (Mac) from the VMWare Campus Webstore: https://www.cmu.edu/computing/software/all/vmware/index.html. From the webstore homepage find the Software tab to find Workstation or Fusion.

Download the VM image from: http://embedded.andrew.cmu.edu/ECE%20349%20VM.vmwarevm.zip

This link can also be found on the course Piazza.

Open the VM with Workstation or Fusion. It is Ubuntu 14.04 (LTS) 32-bit with the guest additions installed. It has the Linux setup described below complete. The default user below has sudo privileges, but the root user is not set up. If you need root, you can use sudo su.

Username: ece349
Password: password

When you boot the VM, we recommend not upgrading since it may change toolchain component versions.

Your VM should be configured to use your host machine's network connection. This means you can ssh, scp and run applications like a web browser to download and install content. If you are interested in installing the toolchain on a bare operating system (not within a VM), we have instructions in an appendix.

## 4 Startercode

At this point, you have the toolchain setup and the hardware breakout completed. Now we can compile code for the Raspberry Pi.

Start by cloning the student repo from https://github.com/18349-14642/F17-student-startercode. More instructions for GitHub can be found in the accompanying document github.pdf.

The startercode you received for this lab should look as follows (**Note**: you don't need to know what every file does at the moment):

```
F17-student-startercode/
                     -> this file
  lab0.pdf
  sdcard/
                     -> JTAG kernel
    kernel.img
    start.elf
                     -> third-stage bootloader
   bootcode.bin
                     -> second-stage bootloader
  code/
    Makefile
                     -> Makefile for the kernel
    3491ibk/
                     -> (TA written source used by kernel.c)
      . . .
    349util/
                     -> Doxygen config file (not necessary for this lab)
      doxygen.conf
      kernel.ld
                     -> linker script
      rpi2.cfg
                     -> openocd JTAG configuration file
                     -> GDB startup script commands
      init.gdb
    kernel_blink/
      kernel.c
                     -> simple kernel that blinks on-chip leds
      config.mk
                     -> config file used by Makefile
    boardcheck/
      kernel.elf
                     -> TA written kernel used to check board connections
  docs/
    arm_arch_ref.pdf -> ARM v7 architecture reference
    arm_isa_ref.pdf -> ARM assembly reference
    BCM2835.pdf
                     -> documentation of Broadcom SoC
    BCM2836.pdf
                     -> documentation of changes between BCM2835 and BCM2836
    gdb_cmd_ref.pdf -> quick reference for GDB commands
    gnu_arm_ref.pdf -> overview of using GNU ARM assembler
    rpi_breakout.pdf -> EAGLE schematic of the breakout board you made
```

Now that you have the toolchain installed, compile the code yourself. To compile the code run make PROJECT=kernel\_blink inside the code/ directory. To delete generated files run make PROJECT=kernel\_blink clean. The makefile should have generated files called kernel.asm, kernel.img, and kernel.elf.

The startercode is an infinite loop that blinks the 2 on-chip LEDs. This code is in kernel\_blink/kernel.c. kernel.asm is the assembly dump produced by running objdump on kernel.elf. Feel free to change the blinking pattern in kernel.c.

# 5 Raspberry Pi Boot Process

Now that you can compile the code, lets figure out how we get to your code when the Pi boots up. This is called the *boot process* of the Raspberry Pi. Here is a step-by-step of how your code is loaded after turning on the Pi.

- 1. When you power on your Raspberry Pi, the first bits of code run are stored in a small ROM chip inside the SoC (System on a Chip). This code is therefore unmodifiable and unreadable. This is the called the first-stage bootloader. At this point, the ARM cores are in RESET mode since they have not been initialized.
- 2. This first-stage bootloader can read the FAT32 filesystem on the MicroSD card that you attach to the Pi. The code looks for a file called bootcode.bin on the SD card which contains the second-stage bootloader.
- 3. This second-stage bootloader is provided by Broadcom as well and is loaded into the L2 cache of the GPU and then executed by the GPU. This code enables the on-chip RAM. Lastly, this code looks in the SD card for start.elf, which contains the firmware for the GPU. start.elf is also written by Broadcom.
- 4. start.elf is the third-stage bootloader. It sets up the GPU and splits up RAM such that it is shared between the GPU and the ARM cores (more about this in a later lab). Lastly, it looks on the SD card for kernel.img. This file is what contains the code you wish to run on the Raspberry Pi. It is loaded at 0x8000 by start.elf as defined by the Broadcom datasheet. Once kernel.img is loaded into RAM at 0x8000, the GPU releases the RESET mode on only one of the ARM cores and allows that core to run the code loaded at 0x8000.

On another note, a good rule to remember for the Raspberry Pi is **the GPU** is **king**. Since the GPU is what boots up first, the Pi is essentially unbrickable (No, this is not a challenge). As long as you are not putting unexpected voltages at various IO pins, the Pi can always come back from some weird state by just turning it off and back on again.

**NOTE:** This process is not how you will be loading your kernel usually. Instead we will use JTAG and GDB to flash over the kernel you compile. We will walk through this in the next section.

## 6 Running Code and Debugging with JTAG and GDB

Now we will see how to debug a running CPU using JTAG.

### 6.1 What is JTAG

To debug on the Pi, we will use JTAG (Joint Test Action Group). This is a debugging method developed in 1985 to test PCBs (Printed Circuit Boards) after they were manufactured. This is the most common interface for debugging embedded processors and is supported by most modern systems. JTAG is also commonly used to load firmware onto new devices. To interpret the JTAG commands, we will use openocd. Openocd is an open-source on-chip debugger. You should not need to interact with openocd directly in this course so don't worry about its internal commands.

### 6.2 Setting Up Your SD Card

To make sure your SD card is in a clean state, you should reform tit before loading any code. You only need to do this once.

- 1. Insert the SD card into the USB to SD card reader and plug the reader into your computer. (or if your computer has an SD card reader, use that directly).
- 2. Next, you need to reformat the SD card to FAT32. On the VM you can use GParted to do this. Otherwise, Google for instructions on how to do this with your respective OS.
- 3. Once formatted, your SD card should be completely empty. Copy over all files from sdcard/ onto the SDcard. These should include:
  - bootcode.bin
  - start.elf

#### • kernel.img

The kernel.img on the SD card is a TA written kernel that enables the JTAG interface on the Pi. You should never have to change the kernel.img on the SD card unless you want your own kernel to run baremetal without debugging capabilities (not recommended).

## 6.3 How to Start GDB Debugging

Note that due to an openocd+vm bug (detail below) we have disabled SIGINT (ctrl+c) in the VM.

Now plug the Pi in with the formatted SD card inserted. When you plug the Pi in, the TA JTAG kernel enables JTAG and hangs waiting for you to flash over your kernel using GDB. To do this, follow these steps:

1. From the code/ directory run make openocd (if you are on Linux or the VM, you'll need to run sudo make openocd instead). You should see output like the following:

```
... (some lines omitted)
Info : clock speed 1000 kHz
Info: JTAG tap: rpi2.dap tap/device found: 0x4ba00477 (mfg: 0x23b, part: 0xba00, ver: 0x4)
Info : rpi2.cpu0: hardware has 6 breakpoints, 4 watchpoints
Info : ttbcr Ottbr0 3f377b7bttbr1 dbfbb45b
Info: rpi2.cpu0 rev 5, partnum c07, arch f, variant 0, implementor 41
Info: number of cache level 2
Error: cache 12 present :not supported
Info : rpi2.cpu0 cluster f core 0 multi core
Info : rpi2.cpu1: hardware has 6 breakpoints, 4 watchpoints
Info: ttbcr Ottbr0 14b76369ttbr1 2ab99d79
Info: rpi2.cpu1 rev 5, partnum c07, arch f, variant 0, implementor 41
Info: number of cache level 2
Error: cache 12 present :not supported
Info : rpi2.cpu1 cluster f core 1 multi core
Info : rpi2.cpu2: hardware has 6 breakpoints, 4 watchpoints
Info : ttbcr Ottbr0 b536db5bttbr1 467e7ccb
Info: rpi2.cpu2 rev 5, partnum c07, arch f, variant 0, implementor 41
Info: number of cache level 2
Error: cache 12 present :not supported
Info : rpi2.cpu2 cluster f core 2 multi core
Info : rpi2.cpu3: hardware has 6 breakpoints, 4 watchpoints
Info : ttbcr Ottbr0 7f9f535bttbr1 9eeebc3
Info: rpi2.cpu3 rev 5, partnum c07, arch f, variant 0, implementor 41
Info: number of cache level 2
Error: cache 12 present :not supported
Info : rpi2.cpu3 cluster f core 3 multi core
```

**Important:** Any time you reset or unplug the Raspberry pi, you'll need to terminate openood and restart it or else gdb will not work.

2. Then, in a new terminal window, run make PROJECT=kernel\_blink gdb inside the code/ directory to begin a GDB debugging session. You should see a standard gdb terminal with output like the following:

```
... (some lines omitted)
0x00008238 in printnumk ()
Loading section .text, size 0xb58 lma 0x8000
Loading section .rodata, size 0x11 lma 0x9000
```

```
Loading section .rodata.str1.4, size 0x18 lma 0x9014
Loading section .ARM.exidx, size 0x8 lma 0x902c
Start address 0x8000, load size 2953
Transfer rate: 15 KB/sec, 738 bytes/write.
0x00008004 in _start ()
(gdb)
```

This just loaded a GDB initialization script called 349util/init.gdb. This script connects to the openood JTAG session and loads the kernel.img (that you compiled) over to the board using JTAG. Then we step the processor once so you can see where you are in the kernel.

Thats it!

## 7 Checking Your Breakout Board and Using FTDITerm

Now that you can load kernels using GDB and debug them, you can test the UART on your board. Plug in the Pi and start your GDB debugging session as mentioned in section 6.3, instead of make gdb you need to run make PROJECT=boardcheck gdb.

- 1. \$ make openocd
- 2. In a new terminal window \$ make PROJECT=boardcheck gdb
- 3. In a new terminal window \$ sudo ftditerm.py -b 115200
- 4. In the GDB window, run (gdb) continue
- 5. Look back at the window running ftditerm.py
- 6. You should see the following output:

```
opening first available ftdi device...
--- Miniterm on None: 115200,8,N,1 ---
--- Quit: Ctrl+] | Menu: Ctrl+T | Help: Ctrl+T followed by Ctrl+H ---
Testing UART... Success
```

If in doubt, ask a TA.

You will be required to show us this output during your lab check off.

## 7.1 Note: tmux

Since you will be using 3 terminal windows to run all of the code in this class, it will make your life much easier to use something like tmux, which is a terminal multiplexer that allows you to split a single terminal window into multiple panes, allowing you to have all 3 of the terminal windows (GDB, OpenOCD, and FTDIterm) open at once. You can install this with \$ sudo apt-get install tmux on Linux. See this tmux reference for some helpful commands: http://www.hamvocke.com/blog/a-quick-and-easy-guide-to-tmux/

# 8 Demoing GDB to TAs

You are now inside the startercode and should be at \_start in code/349libk/src/boot.S. When you demo this lab, you will be required to perform the following steps using GDB:

- 1. Show us you can compile, load, and launch your own code through GDB with JTAG
- 2. Run (gdb) layout split
- 3. Run (gdb) layout regs
- 4. Now use (gdb) si to single step the program until you reach kernel\_main
- 5. Set a breakpoint at led\_set\_red with (gdb) b led\_set\_red
- 6. Now continue until you hit the breakpoint with (gdb) c
- 7. Now print the value of cnt in kernel/kernel.c with (gdb) print cnt. NOTE: You may need to do (gdb) next first.
- 8. Now to see all registers (including banked ones) run (gdb) info all-reg
- 9. Now set a breakpoint on the cnt variable that allows the leds to flash 10 times before it halts. Search the gdb documentation to learn how to break with a conditional on a particular file.

If any of these commands look unfamiliar to you then look at docs/gdb\_cmd\_ref.pdf. When you demo this lab, you will be asked the following questions:

- 1. What is the value of the CPSR at the first breakpoint?
- 2. At the first breakpoint, what mode is the processor in?

## 9 GDB ARM Challenge

We now need you to demonstrate your GDB skills and your ability to understand ARM assembly.

#### 9.1 Starting the challenge

Start your GDB debugging session as mentioned in section 6.3, and instead of running make gdb run the command make PROJECT=gdbchallenge gdb.

!!!There are 4 parts to the GDB challenge!!! Part 1 is worth 10 points, Part 2 is worth 10 points, Part 3 is worth 10 points, and Part 4 is worth 5 points.

The Pi will blink green repeatedly, once for each part you solve. If you solve all 4, the red LED will turn off. You may use GDB arbitrarily to reverse engineer the ARM assembly and prepare for your demo. When you do the demo, you may only do the following:

- set a breakpoint at kernel\_main and continue to this point
- Set the contents of the 8 bytes at 0xa028 to your andrew id. Your id needs to be exactly 8 characters, if it is less than 8 characters please append letters starting with 'a', then 'b', etc. For example, if your andrew id is "doc", you will need to insert your andrew id as "docabcde".
- Set the contents of the 4 bytes at 0xb020 (num1) to an integer of your choice.
- Set the contents of the 8 bytes at 0xa034 (fixme\_array) to characters of your choice.
- Set the contents of the 8 bytes at 0xa000 (fixme2\_array) to characters of your choice.
- Set the contents of the 32 bytes at 0xb000 (fixme\_int\_array) to 8 integers of your choice
- After you have set memory values, continue the program.

You may **not** modify the kernel, change the control flow, or set memory values at a later point in execution.

## 9.2 Hints and Suggestions

- 1. Look out for functions like decode and compare
- 2. Try and understand the logic of the problem challenge. Brute force will be frustrating!
- 3. Be patient! Debugging assembly is painful, especially when you do not have the corresponding C code.
- 4. Note, that if there is no C source data, stepi will advance a single instruction.

## 10 FAQ and Errors

## 10.1 Warn: Invalid ACK 0x7 in JTAG-DP transaction

If you see this error, first check to make sure the SD card is inserted properly. If so, then the kernel you have on the SD card is most likely not the JTAG kernel we released. Re-copy the files from sdcard/ to the SD card and see if the error continues.

## 10.2 Program received signal SIGINT, Interrupt. 0x000000c4 in ?? ()

This is an issue we have seen in the VM using openood + gdb. We fixed the issue by ignoring all SIGINTs in gdb (in the 349util/init.gdb script). This avoids interrupting the debugging session from extra signals sent by openood, but it also means you can't stop the processor if you continue without setting a breakpoint.

The line we added is handle SIGINT nostop noprint ignore. If you see this problem not in the VM or with this line in your init script, please let us know!

### 11 Task List

- 1. Download and run the VM or install the native toolchain
- 2. Format your SD card and copy the files
- 3. Clone the GitHub repo
- 4. Run the boardcheck
- 5. Demo basic GDB commands
- 6. Solve the GDB challenge
- 7. Submit your GDB challenge solution to GitHub

## Appendix A - Native Toolchain (Optional)

Running the toolchain directly on a native host machine is usually faster then running a VM. Below you will find instructions for directly installing the toolchain.

#### Linux

First we need to install a few manual dependencies:

\$ sudo apt-get install build-essential autoconf automake libtool libusb-dev libusb-1.0-0-dev libhidapi-dev git vim

The ARM GCC Embedded project supported by ARM provides precompiled binaries for linux.

```
$ sudo apt-get install gcc-arm-none-eabi gdb-arm-none-eabi
```

To check that the tools are installed correctly, try to run arm-none-eabi-gcc and arm-none-eabi-gdb.

We also need to install openood, the glue between our debugger hardware and gdb. It is available in apt.

```
$ sudo apt-get install openocd
```

To check that OpenOCD is installed correctly, try to run openocd --version.

To access the UART on the FT2232's channel B we'll need a special serial console. It depends on libftdi and pylibftdi which can be found in apt/pip. We'll also add it to our path for convenience.

```
$ sudo apt-get install python python-pip libftdi1
$ sudo pip install pylibftdi
$ mkdir ~/repos
$ cd ~/repos
$ git clone https://github.com/ihartwig/ftditerm.git
$ echo "export PATH=\$PATH:~/repos/ftditerm" >> ~/.bashrc
$ source ~/.bashrc
```

Finally, in some cases we want the programs we added to the path above to be available when we use sudo. Normally, these get overridden by a secure\_path variable. To disable this behavior, run sudo visudo and comment out the line that includes Defaults secure\_path=.... You can test that the secure\_path is disabled by trying to run FTDITerm with your development board plugged in:

```
$ sudo ftditerm.py -b 115200
opening first available ftdi device...
--- Miniterm on None: 115200,8,N,1 ---
--- Quit: Ctrl+] | Menu: Ctrl+T | Help: Ctrl+T followed by Ctrl+H ---
--- exit ---
```

### Mac

Although there are a couple different package managers, we found the packages we needed in Homebrew. You can find installation instructions at http://brew.sh/. Homebrew will also require that you install the Xcode Command Line Tools, which we will need later.

The ARM GCC Embedded project supported by ARM provides precompiled binaries for Mac. At the time of writing, 6-2017-q2 was the latest release. Download the latest Mac .tar.bz2 package from the link. We can then extract the binaries and add them to our path:

```
$ cd ~/Downloads
$ tar -xf gcc-arm-none-eabi-6-2017-q2-update-mac.tar.bz2
$ mv ./gcc-arm-none-eabi-6-2017-q2-update-mac.tar.bz2 ~/gcc-arm-none-eabi
$ echo "export PATH=$PATH:~/gcc-arm-none-eabi/bin" >> ~/.bashrc
$ source ~/.bashrc
```

To check that the tools are installed correctly, try to run arm-none-eabi-gcc and arm-none-eabi-gdb.

We also need to install openood, the glue between our debugger hardware and gdb. It is available in homebrew:

### \$ brew install openocd

To access the UART on the FT2232's channel B we'll need a special serial console. It depends on libftdi and pylibftdi which can be found in brew/pip. We'll also add it to our path for convenience.

```
$ brew install python libftdi
$ pip install pylibftdi
$ cd ~/
$ mkdir repos
$ cd repos
$ git clone https://github.com/ihartwig/ftditerm.git
$ echo "export PATH=\$PATH:~/repos/ftditerm" >> ~/.bashrc
$ source ~/.bashrc
```

Finally, we can try to run FTDITerm with your development board plugged in:

```
$ ftditerm.py -b 115200
opening first available ftdi device...
--- Miniterm on None: 115200,8,N,1 ---
--- Quit: Ctrl+] | Menu: Ctrl+T | Help: Ctrl+T followed by Ctrl+H ---
--- exit ---
```

#### Windows

Not supported. Use the VM. We had issues running the UART and JTAG simultaneously.