## Universidade de Aveiro



# Mestrado Integrado em Engenharia de Computadores e Telemática Arquitectura de Computadores Avançada

# Home group assignment 1 Implementing a forwarding and stall unit in a pipelined architecture

Academic year 2014/2015

Nuno Lau/José Luís Azevedo

#### 1. Introduction

The program MIPS\_SystemC uses SystemC [3] to simulate the internal architecture of a MIPS processor. The simulated architecture, which includes a 5 stage pipeline, is similar to that shown in Figure 6.30 of the book Computer Organization & Design, H & P [1]. The current implementation does not include forwarding and stalls the pipeline to solve all data dependencies.

In this program, each MIPS component is described as a SystemC module (SC\_MODULE). Some components are specified in terms of their behaviour by using methods that are invoked whenever any signal of its sensitivity list has its value changed (see, for instance, alu.h and alu.cpp files that specify the ALU module). Other components are specified in a hierarchical manner by instantiating other modules, interconnected through signals (see, for example, mips.h and mips.cpp files where the main components of the architecture are interconnected).

The source code of MIPS\_SystemC is in the MIPS\_SystemC.0.6.6.tgz archive available on the course web site. This code is the same as the one used in Lesson 3 lab assignment, still containing the error that must be corrected in the first question of that lesson (if you didn't yet solve Lesson 3, solve, at least, the first question of that assignment before starting this work).

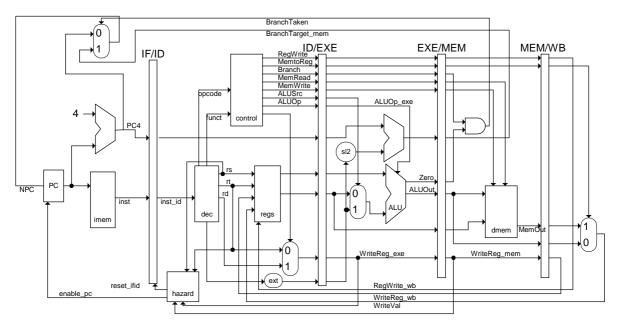


Figure 1

The simulator has a graphical interface, whose development was based on the Qt [4] class library, which allows controlling the assembly program execution, and the visualization, in various forms, of the processor state.

The Arch window enables viewing the architecture through a diagram similar to that shown in Figure 1. The values of the ports of some modules are shown on the figure. The Modules window allows viewing the state of some input and output ports of the main modules of the architecture. There are also windows for viewing the contents of the instruction memory, data memory and processor registers.

The file refman.pdf is the reference manual for the MIPS\_SystemC simulator that thoroughly describes the functionality of each of the components of the simulated model.

### 2. Work description

This assignment is divided into the following cumulative tasks:

- 1. Change the original MIPS\_SystemC architecture so that the conditional jump instruction beq can be resolved during the ID stage (instead of MEM stage), assuming a branch not taken prediction. Add the functionality that allows also the execution of the bne instruction. Submit your source code file as "exl\_pn\_nml\_nm2.tgz".
- 2. Add to the architecture the support for the execution of the instructions j, jr (jump register), jal and jalr (jump and link register), all resolved in the ID pipeline stage. Submit your source code file as "ex2\_pn\_nm1\_nm2.tgz".
- 3. Suppose that it is necessary to increase the clock frequency of the processor, being this increase acceptable in all pipeline stages except in the MEM stage, due to a high memory access time. Therefore, to accomplish that, the MEM stage should be divided in 2 phases (MEM1 and MEM2) by inserting a new pipeline register (MEM1/MEM2) resulting in a processor with a 6 stage pipeline.
  - Implement this new structure by adding the necessary changes to the architecture resulting from task 2<sup>2</sup> (the names of signals and ports of stages IF, ID, EXE, and WB should not be changed). Submit your source code file as "ex3 pn nm1 nm2.tgz".
- 4. Take into consideration the changes introduced in tasks 1, 2 and 3, and:
  - 4.1. Identify all types of forwarding that can occur in the architecture, using, wherever possible, a strategy where the **source of a forwarding action is a pipeline stage and the destination is a pipeline register**. Consider that a forwarding situation is different from another whenever there is any change in the source, in the destination or in the conditions under which the forwarding must be enabled.
  - 4.2. For each type of forwarding identified, provide a code example, as well as the precise logic conditions under which this type of forwarding has to be enabled.
- 5. Change the provided hazard detection unit (files hazard.h and hazard.cpp), so that stalls are never inserted. After that, implement and test all types of forwarding situations identified in the previous task. For that:

<sup>&</sup>lt;sup>1</sup> "pn" is the practical class id (p1, p2, or p3), "nm1" and "nm2" are to be replaced by the numbers of the group students (e.g. "ex1\_p1\_32156\_82345.tgz").

<sup>&</sup>lt;sup>2</sup> For this, and the following, tasks, replace file "dmem.h" by the one provided in "dmem\_afterTask3.tgz" (available at elearning.ua.pt). The latter implements the memory module needed for the 6-stage pipeline and, therefore, should not be changed.

- 5.1. Implement the "forward" module responsible for controlling the forwarding multiplexers;
- 5.2. Add the forwarding registers (files reg\_if\_id.h, reg\_id\_exe.h, reg\_exe\_mem1.h, ...) and the forwarding multiplexers in all required stages;
- 5.3. Change the mips module (mips.h and mips.cpp files) so that it executes the forwarding in a correct way.
- 5.4. Submit your source code file as "ex5\_pn\_nm1\_nm2.tgz".
- 6. After having implemented and tested all types of forwarding identified in task 4, identify the conditions, and give examples of situations that still cause the pipeline to stall. Change the hazard detection and stall generation module (files hazard.h and hazard.cpp) in order to insert pipeline stalls in the identified situations. Submit your source code file as "ex6\_pn\_nm1\_nm2.tgz".

The work should be done, whenever possible, by a group of 2 students (groups of more than 2 students are not allowed). Each group must deliver:

- The source code of the program MIPS\_SystemC for each of the tasks 1, 2, 3, 5 and 6, in a "tgz" file with the names provided before.
- A report, **only at the final due date**, that presents: a) the answers to the questions raised in this document, namely in task 4 and task 6; b) presents the strategy followed for the resolution of the various implementation tasks using, where convenient, schematic drawings that clarify the implemented solution; c) how the implemented solution was validated (which tests were performed).

#### 3. Important notes

- 1. DO NOT change directly the "Makefile" whenever you need to add a file to the project. For that you should 1) edit the "MIPS\_SystemC.pro", adding to the compile list all the files you need and 2) run the "qmake" command. This command will update the project Makefile.
- 2. Before generating the "tgz" archive file, execute the command "make clean", so that unnecessary object and executable files are deleted.
- 3. Generate the "tgz" file of the entire MIPS\_SystemC.0.6.6 directory, e.g.: tar cvzf ex1\_p1\_32156\_82345.tgz MIPS\_SystemC.0.6.6/\*
- 4. Be sure that your code compiles without errors before submitting it. Be also sure that the compiled program does not fail execution, due to run-time errors. <u>Code with compilation or run-time errors</u> will not be taken into consideration.
- 5. The code submitted to solve a given task should not include any code for solving subsequent tasks. Hence, you should make a proper management of your code.
- 6. During the development of this assignment you should follow an ethical conduct that prohibits plagiarism, in any form, as well as the participation of external elements in the assignment development. Any initiative that, judged by the teaching team, might be considered as a plagiarism situation will have real consequences on the student(s) evaluation and may lead to disciplinary sanctions.

#### 4. Due dates:

- **November 3, 2014** (tasks 1, 2 and 3)
- **November 17, 2014** (tasks 4, 5, 6 and report)

## Visualization changes

If necessary, during the development of the previous tasks, the visualization capabilities of MIPS\_SystemC can be extended. Hence, to display the value of port "port" of the component "component" in the Arch window add the following lines to the constructor of MIPSarchCanvas of file GUI/MIPSarch.cpp:

To change the modules to display in the "Modules" window analyze the contents of the GUI/MIPSmods.cpp.

## **Bibliography**

- [1] Computer Organization and Design: The Hardware/Software Interface, Second Edition, D. A. Patterson and J. L. Hennessy, Morgan Kaufmann, 1998 (or a more recent edition)
- [2] Computer Architecture, A Quantitative Approach, Fifth Edition, J. L. Hennessy and D. A. Patterson, Morgan Kaufmann, 2011
- [3] www.systemc.org, SystemC web site
- [4] http://qt-project.org, Qt development tools web site

# **Appendix**

This appendix presents the meaning of some common errors that may occur when using SystemC, namely, compilation, execution and model specification.

# **Compilation errors**

**Using templates incorrectly**: the use of templates is common in the construction of a SystemC model; however, there should be some caution in the way they are declared:

```
mux< sc_uint<32> > *mPC; //correct
mux< sc_uint<32>> *mPC; //wrong (should have a space between >>)
```

Unsing undefined signals, ports or modules: all signals, ports or modules must be defined before being used. For example, an attempt to use port diin (not defined) of the alu module can lead to the following error message:

**Type mismatch between a signal and a port**: the connection between a signal and a port is only possible if they are of compatible types. Failure to comply with this rule leads to error messages like:

#### **Execution errors**

During the execution of the model, SystemC runs some checks looking for model consistency. When an error is detected, SystemC writes an error message and terminates the program. The most common error situations are listed below.

No signal connected to a given port: all ports of a module must be connected to a signal. The following message indicates that the third port (in order of declaration) of the MIPS.alu module is not connected to any signal:

**More than one signal connected to the same port**: only one signal can be connected to a given port; attempts to connect more than one signal at the same port lead to messages like:

# **Specification errors**

**Sensitivity list incomplete**: when changing the functionality of a module described in a behavioral way (**SC\_METHOD**), especially when new input signals are added, the sensitivity list should always be checked.