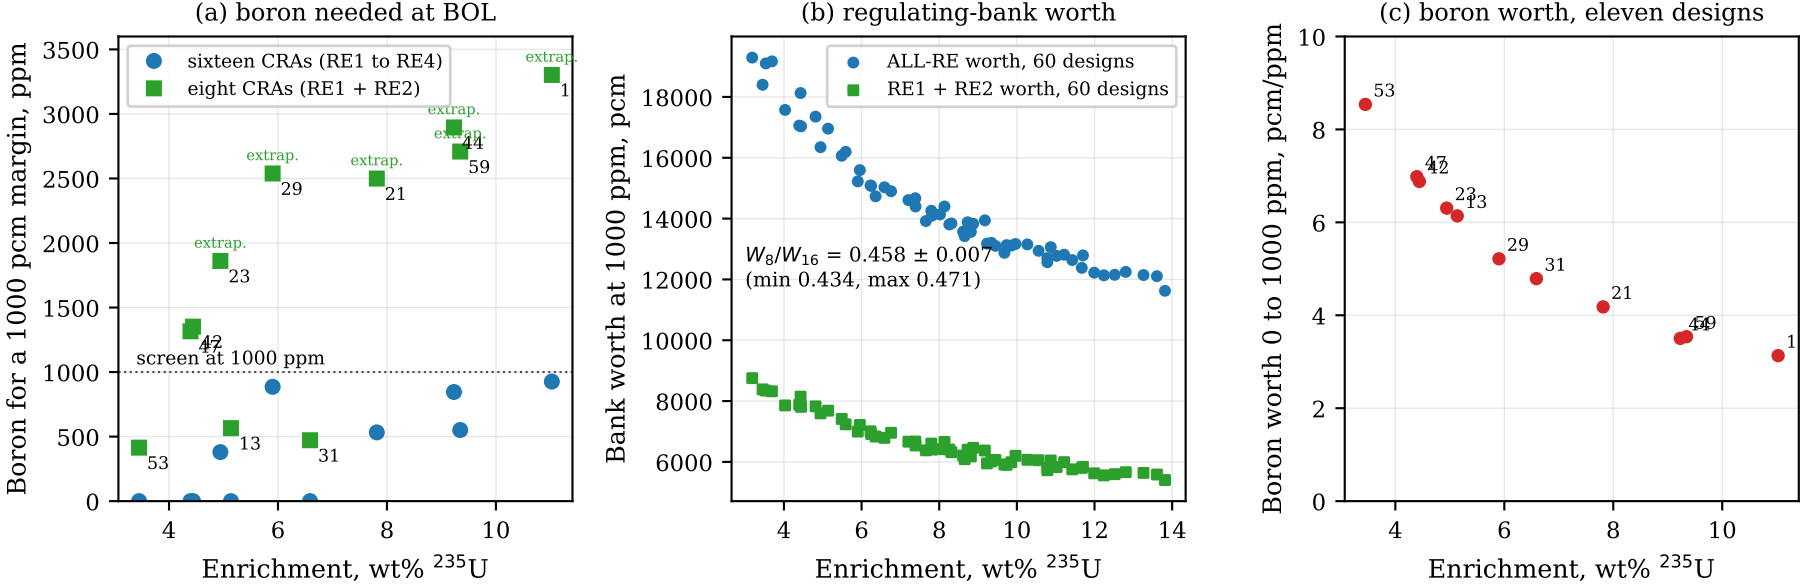
(a) boron needed at BOL
Boron for a 1000 pcm margin, ppm
Enrichment, wt% ^{235}U
sixteen CRAs (RE1 to RE4)
eight CRAs (RE1 + RE2)
screen at 1000 ppm
extrap.
(b) regulating-bank worth
Bank worth at 1000 ppm, pcm
ALL-RE worth, 60 designs
RE1 + RE2 worth, 60 designs
W_8/W_{16} = 0.458 ± 0.007
(min 0.434, max 0.471)
(c) boron worth, eleven designs
Boron worth 0 to 1000 ppm, pcm/ppm