

Ref no:	Module 1	Calders & Grandidge	
Compiled By: D. Losty	Pole Labelling	Revision 4	
Effective Date: Mar 2020		Revision Date: Feb 2026	
		Revised By: D Losty	

1. PROCESS

1.1 Rationale

1 The aim of this module is to ensure that poles are consistently labelled to ensure that:

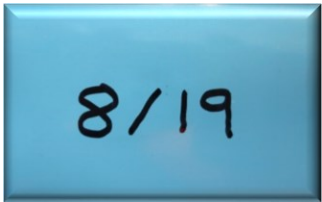
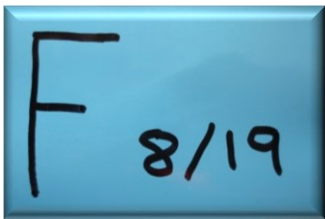
- Each pole is efficiently processed
- The status of each pole is clear and unambiguous
- Defective poles do not enter the supply
- Insufficiently seasoned poles are allowed sufficient time to properly season.
- Poles are traceable back to specific treatment charges.

2 You must label poles according to the following table:

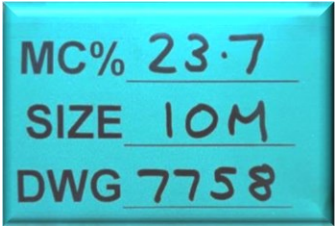
1.2 Table of Approved Labels

Label Colour	Image	Action
Red		You must securely staple a blank, red label to the butt of bleeding poles. You must segregate poles containing a red label where possible (if this is not possible you must leave them in the pole stacks). These poles must only return to the creosote plant to undergo a wash charge (you must never release them for delivery to a customer).
Red 'F'		You must securely staple a Red 'F' label to the butt and the uppermost surface of green treated poles that have failed to be fully impregnated with preservative treatment. The label must contain a large letter 'F', the date that the pole failed treatment, the pole number and the treatment charge number.

Ref no:	Module 1	Calders & Grandidge	
Compiled By: D. Losty	Pole Labelling	Revision 4	
Effective Date: Mar 2020		Revision Date: Feb 2026	
		Revised By: D Losty	

Label Colour	Image	Action
Blue		You must securely staple a Blue label to the butt of every pole that has a moisture content of above 28% (or 25% for Green Poles). You must ensure that the label contains the month and year that the pole was found to have excessive moisture content. You must arrange for poles with blue labels to be segregated (if this is not possible they will remain in the pole stacks until such time as the Production Supervisor elects to inspect them prior to returning to production).
Blue 'F'		You must securely staple a Blue 'F' label to the butt of every pole that has a moisture content above 28% (or 25% for Green Poles) and which has been fabricated . The label must contain the month and year that the pole was found to have excessive moisture content together with a large letter 'F' . Where possible, you must segregate poles with blue labels (if this is not possible they will remain in the pole stacks until such time as the Production Supervisor elects to inspect prior to returning to production).
White Descriptive		You must securely nail a white descriptive laser tag to the butt of every pole that is ready for despatch to the customer. This label gives details such as species, size, class, drawing, customer and date and type of treatment.
White Defect		You must securely staple a white label containing a defect reason code to the butt of every pole that fails to meet the required standards for pole structure and integrity (defective poles). This task can occur at any stage of the production process. All poles with a White Defect Label are moved from wherever they are rejected in the process directly to the reject pole stacks.

Ref no:	Module 1	Calders & Grandidge	
Compiled By: D. Losty	Pole Labelling	Revision 4	
Effective Date: Mar 2020		Revision Date: Feb 2026	
		Revised By: D Losty	

Label Colour	Image	Action
White Failed Treatment		You must securely staple a white 'F' label to every creosote pole that has failed to be fully impregnated with preservative treatment. The label must never contain the word 'FAIL'.
White Defective Product		You must securely staple a white "DEFECTIVE PRODUCT" label to defective products to prevent them being accidentally loaded/ used. These are large labels and you must securely staple the label at all 4 corners . These labels are generally used by loading and unloading staff.
Green		You must securely staple a green label (at the point of fabrication) to every pole that is required to be treated with AC500 preservative. Once the pole is fabricated, you must complete a green treatment label and attach it to the pole butt with a minimum of TWO STAPLES. On the label, you must record the measured moisture content of the pole (MC%), the pole length and class and the drawing that the pole has been fabricated to.

Ref no:	Module 1	Calders & Grandidge	
Compiled By: D. Losty	Pole Labelling	Revision 4	
Effective Date: Mar 2020		Revision Date: Feb 2026	
		Revised By: D Losty	

Label Colour	Image	Action
Yellow		You must securely staple a yellow label to the butt of every pole that is found to be non-conforming. The meaning of the NCR codes is as follows: • Number only – Pole is defective – move to quarantine area and inform Production Supervisor • Number followed by letter 'S' in brackets – Pole is not defective – return to storage stack (generally as a result of a picking error or a change of customer requirements) • Number followed by letter 'B' in brackets – Pole is bleeding – segregate for a wash charge (for these poles, you must also securely attach a blank red label to indicate that the pole needs to be washed) When poles are returned as a result of a customer complaint you must keep them in quarantine until an investigation has been completed.

1.3 Latschbacher ID Tags

1 Following treatment of a batch of poles you must:

- Obtain sufficient quantities of Latschbacher ID tags for the charge that you will be labelling (customers who have requested that batch numbers are inscribed on their poles do not generally require ID tags, as traceability is achieved via the batch number – if in doubt, check with the Production Supervisor or Production Team Leader).
- Apply the ID tags, using the approved hammer and cartridge and in accordance with your training. This must be completed before the poles are removed from the outfeed area of the relevant treatment plant.
- Record the numbers (or range of numbers) of the ID tags that you have applied on the relevant Tag Record Sheet.
- Double check the number of poles on the charge and, if there are any discrepancies, ensure that the correct quantities are recorded on the Tag Record Sheet and that the Production Supervisor or Production Team Leader is informed.

Ref no:	Module 1	Calders & Grandidge	
Compiled By: D. Losty	Pole Labelling	Revision 4	
Effective Date: Mar 2020		Revision Date: Feb 2026	
		Revised By: D Losty	

Documents Replaced by this Module

Document Ref.	Document Title
QTG17	Labelling of Treated Poles
QTG55	Pole Marking

Updates

Date	Amendment	By
1-3-20	Original Document	DL
13-7-21	Examples of creosote and AC500 biocidal labels added.	DL
1-6-23	Creosote treatment failure label changed from 'FAIL' to 'F'.	DL
5-2-26	Laser butt tags added.	DL