



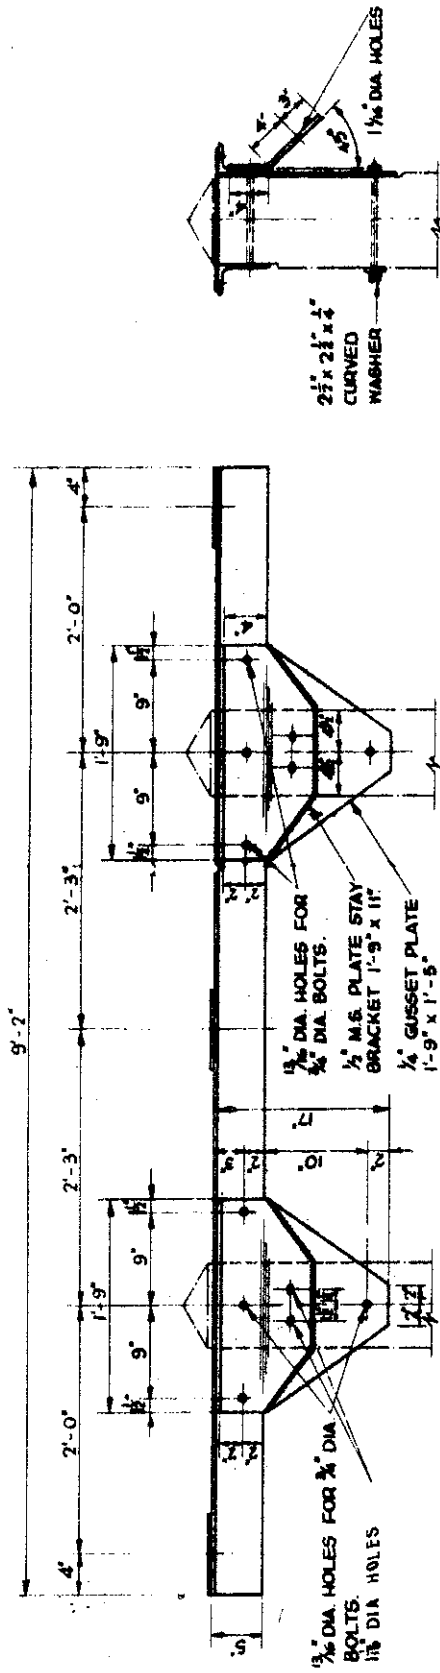

ELEVATION

SIDE ELEVATION

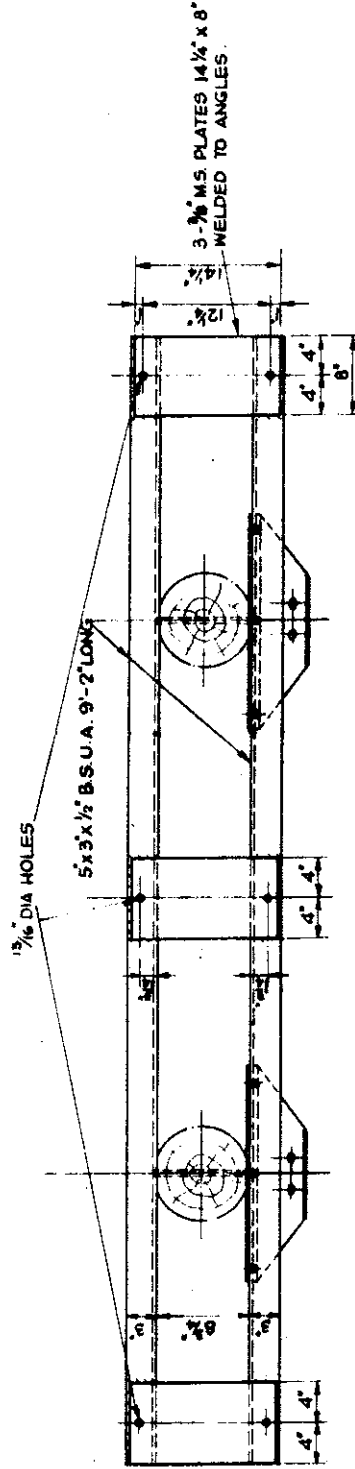

PLAN

LIST OF BOLTS

Nº	DIA.	LENGTH	LOCATION	THREADED	NUTS	WASHER
4	3/4"	12"	POLE/CROSSARM/GUSSET	4"	4	2 1/2" x 2 1/2" x 1/4" CURVED
4	3/4"	2 1/2"	CROSSARM/GUSSET	1 1/8"	4	-

MATERIALS


STEELWORK TO B.S.4 PART 1 & B.S.4360 GRADE 43A
 BOLTS TO B.S.916 THREADED BSW.
 ALL GALVANISED TO B.S.729.
 CURVED WASHERS TO BS 1320 FIG 38

Drawn	Traced	M.S.B.	33KV OVERHEAD LINES
Checked	Checked		CROSSARM STEELWORK FOR
date 29.4.69	date 29.4.69		TERMINAL SUPPORT
scale 1"=1'	scale 1"=1'		(4'-6" POLE CENTRES)


Yorkshire Electricity Board Y003 X 3308

A TITLE MODIFIED B C D


CDM 30.12.70

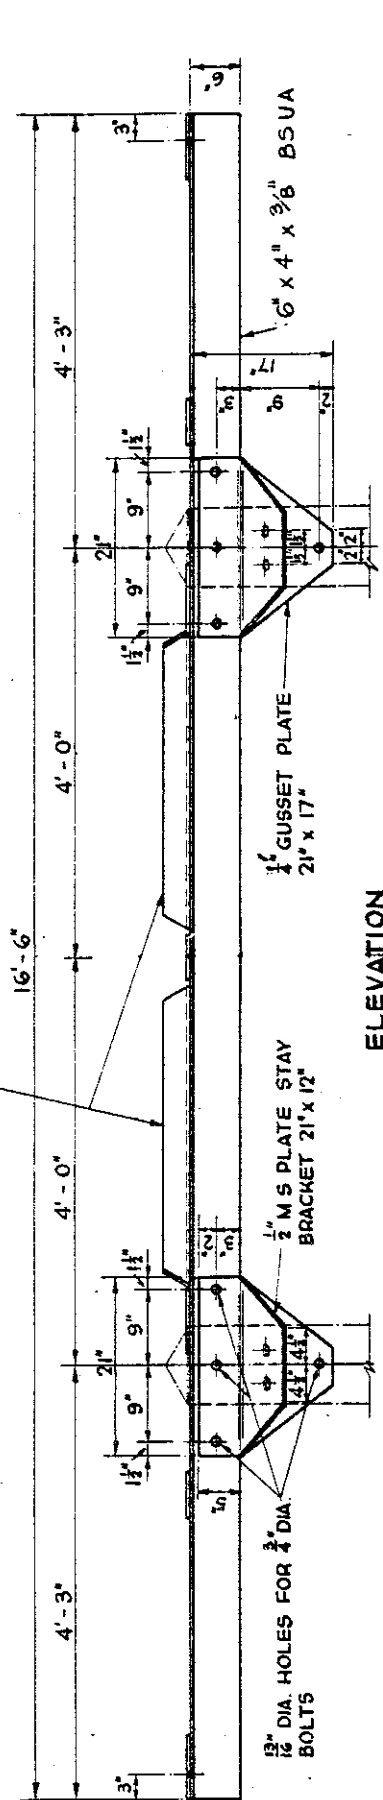

ELEVATION

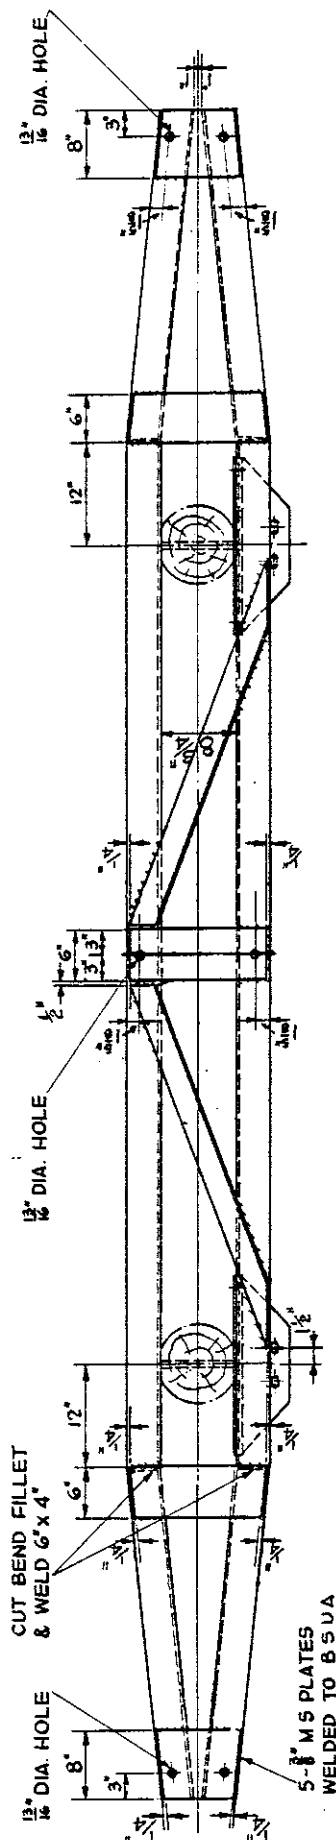

PLAN

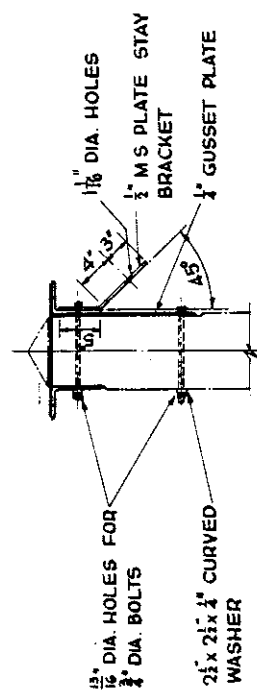

SIDE ELEVATION

NP	DIA.	LENGTH	LOCATION	THREADED	NUTS	WASHERS
4	$\frac{3}{4}$ "	12"	POLE / CROSSARM / GUSSET	4"	4	2 / 2 1/2" x 2 1/2"
4	$\frac{3}{4}$ "	2"	CROSSARM / GUSSET	1"	4	2 x 1/2" CURVED

MATERIALS:

STEELWORK TO BS 4848 PART 4 & BS 54360 GRADE 43 A
BOLTS TO BS 916 THREADED BS W
ALL GALVANISED TO BS 729
CURVED WASHERS TO BS 1320 FIG 38

drawn	
traced M.G.B	
checked	
date 23.4.69	
scale	$\frac{3}{4}$ " To 1'

H.V. OVERHEAD LINES

**CROSSARM STEELWORK FOR
PORTAL TERMINAL SUPPORT
(8'-0" POLE CENTRES)**

Yorkshire Electricity Board	Y003 X 3309
-----------------------------	-------------