RESOLUTION MSC.261(84) (adopted on 16 May 2008)

ADOPTION OF AMENDMENTS TO THE GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS AND OIL TANKERS (RESOLUTION A.744(18), AS AMENDED)

THE MARITIME SAFETY COMMITTEE,

RECALLING Article 28(b) of the Convention on the International Maritime Organization concerning the functions of the Committee,

RECALLING ALSO resolution A.744(18) by which the Assembly adopted the Guidelines on the enhanced programme of inspections during surveys of bulk carriers and oil tankers (the Guidelines),

RECALLING FURTHER article VIII(b) and regulation XI-1/2 of the International Convention for the Safety of Life at Sea (SOLAS), 1974 (hereinafter referred to as "the Convention") concerning the procedure for amending the Guidelines,

NOTING that the Assembly, when adopting resolution A.744(18), requested the Maritime Safety Committee and the Marine Environment Protection Committee to keep the Guidelines under review and update them as necessary, in the light of experience gained in their application,

NOTING ALSO resolutions MSC.49(66), MSC.105(73), MSC.125(75), MSC.144(77), MSC.197(80) and resolution 2 of the 1997 Conference of Contracting Governments to the Convention, by which amendments to the Guidelines were adopted by the Maritime Safety Committee and the Conference of Contracting Governments to the Convention, in accordance with article VIII(b) and regulation XI/2 of the Convention,

HAVING CONSIDERED, at its eighty-fourth session, amendments to the Guidelines proposed and circulated in accordance with article VIII(b)(i) of the Convention,

- 1. ADOPTS, in accordance with article VIII(b)(iv) of the Convention, amendments to the Guidelines on the enhanced programme of inspections during surveys of bulk carriers and oil tankers, the text of which is set out in the Annex to the present resolution;
- 2. DETERMINES, in accordance with article VIII(b)(vi)(2)(bb) of the Convention, that the amendments shall be deemed to have been accepted on 1 July 2009, unless, prior to that date, more than one third of the Contracting Governments to the Convention or Contracting Governments the combined merchant fleets of which constitute not less than 50% of the gross tonnage of the world's merchant fleet, have notified their objections to the amendments;
- 3. INVITES Contracting Governments to note that, in accordance with article VIII(b)(vii)(2) of the Convention, the amendments shall enter into force on 1 January 2010 upon their acceptance in accordance with paragraph 2 above;

- 4. REQUESTS the Secretary-General, in conformity with article VIII(b)(v) of the Convention, to transmit certified copies of the present resolution and the text of the amendments contained in the Annex to all Contracting Governments to the Convention;
- 5. FURTHER REQUESTS the Secretary-General to transmit copies of this resolution and its Annex to Members of the Organization, which are not Contracting Governments to the Convention.

ANNEX

AMENDMENTS TO THE GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS AND OIL TANKERS (RESOLUTION A.744(18)), AS AMENDED

Contents

1 After the existing title of "ANNEX A" the following new title is inserted:

"Part A

GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS HAVING SINGLE-SIDE SKIN CONSTRUCTION"

After the existing list of contents for "ANNEX A", the following is inserted:

"Part B

GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS HAVING DOUBLE-SIDE SKIN CONSTRUCTION

1	General
1.1	Application
1.2	Definitions
1.3	Repairs
1.4	Surveyors
2	Renewal survey
2.1	General
2.2	Dry-dock survey
2.3	Space protection
2.4	Hatch covers and coamings
2.5	Extent of overall and close-up surveys
2.6	Extent of thickness measurements
2.7	Extent of tank pressure testing
3	Annual survey
3.1	General

Examination of the hull

Examination of cargo holds

Examination of ballast tanks

Examination of hatch covers and coamings

3.2

3.3

3.4 3.5

4	Intermediate	survey
---	--------------	--------

- 4.1 General
- 4.2 Bulk carriers 5 to 10 years of age
- 4.3 Bulk carriers 10 to 15 years of age
- 4.4 Bulk carriers exceeding 15 years of age

5 Preparations for survey

- 5.1 Survey programme
- 5.2 Conditions for survey
- 5.3 Access to structures
- 5.4 Equipment for survey
- 5.5 Survey at sea or at anchorage
- 5.6 Survey planning meeting

6 Documentation on board

- 6.1 General
- 6.2 Survey report file
- 6.3 Supporting documents
- 6.4 Review of documentation on board

7 Procedures for thickness measurements

- 7.1 General
- 7.2 Certification of thickness measurement company
- 7.3 Reporting

8 Reporting and evaluation of survey

- 8.1 Evaluation of survey report
- 8.2 Reporting

Annex 1	Reau	irements	for	close-up	survey	at	renewal	surve	VS

- Annex 2 Requirements for thickness measurements at renewal surveys
- Annex 3 Owner's inspection report
- Annex 4A Survey programme
- Annex 4B Survey planning questionnaire
- Annex 5 Procedures for certification of a company engaged in thickness

measurement of hull structures

Annex 6 Survey reporting principles

Annex 7	Condition evaluation report
Annex 8	Recommended procedures for thickness measurements
Annex 9	Guidelines for technical assessment in conjunction with planning for enhanced surveys of bulk carriers relevant survey
Annex 10	Requirements for extent of thickness measurements at those areas of substantial corrosion of bulk carriers with double-side skin construction within the cargo length area
Annex 11	Strength of cargo hatch cover securing arrangements for bulk carriers
Annex 12	Procedural requirements for thickness measurements"

ANNEX A

GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS

After the above title, the following is inserted:

"Part A

GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS HAVING SINGLE-SIDE SKIN CONSTRUCTION"

1.1 Application

- 4 The existing text of paragraph 1.1.1 is replaced by the following:
 - "1.1.1 The Guidelines should apply to all self-propelled bulk carriers of 500 gross tonnage and above having single-side skin construction. Where a bulk carrier has a combination of single- and double-side skin construction, the relevant requirements of parts A and B should apply to that construction, as applicable."
- 5 The following new part B is inserted after part A:

"Part B

GUIDELINES ON THE ENHANCED PROGRAMME OF INSPECTIONS DURING SURVEYS OF BULK CARRIERS HAVING DOUBLE-SIDE SKIN CONSTRUCTION

1 General

1.1 Application*

- **1.1.1** The Guidelines should apply to all self-propelled bulk carriers of 500 gross tonnage and above having double-side skin construction. Where a bulk carrier has a combination of single- and double-side skin construction, the relevant requirements of parts A and B should apply to that construction, as applicable.
- **1.1.2** The Guidelines should apply to surveys of hull structure and piping systems in way of cargo holds, cofferdams, pipe tunnels, void spaces within the cargo length area and all ballast tanks. The surveys should be carried out during the surveys prescribed by regulation I/10 of the Convention.
- **1.1.3** The Guidelines contain the extent of examination, thickness measurements and tank testing. The survey should be extended when substantial corrosion and/or structural defects are found and include additional close-up survey when necessary.

1.2 Definitions

- **1.2.1** *Bulk carrier* is a ship which is constructed generally with single deck, topside tanks and hopper side tanks in cargo spaces, and is intended primarily to carry dry cargo in bulk and includes such types as ore carriers and combination carriers.**
- **1.2.2** Ballast tank is a tank which is used for water ballast and includes side ballast tanks, ballast double bottom spaces, topside tanks, hopper side tanks and peak tanks. A double-side tank should be considered, for survey purposes, as a separate tank even if it is in connection to either the topside tank or the hopper side tank.
- **1.2.3** *Spaces* are separate compartments including holds and tanks.
- **1.2.4** Overall survey is a survey intended to report on the overall condition of the hull structure and determine the extent of additional close-up surveys.

The intention of these Guidelines is to ensure that an appropriate level of review of plans and documents is conducted and consistency in application is attained. Such evaluation of survey reports, survey programmes, planning documents, etc., should be carried out at the managerial level of the Administration or organization recognized by the Administration.

For combination carriers, additional requirements are specified in the Guidelines on the enhanced programme of inspections during surveys for oil tankers, set out in Annex B.

- **1.2.5** *Close-up survey* is a survey where the details of structural components are within the close visual inspection range of the surveyor, i.e., preferably within reach of hand.
- **1.2.6** *Transverse section* includes all longitudinal members such as plating, longitudinals and girders at the deck, sides, bottom, inner bottom, hopper sides, inner sides, top wing inner sides and longitudinal bulkheads.
- **1.2.7** Representative spaces are those which are expected to reflect the condition of other spaces of similar type and service and with similar corrosion prevention systems. When selecting representative spaces, account should be taken of the service and repair history on board and identifiable critical and/or suspect areas.
- **1.2.8** Suspect areas are locations showing substantial corrosion and/or are considered by the surveyor to be prone to rapid wastage.
- **1.2.9** Substantial corrosion is an extent of corrosion such that assessment of corrosion pattern indicates a wastage in excess of 75% of allowable margins, but within acceptable limits.
- **1.2.10** A corrosion prevention system is normally considered a full hard coating.

Protective coating should usually be epoxy coating or equivalent. Other coating systems may be considered acceptable as alternatives provided that they are applied and maintained in compliance with the manufacturer's specifications.

Where soft coatings have been applied, safe access should be provided for the surveyor to verify the effectiveness of the coating and to carry out an assessment of the conditions of internal structures which may include spot removal of the coating. When safe access cannot be provided, the soft coating should be removed.

- **1.2.11** *Coating condition* is defined as follows:
 - GOOD condition with only minor spot rusting;
 - FAIR condition with local breakdown of coating at edges of stiffeners and weld connections and/or light rusting over 20% or more of areas under consideration, but less than as defined for POOR condition;
 - POOR condition with general breakdown of coating over 20% or more of areas or hard scale at 10% or more of areas under consideration.
- **1.2.12** *Critical structural areas* are locations which have been identified from calculations to require monitoring or from the service history of the subject ship or from similar or sister ships to be sensitive to cracking, buckling or corrosion which would impair the structural integrity of the ship.
- **1.2.13** Cargo length area is that part of the ship which includes all cargo holds and adjacent areas including fuel tanks, cofferdams, ballast tanks and void spaces.

- **1.2.14** *Intermediate survey* is a survey carried out either at the second or third annual survey or between these surveys.
- **1.2.15** A prompt and thorough repair is a permanent repair completed at the time of survey to the satisfaction of the surveyor, therein removing the need for the imposition of any associated condition of classification or recommendation.
- **1.2.16** Convention means the International Convention for the Safety of Life at Sea, 1974, as amended.
- **1.2.17** Specially considered means sufficient close-up inspection and thickness measurements are taken to confirm the actual average condition of the structure under coating.

1.3 Repairs

- **1.3.1** Any damage in association with wastage over the allowable limits (including buckling, grooving, detachment or fracture), or extensive areas of wastage over the allowable limits, which affects or, in the opinion of the Administration, will affect the ship's structural, watertight or weathertight integrity, should be promptly and thoroughly repaired. Areas which should be considered include:
 - .1 side shell frames, their end attachments or adjacent shell plating;
 - .2 deck structure and deck plating;
 - .3 bottom structure and bottom plating;
 - .4 watertight or oiltight bulkheads; and
 - .5 hatch covers or hatch coamings.

Where adequate repair facilities are not available, the Administration may allow the ship to proceed directly to a repair facility. This may require discharging the cargo and/or temporary repairs for the intended voyage.

1.3.2 Additionally, when a survey results in the identification of corrosion or structural defects, either of which, in the opinion of the Administration, will impair the ship's fitness for continued service, remedial measures should be implemented before the ship continues in service.

1.4 Surveyors

For bulk carriers of 20,000 tons deadweight and above, two surveyors should jointly carry out the first scheduled renewal survey after the bulk carrier passes 10 years of age, and all subsequent renewal surveys and intermediate surveys. If the surveys are carried out by a recognized organization, the surveyors should be exclusively employed by such recognized organizations.

2 Renewal survey

2.1 General

- **2.1.1** The renewal survey may be commenced at the fourth annual survey and be progressed during the succeeding year with a view to completion by the fifth anniversary date.
- **2.1.2** As part of the preparation for the renewal survey, the survey programme should be dealt with in advance of the survey. The thickness measurement should not be held before the fourth annual survey.
- **2.1.3** The survey should include, in addition to the requirements of the annual survey, examination, tests and checks of sufficient extent to ensure that the hull and related piping is in a satisfactory condition and is fit for its intended purpose for the new period of validity of the Cargo Ship Safety Construction Certificate, subject to proper maintenance and operation and to renewal surveys being carried out.
- **2.1.4** All cargo holds, ballast tanks, including double bottom and double-side tanks, pipe tunnels, cofferdams and void spaces bounding cargo holds, decks and outer hull should be examined, and this examination should be supplemented by thickness measurement and testing, as required by 2.6 and 2.7, to ensure that the structural integrity remains effective. The examination should be sufficient to discover substantial corrosion, significant deformation, fractures, damages or other structural deterioration.
- **2.1.5** All piping systems within the above spaces should be examined and operationally tested under working conditions to ensure that the condition remains satisfactory.
- **2.1.6** The survey extent of ballast tanks converted to void spaces should be specially considered in relation to the requirements for ballast tanks.

2.2 Dry-dock survey

- **2.2.1** A survey in dry dock should be a part of the renewal survey. There should be a minimum of two inspections of the outside of the ship's bottom during the five-year period of the certificate. In all cases, the maximum interval between bottom inspections should not exceed 36 months.
- **2.2.2** For ships of 15 years of age and over, inspection of the outside of the ship's bottom should be carried out with the ship in dry dock. For ships of less than 15 years of age, alternate inspections of the ship's bottom not conducted in conjunction with the renewal survey may be carried out with the ship afloat. Inspection of the ship afloat should only be carried out when the conditions are satisfactory and the proper equipment and suitably qualified staff are available.
- **2.2.3** If a survey in dry-dock is not completed in conjunction with the enhanced survey during renewal survey or if the 36 month maximum interval referred to in 2.2.1 is not complied with, the Cargo Ship Safety Construction Certificate should cease to be valid until a survey in dry-dock is completed.

2.3 Space protection

Where provided, the condition of the corrosion prevention system of ballast tanks should be examined. For ballast tanks, excluding double bottom tanks, where a coating is found in POOR condition as defined in 1.2.11, and it is not renewed, or where a soft coating has been applied, or where a coating has not been applied, the tanks in question should be examined at annual intervals. When such breakdown of coating is found in ballast double bottom tanks, or where a soft coating has been applied or where a coating has not been applied, the tanks in question may be examined at annual intervals. When considered necessary by the surveyor, or where extensive corrosion exists, thickness measurement should be carried out. Where a protective coating is provided in cargo holds and is found in good condition, the extent of close-up surveys and thickness measurements may be specially considered.

2.4 Hatch covers and coamings

- **2.4.1** A thorough inspection of the items listed in 3.3 should be carried out.
- **2.4.2** Checking of the satisfactory operation of all mechanically operated hatch covers should be made, including:
 - .1 stowage and securing in open condition;
 - .2 proper fit and efficiency of sealing in closed condition;
 - .3 operational testing of hydraulic and power components, wires, chains and link drives.
- **2.4.3** The effectiveness of sealing arrangements of all hatch covers by hose testing or equivalent should be checked.
- **2.4.4** Thickness measurement of the hatch cover and coaming plating and stiffeners should be carried out as given in annex 2.

2.5 Extent of overall and close-up surveys

- **2.5.1** An overall survey of all spaces excluding fuel oil tanks should be carried out at the renewal survey. Fuel oil tanks in way of cargo holds should be sufficiently examined to ensure that their condition is satisfactory.
- **2.5.2** Each renewal survey should include a close-up examination of sufficient extent to establish the condition of the cargo holds and ballast tanks as indicated in annex 1.

2.6 Extent of thickness measurements

2.6.1 The requirements for thickness measurements at the renewal survey are given in annex 2.

- **2.6.2** Representative thickness measurements to determine both general and local levels of corrosion in the transverse web frames in all water ballast tanks should be carried out. Thickness measurements should also be carried out to determine the corrosion levels on the transverse bulkhead plating. The thickness measurements may be dispensed with provided the surveyor is satisfied by the close-up examination that there is no structural diminution, and the coating where applied remains efficient.
- **2.6.3** The surveyor may extend the thickness measurements as deemed necessary. Provisions for extended measurements for areas with substantial corrosion as defined in 1.2.9 are given in annex 10.
- **2.6.4** For areas in spaces where coatings are found to be in GOOD condition as defined in 1.2.11, the extent of thickness measurements according to annex 2 may be specially considered by the Administration. Where a protective coating is provided in cargo holds and is found in good condition, the extent of close-up surveys and thickness measurements may be specially considered.
- **2.6.5** Transverse sections should be chosen where the largest reductions are suspected to occur or are revealed from deck plating measurements.

2.7 Extent of tank pressure testing

- **2.7.1** All boundaries of ballast tanks, deep tanks and cargo holds used for ballast within the cargo hold length should be pressure tested. Representative tanks for fresh water, fuel oil and lubrication oil should also be pressure tested.
- **2.7.2** Generally, the hydrostatic pressure should correspond to a water level to the top of hatches for ballast/cargo holds, or top of air pipes for ballast tanks or fuel tanks.

3 Annual survey

3.1 General

The annual survey should consist of an examination for the purpose of ensuring, as far as practicable, that the hull hatch covers, coamings and piping are maintained in a satisfactory condition and should take into account the service history, condition and extent of the corrosion prevention system of ballast tanks and areas identified in the survey report file.

3.2 Examination of the hull

- **3.2.1** Examination of the hull plating and its closing appliances should be carried out as far as can be seen.
- **3.2.2** Examination of watertight penetrations should be carried out as far as practicable.

3.3 Examination of hatch covers and coamings

- **3.3.1** It should be confirmed that no unapproved changes have been made to the hatch covers, hatch coamings and their securing and sealing devices since the last survey.
- **3.3.2** A thorough survey of cargo hatch covers and coamings is only possible by examination in the open as well as closed positions and should include verification of proper opening and closing operation. As a result, at least the hatch covers sets within the forward 25% of the ship's length and at least one additional set, such that all the sets on the ship are assessed at least once in every 5-year period, should be surveyed open, closed and in operation to the full extent in each direction at each annual survey, including:
 - .1 stowage and securing in open condition;
 - .2 proper fit and efficiency of sealing in closed condition; and
 - .3 operational testing of hydraulic and power components, wires, chains and link drives.

The closing of the covers should include the fastening of all peripheral, and cross joint cleats or other securing devices. Particular attention should be paid to the condition of hatch covers in the forward 25% of the ship's length, where sea loads are normally greatest.

- **3.3.3** If there are indications of difficulty in operating and securing hatch covers, additional sets above those required by 3.3.2, at the discretion of the surveyor, should be tested in operation.
- **3.3.4** Where the cargo hatch securing system does not function properly, repairs should be carried out under the supervision of the Administration. Where hatch covers or coamings undergo substantial repairs, the strength of securing devices should be upgraded to comply with annex 13.
- **3.3.5** For each cargo hatch cover set, at each annual survey, the following items should be surveyed:
 - .1 cover panels, including side plates, and stiffener attachments that may be accessible in the open position by close-up survey (for corrosion, cracks, deformation):
 - .2 sealing arrangements of perimeter and cross joints (gaskets for condition and permanent deformation, flexible seals on combination carriers, gasket lips, compression bars, drainage channels and non-return valves);
 - .3 clamping devices, retaining bars, cleating (for wastage, adjustment, and condition of rubber components);
 - .4 closed cover locating devices (for distortion and attachment);

- .5 chain or rope pulleys;
- **.6** guides;
- .7 guide rails and track wheels;
- **.8** stoppers;
- .9 wires, chains, tensioners and gypsies;
- .10 hydraulic system, electrical safety devices and interlocks; and
- .11 end and interpanel hinges, pins and stools where fitted.
- **3.3.6** At each hatchway, at each annual survey, the coamings, with plating, stiffeners and brackets should be checked for corrosion, cracks and deformation, especially of the coaming tops.
- **3.3.7** Where considered necessary, the effectiveness of sealing arrangements may be proved by hose or chalk testing supplemented by dimensional measurements of seal compressing components.
- **3.3.8** Where portable covers, wooden or steel pontoons are fitted, the satisfactory condition of the following should be confirmed:
 - .1 wooden covers and portable beams, carriers or sockets for the portable beam, and their securing devices;
 - .2 steel pontoons, including close-up survey of hatch cover plating;
 - .3 tarpaulins;
 - .4 cleats, battens and wedges;
 - .5 hatch securing bars and their securing devices;
 - .6 loading pads/bars and the side plate edge;
 - .7 guide plates and chocks;
 - .8 compression bars, drainage channels and drain pipes (if any).

3.4 Examination of cargo holds

- **3.4.1** For bulk carriers over 10 years of age, the following should be carried out:
 - .1 overall survey of two selected cargo holds. Where a protective coating is provided in cargo holds and is found in GOOD condition, the extent of

- close-up surveys and thickness measurements may be specially considered; and
- when considered necessary by the surveyor, thickness measurement should be carried out. If the results of these thickness measurements indicate that substantial corrosion is found, the extent of thickness measurements should be increased in accordance with annex 10.
- **3.4.2** For bulk carriers over 15 years of age, the following should be carried out:
 - overall survey of all cargo holds. Where a protective coating is provided in cargo holds and is found in GOOD condition, the extent of close-up surveys and thickness measurements may be specially considered; and
 - when considered necessary by the surveyor, thickness measurement should be carried out. If the results of these thickness measurements indicate that substantial corrosion is found, the extent of thickness measurements should be increased in accordance with annex 10.
- **3.4.3** All piping and penetrations in cargo holds, including overboard piping, should be examined for bulk carriers over 10 years of age.

3.5 Examination of ballast tanks

Examination of ballast tanks should be carried out when required as a consequence of the results of the renewal survey and intermediate survey. When considered necessary by the surveyor, thickness measurement should be carried out. If the results of these thickness measurements indicate that substantial corrosion is found, the extent of thickness measurements should be increased in accordance with annex 10.

4 Intermediate survey

4.1 General

- **4.1.1** Notwithstanding the provisions of 1.1.2, items that are additional to the requirements of the annual survey may be surveyed either at the second or third annual survey or between these surveys.
- **4.1.2** The extent of survey is dependent upon the age of the ship as specified in 4.2, 4.3 and 4.4.

4.2 Bulk carriers 5 to 10 years of age

4.2.1 Ballast tanks

4.2.1.1 For spaces used for salt water ballast, an overall survey of representative spaces selected by the surveyor should be carried out. If such inspections reveal no visible structural defects, the examination may be limited to a verification that the protective coating remains efficient.

- **4.2.1.2** Where POOR coating condition, corrosion or other defects are found in salt water ballast spaces or where protective coating was not applied from the time of construction, the examination should be extended to other ballast spaces of the same type.
- **4.2.1.3** In salt water ballast spaces other than double bottom tanks, where a protective coating is found in POOR condition and it is not renewed, or where soft coating has been applied, or where a protective coating was not applied from the time of construction, the tanks in question should be examined and thickness measurements carried out as considered necessary at annual intervals. When such breakdown of coating is found in salt water ballast double bottom tanks, where a soft coating has been applied, or where a coating has not been applied, the tanks in question should be examined at annual intervals. When considered necessary by the surveyor, or where extensive corrosion exists, thickness measurements should be carried out.
- **4.2.1.4** In addition to the above requirements, areas found to be suspect areas at the previous renewal survey should be overall and close-up surveyed.

4.2.2 Cargo holds

- **4.2.2.1** An overall survey of all cargo holds should be carried out.
- **4.2.2.2** Where considered necessary by the surveyor as a result of the overall survey of any one cargo hold as described in 4.2.2.1, the survey should be extended to include a close-up survey of that cargo hold as well as a close-up survey of sufficient extent of those areas of the structure as deemed necessary.

4.2.3 Extent of thickness measurement

- **4.2.3.1** Thickness measurement should be carried out to an extent sufficient to determine both general and local corrosion levels at areas subject to close-up survey as described in 4.2.2.1. The minimum requirement for thickness measurements at the intermediate survey are areas found to be suspect areas at the previous renewal survey.
- **4.2.3.2** Where substantial corrosion is found, the extent of thickness measurements should be increased in accordance with the requirements of annex 10.
- **4.2.3.3** The thickness measurement may be dispensed with provided the surveyor is satisfied by the close-up survey, that there is no structural diminution and the protective coating, where applied, remains effective.

4.3 Bulk carriers 10 to 15 years of age

4.3.1 Ballast tanks

4.3.1.1 For bulk carriers:

All salt water ballast tanks should be examined. If such inspections reveal no visible structural defects, the examination may be limited to a verification that the protective coating remains efficient.

4.3.1.2 For ore carriers:

- .1 all web frame rings in one ballast wing tank;
- .2 one deck transverse in each of the remaining ballast wing tanks;
- .3 both transverse bulkheads in one ballast wing tank; and
- .4 one transverse bulkhead in each remaining ballast wing tank.
- **4.3.1.3** In addition, the requirements described in 4.2.1.2 to 4.2.1.4 apply.

4.3.2 Cargo holds

- **4.3.2.1** An overall survey of all cargo holds should be carried out.
- **4.3.2.2** Where considered necessary by the surveyor as a result of the overall survey of any one cargo hold as described in 4.3.2.1, the survey should be extended to include a close-up survey of that cargo hold as well as a close-up survey of sufficient extent of those areas of the structure as deemed necessary.

4.3.3 Extent of thickness measurement

- **4.3.3.1** Thickness measurement should be carried out to an extent sufficient to determine both general and local corrosion levels at areas subject to close-up survey as described in 4.3.2.1. The minimum requirement for thickness measurements at the intermediate survey are areas found to be suspect areas at the previous renewal survey.
- **4.3.3.2** In addition, the requirements described in 4.2.3.2 and 4.2.3.3 apply.

4.4 Bulk carriers exceeding 15 years of age

- **4.4.1** The requirements of the intermediate survey should be to the same extent as the previous renewal survey required in 2 and 5.1. However, pressure testing of tanks and cargo holds used for ballast is not required unless deemed necessary by the attending surveyor.
- **4.4.2** In application of 4.4.1, the intermediate survey may be commenced at the second annual survey and be progressed during the succeeding year with a view to completion at the third annual survey in lieu of the application of 2.1.1.

5 Preparations for survey

5.1 Survey programme

5.1.1 A specific survey programme should be worked out in advance of the renewal survey by the owner in co-operation with the Administration. The survey programme should be in a written format based on the information in annex 4A. The survey should not commence until the survey programme has been agreed.

- **5.1.2** Prior to the development of the survey programme, the survey planning questionnaire should be completed by the owner based on the information set out in annex 4B, and forwarded to the Administration.
- **5.1.3** In developing the survey programme, the following documentation should be collected and consulted with a view to selecting tanks, holds, areas and structural elements to be examined:
 - .1 survey status and basic ship information;
 - .2 documentation on board, as described in 7.2 and 7.3;
 - .3 main structural plans (scantlings drawings), including information regarding use of high-tensile steels (HTS);
 - .4 relevant previous survey and inspection reports from both the classification society and the owner;
 - .5 information regarding the use of ship's holds and tanks, typical cargoes and other relevant data;
 - .6 information regarding corrosion protection level on the new building; and
 - .7 information regarding the relevant maintenance level during operation.
- **5.1.4** The submitted survey programme should account for, and comply, as a minimum, with the provisions of annexes 1 and 2 and paragraph 2.7 for close-up survey, thickness measurement and tank testing, respectively, and should include relevant information, including at least:
 - .1 basic ship information and particulars;
 - .2 main structural plans (scantling drawings), including information regarding use of high-tensile steels (HTS);
 - .3 plan of holds and tanks;
 - .4 list of holds and tanks with information on use, protection and condition of coating;
 - .5 conditions for survey (e.g., information regarding tank cleaning, gas-freeing, ventilation, lighting, etc.);
 - .6 provisions and methods for access to structures;
 - .7 equipment for surveys;
 - .8 nomination of holds and tanks and areas for close-up survey (per annex 1);

- .9 nomination of sections for thickness measurement (per annex 2);
- .10 nomination of tanks for testing (per 2.7); and
- .11 damage experience related to ship in question.
- **5.1.5** The Administration should advise the owner of the maximum acceptable structural corrosion diminution levels applicable to the ship.
- **5.1.6** Use may also be made of the Guidelines for technical assessment in conjunction with the planning of enhanced surveys for bulk carriers, contained in annex 9. These Guidelines are a recommended tool which may be invoked at the discretion of the Administration, when considered necessary and appropriate, in conjunction with the preparation of the required survey programme.

5.2 Conditions for survey

- **5.2.1** The owner should provide the necessary facilities for a safe execution of the survey.
- **5.2.2** In order to enable the attending surveyors to carry out the survey, provisions for proper and safe access, should be agreed between the owner and the Administration.
- **5.2.3** Details of the means of access should be provided in the survey planning questionnaire.
- **5.2.4** In cases where the provisions of safety and required access are judged by the attending surveyors not to be adequate, the survey of the spaces involved should not proceed.
- **5.2.5** Cargo holds, tanks and spaces should be safe for access. Cargo holds, tanks and spaces should be gas free and properly ventilated. Prior to entering a tank, void or enclosed space, it should be verified that the atmosphere in the tank is free from hazardous gas and contains sufficient oxygen.
- **5.2.6** Cargo holds, tanks and spaces should be sufficiently clean and free from water, scale, dirt, oil residues, sediments, etc., to reveal corrosion, deformation, fractures, damages or other structural deterioration as well as the condition of the coating. In particular, this applies to areas which are subject to thickness measurement.
- **5.2.7** Sufficient illumination should be provided to reveal corrosion, deformation, fractures, damages or other structural deterioration as well as the condition of the coating.
- **5.2.8** The surveyor(s) should always be accompanied by, at least, one responsible person, assigned by the owner, experienced in tank and enclosed spaces inspection. In addition, a back-up team of at least two experienced persons should be stationed at the hatch opening of the tank or space that is being surveyed. The back-up team should continuously observe the work in the tank or space and should keep life-saving and evacuation equipment ready for use.

5.2.9 A communication system should be arranged between the survey party in the cargo hold, tank or space being examined, the responsible officer on deck and, as the case may be, the navigation bridge. The communication arrangements should be maintained throughout the survey.

5.3 Access to structures*

- **5.3.1** For overall survey, means should be provided to enable the surveyor to examine the structure in a safe and practical way.
- **5.3.2** For close-up survey, one or more of the following means for access, acceptable to the surveyor, should be provided:
 - .1 permanent staging and passages through structures;
 - .2 temporary staging and passages through structures;
 - .3 lifts and moveable platforms;
 - .4 portable ladders;
 - .5 other equivalent means.

5.4 Equipment for survey

- **5.4.1** Thickness measurements should normally be carried out by means of ultrasonic test equipment. The accuracy of the equipment should be proven to the surveyor as required.
- **5.4.2** One or more of the following fracture detection procedures may be required if deemed necessary by the surveyor:
 - .1 radiographic equipment;
 - .2 ultrasonic equipment;
 - .3 magnetic particle equipment;
 - .4 dye penetrant;
 - .5 other equivalent means.
- **5.4.3** Explosimeter, oxygen-meter, breathing apparatus, lifelines, riding belts with rope and hook and whistles together with instructions and guidance on their use should be made available during the survey. A safety check-list should be provided.

Refer to the Guidelines on the means of access to structures for inspection and maintenance of oil tankers and bulk carriers (MSC/Circ.686).

- **5.4.4** Adequate and safe lighting should be provided for the safe and efficient conduct of the survey.
- **5.4.5** Adequate protective clothing should be made available and used (e.g., safety helmet, gloves, safety shoes, etc.) during the survey.

5.5 Survey at sea or at anchorage

- **5.5.1** Survey at sea or at anchorage may be accepted provided the surveyor is given the necessary assistance from the personnel on board. Necessary precautions and procedures for carrying out the survey should be in accordance with 5.1, 5.2, 5.3 and 5.4.
- **5.5.2** A communication system should be arranged between the survey party in the spaces and the responsible officer on deck.
- **5.5.3** When rafts or boats will be used for close-up survey, the following conditions should be observed:
 - .1 only rough duty, inflatable rafts or boats, having satisfactory residual buoyancy and stability even if one chamber is ruptured, should be used;
 - .2 the boat or raft should be tethered to the access ladder and an additional person should be stationed down the access ladder with a clear view of the boat or raft;
 - .3 appropriate lifejackets should be available for all participants;
 - .4 the surface of water in the tank or hold should be calm (under all foreseeable conditions the expected rise of water within the tank should not exceed 0.25 m) and the water level either stationary or falling. On no account should the level of the water be rising while the boat or raft is in use;
 - .5 the tank, hold or space should contain clean ballast water only. Even a thin sheen of oil on the water is not acceptable; and
 - at no time should the water level be allowed to be within 1 m of the deepest under deck web face flat so that the survey team is not isolated from a direct escape route to the tank hatch. Filling to levels above the deck transverses should only be contemplated if a deck access manhole is fitted and open in the bay being examined, so that an escape route for the survey party is available at all times. Other effective means of escape to the deck may be considered.
- **5.5.4** Rafts or boats alone may be allowed for inspection of the under deck areas for tanks or spaces, if the depth of the webs is 1.5 m or less.

- **5.5.5** If the depth of the webs is more than 1.5 m, rafts or boats alone may be allowed only:
 - .1 when the coating of the under deck structure is in GOOD condition and there is no evidence of wastage; or
 - .2 if a permanent means of access is provided in each bay to allow safe entry and exit. This means of access should be direct from the deck via a vertical ladder with a small platform fitted approximately 2 m below the deck. Other effective means of escape to the deck may be considered.

If neither of the above conditions are met, then staging or other equivalent means should be provided for the survey of the under deck areas.

5.5.6 The use of rafts or boats alone in 5.5.4 and 5.5.5 does not preclude the use of boats or rafts to move about within a tank during a survey.

5.6 Survey planning meeting

- **5.6.1** The establishment of proper preparation and the close co-operation between the attending surveyor(s) and the owner's representatives onboard prior to and during the survey are an essential part in the safe and efficient conduct of the survey. During the survey on board safety meetings should be held regularly.
- **5.6.2** Prior to commencement of any part of the renewal and intermediate survey, a survey planning meeting should be held between the attending surveyor(s), the owner's representative in attendance, the thickness measurement company operator (as applicable) and the master of the ship or an appropriately qualified representative appointed by the master or Company for the purpose to ascertain that all the arrangements envisaged in the survey programme are in place, so as to ensure the safe and efficient conduct of the survey work to be carried out.
- **5.6.3** The following is an indicative list of items that should be addressed in the meeting:
 - .1 schedule of the ship (i.e., the voyage, docking and undocking manoeuvres, periods alongside, cargo and ballast operations, etc.);
 - .2 provisions and arrangements for thickness measurements (i.e., access, cleaning/de-scaling, illumination, ventilation, personal safety);
 - .3 extent of the thickness measurements;
 - .4 acceptance criteria (refer to the list of minimum thicknesses);
 - .5 extent of close-up survey and thickness measurement considering the coating condition and suspect areas/areas of substantial corrosion;
 - **.6** execution of thickness measurements:

- Page 22
- .7 taking representative readings in general and where uneven corrosion/pitting is found;
- .8 mapping of areas of substantial corrosion; and
- .9 communication between attending surveyor(s) the thickness measurement company operator(s) and owner's representative(s) concerning findings.

6 Documentation on board

6.1 General

- **6.1.1** The owner should obtain, supply and maintain on board the ship documentation as specified in 6.2 and 6.3, which should be readily available for the surveyor. The condition evaluation report referred to in 6.2 should include a translation into English.
- **6.1.2** The documentation should be kept on board for the lifetime of the ship.

6.2 Survey report file

- **6.2.1** A survey report file should be a part of the documentation on board consisting of:
 - .1 reports of structural surveys (annex 6);
 - .2 condition evaluation report (annex 7); and
 - .3 thickness measurement reports (annex 8).
- **6.2.2** The survey report file should be available also in the owner's and the Administration offices.

6.3 Supporting documents

- **6.3.1** The following additional documentation should be available on board:
 - .1 main structural plans of holds and ballast tanks;
 - .2 previous repair history;
 - .3 cargo and ballast history;
 - .4 inspections by ship's personnel with reference to:
 - .4.1 structural deterioration in general;
 - .4.2 leakages in bulkheads and piping;
 - .4.3 condition of coating or corrosion prevention system, if any. A guidance for reporting is shown in annex 3;

survey programme as required by 5.1 until such time as the renewal survey has been completed,

and any other information that would help to identify critical structural areas and/or suspect areas requiring inspection.

6.4 Review of documentation on board

Prior to survey, the surveyor should examine the completeness of the documentation on board, and its contents as a basis for the survey.

7 Procedures for thickness measurements

7.1 General

- **7.1.1** The required thickness measurements, if not carried out by the recognized organization acting on behalf of the Administration, should be witnessed by a surveyor of the recognized organization. The surveyor should be on board to the extent necessary to control the process.
- **7.1.2** The thickness measurement company should be part of the survey planning meeting to be held prior to commencing the survey.
- **7.1.3** In all cases the extent of the thickness measurements should be sufficient as to represent the actual average condition.
- **7.1.4** Procedural requirements for thickness measurements are set out in annex 12.

7.2 Certification of thickness measurement company

The thickness measurements should be carried out by a qualified company certified by an organization recognized by the Administration according to principles stated in annex 5.

7.3 Reporting

- **7.3.1** A thickness measurement report should be prepared and submitted to the Administration. The report should give the location of measurements, the thickness measured as well as corresponding original thickness. Furthermore, the report should give the date when the measurements were carried out, type of measuring equipment, names of personnel and their qualifications and be signed by the operator. The thickness measurement report should follow the principles as specified in the recommended procedures for thickness measurements set out in annex 8.
- **7.3.2** The surveyor should verify and countersign the thickness measurement reports.

8 Reporting and evaluation of survey

8.1 Evaluation of survey report

- **8.1.1** The data and information on the structural condition of the ship collected during the survey should be evaluated for acceptability and continued structural integrity of the ship.
- **8.1.2** The analysis of data should be carried out and endorsed by the Administration and the conclusions of the analysis should form a part of the condition evaluation report.

8.2 Reporting

- **8.2.1** Principles for survey reporting are shown in annex 6.
- **8.2.2** When a survey is split between different survey stations, a report should be made for each portion of the survey. A list of items examined and/or tested (pressure testing, thickness measurements etc.) and an indication of whether the item has been credited, should be made available to the next attending surveyor(s), prior to continuing or completing the survey.
- **8.2.3** A condition evaluation report of the survey and results should be issued to the owner as shown in annex 7 and placed on board the ship for reference at future surveys. The condition evaluation report should be endorsed by the Administration.

ANNEX 1

REQUIREMENTS FOR CLOSE-UP SURVEY AT RENEWAL SURVEYS

AGE ≤ 5 years	5 < AGE ≤ 10 years 2	10 < AGE ≤ 15 years 3	AGE > 15 years
One transverse web with associated plating and longitudinals in two representative water ballast	One transverse web with associated plating and longitudinals as applicable in each water ballast tank. (A)	All transverse webs with associated plating and longitudinals as applicable in each water ballast tank. (A)	All transverse webs with associated plating and longitudinals as applicable in each water ballast tank. (A)
tanks of each type. This is to include the foremost topside and double-side water ballast tanks on either side. (A)		All transverse bulkheads including stiffening system in each water ballast tank. (A) 25% of ordinary transverse frames in the foremost double-side tanks. (B)	All transverse bulkheads including stiffening system in each water ballast tank. (A)
Two selected cargo hold transverse bulkheads, including internal structure of upper and	25% of ordinary transverse frames in the foremost double-side tanks. (B)	All cargo hold transverse bulkheads including internal structure of upper and	All ordinary transverse frames in all double-side tanks. (B)
lower stools, where fitted. (C) All cargo hold hatch covers and	One transverse bulkhead in each cargo hold, including internal structure of upper and lower stools, where fitted. (C)	lower stools, where fitted. (C) All cargo hold hatch covers and coamings. (D)	Areas (C) – (E) as for column 3
coaming. (D)	All cargo hold hatch covers and coamings. (D) All deck plating and under deck structures inside line of hatch openings between cargo hold hatches. (E)	All deck plating and under deck structures inside line of hatch openings between cargo hold hatches. (E)	

RESOLUTION MSC.261(84)

Page 26

- (A) Transverse web or watertight transverse bulkhead in topside, hopper side and double-side ballast tanks. In fore and aft peak tanks transverse web means a complete transverse web frame ring including adjacent structural members.
- (B) Ordinary transverse frame in double-side tanks.
- (C) Cargo hold transverse bulkheads, platings, stiffeners and girders.
- (D) Cargo hold hatch covers and coamings.
- (E) Deck plating and under deck structure inside line of hatch openings between cargo hold hatches.

Note: Close-up survey of transverse bulkheads to be carried out at four levels:

- Level (a) Immediately above the inner bottom and immediately above the line of gussets (if fitted) and shedders for ships without lower stool.
- Level (b) Immediately above and below the lower stool shelf plate (for those ships fitted with lower stools), and immediately above the line of the shedder plates.
- Level (c) About mid-height of the bulkhead.
- Level (d) Immediately below the upper deck plating and immediately adjacent to the upper wing tank, and immediately below the upper stool shelf plate for those ships fitted with upper stools, or immediately below the topside tanks.

ANNEX 2

REQUIREMENTS FOR THICKNESS MEASUREMENTS AT RENEWAL SURVEYS

AGE ≤ 5 years	5 < AGE ≤ 10 years	10 < AGE ≤ 15 years	AGE > 15 years
1	2	3	4
1 Suspect areas	1 Suspect areas	1 Suspect areas	1 Suspect areas
	Within the cargo length area: two transverse sections of deck plating	2 Within the cargo length area:	2 Within the cargo length area:
	outside line of cargo hatch openings3 Measurement, for general assessment	.1 each deck plate outside line of cargo hatch openings.2 two transverse sections, one of which should be in the	.1 each deck plate outside line of cargo hatch
	and recording of corrosion pattern, of those structural members subject to	amidship area, outside line of cargo hatch openings Massyrament, for general assessment, and recording of	openings 2 three transverse
	close-up survey according to annex 14 All cargo holds hatch covers and coamings (plating and stiffeners)	3 Measurement, for general assessment and recording of corrosion pattern, of those structural members subject to close-up survey according to annex 1	.2 three transverse sections, one of which should be in the amidship area, outside
	5 All deck plating inside line of openings between cargo hold hatches	4 All cargo hold hatch covers and coamings (plating and stiffeners)	line of cargo hatch openings
	6 Wind and water strakes in way of transverse sections considered under	5 All deck plating inside line of openings between cargo hold hatches	.3 each bottom plate 3 Points 3 to 7 referred to in
	point 2 above	6 All wind and water strakes within the cargo length area	column 3
		7 Selected wind and water strakes outside the cargo length area	

ANNEX 3

OWNER'S INSPECTION REPORT

Structural condition

Ship's name:	Ship's name:						
OWNER'S INS	OWNER'S INSPECTION REPORT – Structural condition						
For tank/hold 1	10.:						
Grade of steel:		k: om:					
Elements	Cracks	Buckles	Corrosion	Coating condition	Pitting	Modification/ Other repair	
Deck:							
Bottom:							
Side:							
Side framing:							
Longitudinal bulkheads:							
Transverse bulkheads:							
Repairs carried	out due to:						
Thickness mea	surements of	carried out (da	ntes):				
Results in general:							
Overdue surveys:							
Outstanding conditions of class:							
Comments:							
Date of inspect Inspected by: Signature:							

ANNEX 4A

SURVEY PROGRAMME

Basic information and particulars

Name of ship:
IMO number:
Flag State:
Port of registry:
Gross tonnage:
Deadweight (metric tonnes):
Length between perpendiculars (m):
Shipbuilder:
Hull number:
Recognized organization (RO):
RO ship identity:
Date of delivery of the ship:
Owner:
Thickness measurement company:

1 Preamble

1.1 Scope

- **1.1.1** The present survey programme covers the minimum extent of overall surveys, close-up surveys, thickness measurements and pressure testing within the cargo length area, cargo holds, ballast tanks, including fore and aft peak tanks, required by the Guidelines.
- **1.1.2** The arrangements and safety aspects of the survey should be acceptable to the attending surveyor(s).

1.2 Documentation

All documents used in the development of the survey programme should be available onboard during the survey as required by section 6.

2 Arrangement of cargo holds, tanks and spaces

This section of the survey programme should provide information (either in the form of plans or text) on the arrangement of cargo holds, tanks and spaces that fall within the scope of the survey.

3 List of cargo holds, tanks and spaces with information on their use, extent of coatings and corrosion protection system

This section of the survey programme should indicate any changes relating to (and should update) the information on the use of the holds and tanks of the ship, the extent of coatings and the corrosion protective system provided in the Survey Planning Questionnaire.

4 Conditions for survey

This section of the survey programme should provide information on the conditions for survey, e.g., information regarding cargo hold and tank cleaning, gas freeing, ventilation, lighting, etc.

5 Provisions and method of access to structures

This section of the survey programme should indicate any changes relating to (and should update) the information on the provisions and methods of access to structures provided in the Survey Planning Questionnaire.

6 List of equipment for survey

This section of the survey programme should identify and list the equipment that will be made available for carrying out the survey and the required thickness measurements.

7 Survey requirements

7.1 Overall survey

This section of the survey programme should identify and list the spaces that should undergo an overall survey for this ship in accordance with 2.4.1 and 2.5.1.

7.2 Close-up survey

This section of the survey programme should identify and list the hull structures that should undergo a close-up survey for this ship in accordance with 2.5.2.

8 Identification of tanks for tank testing

This section of the survey programme should identify and list the cargo holds and tanks that should undergo tank testing for this ship in accordance with 2.7.

9 Identification of areas and sections for thickness measurements

This section of the survey programme should identify and list the areas and sections where thickness measurements should be taken in accordance with 2.6.1.

10 Minimum thickness of hull structures

This section of the survey programme should specify the minimum thickness for hull structures of this ship that are subject to survey, according to .1 or .2:

1	Determined from the attached wastage allowance table and the original thickness to the hull structure plans of the ship;
2	Given in the following table(s):

Area or location	Original as-built thickness (mm)	Minimum thickness (mm)	Substantial corrosion thickness (mm)
Deck	(IIIII)		(mm)
Plating			
Longitudinals			
Longitudinal girders			
Cross deck plating			
Cross deck stiffeners			
Bottom			
Plating			
Longitudinals			
Longitudinal girders			
Inner bottom			
Plating			
Longitudinals			
Longitudinal girders			
Floors			
Ship side in way of			
topside tanks			
Plating			
Longitudinals			
Ship side in way of			
hopper side tanks			
Plating			
Longitudinals			
Ship side in way of			
double-side tanks			
(if applicable)			
Plating			
Longitudinals or ordinary			
transverse frames			
Longitudinal stringers			
Longitudinal bulkhead			
(if applicable)			
Plating			
Longitudinals			
(if applicable)			
Longitudinal girders			
(if applicable)			
Transverse bulkheads			
Plating			
Stiffeners (if applicable)			
Upper stool plating			
Upper stool stiffeners			
Lower stool plating			
Lower stool stiffeners			
Transverse web in			
topside tanks			
Plating			
Flanges			
Stiffeners			

RESOLUTION MSC.261(84) Page 32

Transverse web in		
hopper tanks		
Plating		
Flanges		
Stiffeners		
Transverse web in		
double-side tanks		
Plating		
Flanges		
Stiffeners		
Hatch covers		
Plating		
Stiffeners		
Hatch coamings		
Plating		
Stiffeners		

Note: The wastage allowance tables should be attached to the survey programme.

11 Thickness measurement company

This section of the survey programme should identify changes, if any, relating to the information on the thickness measurement company provided in the Survey Planning Questionnaire.

12 Damage experience related to the ship

This section of the survey programme should, using the tables provided below, provide details of the hull damages for at least the last three years in way of the cargo holds, ballast tanks and void spaces within the cargo length area. These damages are subject to survey.

Hull damages sorted by location for this ship

Cargo hold, tank or space number or area	Possible cause, if known	Description of the damages	Location	Repair	Date of repair

Hull damages for sister or similar ships (if available) in the case of design related damage

Cargo hold, tank or space number	·	Description of the damages	Location	Repair	Date of repair
or area					

13 Areas identified with substantial corrosion from previous surveys

This section of the survey programme should identify and list the areas of substantial corrosion from previous surveys.

14 Critical structural areas and suspect areas

This section of the survey programme should identify and list the critical structural areas and the suspect areas, when such information is available.

15 Other relevant comments and information

This section of the survey programme should provide any other comments and information relevant to the survey.

Appendices

Appendix 1 – List of plans

The provisions of 5.1.4.2 require that the main structural plans of cargo holds and ballast tanks (scantling drawings), including information regarding the use of high-tensile steel (HTS), should be available. This appendix of the survey programme should identify and list the main structural plans which form part of the survey programme.

Appendix 2 - Survey Planning Questionnaire

The Survey Planning Questionnaire (annex 4B), which has been submitted by the owner, should be appended to the survey programme.

Appendix 3 – Other documentation

This part of the survey programme should identify and list any other documentation that forms part of the plan.

RESOLUTION MSC.261(84) Page 34

Prepared by the owner in co-o	peration with the Administration for compliance with 5.1.4.
Date:	(name and signature of authorized owner's representative)
Date:	(name and signature of authorized representative of the Administration)

ANNEX 4B

SURVEY PLANNING QUESTIONNAIRE

The following information will enable the owner, in co-operation with the Administration, to develop a Survey Plan complying with the requirements of the Guidelines. It is essential that the owner provides, when completing the present questionnaire, up-to-date information. The present questionnaire, when completed, should provide all information and material required by the Guidelines.

Particulars

Ship's name:
IMO number:
Flag State:
Port of registry:
Owner:
Recognized organization:
Gross tonnage:
Deadweight (metric tonnes):
Date of delivery:

Information on access provision for close-up surveys and thickness measurement

The owner should indicate, in the table below, the means of access to the structures subject to close-up survey and thickness measurement. A close-up survey is an examination where the details of structural components are within the close visual inspection range of the attending surveyor, i.e., preferably within reach of hand.

RESOLUTION MSC.261(84) Page 36

Hold/Tank	Structure	Temporary	Rafts	Ladders	Direct	Other means
No.		staging			access	(please specify)
F.P.	Fore peak					
A.P.	P. Aft peak					
	Hatch side coamings					
Cargo holds	Topside sloping plate					
	Upper stool plating					
	Cross deck					
	Double-side tank plating					
	Transverse bulkhead					
	Hopper tank platting					
	Lower stool					
	Tank top					
o o	Under deck structure					
Topside tanks	Side shell and structure					
opsid	Sloping plate and structure					
L	Webs and bulkheads					
ks	Hopper sloping plate and					
tan	structure					
er 1	Side shell and structure					
Hopper tanks	Bottom structure					
H	Webs and bulkheads					
side	Side shell and structure					
Double-side tanks	Inner skin and structure					
Dor	Webs and bulkheads					
	Double bottom structure					
	Upper stool internal structure					
	Lower stool internal structure					
	Under deck and structure					
50	Side shell and structure					
Wing tanks of double ore carriers	Side shell vertical web and					
	structure					
	Longitudinal bulkhead and					
	structure					
	Longitudinal bulkhead web and					
	structure					
	Bottom plating and structure					
	Cross ties/stringers					

History of bulk cargoes of a corrosive nature (e.g., high sulphur content)					

Owner's inspections

Using a format similar to that of the table below (which is given as an example), the owner should provide details of the results of their inspections, for the last 3 years – in accordance with the Guidelines – on all CARGO holds and BALLAST tanks and VOID spaces within the cargo area.

Tank/Hold No.	Corrosion protection (1)	Coating extent (2)	Coating condition (3)	Structural deterioration (4)	Hold and tank history (5)
Cargo holds					
Topside tanks					
Hopper tanks					
Double-side					
skin tanks					
Double bottom					
tanks					
Upper stools					
Lower stools					
Wing tanks (ore carriers)					
Fore peak					
Aft peak					
Miscellaneous other spaces:					
•					

Note: Indicate tanks which are used for oil/ballast.

1)	HC = hard coating; SC = soft coating;	
	A = anodes; NP = no protection	
2)	U = upper part; M = middle part; L = lower	Name of owner's representative:
	part; $C = complete$	
3)	G = good; $F = fair;$ $P = poor;$	
	RC = recoated (during the last 3 years)	
4)	N = no findings recorded; $Y = findings$	
	recorded, description of findings should be	Signature:
	attached to this questionnaire	
5)	DR = damage and repair; $L = leakages$;	
	CV = conversion (description to be attached	Date:
	to this questionnaire)	

Reports of port State control inspections

Safety management system
List non-conformities related to hull maintenance, including the associated corrective actions:
Name and address of the approved thickness measurement company:

PROCEDURES FOR CERTIFICATION OF A COMPANY ENGAGED IN THICKNESS MEASUREMENT OF HULL STRUCTURES

1 Application

This guidance applies for certification of the company which intends to engage in the thickness measurement of hull structures of ships.

2 Procedures for certification

Submission of documents

- **2.1** The following documents should be submitted to an organization recognized by the Administration for approval:
 - .1 outline of the company, e.g., organization and management structure;
 - .2 experience of the company on thickness measurement of hull structures of ships;
 - .3 technicians' careers, i.e., experience of technicians as thickness measurement operators, technical knowledge and experience of hull structure, etc. Operators should be qualified according to a recognized industrial NDT Standard;
 - .4 equipment used for thickness measurement such as ultrasonic testing machines and their maintenance/calibration procedures;
 - .5 a guide for thickness measurement operators;
 - **.6** training programmes for technicians for thickness measurement;
 - .7 measurement record format in accordance with recommended procedures for thickness measurements (see annex 8).

Auditing of the company

- 2.2 Upon reviewing the documents submitted with satisfactory results, the company should be audited in order to ascertain that the company is duly organized and managed in accordance with the documents submitted, and eventually is capable of conducting thickness measurement of the hull structure of ships.
- **2.3** Certification is conditional upon an on-board demonstration of thickness measurement as well as satisfactory reporting.

3 Certification

- 3.1 Upon satisfactory results of both the audit of the company referred to in 2.2 and the demonstration tests referred to in 2.3, the Administration or organization recognized by the Administration should issue a certificate of approval as well as a notice to the effect that the thickness measurement operation system of the company has been certified.
- **3.2** Renewal/endorsement of the certificate should be made at intervals not exceeding three years by verification that original conditions are maintained.

4 Report of any alteration to the certified thickness measurement operation system

In cases where any alteration to the certified thickness measurement operation system of the company is made, such an alteration should be immediately reported to the organization recognized by the Administration. Re-audit should be made where deemed necessary by the organization recognized by the Administration.

5 Withdrawal of the certification

The certification may be withdrawn in the following cases:

- .1 where the measurements were improperly carried out or the results were improperly reported;
- where the surveyor found any deficiencies in the approved thickness measurement operation systems of the company; and
- .3 where the company failed to report any alteration referred to in 4 to the organization recognized by the Administration as required.

SURVEY REPORTING PRINCIPLES

As a principle, for bulk carriers subject to the Guidelines, the surveyor should include the following contents in his report for survey of hull structure and piping systems, as relevant for the survey.

1 General

- 1.1 A survey report should be generated in the following cases:
 - in connection with commencement, continuation and/or completion of periodical hull surveys, i.e., annual, intermediate and renewal surveys, as relevant;
 - .2 when structural damages/defects have been found;
 - .3 when repairs, renewals or modifications have been carried out; and
 - .4 when condition of class (recommendation) has been imposed or has been deleted.
- **1.2** The reporting should provide:
 - .1 evidence that prescribed surveys have been carried out in accordance with applicable requirements;
 - .2 documentation of surveys carried out with findings, repairs carried out and condition of class (recommendation) imposed or deleted;
 - .3 survey records, including actions taken, which should form an auditable documentary trail. Survey reports should be kept in the survey report file required to be on board;
 - .4 information for planning of future surveys; and
 - .5 information which may be used as input for maintenance of classification rules and instructions.
- 1.3 When a survey is split between different survey stations, a report should be made for each portion of the survey. A list of items surveyed, relevant findings and an indication of whether the item has been credited, are to be made available to the next attending surveyor, prior to continuing or completing the survey. Thickness measurement and tank testing carried out is also to be listed for the next surveyor.

2 Extent of the survey

2.1 Identification of compartments where an overall survey has been carried out.

- 2.2 Identification of locations, in each ballast tank and cargo hold including hatch covers and coamings, where a close-up survey has been carried out, together with information on the means of access used.
- **2.3** Identification of locations, in each ballast tank and cargo hold including hatch covers and coamings, where thickness measurement has been carried out.
 - **Note:** As a minimum, the identification of location of close-up survey and thickness measurement should include a confirmation with description of individual structural members corresponding to the extent of requirements stipulated in Annex A based on type of periodical survey and the ship's age.

Where only partial survey is required, e.g., one transverse web, two selected cargo hold transverse bulkheads, the identification should include location within each ballast tank and cargo hold by reference to frame numbers.

- 2.4 For areas in ballast tanks and cargo holds where protective coating is found to be in good condition and the extent of close-up survey and/or thickness measurement has been specially considered, structures subject to special consideration should be identified.
- **2.5** Identification of tanks subject to tank testing.
- **2.6** Identification of piping systems on deck and within cargo holds, ballast tanks, pipe tunnels, cofferdams and void spaces where:
 - .1 examination including internal examination of piping with valves and fittings and thickness measurement, as relevant, has been carried out; and
 - .2 operational test to working pressure has been carried out.

3 Result of the survey

- **3.1** Type, extent and condition of protective coating in each tank, as relevant (rated GOOD, FAIR or POOR) including identification of tanks fitted with anodes.
- 3.2 Structural condition of each compartment with information on the following, as relevant:
 - .1 identification of findings, such as:
 - .1.1 corrosion with description of location, type and extent;
 - .1.2 areas with substantial corrosion;
 - .1.3 cracks/fractures with description of location and extent;
 - .1.4 buckling with description of location and extent; and
 - .1.5 indents with description of location and extent:

- .2 identification of compartments where no structural damages/defects are found. The report may be supplemented by sketches/photos; and
- .3 thickness measurement report should be verified and signed by the surveyor controlling the measurements on board.

4 Actions taken with respect to findings

- 4.1 Whenever the attending surveyor is of the opinion that repairs are required, each item to be repaired should be identified in a numbered list. Whenever repairs are carried out, details of the repairs effected should be reported by making specific reference to relevant items in the numbered list
- **4.2** Repairs carried out should be reported with identification of:
 - .1 compartment;
 - .2 structural member;
 - .3 repair method (i.e., renewal or modification), including:
 - .3.1 steel grades and scantlings (if different from the original); and
 - **.3.2** sketches/photos, as appropriate;
 - .4 repair extent; and
 - .5 non-destructive test (NDT)/tests.
- **4.3** For repairs not completed at the time of survey, condition of class/recommendation should be imposed with a specific time limit for the repairs. In order to provide correct and proper information to the surveyor attending for survey of the repairs, condition of class/recommendation should be sufficiently detailed with identification of each item to be repaired. For identification of extensive repairs, reference may be made to the survey report.

CONDITION EVALUATION REPORT Issued upon completion of renewal survey

General particulars		
Ship's name:	Class/Administration Previous class/Adm IMO number:	on identity number: inistration identity number(s):
Port of registry:	National flag: Previous national fl	ag(s):
Deadweight (metric tonnes):	Gross tonnage: National: ITC (1969):	
Date of build:	Classification notati	ion:
Date of major conversion:		
Type of conversion:	Owner: Previous owner(s)	
to be satisfactory	been completed in accordance	ewed by the undersigned and found with the present Guidelines on
	T	
Condition evaluation report completed by	Name Signature	Title
Office	Date	
Condition evaluation report verified by	Name Signature	Title
Office	Date	

Attached reports and documents:

- 1)
- 2)
- 3)
- 4)
- 5)
- 6)

Contents of condition evaluation report

Part 1 – General particulars: – See front page

Part 2 – Report review: – Where and how survey was done

Part 3 – Close-up survey: – Extent (which tanks/holds)

Part 4 – Thickness measurements: – Reference to thickness measurement report

Summary of where measured

 Separate form indicating the spaces with substantial corrosion, and corresponding:

thickness diminutioncorrosion pattern

Part 5 - Tank corrosion - Separate form indicating:

prevention system: – location of coating/anodes

condition of coating (if applicable)

Part 6 – Repairs: – Identification of spaces/areas

Part 7 - Condition of class/flag State

requirements:

Part 8 – Memoranda: – Acceptable defects

- Any points of attention for future surveys,

e.g., for suspect areas

- Extended annual/intermediate survey due to

coating breakdown

Part 9 - Conclusion: - Statement on evaluation/verification of survey

report

Extract of thickness measurements

Reference is made to the thickness measurement report:

Position of substantially corroded tanks/areas ¹ or areas with deep pitting ³	Thickness diminution [%]	Corrosion pattern ²	Remarks: e.g. (e.g., ref. attached sketches)

RESOLUTION MSC.261(84) Page 46

Notes:

- 1 Substantial corrosion, i.e., 75% 100% of acceptable margins wasted.
- P = Pitting

C = Corrosion in general

Any bottom plating with a pitting intensity of 20% or more, with wastage in the substantial corrosion range or having an average depth of pitting of 1/3 or more of actual plate thickness should be noted.

Tank/hold corrosion prevention system

Tank/hold Nos.1	Tank/hold corrosion prevention system ²	Coating condition ³	Remarks

Notes:

1 All ballast tanks and cargo holds should be listed.

C = Coating A = Anodes NP = No protection

3 Coating condition according to the following standard:

GOOD condition with only minor spot rusting.

FAIR condition with local breakdown of coating at edges of stiffeners

and weld connections and/or light rusting over 20% or more of areas under consideration, but less than as defined for POOR

condition.

POOR condition with general breakdown of coating over 20% or more of

areas or hard scale at 10% or more of areas under consideration.

If coating condition POOR is given, extended annual surveys should be introduced. This should be noted in part 7 of the Contents of condition evaluation report.

RECOMMENDED PROCEDURES FOR THICKNESS MEASUREMENTS

- 1 This annex should be used for recording thickness measurements as required by part B of Annex A.
- Thickness measurement sheet forms TM1-DSBC, TM2-DSBC, TM3-DSBC, TM4-DSBC, TM5-DSBC and TM6-DSBC (appendices 2 to 5) should be used, as appropriate, for recording thickness measurements and these sheets should be bound with the cover sheet of the report of GENERAL PARTICULARS in appendix 1. The maximum allowable diminution should be stated. The maximum allowable diminution could be stated in an attached document.
- 3 Appendices 3 to 5 are guidance diagrams and notes relating to the reporting forms and the procedure for the thickness measurements.

THICKNESS MEASUREMENT REPORT

GENERAL PARTICULARS

Ship's name:	
IMO Number:	
Administration Identification Number:	
Port of registry:	
Gross tonnage:	
Deadweight:	
Date of build:	
Classification society:	
Name of Company performing the thickness measu	rement:
Thickness measurement company certified by:	
Certificate No.:	
Certificate valid from:	to
Place of measurement:	
First date of measurement:	
Last date of measurement:	
Renewal survey/intermediate survey* due:	
Details of measurement equipment:	
Qualification of operator:	
Report Number:	
Consisting of Forms	
consisting of I offine	
Name of operator:	Name of surveyor:
Signature of operator:	Signature of surveyor:
Company official stamp:	Administration official stamp:

^{*} Delete as appropriate.

NOTES - See Reverse

APPENDIX 2

Stransport Str	TMI-DSBC	Repor	t on THI	CKNES	S MEAS	UREME	NT OF A	LL DE	Report on THICKNESS MEASUREMENT OF ALL DECK PLATING, ALL BOTTOM SHEEL PLATING AND SIDE SHELL PLATING* (* – delete as appropriate)	PLATING, ALL BOTT (* – delete as appropriate)	L BOTT propriate	OM SHI	EL PLA	TINGA	ND SIDE	SHELL	L PLATI	"Su
STRAKE POSITION	Ship's name				:	Class	Identity N					ort No				No		
PLATE No. or Table Title Gauged Dimination Position Aff Reaching Aff Reaching Mean Dimination Stress POSTTION Letter mm % nmm % nmm % p s mm % mm	STRAKE POSITION																	
POSITION Letter Title, Gauged Diminution P Diminution P Diminution P Diminution P Diminution P S num % P S Num % P S Num % P S Num P Num P S Num P Num P S Num P S Num P Num P Num P Num	DI ATE	No or	Org.			Forward	1 Reading					Aft R	sading			эW	an Dimin	ntion
Consideration Consideratio	POSITION	I effer	Thk.	Gar	pagn	Dimit	nution P	Dimi	nution S	Gau	pegi	Dimin	ution P	Dimin	ution S		%	
12th forward	TOTAL TOTAL	Tanaa a	mm	Ь	s	mm	%	mm	%	Ь	S	mm	%	mm	%	ď	s	mm
11th	12th forward																	
10th	11th																	
9th 9th <td>10th</td> <td></td>	10th																	
8th 8th <td>9th</td> <td></td>	9th																	
7th 7th <td>8th</td> <td></td>	8th																	
6th 6th <td>7th</td> <td></td>	7th																	
5th 4th 4th <td>6th</td> <td></td>	6th																	
4th 4th <td>5th</td> <td></td>	5th																	
3rd 3rd 3rd 9 9 9 2nd Amidships 9 9 9 9 1st aft 2nd 9 9 9 9 9 9 4th 3rd 9	4th																	
2nd 2nd 1st 2nd 2nd <td>3rd</td> <td></td>	3rd																	
1st Amidships Permidships Per	2nd																	
Amidships Amidships <t< td=""><td>lst</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>	lst																	
1st aft 1st aft <t< td=""><td>Amidships</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></t<>	Amidships																	
2nd 2nd <td>1st aft</td> <td></td>	1st aft																	
3rd 4th 4th 6th 6th <td>2nd</td> <td></td>	2nd																	
4th 4th <td>3rd</td> <td></td>	3rd																	
5th 5th 6th 6th <td>4th</td> <td></td>	4th																	
6th 6th <td>5th</td> <td></td>	5th																	
7th 7th <td>6th</td> <td></td>	6th																	
8th 9th 6th 6th <td>7th</td> <td></td>	7th																	
9th 10th 11th 12th	8th																	
10th 11th 12th 12th <td< td=""><td>9th</td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td><td></td></td<>	9th																	
11th 12th	10th																	
12th	11th																	
	12th																	

Operator's Signature

NOTES TO REPORT TM1-DSBC

- 1 This report should be used for recording the thickness measurement of:
 - .1 all strength deck plating within cargo length area;
 - .2 all keel, bottom shell plating and bilge plating within the cargo length area;
 - .3 side shell plating including selected wind and water strakes outside cargo length area; and
 - .4 all wind and water strakes within cargo length area.
- 2 The strake position should be cleared as follows:
 - .1 for strength deck indicate the number of the strake of plating inboard from the stringer plate;
 - .2 for bottom plating indicate the number of the strake of plating outboard from the keel plate; and
 - .3 for side shell plating give number of the strake of plating sheerstrake and letter as shown on shell expansion.
- Only the deck plating strakes outside line of openings are to be recorded.
- 4 Measurements should be taken at the forward and aft areas of all plates and where plates cross ballast/cargo tank boundaries separate measurements for the area of plating in way of each type of tank should be recorded.
- 5 The single measurements recorded are to represent the average of multiple measurements.
- 6 The maximum allowable diminution could be stated in an attached document.

NOTES - See Reverse

Operator's Signature

Report on THICKNESS MEASUREMENT OF SHELL AND DECK PLATING at transverse sections (one, two or three transverse sections) TM2-DSBC(i)

Ship's name							ū	Class Identity No	ntity]	No					:	Repo	Report No				:	IMO) No.	IMO No		
								STRENGTH DECK AND SHEERSTRAKE PLATING	GTH	DECK	ANE	SHE	RST	RAKE	PLA	LING						Ш				
	FII	RSTT	RANS	VERS NL	ERSE SECT NUMBER	FIRST TRANSVERSE SECTION AT FRAME NUMBER	AT FI	RAME		SECO	ND T	RANS	VER	ERSE SEC NUMBER	CTIO	(AT)	SECOND TRANSVERSE SECTION AT FRAME NUMBER		THIRD	TRA	NSVE	ER SE SEC NUMBER	SECT BER	THIRD TRANSVERSE SECTION AT FRAME NUMBER	TFRA	ME
STRAKE	No. or	Org. Thk.	Max. Alwb. Gauged Dim.	Gau		Diminution P	1	Diminution S		No. C or T	Org.	Max. Alwb. Dim.	Gauged		iminut P	ion [Diminution Diminution S	on No.	org.		Max. Alwb. Gauged Dim.	auged		Diminution Diminution S	Dimi	nution S
	Dinor.	mm	mm	Ь	s	mm	1 %	% mm			mm	mm	Ь	S	mm	I %	% uuu		mm	mm m	-	P S	mm	% 1	mm	%
Stringer Plate							_		_		_			_			_	_	_	_	_					
1st strake inboard							_		_		_			_			_			_	_					
2nd																					_					
3rd							_		_		_			_		_	_	_	_	_	_					
4th																					_					
5th							H		_		Н			_		_	_	_	_	_	_					
6th									_					_		_	_	_		_	_					
7th							_		_		_			_		_	_	_	_	_	_		L		_	
8th																										
oth 9th									_		_															
10th									\vdash					\vdash												
11th							_		_		_			_		_	_	_	_	_						
12th							\vdash		Н					-			-	\square			_			_		
13th									_					_		_	_	_		_						
14th									\vdash					\vdash					\vdash							
centre strake							Н		\vdash		Н															
sheer strake									\dashv		\dashv			\dashv				\dashv								
TOPSIDE TOTAL							\dashv		\dashv	-	\neg		-	-	-		\neg		\dashv		-					

NOTES TO REPORT TM2-DSBC(i)

1 This report should be used for recording the thickness measurement of:

Strength deck plating and sheerstrake plating transverse sections:

One, two or three sections within the cargo length area, comprising the structural items (0), (1) and (2) as shown on the diagrams of typical transverse sections (Appendices 3 and 4).

- 2 Only the deck plating strakes outside line of hatch openings should be recorded.
- 3 The top side area comprises deck plating, stringer plate and sheerstrake (including rounded gunwales).
- 4 The exact frame station of measurement should be stated.
- 5 The single measurements recorded should represent the average of multiple measurements.
- 6 The maximum allowable diminution could be stated in an attached document.

NOTES - See Reverse

Operator's Signature ...

Report on THICKNESS MEASUREMENT OF SHELL AND DECK PLATING at transverse sections (one, two or three transverse sections) TM2-DSBC(ii)

		ME	Diminution Diminution P	%																						
		rfra	Dimi	mm																						
		NA.	inu bon P	%																						
IMO No		SCTIC ER	Dimir	mm																						
MO		ERSE SEC NUMBER	Ganged	02																						
		SVER		Ь								Н						Н	Н	Н				Н	Н	\dashv
		THIRD TRANSVERSE SECTION AT FRAME NUMBER	Max. Alwb. Dim.	mm														Ц	Ц							
		IRD 1	Org. Thk.	mm																						
		H	No. or	Total																						
Report No		ME	ution	%																						\Box
Ϋ́		FRA	Diminution S	mm																						
Rep		N AI	tion	%								П												П		٦
		SECOND TRANSVERSE SECTION AT FRAME NUMBER	Diminution P	mm																						
		YERSE SEC NUMBER	Gauged	02																						
	TING	SVE		Ь					Ш									Д	\Box							
	SHELL PLATING	TRAN	Max. Alwb. Dim.	ww																						
	HELI	OND	Org. Thk	ww																						
	Ψ,	SEC	No. or	Lotes																						
ntity		Ε		%	Г							П						П						П		T
Class Identity No.		FRAM	Diminution Diminution P S	mm																						
		IAT	uoga.	%			Г					П						П	П					П		
		CTIO)	Simin P	mm																						
		RSE SECT NUMBER	Gauged	02																						
		/ERS	Gau	Ь																						
		FIRST TRANSVERSE SECTION AT FRAME NUMBER	Max. Alwb. Dim.	ww																						
		STT	Org. Thk.	mm																						
		FIR	No. or	Totto																						
Ship's name			STRAKE POSITION		1st below sheer strake	2nd	3rd	4th	3th	qu Qu	7th	3th	Ah	10th	11th	12 th	13th	14th	15th	16th	17th	18th	19th	30th	keel strake	BOTTOM TOTAL
40	Ь.	Ь——	97	-	_	cq	(4)	4	43	9	E.	90	Š	_	_	_	_	_	_	_	_	_	_	6.4	÷	→

NOTES TO REPORT TM2-DSBC(ii)

1 This report should be used for recording the thickness measurement of:

Shell plating at transverse sections:

One, two or three sections within the cargo length area, comprising the structural items (3), (4), (5) and (6) as shown on the diagrams of typical transverse sections in appendices 3 and 4.

- The bottom area comprises keel, bottom and bilge plating.
- The exact frame station of measurement should be stated.
- The single measurements recorded should represent the average of multiple measurements.
- 5 The maximum allowable diminution could be stated in an attached document.

Max. Alwb. Gauged Diminution Diminution S THIRD TRANSVERSE SECTION AT FRAME NUMBER % mm S Ь mm Org. Thk. mm Item No. Diminution Diminution P S % SECOND TRANSVERSE SECTION AT FRAME NUMBER mm % mm Max. Alwb. Gauged S Ы Dim. mm Org. Thk. mm Item No. Max. Alwb. Gauged Diminution Diminution S % FIRST TRANSVERSE SECTION AT FRAME NUMBER mm % mm S Ь Dim. mm m m Org. Thk Item No. STRUCTURAL MEMBER

Report on THICKNESS MEASUREMENT OF LONGITUDINAL MEMBERS at transverse sections (one, two or three transverse sections)

TM3-DSBC

Ship's name

IMO No.

Report No.

Class Identity No.

mm

Operator's Signature

NOTES - See Reverse

NOTES TO REPORT TM3-DSBC

1 This report should be used for recording the thickness measurement of:

Longitudinal members at transverse sections:

Two, or three sections within the cargo length area comprising the appropriate structural items (10) to (25) as shown on diagrams of typical transverse sections in appendices 3 and 4.

- 2 The exact frame station of measurement should be stated.
- The single measurements recorded should represent the average of multiple measurements.
- 4 The maximum allowable diminution could be stated in an attached document.

NOTES - See Reverse

Operator's Signature

Report on THICKNESS MEASUREMENT OF TRANSVERSE STRUCTURAL MEMBERS In the double bottom, hopper side and topside water ballast tanks TM4-DSBC

NOTES TO REPORT TM4-DSBC

- 1 This report should be used for recording the thickness measurement:
 - Transverse structural members, comprising the appropriate structural items (30) to (34) as shown on diagrams of typical transverse sections illustrated in appendices 3 and 4.
- 2 Guidance for areas of measurements is indicated in appendix 5.
- The single measurements recorded should represent the average of multiple measurements.
- 4 The maximum allowable diminution could be stated in an attached document.

				nution S	%										everse
S	IMO No			Diminution S	mm										NOTES - See Reverse
кво ногр		FRAME NO.:		ntion	%										ON
EADS IN CA	Report No.			Diminution P	mm										
SE BULKH	Report No			pag	Starboard										
TRANSVE				Gauged	Port										
ERTIGHT				Max. Alwb. Dim.	mm										
SS OF WAT	Class Identity No			Original Thickness	mm										
Report on THICKNESS OF WATERTIGHT TRANSVERSE BULKHEADS IN CARGO HOLDS	Ship's name Class Ic	TURE:	STRUCTURAL COMPONENT (PLATING/STIFFENER)												Operator's Signature
TMS-DSBC	Ship's name	LOCATION OF STRUCTURE:	STRUCTURAL												Operator's Sign

NOTES TO REPORT TM5-DSBC

- 1 This report should be used for recording the thickness measurement of:
 - Watertight transverse bulkheads in cargo holds.
- 2 Guidance for areas of measurements is indicated in appendix 3.
- The single measurements recorded should represent the average of multiple measurements.
- 4 The maximum allowable diminution could be stated in an attached document.


TM6-DSBC		Report	on THIC	KNESS	MEASUR	EMENT	OF MIS	CELLAN	Report on THICKNESS MEASUREMENT OF MISCELLANEOUS STRUCTURAL MEMBERS
Ship's name				Jass Ident	Class Identity No				Report No
STRUCTURAL MEMBER:									SKETCH
LOCATION OF STRUCTURE:									
Description	Org. Thk.	Max. Alwb. Dim.	Gauged	peg	Diminution P	ution	Diminution S	ution	
	mm	mm	Ь	S	mm	%	mm	%	
						-			
							•		
Operator's Signature		: : : : :	:			:			NOTES - See Reverse

NOTES TO REPORT TM6-DSBC

- 1 This report should be used for recording the thickness measurement of:
 - Miscellaneous structural members including the structural items (40), (41) and (42) as shown on diagrams of typical transverse sections illustrated in Appendix 3.
- 2 Guidance for areas of measurements is indicated in appendix 5.
- The single measurements recorded should represent the average of multiple measurements.
- 4 The maximum allowable diminution could be stated in an attached document.

THICKNESS MEASUREMENT – DOUBLE-SIDE SKIN CONSTRUCTION

Typical transverse section of a double skin bulk carrier with indication of longitudinal and transverse members.

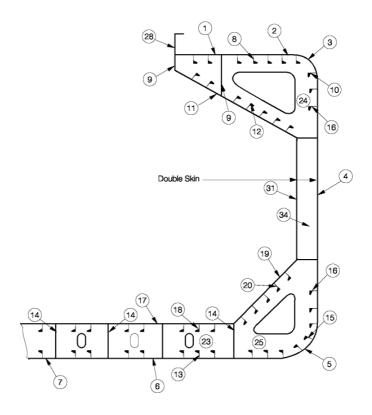

T	Report on M2-DSBC(i) and (ii)
1	Strength deck plating
2	Stringer plate
3	Sheerstrake
4	Side shell plating
5	Bilge plating
6	Bottom shell plating
7	Keel plate


	Report on 7	ГМ3-DSBC
8	Deck longitudinals	17 Inner bottom plating
9	Deck girders	18 Inner bottom longitudinals
10	Sheerstrake	
	longitudinals	19 Hopper plating
11	Topside tank sloping	20 Hopper longitudinals
	plating	31 Inner side plating
12	Topside tank sloping plating longitudinals	- Inner side longitudinals, if any
13	Bottom longitudinals	- Horizontal girders in
14	Bottom girders	wing ballast tanks
15	Bilge longitudinals	
16	Side shell longitudinals, if any	

	Report on TM4-DSBC
23	Double bottom tank floors
25	Hopper side tank transverses
34	Transverse web frame
-	Topside tank transverses

Re	port on TM6-DSBC
	Hatch coamings Deck plating between hatches
-	Hatch covers

THICKNESS MEASUREMENT – ORE CARRIERS

Typical transverse section of an ore carrier with indication of longitudinal and transverse members.

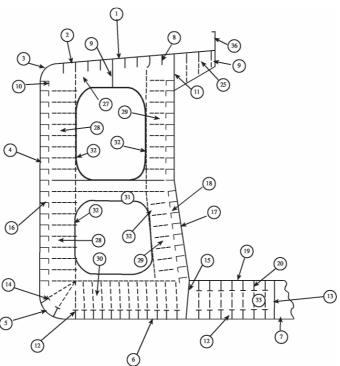

T	Report on SM2-DSBC(i) and (ii)
1	Strength deck plating
2	Stringer plate
3	Sheerstrake
4	Side shell plating
5	Bilge plating
6	Bottom shell plating
7	Keel plate


Rej	port on TM6-DSBC
36	Hatch coamings
37	Deck plating between hatches
38	Hatch covers
39	
40	

	Report on TM3-DSBC
8	Deck longitudinals
9	Deck girders
10	Sheerstrake longitudinals
11	Longitudinal bulkhead top strake
12	Bottom longitudinals
13	Bottom girders
14	Bilge longitudinals
15	Longitudinal bulkhead lower strake
16	Side shell longitudinals
17	Longitudinal bulkhead plating (remainder)
18	Longitudinal bulkhead longitudinals
19	Inner bottom plating
20	Inner bottom longitudinals
21	
22	
23	
24	

	Report on TM4-DSBC
25	Deck transverse centre tank
26	Bottom transverse centre tank
27	Deck transverse wing tank
28	Side shell vertical web
29	Longitudinal bulkhead vertical web
30	Bottom transverse wing tank
31	Struts
32	Transverse web face plate
33	Double bottom floors
34	
35	

THICKNESS MEASUREMENT – DOUBLE-SIDE SKIN CONSTRUCTION

Transverse section outline: the diagram may be used for those ships where the diagrams given in appendices 3 and 4 are not suitable.

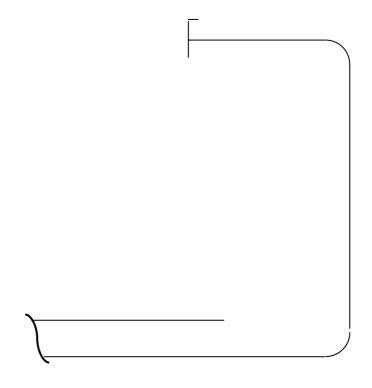

T	Report on M2-DSBC(i) and (ii)
1	Strength deck plating
2	Stringer plate
3	Sheerstrake
4 5	Side shell plating
5	Bilge plating
6	Bottom shell plating
7	Keel plate
	_

	Report on 7	ГМ3-DSBC
8	Deck longitudinals	17 Inner bottom plating
9	Deck girders	18 Inner bottom longitudinals
10	Sheerstrake	
	longitudinals	19 Hopper plating
11	Topside tank sloping	20 Hopper longitudinals
	plating	31 Inner side plating
12	Topside tank sloping plating longitudinals	- Inner side longitudinals, if any
13	Bottom longitudinals	- Horizontal girders in
14	Bottom girders	wing ballast tanks
15	Bilge longitudinals	
16	Side shell longitudinals, if any	

	Report on TM4-DSBC
23	Double bottom tank floors
25	Hopper side tank transverses
34	Transverse web frame
-	Topside tank transverses

Report on TM6-DSBC 28 Hatch coamings - Deck plating between hatches - Hatch covers

GUIDELINES FOR TECHNICAL ASSESSMENT IN CONJUNCTION WITH PLANNING FOR ENHANCED SURVEYS OF BULK CARRIERS*

1 INTRODUCTION

These guidelines contain information and suggestions concerning technical assessments, which may be of use in conjunction with the planning of enhanced surveys of double skin bulk carriers. As indicated in 5.1.6, the guidelines are a recommended tool which may be invoked at the discretion of the Administration, when considered necessary and appropriate, in conjunction with the preparation of the required survey programme.

2 PURPOSE AND PRINCIPLES

2.1 Purpose

- **2.1.1** The purpose of the technical assessments described in these guidelines is to assist in identifying critical structural areas, nominating suspect areas and in focusing attention on structural elements or areas of structural elements which may be particularly susceptible to, or evidence a history of, wastage or damage. This information may be useful in nominating locations, areas holds and tanks for thickness measurement, close-up survey and tank testing.
- **2.1.2** Critical structural areas are locations which have been identified from calculations to require monitoring or from the service history of the subject ship or from similar or sister ships (if available) to be sensitive to cracking, buckling or corrosion which would impair the structural integrity of the ship.

2.2 Minimum requirements

However, these guidelines may not be used to reduce the requirements pertaining to thickness measurement, close-up survey and tank testing contained in annexes 1 and 2 of part B and in paragraph 2.7, respectively, which, in all cases, should be complied with as a minimum.

2.3 Timing

As with other aspects of survey planning, the technical assessments described in these guidelines should be worked out by the owner or operator in co-operation with the Administration well in advance of the commencement of the renewal survey, i.e., prior to commencing the survey and normally at least 12 to 15 months before the survey's completion due date.

^{*} References:

¹ IACS, "Unified Requirement Z10.5, "Hull Surveys of Double Skin Bulk Carriers""

² IACS, "Bulk Carriers: Guidelines for Surveys, Assessment and Repair of Hull Structures, January 2002"

³ TSCF, "Guidelines for the Inspection and Maintenance of Double Hull Tanker Structures, 1995"

⁴ TSCF, "Guidance Manual for Tanker Structures, 1997"

2.4 Aspects to be considered

- **2.4.1** Technical assessments, which may include quantitative or qualitative evaluation of relative risks of possible deterioration, of the following aspects of a particular ship may be used as a basis for the nomination of holds, tanks and areas for survey:
 - .1 design features such as stress levels on various structural elements, design details and extent of use of high-tensile steel;
 - .2 former history with respect to corrosion, cracking, buckling, indents and repairs for the particular ship as well as similar vessels, where available; and
 - .3 information with respect to types of cargo carried, use of different holds/tanks for cargo/ballast, protection of holds and tanks and condition of coating, if any.
- **2.4.2** Technical assessments of the relative risks of susceptibility to damage or deterioration of various structural elements and areas are to be judged and decided on the basis of recognized principles and practices, such as may be found in references 2, 3 and 4.

3 TECHNICAL ASSESSMENT

3.1 General

- **3.1.1** There are three basic types of possible failure, which may be the subject of technical assessment in connection with planning of surveys; corrosion, cracks and buckling. Contact damages are not normally covered by the survey planning since indents are usually noted in memoranda and assumed to be dealt with as a normal routine by surveyors.
- **3.1.2** Technical assessments performed in conjunction with the survey planning process should, in principle, be as shown schematically in figure 1. The approach is basically an evaluation of the risk in the following aspects based on the knowledge and experience related to:
 - .1 design; and
 - .2 corrosion.
- **3.1.3** The design should be considered with respect to structural details, which may be susceptible to buckling or cracking as a result of vibration, high stress levels or fatigue.
- **3.1.4** Corrosion is related to the ageing process, and is closely connected with the quality of corrosion prevention systems fitted at new building, and subsequent maintenance during the service life. Corrosion may also lead to cracking and/or buckling.

3.2 Methods

3.2.1 Design details

3.2.1.1 Damage experience related to the ship in question and sister and/or similar ships, where available, is the main source of information to be used in the process of planning. In addition, a selection of structural details from the design drawings is to be included.

- **3.2.1.2** Typical damage experience to be considered will consist of:
 - .1 number, extent, location and frequency of cracks; and
 - .2 location of buckles.
- **3.2.1.3** This information may be found in the survey reports and/or the owner's files, including the results of the owner's own inspections. The defects should be analysed, noted and marked on sketches.
- **3.2.1.4** In addition, general experience should be utilized. Also, reference should be made to reference 2, which contains a catalogue of typical damages and proposed repair methods for various structural details on single skin bulk carriers. Reference should also be made to reference 3, which contains catalogues of typical damages and proposed repair methods for double hull oil tanker structural details which may to some extent be similar to structural details in double skin bulk carriers. Such figures should be used together with a review of the main drawings, in order to compare with the actual structure and search for similar details that may be susceptible to damage. In particular, chapter 3 of reference 3 deals with various aspects specific to double hull tankers, such as stress concentration locations, misalignment during construction, corrosion trends, fatigue considerations and areas requiring special attention, while chapter 4 of reference 3 addresses experience gained on structural defects in double hulls (chemical tankers, OBO carriers, ore/oil carriers, gas carriers), which should also be considered in working out the survey planning.
- **3.2.1.5** The review of the main structural drawings, in addition to using the above-mentioned figures, should include checking for typical design details where cracking has been experienced. The factors contributing to damage should be carefully considered.
- **3.2.1.6** The use of high-tensile steel (HTS) is an important factor. Details showing good service experience where ordinary, mild steel has been used may be more susceptible to damage when HTS, and its higher associated stresses, are utilized. There is extensive and, in general, good experience, with the use of HTS for longitudinal material in deck and bottom structures. Experience in other locations, where the dynamic stresses may be higher, is less favourable, e.g., side structures.
- **3.2.1.7** In this respect, stress calculations of typical and important components and details, in accordance with relevant methods, may prove useful and should be considered.
- **3.2.1.8** The selected areas of the structure identified during this process should be recorded and marked on the structural drawings to be included in the Survey Programme.
- 3.2.2 Corrosion
- **3.2.2.1** In order to evaluate relative corrosion risks, the following information should generally be considered:
 - .1 usage of tanks, holds and spaces;
 - .2 condition of coatings;

- .3 cleaning procedures;
- .4 previous corrosion damage;
- .5 ballast use and time for cargo holds;
- .6 risk of corrosion in cargo holds and ballast tanks; and
- .7 location of ballast tanks adjacent to heated fuel oil tanks.
- **3.2.2.2** Reference 4 gives definitive examples which can be used for judging and describing coating condition, using typical pictures of conditions.
- **3.2.2.3** The evaluation of corrosion risks should be based on information in both reference 2 and reference 4, as far as applicable to double-side skin construction, together with relevant information on the anticipated condition of the ship as derived from the information collected in order to prepare the Survey Programme and the age of the ship. The various holds, tanks and spaces should be listed with the corrosion risks nominated accordingly.
- **3.2.3** Locations for close-up survey and thickness measurement
- **3.2.3.1** On the basis of the table of corrosion risks and the evaluation of design experience, the locations for initial close-up survey and thickness measurement (areas and sections) may be nominated.
- **3.2.3.2** The sections subject to thickness measurement should normally be nominated in tanks, holds and spaces where corrosion risk is judged to be the highest.
- **3.2.3.3** The nomination of tanks, holds and spaces for close-up survey should initially be based on highest corrosion risk, and should always include ballast tanks. The principle for the selection should that the extent is increased by age or where information is insufficient or unreliable.

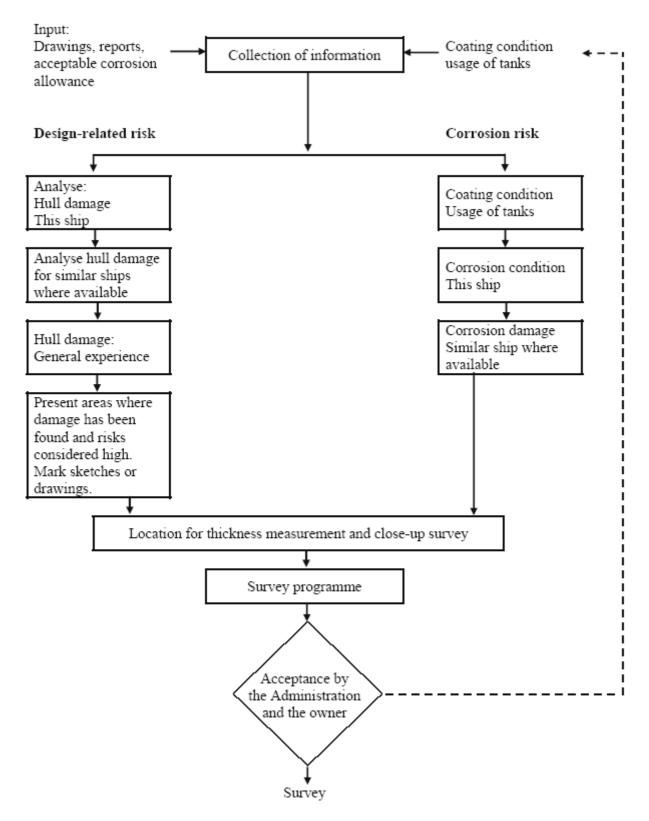


Figure 1 - Technical assessment and the survey planning process

REQUIREMENTS FOR EXTENT OF THICKNESS MEASUREMENTS AT THOSE AREAS OF SUBSTANTIAL CORROSION OF BULK CARRIERS WITH DOUBLE-SIDE SKIN CONSTRUCTION WITHIN THE CARGO LENGTH AREA

TABLE 1 – BOTTOM, INNER BOTTOM AND HOPPER STRUCTURE				
Structural member	Extent of measurement	Pattern of measurement		
Bottom, inner bottom and hopper structure plating	Minimum of three bays across double bottom tank, including aft bay Measurements around and under all suction bell mouths	Five-point pattern for each panel between longitudinals and floors		
Bottom, inner bottom and hopper structure longitudinals	Minimum of three longitudinals in each bay where bottom plating measured	Three measurements in line across flange and three measurements on the vertical web		
Bottom girders, including the watertight ones	At fore and aft watertight floors and in centre of tanks	Vertical line of single measurements on girder plating with one measurement between each panel stiffener, or a minimum of three measurements		
Bottom floors, including the watertight ones	Three floors in the bays where bottom plating measured, with measurements at both ends and middle	Five-point pattern over two square metre area		
Hopper structure web frame ring	Three floors in bays where bottom plating measured	Five-point pattern over one square metre of plating Single measurements on flange		
Hopper structure transverse watertight bulkhead or swash bulkhead	– lower 1/3 of bulkhead	five-point pattern over one square metre of plating		
	- upper 2/3 of bulkhead	 five-point pattern over two square metre of plating 		
	- stiffeners (minimum of three)	 For web, five-point pattern over span (two measurements across web at each end and one at centre of span). For flange, single measurements at each end and centre of span 		
Panel stiffening	Where applicable	Single measurements		

TABLE 2 – DECK STRUCTURE INCLUDING CROSS STRIPS, MAIN CARGO HATCHWAYS, HATCH COVERS, COAMINGS AND TOPSIDE TANKS				
Structural member	Extent of measurement	Pattern of measurement		
Cross deck strip plating	Suspect cross deck strip plating	Five-point pattern between under deck stiffeners over 1 metre length		
Under deck stiffeners	Transverse members Longitudinal member	Five-point pattern at each end and mid span Five-point pattern on both web and flange		
Hatch covers	Side and end skirts, each three locations	Five-point pattern at each location		
	Three longitudinal bands, outboard strakes (2) and centreline strake (1)	Five-point measurement each band		
Hatch coamings	Each side and end of coaming, one band lower 1/3, one band upper 2/3 of coaming	Five-point measurement each band i.e., end or side coaming		
Topside ballast tanks	 a) watertight transverse bulkheads: Lower 1/3 of bulkhead Upper 2/3 of bulkhead Stiffeners 	Five-point pattern over 1 sq. metre of plating Five-point pattern over 1 sq. metre of plating Five-point pattern over 1 metre length		
Topside ballast tanks	b) two representative swash transverse bulkheads: - Lower 1/3 of bulkhead - Upper 2/3 of bulkhead - Stiffeners	Five-point pattern over 1 sq. metre of plating Five-point pattern over 1 sq. metre of plating Five-point pattern over 1 metre length		
Topside ballast tanks	c) three representative bays of slope plating: - Lower 1/3 of tank - Upper 2/3 of tank	Five-point pattern over 1 sq. metre of plating Five point pattern over 1 sq. metre of plating		
Topside ballast tanks	d) Longitudinals, suspect and adjacent	Five point pattern on both web and flange over 1 metre length		
Main deck plating	Suspect plates and adjacent (4)	Five-point pattern over 1 sq. metre of plating		
Main deck longitudinals	Suspect plates	Five point pattern on both web and flange over 1 metre length		
Web frames/transverses	Suspect plates	Five-point pattern over 1 sq. metre		

TABLE 3 – STRUCTURE IN DOUBLE-SIDE BALLAST TANKS				
Structural member	Extent of measurement	Pattern of measurement		
Side shell and inner plating:				
Upper strake and strakes in way of horizontal girdersAll other strakes	 Plating between each pair of transverse frames/longitudinals in a minimum of three bays (along the tank) Plating between every third pair of longitudinals in same three bays 	Single measurementSingle measurement		
Side shell and inner side transverse frames/longitudinals on:				
upper strakeall other strakes	 Each transverse frame/ longitudinal in same three bays Every third transverse frame/ longitudinal in same three bays 	 Three measurements across web and 1 measurement on flange Three measurements across web and 1 measurement on flange 		
Transverse frames/ longitudinals: - brackets	Minimum of three at top, middle and bottom of tank in same three bays	Five-point pattern over area of bracket		
Vertical web and transverse bulkheads:				
strakes in a way of horizontal girdersother strakes	 Minimum of two webs and both transverse bulkheads Minimum of two webs and both transverse bulkheads 	 Five-point pattern over approx. two square metre area Two measurements between each pair of vertical stiffeners 		
Horizontal girders	Plating on each girder in a minimum of three bays	Two measurements between each pair of longitudinal girder stiffeners		
Panel stiffening	Where applicable	Single measurements		

TABLE 4 – TRANSVERSE BULKHEADS IN CARGO HOLDS				
Structural member	Extent of measurement	Pattern of measurement		
Lower stool, where fitted	 Transverse band within 25 mm of welded connection to inner bottom Transverse bands within 25 mm of welded connection to shelf plate 	stiffeners over one metre length - Five-point pattern between		
Transverse bulkheads	 Transverse band at approximately mid height Transverse band at part of bulkhead adjacent to upper deck or below upper stool shelf plate (for those ships fitted with upper stools) 	1 1		

STRENGTH OF CARGO HATCH COVER SECURING ARRANGEMENTS FOR BULK CARRIERS

1 Securing devices

The strength of securing devices should comply with the following requirements:

- .1 Panel hatch covers should be secured by appropriate devices (bolts, wedges or similar) suitably spaced alongside the coamings and between cover elements. Arrangement and spacing should be determined with due attention to the effectiveness for weather-tightness, depending upon the type and the size of the hatch cover, as well as on the stiffness of the cover edges between the securing devices.
- .2 The net sectional area of each securing device is not to be less than:

$$A = 1.4 a / f (cm^2)$$

where:

a = spacing between securing devices not to be taken less than 2 metres

 $f = (\sigma_Y/235)^e$

 σ_Y = specified minimum upper yield stress in N/mm² of the steel used for fabrication, not to be taken greater than 70% of the ultimate tensile strength

e = 0.75 for $\sigma_{Y} > 235$ = 1.0 for $\sigma_{Y} \le 235$

Rods or bolts should have a net diameter not less than 19 mm for hatchways exceeding 5 m^2 in area.

- .3 Between cover and coaming and at cross-joints, a packing line pressure sufficient to obtain weathertightness should be maintained by the securing devices. For packing line pressures exceeding 5 N/mm, the cross section area should be increased in direct proportion. The packing line pressure should be specified.
- .4 The cover edge stiffness should be sufficient to maintain adequate sealing pressure between securing devices. The moment of inertia, I, of edge elements be less than:

$$I = 6 p a^4 (cm^4)$$

where:

p = packing line pressure in N/mm, minimum 5 N/mm

a = spacing in m of securing devices

RESOLUTION MSC.261(84) Page 76

- .5 Securing devices should be of reliable construction and securely attached to the hatchway coamings, decks or covers. Individual securing devices on each cover are to have approximately the same stiffness characteristics.
- .6 Where rod cleats are fitted, resilient washers or cushions should be incorporated.
- .7 Where hydraulic cleating is adopted, a positive means should be provided to ensure that it remains mechanically locked in the closed position in the event of failure of the hydraulic system.

2 Stoppers

- 2.1 Nos.1 and 2 hatch covers should be effectively secured, by means of stoppers, against the transverse forces arising from a pressure of 175 kN/m^2 .
- 2.2 No.2 hatch covers should be effectively secured, by means of stoppers, against the longitudinal forces acting on the forward end arising from a pressure of 175 kN/m².
- 2.3 No.1 hatch cover should be effectively secured, by means of stoppers, against the longitudinal forces acting on the forward end arising from a pressure of 230 kN/m 2 . This pressure may be reduced to 175 kN/m 2 if a forecastle is fitted.
- 2.4 The equivalent stress in stoppers and their supporting structures and calculated in the throat of the stopper welds is not to exceed the allowable value of $0.8 \sigma_Y$.

3 Materials and welding

Where stoppers or securing devices are fitted to comply with this annex, they should be manufactured of materials, including welding electrodes, to the satisfaction of the Administration.

PROCEDURAL REQUIREMENTS FOR THICKNESS MEASUREMENTS

1 General

Thickness measurements required in the context of hull structural surveys, if not carried out by the society itself should be witnessed by a surveyor. The attendance of the surveyor should be recorded. This also applies to thickness measurements taken during voyages.

2 Survey meeting

- 2.1 Prior to commencement of the renewal or intermediate survey, a meeting should be held between the attending surveyor(s), the owner's representative(s) in attendance and the thickness measurement firm's representative(s) so as to ensure the safe and efficient execution of the surveys and thickness measurements to be carried out on board.
- **2.2** Communication with the thickness measurement operator(s) and owner's representative(s) should be agreed during the meeting, with respect to the following:
 - .1 reporting of thickness measurements on regular basis;
 - .2 prompt notification to the surveyor in case of findings such as:
 - **.2.1** excessive and/or extensive corrosion or pitting/grooving of any significance;
 - .2.2 structural defects like buckling, fractures and deformed structures:
 - .2.3 detached and/or holed structure; and
 - **.2.4** corrosion of welds.
- 2.3 The survey report should indicate where and when the meeting took place and who attended (the name of the surveyor(s), the owner's representative(s) and the thickness measurement firm's representative(s)).

3 Monitoring of the thickness measurement process onboard

- **3.1** The surveyor should decide final extent and location of thickness measurements after overall survey of representative spaces onboard.
- 3.2 In case the owner prefers to commence the thickness measurements prior to the overall survey, then the surveyor should advise that the planned extent and locations of thickness measurements are subject to confirmation during the overall survey. Based on findings, the surveyor may require additional thickness measurements to be taken.
- 3.3 The surveyor should direct the gauging operation by selecting locations such that readings taken represent, on average, the condition of the structure for that area.

- 3.4 Thickness measurements taken mainly to evaluate the extent of corrosion, which may affect the hull girder strength, should be carried out in a systematic manner such that all longitudinal structural members are gauged, as required.
- **3.5** Where thickness measurements indicate substantial corrosion or wastage in excess of allowable diminution, the surveyor should direct locations for additional thickness measurements in order to delineate areas of substantial corrosion and to identify structural members for repairs/renewals.
- **3.6** Thickness measurements of structures in areas where close-up surveys are required should be carried out simultaneously with close-up survey.

4 Review and verification

- **4.1** Upon completion of the thickness measurements, the surveyor should confirm that no further gaugings are needed, or specify additional gaugings.
- **4.2** Where these guidelines allow the extent of thickness measurements to be reduced after special considerations by the surveyor, these special considerations should be reported, where appropriate.
- **4.3** In case thickness measurements are partly carried out, the extent of remaining thickness measurements should be reported for the use of the next surveyor."
