

AeroGen Service Bulletin SB-27-104

Subject: Harness H-12 and temperature sensor T2 inspection


Perform this inspection every 600 flight hours. Connector J4 must be disconnected before visual inspection. Reconnect J4 using the torque specified in the table below. Do not apply lubricant to the connector threads.

Inspection / installation values

Item	Requirement	Tolerance / Notes
Connector J4 torque	8 N·m	± 0.5 N·m
Harness H-12 inspection interval	600 flight hours	or at every C-check
Sensor T2 resistance at 25 °C	10.0 kΩ	± 2%

If the cable jacket is damaged, use the diagram on the next page to determine whether replacement is mandatory.

Figure 1 — Harness H-12 inspection diagram

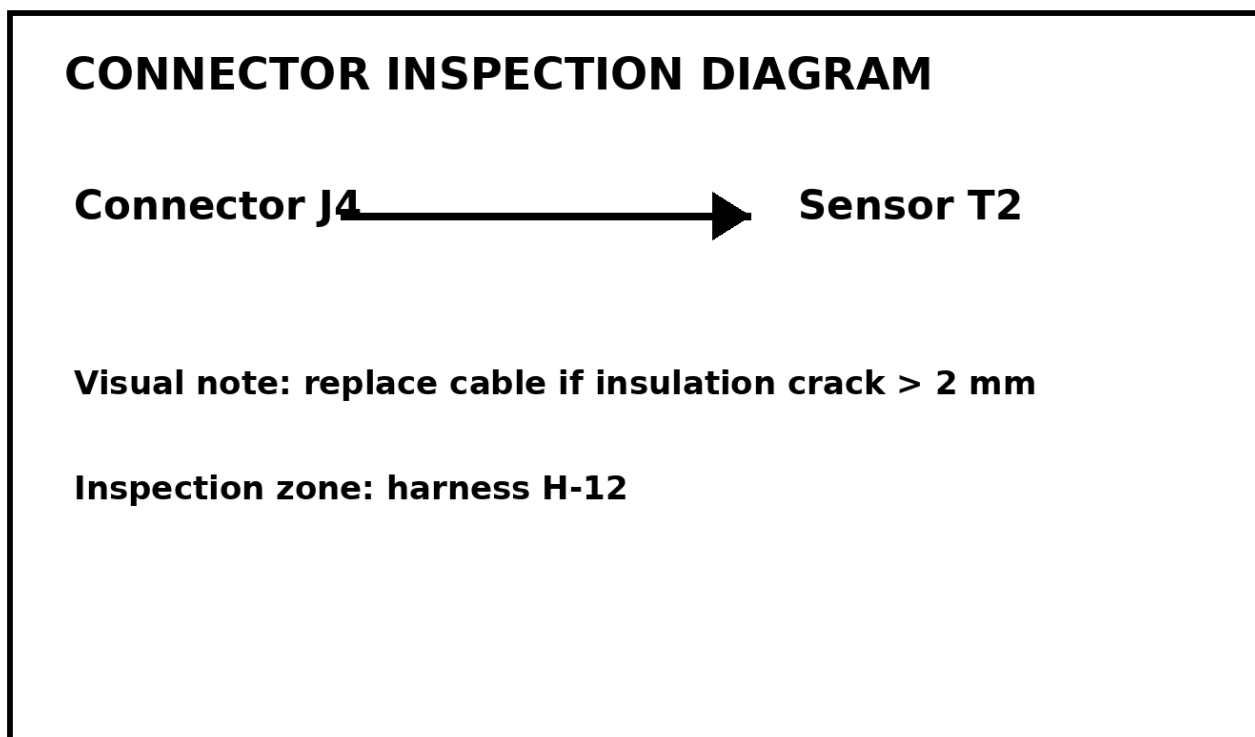

Record the final inspection result in maintenance record MR-27.