

Module 1







Friday, January 2, 2026 11:53 AM

Device Profinet Name and IP assignment


S7-1500RH System Hardware Inventory

Device Name	Type / Description	IP Address	Subnet	IO System	Redundancy Mode
PLC-A	CPU 1518HF-4 PN	192.168.0.1	PN/IE_Plant	PROFINET IO-System	Primary
PLC-B	CPU 1518HF-4 PN	192.168.0.2	PN/IE_Plant	PROFINET IO-System	Backup
CP1543-A1	CP 1543-1	192.168.0.71	Not connected	-	-
CP1543-A2	CP 1543-1	192.168.0.72	Not connected	-	-
CP1543-B1	CP 1543-1	192.168.0.73	Not connected	-	-
CP1543-B2	CP 1543-1	192.168.0.74	Not connected	-	-
ET200SP-A.IO Device-1	IM 155-6 PN R1 (ET200SP-A)	192.168.0.4	PN/IE_Plant	PROFINET IO-System	R1
ET200SP-A.IO Device 2	IM 155-6 PN R1 (ET200SP-A)	192.168.0.5	PN/IE_Plant	PROFINET IO-System	R1
IEPBLinkHA-A	IE/PB LINK HA	192.168.0.30	PN/IE_Plant	PROFINET IO-System	S2
PNPNCoupler-B.X1	PN/PN Coupler	192.168.0.11	PN/IE_Plant	PROFINET IO-System	S2
PNPNCoupler-B.X2	PN/PN Coupler	192.168.0.102	PN/IE_Subordinate	PROFINET IO-System	-
ET200SP-B	IM 155-6 PN/2 HF	192.168.0.12	PN/IE_Plant	PROFINET IO-System	S2
YSwitch-A	SCALANCE XF204-2BA	192.168.0.8	PN/IE_Plant	PROFINET IO-System	S2
Switch-A	SCALANCE XC208 (Side A)	192.168.0.10	PN/IE_Plant	PROFINET IO-System	S1
Switch-B	SCALANCE XC208 (Side B)	192.168.0.6	PN/IE_Plant	PROFINET IO-System	S1
PLC-C	CPU 1510SP F-1 PN	192.168.0.101	PN/IE_Subordinate	PROFINET IO-System	-
UnifiedPCRT	SIMATIC WinCC Unified PC RT	192.168.0.245	PN/IE_Plant	-	Switched Comms

Wiring Diagram

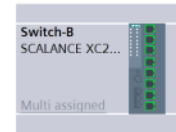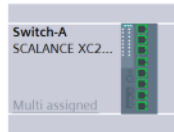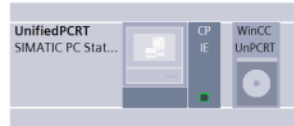



Network Assignment

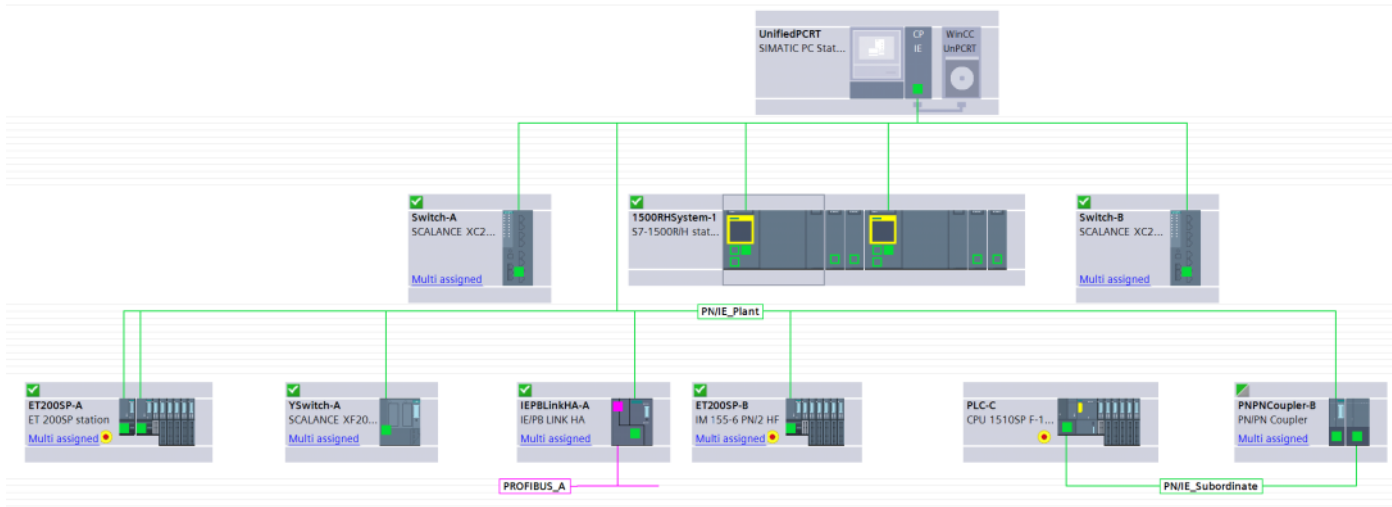

Switch Configurations

Same MRP configurations for Both Switch-A and Switch-B except Switch-A is on mrpdomain-1, and Switch-B is on mrpdomain-2

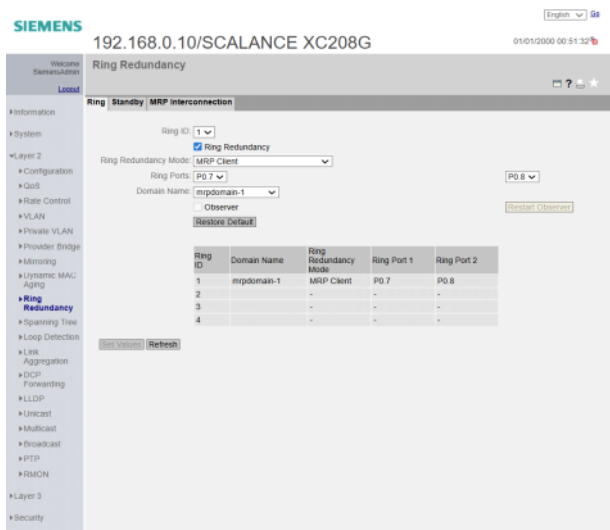

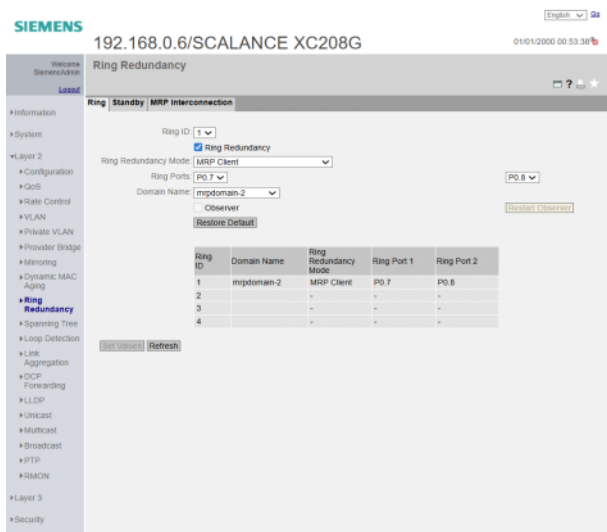

Y-Switch configuration

Module parameters - enable DNA redundancy, then click the green go to arrow on the right
 Enable the Ring redundancy for p1.1 and p2.1, while leaving the DNA Redundancy checkbox unchecked, since we only have one Y-switch in the MRP ring.

