

TYNE TEES DAMP PROOFING

DOM Survey Report & Costing Platform

Live Testing Findings, Technical Change Register and Recommended Delivery Route

Prepared for	Dom and the AI development agents
Prepared by	Steven Robinson, Tyne Tees Damp Proofing
Evidence base	Live site testing, office-admin feedback, customer-facing screenshots, videos, reports and existing costing workbooks
Date	11 July 2026
Status	Working technical review - for discussion, correction and joint development

Purpose of this review

This is not a request to copy the old system rigidly. The old reports and costing workbooks are the proven reference point. The aim is to preserve the important technical and commercial logic while building a quicker, clearer and more flexible tablet-based workflow.

Central recommendation

Keep the strong survey, photograph and report-building features of Dom's platform. Use the existing workbooks as the golden-master costing engine or translate their formulas only after full parity testing. The front end should be simple; the business logic behind it must remain complete.

1. Executive Summary

Live testing shows that the report platform can become a very strong operational system. The survey capture, photograph handling and report generation are capable of reducing the office time currently spent assembling reports manually. The main risk is the costing layer: several missing options, calculation differences and workflow assumptions show that the existing workbook logic has not yet been reproduced consistently.

What is already working well

- A modern tablet-based survey workflow with the potential to capture findings and photographs quickly on site.
- Clear customer-facing report presentation and the ability to dictate technical observations.
- A foundation for one connected workflow covering office booking, survey, report, quotation and later job management.
- The ability to improve on the older report process rather than copying its slower layout.

Main concerns identified

- Essential treatment options are missing or hard to locate, including Warmline DC and reliable core-hole selection.
- DPC injection appears to use a different measurement principle from the approved workbook.
- Floor-resin inputs automatically include components that are independently selectable in the workbook.
- The same customer-specific job produced a £638.41 ex-VAT variance against the completed Excel benchmark.
- Subcontractor pay, projected hours, material outputs and time-on-site calculations are not yet clearly visible in the new workflow.
- Customer documents have delivery, browser, itemisation and company-detail issues that need correcting before full live use.

Recommended direction

- Treat the current Excel workbooks as the golden master for formulas and outputs.
- Enter measurements once in a clean tablet-friendly costing screen; do not create a second mandatory data-entry process.
- Use the established formulas behind that screen, either through a controlled Excel-backed integration or an exact formula translation with automated regression tests.
- Continue improving the report side in parallel, but stop treating each costing difference as an isolated patch until the complete calculation map is agreed.
- Run a representative parity test suite before any costing release is accepted.

Priority overview

Priority	Points	Summary
Critical	4, 6, 11, 14, 14A, 16	Missing treatment/costing functions, wrong calculation logic, benchmark variance and payment reconciliation.
High	1, 2, 3, 5, 7, 8, 10, 12, 13, 15	Customer clarity, workflow ownership, site evidence, usable costing view and internal operational outputs.
Medium	9	Company office details and document branding should be centralised before go-live.

2. Agreed Design Principles

Reference, not rigid copy

The old reports and workbooks explain what information is needed and why. The new system should improve the workflow, not reproduce every slow step.

Simple front end, complete back end

A clean surveyor screen must not remove material, labour, subcontractor, travel, time-on-site or margin logic.

One entry wherever possible

Information already known by admin or already entered by the surveyor should not be typed again.

Correct role ownership

Admin enters booking and mileage information. Steven, Mike or Graeme decide technical scope and the number of men required.

No invented formulas

The AI development agents should not create new rates or multipliers where an approved workbook rule already exists.

Flexible combinations

One property may require damp, condensation, woodworm and timber reporting together. The system must support combined findings and outputs.

Customer and internal views differ

Customers should see transparent itemised work prices. Internal margins, subcontractor pay and operating calculations remain permission-controlled.

Every change is regression-tested

A fix to one section must not silently alter another calculation or output.

3. Survey Costing - Critical and High-Priority Changes

POINT 4 Warline DC is missing from the survey costing workflow

Survey costing / live-site blocker | **CRITICAL**

Finding: During a live occupied-property survey, Steven and a colleague searched the new costing workflow but could not find Warline DC. The survey had to be abandoned on the new system and completed using the established process. The customer proceeded there and then through the old system.

Operational impact: A missing treatment prevents the surveyor from specifying, pricing and closing a legitimate live job. It also shows that the new costing menu is not yet complete against the approved workbooks.

Required change

- Add a clear treatment option for Warline DC internal wall insulation.
- Keep it separate from ordinary membrane and cementitious tanking.
- Allow wall length/area, preparation, finishing, labour, materials and section adjustment to be calculated through the approved workbook rules.

Technical instruction for Dom and the AI development agents

- Map the Warline fields and formulas from the Damp and Timber workbooks before setting new rates.
- Make the option visible in the normal wall-treatment workflow, not hidden in an unrelated section.
- Generate the correct report wording, internal costing, subcontractor hours and customer line item.

Acceptance test

1. Repeat the aborted survey using only the new workflow.
2. Select Warline DC, enter measurements and generate the correct itemised quotation.
3. Confirm the result against the approved workbook to the penny.

Evidence: Photos 4A-4B - wall-treatment screen without a Warline option

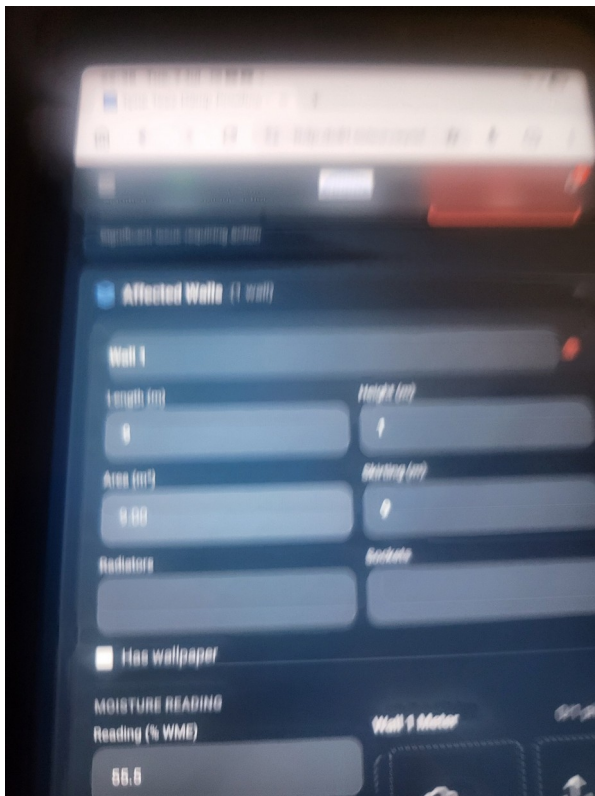


Photo 4A - available wall-treatment fields

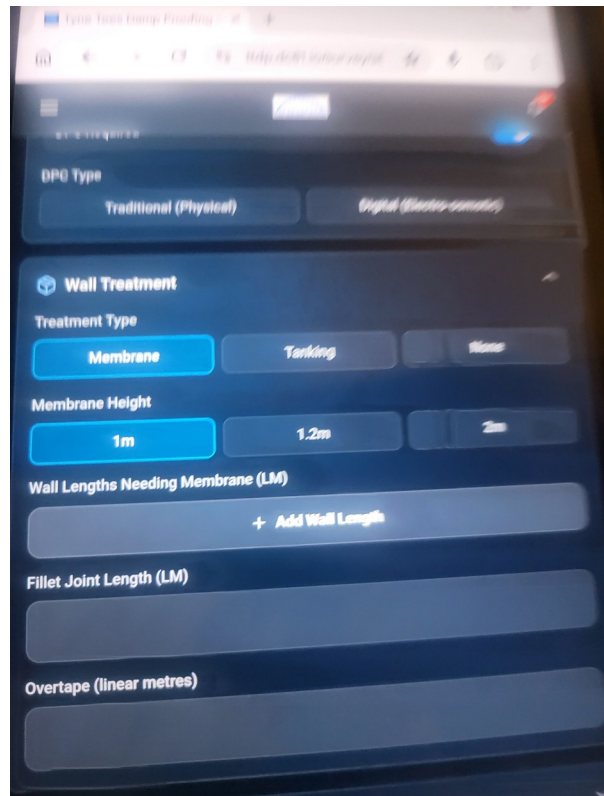


Photo 4B - Membrane/Tanking/None shown, but no Warline DC

POINT 6 DPC injection is using the wrong measurement concept

Survey costing / formula logic | **CRITICAL**

Finding: The new screen asks for wall depth in brick courses and offers 0.5, 1, 1.5, 2, 2.5 and 3 courses. Standard DPC injection is not priced by multiplying the treated wall length by the number of courses. The approved workbook prices the linear length while using wall thickness/construction to account for drilling time and injection material.

Operational impact: Using courses as a multiplier can double or triple the treatment quantity and customer price. The customer-specific benchmark produced £490.52 for DPC, while the new system displayed £907.20.

Important clarification

The exact backend formula may not be visible from the screen alone, but the result and control design make this the first calculation Dom should investigate.

Required change

- Replace the normal “brick courses” control with wall construction and wall thickness.
- Use the measured linear metres once.
- Use the approved rate/material logic for the selected thickness, including standard solid, cavity and stone-wall thicknesses.
- Keep any genuinely exceptional second injection course behind a deliberate specialist override.

Technical instruction for Dom and the AI development agents

- Benchmark formula from the completed workbook: 18 LM x 0.33 m thickness = 5.94 calculation basis; DPC material £104.58; labour 6.3 hours; total customer DPC price £490.52.
- Do not invent a new multiplier. Reuse or exactly translate the existing formulas.
- Allow separate walls to use different thicknesses without averaging them.

Acceptance test

4. 10 LM remains 10 LM when wall thickness changes.
5. Changing thickness changes the approved rate/material and labour outcome, not the treatment length.
6. The benchmark customer returns £490.52 for the same inputs.
7. A multi-course override cannot be triggered accidentally.

Evidence: Photo 6A - brick-course selector; Completed Damp Costing v47 benchmark

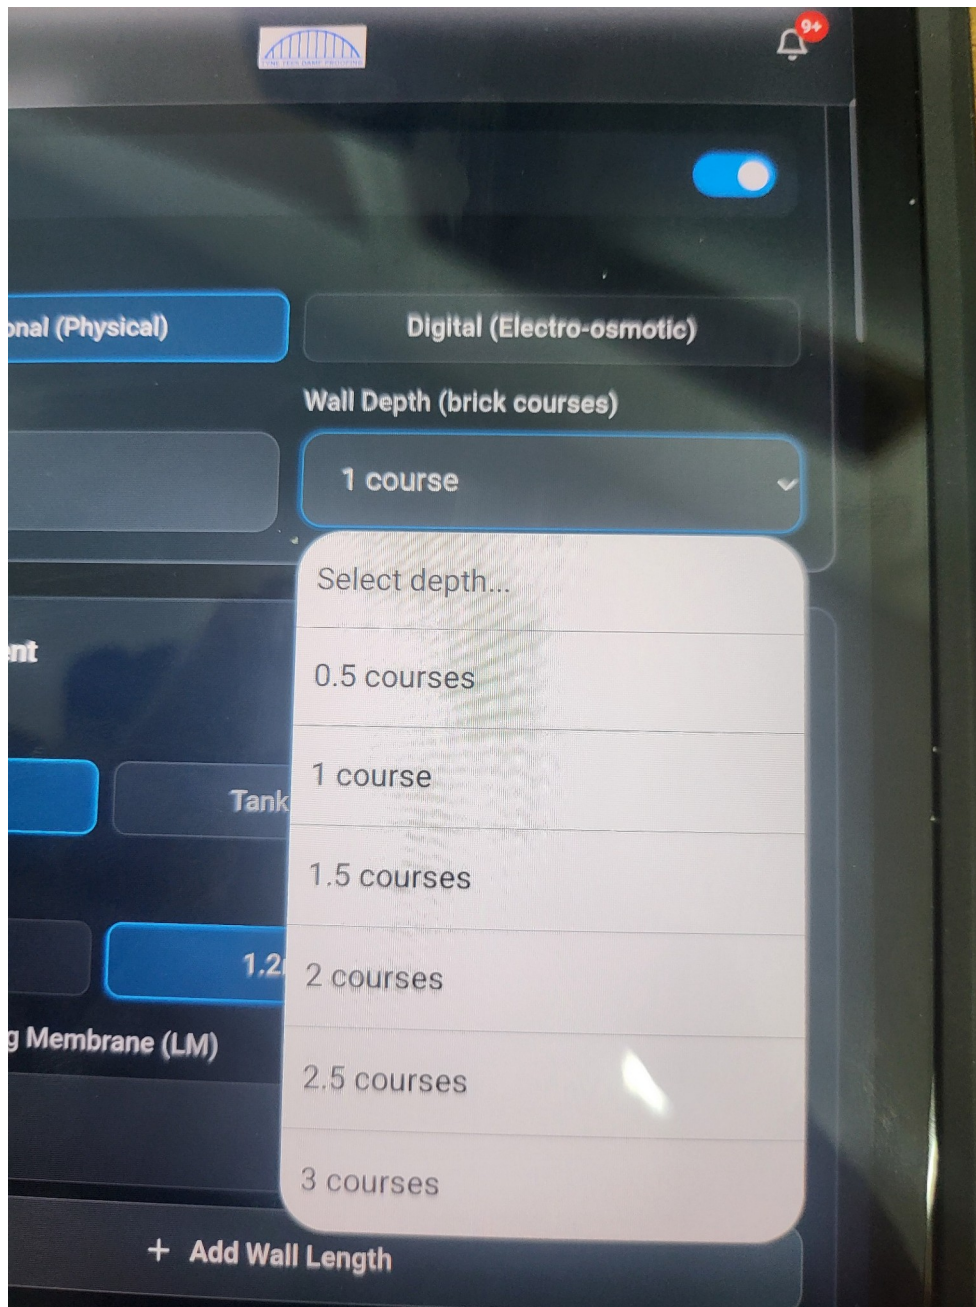


Photo 6A - current brick-course selector

POINT 7 Mileage must be entered by admin; men travelling must be selected by the survey team

Office-to-surveyor workflow | **HIGH**

Finding: The new costing screen requires the surveyor to enter distance from the office and men travelling at the end of the survey. The office has already checked the property location when booking the appointment. The surveyor may be in a basement, rural property or poor-signal area and should not need Google Maps. By contrast, only the attending surveyor can decide whether the proposed job requires one, two or more men.

Operational impact: The current layout duplicates office work, delays the survey and risks guessed mileage. Automatically deciding crew size would also be wrong because admin has not inspected the job.

Required change

- Admin enters or corrects the mileage once during booking.

- The confirmed mileage is stored with the job and is available offline on the surveyor's device.
- Steven, Mike or Graeme selects 1, 2, 3 or other men after assessing the work.
- Do not treat example towns or survey charges as new pricing bands.

Technical instruction for Dom and the AI development agents

- Keep mileage and men travelling as separate permission-controlled fields.
- Mileage comes from the booking record; crew size comes from the survey costing screen.
- Feed both values into the existing travel and operating-cost formulas.
- Do not require Steven personally to correct admin mileage.

Acceptance test

- Admin enters mileage before the appointment.
- The surveyor opens the job offline and the value is already present.
- The surveyor selects the crew size.
- The travel cost matches the workbook calculation.

Evidence: Photo 7A - required Distance from Office and Men Travelling fields

The screenshot shows a mobile application interface for a surveyor. The screen is titled 'Waste & Logistics * Required'. Below the title, there are three input fields: 'Count', 'Distance from Office (miles) *', and 'Men Travelling *'. The 'Distance from Office' field is highlighted with a red border. Below the fields, there is a note: 'Distance and men travelling are required for accurate costing calculations'. At the bottom of the screen, there is a navigation bar with a 'Back' button, 'Step 4 of 5' indicator, and a 'Next' button with a right arrow. Below the navigation bar, there is a dock with several icons: a grid of dots, a red speech bubble, a yellow envelope, a green phone, a blue speech bubble, a blue magnifying glass, a blue camera, a blue document with a pencil, and a blue envelope.

Photo 7A - current required fields at Step 4 of 5

POINT 11 Core-hole drilling is not reliably connected to fan installation type

Condensation costing / repeatable fault | **CRITICAL**

Finding: There are two different scenarios: replacing/upgrading a fan through a suitable existing opening, and installing a completely new fan that requires a core-drilled opening. During testing, the workflow did not clearly and reliably distinguish these options. The fault occurred twice.

Operational impact: A new fan can be underpriced if the core hole is omitted, while a replacement fan can be overcharged if a new core hole is added automatically.

Required change

- For each fan, provide a simple installation-type choice: replacement using existing suitable opening; new fan using an existing suitable opening; or new installation requiring a core hole.
- Allow mixed scenarios on the same job.
- Add ducting/sleeve, grille, electrical pack and making-good requirements only where applicable.


Technical instruction for Dom and the AI development agents

- The existing PIV workbook already includes separate "Diamond core 107mm hole" rows under wall-mounted PIV, trickle-and-boost fan, passive vent and Cvent sections.
- Reuse those approved labour rules and allow the quantity to be zero or more.
- Do not bundle core drilling into every fan by default.


Acceptance test

12. A replacement fan prices with zero core holes.
13. A new fan with no suitable opening adds one core hole and the correct associated components.
14. Two different fans can use different installation types in the same survey.
15. The report wording matches what is actually being done.

Evidence: Videos 11A and 11B - repeatable core-hole issue

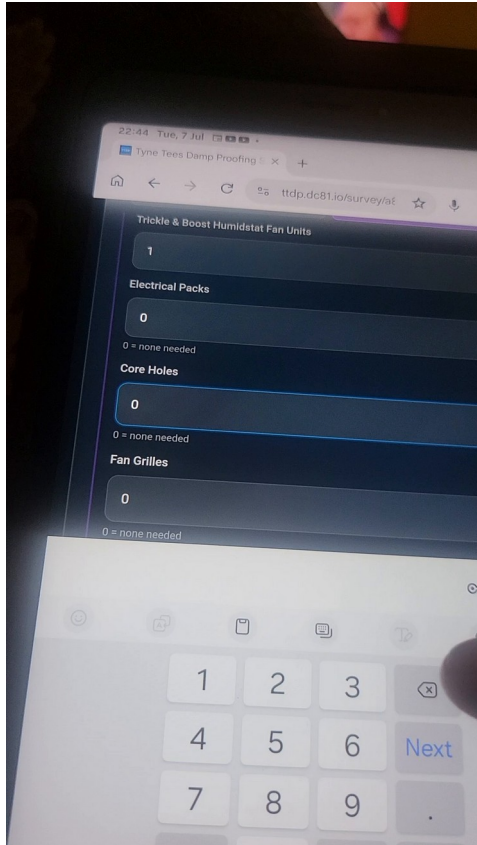

Video still 11A - core-hole quantity entry

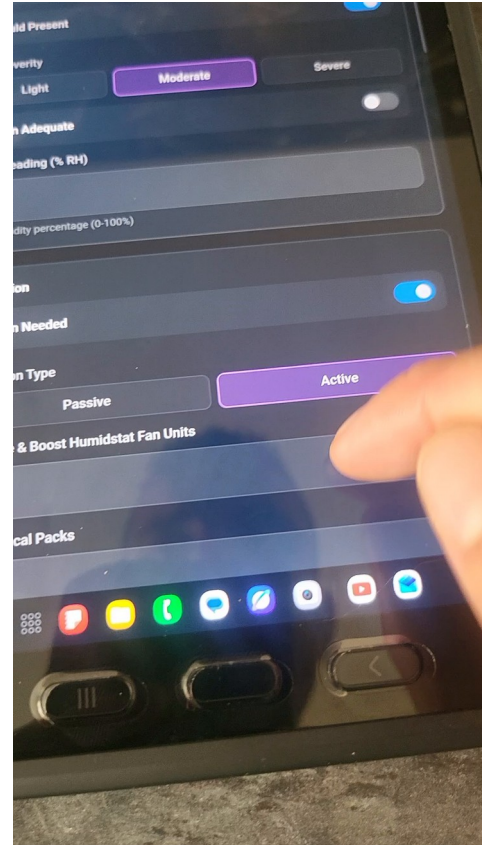

Video still 11B - second occurrence in the fan workflow

POINT 13 The fixed Job Cost Summary obstructs the detailed costing screen

Tablet and phone usability | **HIGH**

Finding: The fixed Job Cost Summary occupies a large proportion of the tablet screen and leaves only a small area for detailed line items. On a phone the usable area would be smaller again.

Operational impact: This is the point where a surveyor may be checking itemised costs with a customer ready to proceed. Restricted visibility makes errors more likely and reduces confidence in the price.

Required change


- Default the summary to a narrow collapsed bar on phones and tablets.
- Show only the current total when collapsed.
- Allow the full summary to expand and collapse immediately.
- On desktop, use a side panel only where it does not cover the costing table.

Technical instruction for Dom and the AI development agents

- Ensure no input, quantity, line price or button is hidden behind a fixed footer.
- Do not require browser zoom changes or device rotation.
- Keep the total visible without sacrificing the detailed cost view.

Acceptance test

16. All costing lines can be read and edited on Steven's tablet.
17. The summary opens and closes easily.
18. The same page is practical on a mobile phone.
19. No controls are obscured at the bottom of the page.

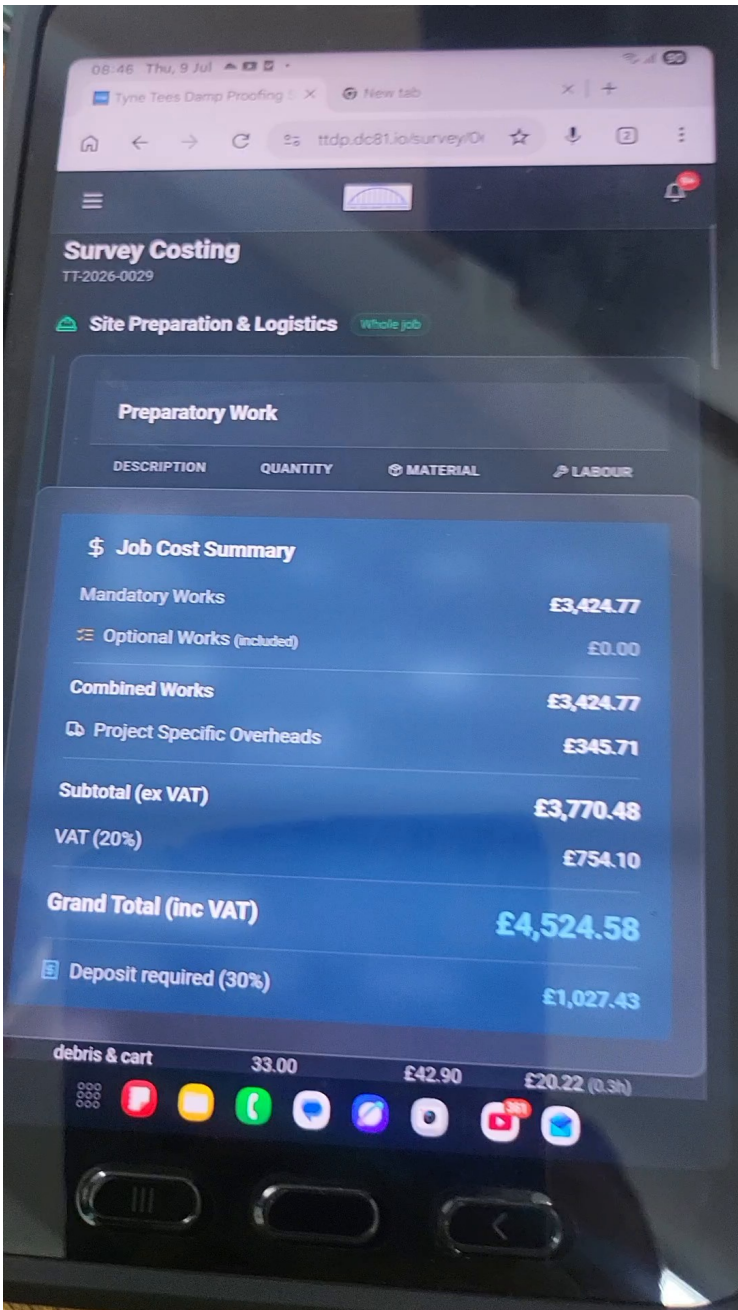

Video still 13A - fixed summary covering much of the tablet screen

POINT 14 The same customer-specific job produced a £638.41 ex-VAT variance

Costing parity / release control | **CRITICAL**

Finding: The completed Excel workbook for Brad Brown, 16 Benson Street, calculates £4,659.51 excluding VAT. The new system displayed £5,297.92 excluding VAT for the same job after the scope was reviewed and re-entered. Earlier tests had matched, suggesting later changes may have affected formula flow or field mapping.

Operational impact: A material variance on a live quotation can lead to lost work, underpricing, overpricing and uncertainty over which output is correct. It also indicates that one change may be affecting calculations elsewhere.

Required change

- Use the completed customer workbook as the golden-master test case.
- Compare every section, input, material line, labour hour, subcontractor figure, travel value and adjustment.
- Freeze further native costing changes until the exact causes are isolated.
- Add automated regression tests so a future UI change cannot alter an approved calculation silently.

Technical instruction for Dom and the AI development agents

- Known variance drivers include: DPC +£416.68; floor resin +£258.78; overheads +£213.84; preparatory work -£59.37; strip-out -£159.75; plastering -£42.47; wall membrane approximately +£10.67.
- The visible screen also shows a 3p reconciliation difference between mandatory works plus overheads and the displayed subtotal.
- The benchmark workbook calculates projected subcontractor cost of £1,405.01 and 50.179 projected hours; these outputs must also be compared.

Acceptance test

20. Identical inputs produce identical results to the penny.
21. Displayed line items add exactly to the displayed subtotal.
22. Subcontractor pay, material quantities, labour hours, travel and customer totals all pass the comparison.
23. The test is rerun automatically after future calculation changes.

Evidence: Photo 14A - new-system total; Completed Damp Costing v47 customer workbook

PROPOSED WORKS	
DAMP PROOFING WORKS	
Preparatory Work	£172.62
Strip Out	£325.29
Dpc Traditional	£907.20
Wall Membrane	£1,451.98
Floor Resin	£538.98
Plastering	£1,228.39
Mandatory Works Subtotal	£4,624.46
Project Specific Overheads	£673.43
SUMMARY	
Mandatory Works	£4,624.46
Project Specific Overheads	£673.43
Subtotal (exc. VAT)	£5,297.92
VAT (20%)	£1,059.58
Total (inc. VAT)	£6,357.50
Deposit required (30%)	£1,451.50
Balance due on completion	£4,906.00

Photo 14A - £5,297.92 ex-VAT shown in the new system

Point 14 benchmark comparison

Section	Excel benchmark	New platform	Variance
Preparatory work	£231.99	£172.62	£-59.37
Strip-out	£485.04	£325.29	£-159.75
DPC traditional	£490.52	£907.20	+£416.68
Wall membrane excluding DPC	£1,441.31	£1,451.98	+£10.67
Floor resin	£280.20	£538.98	+£258.78

Section	Excel benchmark	New platform	Variance
Plastering	£1,270.86	£1,228.39	£-42.47
Project-specific overheads	£459.59	£673.43	+£213.84

POINT 14A Floor-resin area automatically applies primer, top coat and grip grit

Costing selection logic | **CRITICAL**

Finding: For the benchmark job, the approved Excel sheet uses 40 m² of top coat only: primer 0, top coat 40, grip grit 0. The new platform takes one 40 m² entry and automatically applies the same quantity to primer, top coat and grip grit, including labour for each component.

Operational impact: The platform produced approximately £538.98, compared with the workbook's £280.20. Surveyors tried altering and halving entries, but the result remained unclear and unpredictable.

Required change

- Enter the floor area once.
- Allow the surveyor to select which components are required: primer, top coat, grip grit and fillet joint.
- Calculate only the selected components.
- Preserve a section price-adjustment percentage for authorised surveyors where the approved base rate needs increasing.

Technical instruction for Dom and the AI development agents

- Benchmark: top coat 40 m², primer 0, grip grit 0; materials £182.18; labour £98.02; total £280.20.
- Do not make the surveyor manipulate the measured area to stop duplicate charging.
- Record the original calculation, adjustment percentage, revised price and user who applied it.

Acceptance test

24. Top coat only returns £280.20 for the benchmark inputs.
25. Primer and top coat calculates both only when both are selected.
26. Grip grit is optional and independently selectable.
27. The adjustment field alters the section price without changing the real measurement.

Evidence: Photos 14B-14C - 40 m² input and automatic component breakdown

Photo 14B - one 40 m² floor-area entry

DESCRIPTION	QUANTITY	MATERIAL	LABOUR
EP40 2 Pack resin Primer	40.00	£147.42	£98.02 (1.6h)
EP40 2 Pack resin top coat	40.00	£165.62	£98.02 (1.6h)
Grip grit	40.00	£5.41	£24.50 (0.4h)
Section Subtotal		£318.45	£220.54

\$ Job Cost Summary	
Mandatory Works	£4,838.32
Optional Works (included)	£0.00
Combined Works	£4,838.32
Project Specific Overheads	£459.59
Subtotal (ex VAT)	£5,297.91
VAT (20%)	£1,059.58
Grand Total (inc VAT)	£6,357.50
Deposit required (30%)	£1,451.50

Photo 14C - 40 m² automatically applied to primer, top coat and grip grit

POINT 15 Subcontractor costs, projected hours, materials and time on site need a clear internal output

Operational costing / permissions | **HIGH**

Finding: The existing workbooks do more than generate a customer total. They calculate projected subcontractor pay, projected hours, material quantities, travel and expected time on site. It is not yet clear where these outputs are visible, reviewed or issued in the new platform.

Operational impact: These figures support Monday-morning job allocation, subcontractor instructions, payment checks, materials preparation and programme planning. A customer total alone is not a complete costing system.

Required change

- Provide a permission-controlled internal costing view for owner/admin users.
- Show subcontractor amount, projected hours/days, material list, travel and crew size by work section.
- Generate an operative/subcontractor work instruction containing customer/site details, sketch, measurements, scope, rate of pay and travel allowance without exposing company margin.
- Allow office staff to review and assign work.

Technical instruction for Dom and the AI development agents

- Use the existing “Sub Contractor Costs”, “Material-List” and time-on-site outputs as the reference.
- For the Brad Brown benchmark, projected subcontractor cost is £1,405.01 and projected time is 50.179 hours before travel.
- Role permissions must keep internal costs away from customers and operatives who do not need them.

Acceptance test

- 28. The platform reproduces the benchmark subcontractor cost and hours.
- 29. An authorised user can see and edit assignment/comments.
- 30. An operative receives practical scope and measurements but not customer price or margin.
- 31. Material quantities can be produced before the job starts.

Evidence: Damp, PIV, Timber and Woodworm workbook structures; Sub Contractor Costs and Material-List tabs

POINT 16 Initial-payment percentage and wording must reconcile with the quotation

Customer pricing / payment terms | **CRITICAL**

Finding: Screenshots show “Deposit required (30%)” or “Deposit required (50%)”, but the displayed amount does not consistently equal the stated percentage of the visible subtotal or total. The wording also conflicts with Tyne Tees Damp Proofing’s approved staged-payment terminology.

Operational impact: A payment request that does not reconcile can create customer complaints, office confusion and contractual ambiguity.

Required change

- Remove the word “deposit”. Use “Initial payment required on acceptance”.
- Apply the approved three-stage structure: 30% on acceptance; 50% of the remaining balance after completion of the works; and the final 50% of the remaining balance one month later.
- Show the full staged-payment schedule on the quotation so the customer can see the amount and due point for each stage.
- Accepted optional works must be included in the approved quotation total before the stages are calculated; unaccepted options must remain excluded.

Technical instruction for Dom and the AI development agents

- Store the payment structure once in central company settings; do not hard-code different percentages into templates.
- Use the same approved quotation total and VAT treatment for every displayed stage.
- The visible arithmetic must reconcile exactly to the final approved quotation total.
- Use identical wording and figures in the online quotation, PDF, email and CRM record.

Acceptance test

- 32. Stage 1 equals 30% of the approved quotation total and is labelled “Initial payment required on acceptance”.
- 33. Stages 2 and 3 each equal 50% of the remaining balance after Stage 1.
- 34. All three stages add back exactly to the approved quotation total.
- 35. Report, online quotation and PDF show the same figures and wording.
- 36. Admin can maintain the approved payment configuration centrally without editing templates.

Evidence: Photos 1 and 14 - inconsistent deposit/initial-payment figures shown against quotation totals

4. Customer Documents, Delivery and Company Details

POINT 1 Customer quotation does not show the same itemised prices as the surveyor view

Customer quotation | **HIGH**

Finding: The internal/surveyor view shows individual prices for preparatory work, strip-out, wall membrane, plastering and the humidistat fan. The emailed/customer view keeps the descriptions but removes most individual prices and shows one combined subtotal.

Operational impact: A single large figure can look expensive and gives the customer less transparency. Itemisation helps the customer understand the separate stages and value of the work.

Required change

- Display each customer-facing work item and its individual price.
- Keep optional works clearly separate.
- Show subtotal, VAT and total.
- Do not expose internal margin, raw overhead or subcontractor-pay calculations.

Technical instruction for Dom and the AI development agents

- Use the same customer itemisation in the web page, email/PDF and print output.
- Allocate internal overhead across the approved selling prices or keep it in an appropriately worded customer line, according to the final commercial decision.
- Ensure all visible lines reconcile exactly.

Acceptance test

37. The customer sees each selected work item and price.
38. The PDF and print version match the online quotation.
39. Internal-only commercial information remains hidden.

Evidence: Photos 1A-1E - internal itemisation compared with customer view

20:56 Fri, 10 Jul

TYNE TEES DAMP PROOFING LTD
QT-2026-0038

Download PDF Print

Strip Out	
Wall Membrane	
Floor Resin	
Plastering	
CONDENSATION WORKS	
Humidistat Fan	
Works subtotal	£1,497.45
OPTIONAL WORKS	
Mould Treatment	£95.79
Optional Works Subtotal	£95.79

The full scope of works for each item is set out in your survey report.

SUMMARY	
Works subtotal	£1,497.45
Optional Works	£95.79
Subtotal (exc. VAT)	£1,593.23
VAT (20%)	£318.65

Photo 1A - customer quotation lists headings but not individual prices

20:57 Fri, 10 Jul

Tyne Tees Damp Proofing

ttdp.dc81.io/survey/a£

Preparatory Work	£39.88
Strip Out	£165.40
Wall Membrane	£449.59
Plastering	£674.95
CONDENSATION WORKS	
Humidistat Fan	£183.15
Mandatory Works Subtotal	£1,512.97
Project Specific Overheads	£249.67

SUMMARY	
Mandatory Works	£1,512.97
Project Specific Overheads	£249.67
Subtotal (exc. VAT)	£1,762.64
VAT (20%)	£352.53
Total (inc. VAT)	£2,115.17
Deposit required (50%)	£825.39
Balance due on completion	£1,289.78

Photo 1B - customer summary with combined subtotal

20:57 Fri, 10 Jul

world cup 2026 - Google Search

Quotation for Steven Robins...

ttdp.dc81.io

TYNE TEES DAMP PROOFING LTD
QT-2026-0044

Download PDF Print

DAMP PROOFING WORKS	
Preparatory Work	
Strip Out	
Wall Membrane	
Plastering	
CONDENSATION WORKS	
Humidistat Fan	
Works subtotal	£1,762.64

The full scope of works for each item is set out in your survey report.

SUMMARY	
Works subtotal	£1,762.64
VAT (20%)	£352.53
Total (inc. VAT)	£2,115.17
Deposit required (50%)	£825.39

Photo 1C - customer-facing quotation total

20:55 Fri, 10 Jul

Tyne Tees Damp Proofing

ttdp.dc81.io/survey/a£

PROPOSED WORKS	
DAMP PROOFING WORKS	
Preparatory Work	£39.88
Strip Out	£165.40
Wall Membrane	£449.59
Plastering	£674.95
CONDENSATION WORKS	
Humidistat Fan	£183.15
Mandatory Works Subtotal	£1,512.97
Project Specific Overheads	£249.67

SUMMARY	
Mandatory Works	£1,512.97
Project Specific Overheads	£249.67
Subtotal (exc. VAT)	£1,762.64
VAT (20%)	£352.53
Total (inc. VAT)	£2,115.17

Photo 1D - surveyor/internal estimate with individual prices

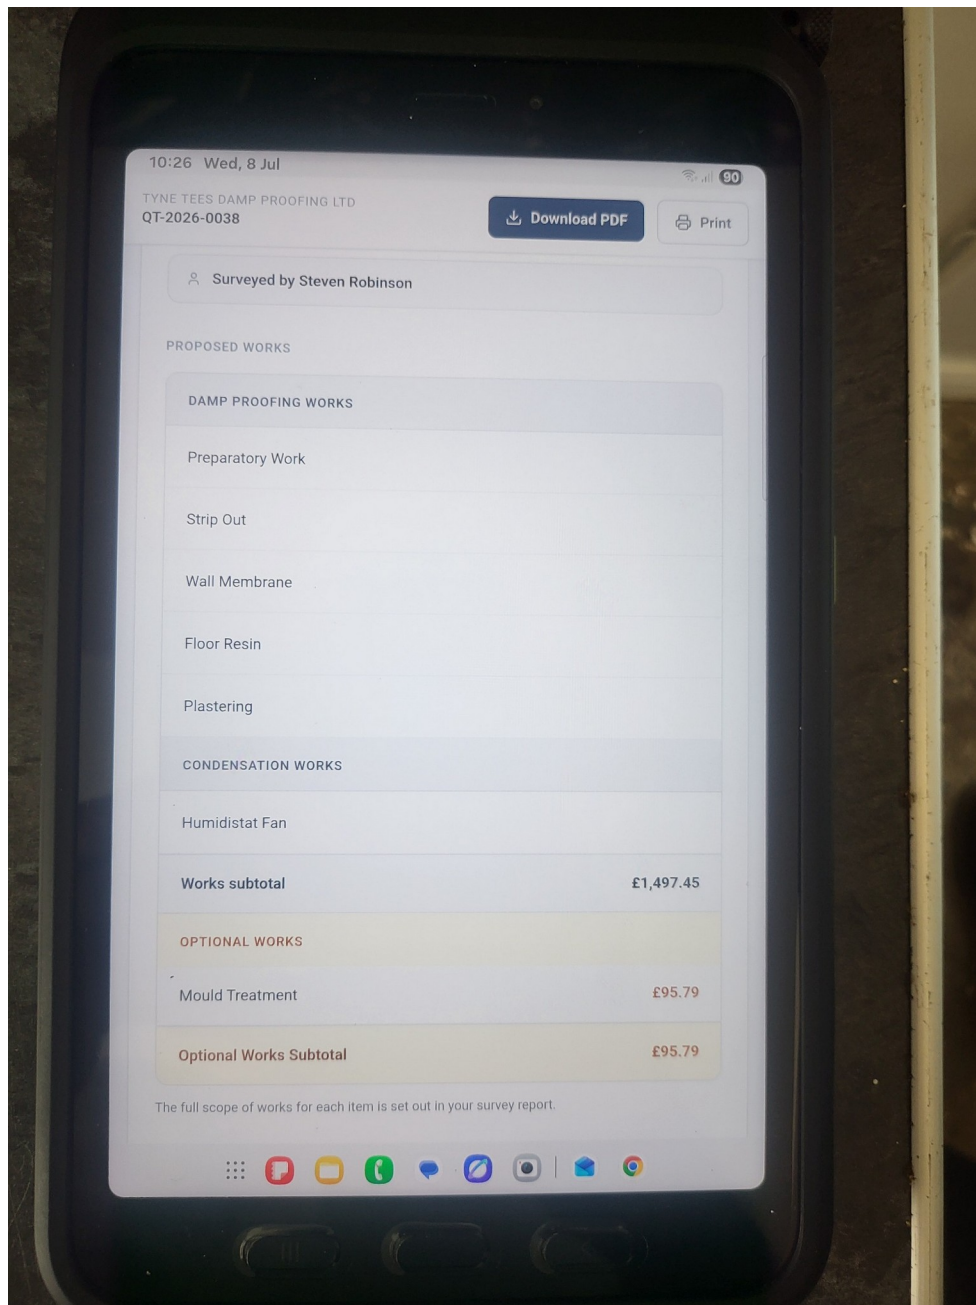


Photo 1E - tablet view showing customer lines without prices

POINT 2 Report/quotation link does not reliably open on a Windows laptop using Microsoft Edge

Browser compatibility | **HIGH**

Finding: The emailed link opens on Steven's newer tablet but does not open or display reliably on the Windows laptop in Microsoft Edge. Customers may use older computers or browsers.

Operational impact: A customer may receive the email but be unable to access the document, creating support calls and the impression that the report is broken.

Required change

- Make the customer page compatible with current and reasonably recent Edge, Chrome, Safari and Firefox versions.
- Use responsive standard web code and avoid browser-specific dependencies.

- Always attach or provide a combined PDF fallback.
- Display a clear fallback message rather than an unformatted page.

Technical instruction for Dom and the AI development agents

- Test the exact emailed customer link while logged out.
- Check CSS, JavaScript, font, mixed-content, cache and security-header behaviour.
- Log a useful browser/device error for support.

Acceptance test

40. The same link works in Edge and Chrome on the laptop and on the tablet.
41. The full document remains available as a PDF if the web page cannot load.
42. Download and print work consistently.

Evidence: Photo 2A - laptop/Edge test

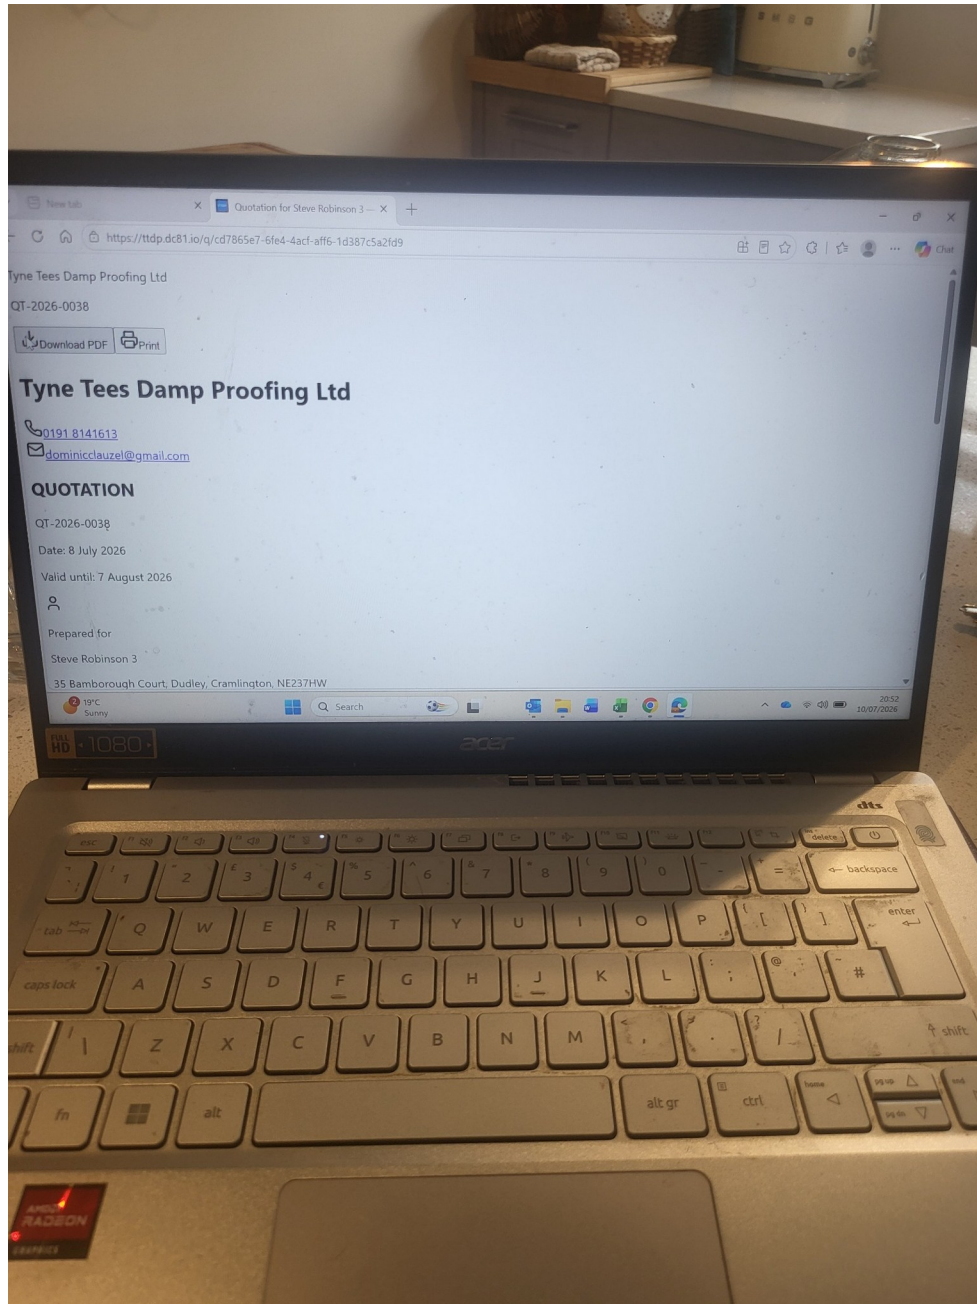


Photo 2A - customer quotation link tested on Windows laptop

POINT 3 Survey report and quotation should be sent together in one email

Customer communication / automation | **HIGH**

Finding: The report and quotation are currently sent separately. The customer can receive one and miss the other, or read the price without the technical explanation.

Operational impact: Separate automated emails create confusion, duplicate replies and additional office follow-up.

Required change

- Send one customer email only after both the approved report and quotation are ready.
- Preferred output: one combined PDF; acceptable alternative: two clearly named attachments in the same email.
- Include one online-view link and a PDF fallback.
- Record the combined send event in the CRM.

Technical instruction for Dom and the AI development agents

- Match documents by job ID, customer and site address.
- Hold the email if either document is missing.
- Prevent a second automation from sending the quotation again.

Acceptance test

43. One email contains both report and quotation.
44. No duplicate separate quotation email is sent.
45. The CRM records one complete customer-document package.

POINT 8 Developer email address appears on customer quotations

Customer-facing branding | **HIGH**

Finding: Customer quotations display dominicclauzel@gmail.com beneath the Tyne Tees Damp Proofing name and telephone number.

Operational impact: A developer/test address on a live quotation is unprofessional and may direct customer replies away from the office.

Required change

- Remove the developer email from every live and test customer template.
- Use the approved office email: info@tyneteesdampproofing.co.uk.
- Store company contact details once in central settings.

Technical instruction for Dom and the AI development agents

- Do not derive the company email from the logged-in developer or surveyor account.
- Check reports, quotations, PDFs, print output, guarantees, portal pages, automated signatures and Reply-To settings.

Acceptance test

46. No customer document contains the developer address.
47. Replies go to the approved office inbox.
48. Changing the central company email updates every output.

Evidence: Photo 8A - developer email in quotation header

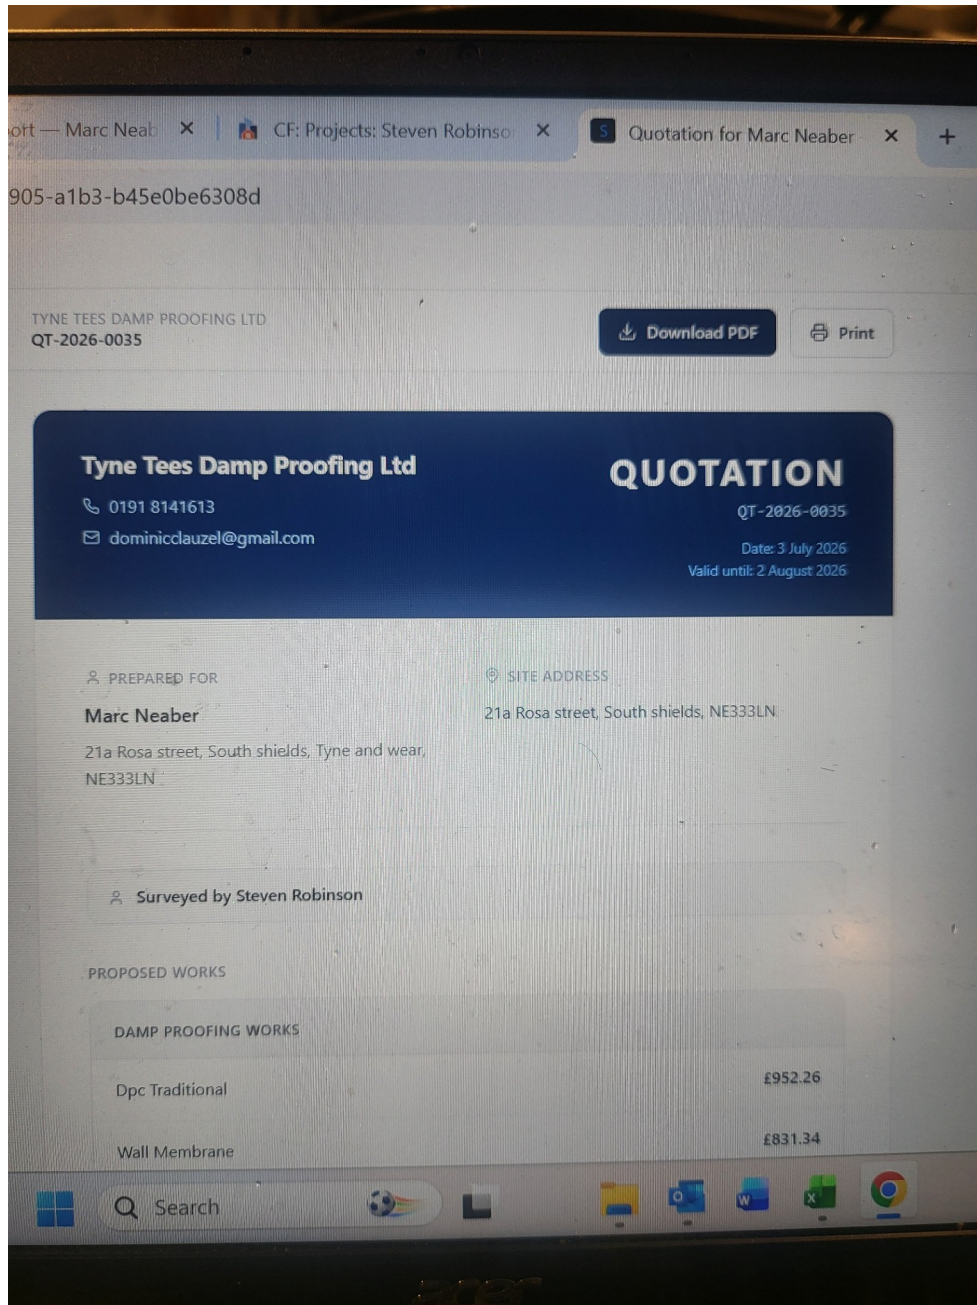


Photo 8A - developer email shown as the company contact

POINT 9 Office and regional location details are incomplete and should be centralised

Company details / document footer | **MEDIUM**

Finding: The report footer shows the registered office and a list of regional town names, but it does not contain the complete approved office/location details used in the earlier report design.

Operational impact: Incomplete or hard-coded location details make documents inconsistent and increase the risk of old or incorrect addresses being published.

Required change

- Create one central Company Locations record.
- Separate registered office, physical regional offices and service areas.
- Use the approved full-address list below.

- Only label a town as a physical office when an approved postal address is stored.

Technical instruction for Dom and the AI development agents

- Registered office: The Town Hall Conference & Business Centre, High Street East, Wallsend, Tyne & Wear, NE28 7AT.
- South Shields: South Shields Business Works, Henry Robson Way, South Shields, NE33 1RF.
- Blyth: Blyth Community Enterprise Centre, Ridley Street, Quayside, Blyth, NE24 3AG.
- Corbridge: Tinklers Yard, Corbridge Business Centre, Corbridge, NE45 5SB.
- Sunderland: Liberty Way, North Sands Business Centre, Sunderland, SR6 0QA.
- Regional numbers: Tyneside 0191 814 1613; Wearside 0191 500 1097; Northumberland 01434 303 725; Durham 0191 300 3625.

Acceptance test

49. The approved registered office and regional office details appear consistently on reports, quotations, PDFs and guarantees.
50. Service areas such as Whitley Bay, North Shields or Durham are not presented as postal offices unless approved addresses are added.
51. Admin can update a location once in central settings.

Evidence: Photo 9A - incomplete regional-presence footer

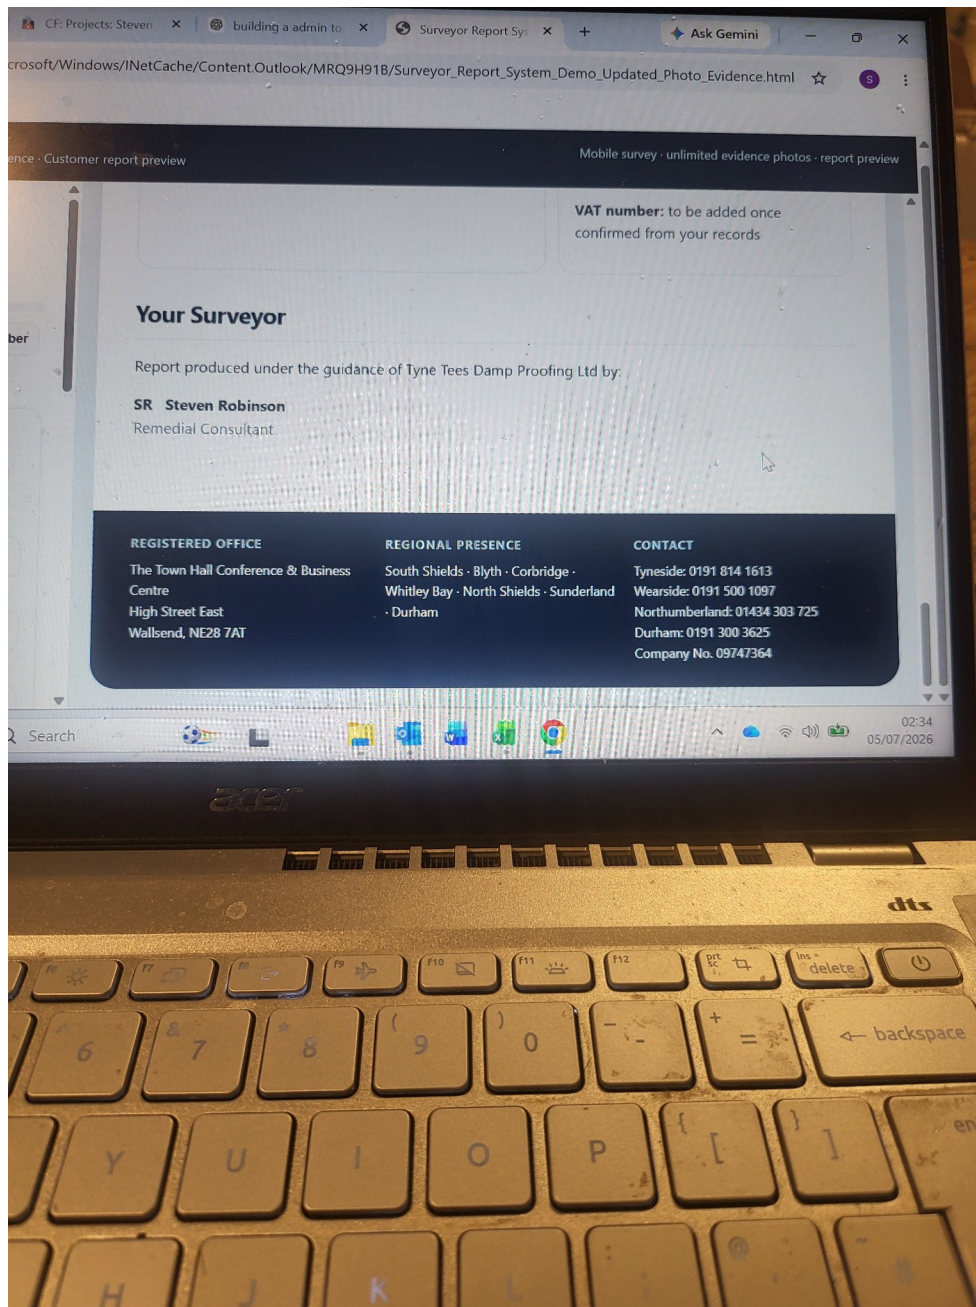


Photo 9A - current report footer with incomplete location detail

5. Survey Capture and Technical Record Improvements

POINT 5

Existing airbricks must be recorded by elevation, including offshoots

Technical survey record | **HIGH**

Finding: The new system prices new, raised or upgraded airbricks, but the survey record must also show how many existing airbricks were visible at each elevation. A diagram showing proposed additions is not a complete written record of the original ventilation arrangement.

Operational impact: Existing numbers and condition are important for pre-purchase advice, operative instructions, future guarantee queries and evidence of what changed.

Required change

- Record front, rear, left-side, right-side and offshoot elevations.
- Allow “Add another elevation” for multiple offshoots, returns, extensions and courtyards.
- For each elevation record existing number, condition, proposed action, new additions and expected final total.
- Allow photograph and sketch references.

Technical instruction for Dom and the AI development agents

- Keep the quick preset workflow but create a written existing-condition record separate from the proposed-work cost.
- Useful condition choices include clear, blocked, low, damaged, undersized, not visible and access restricted.
- Auto-generate concise report wording from the selected entries.

Acceptance test

52. A survey can record, for example, 2 front, 5 left and 2 rear airbricks.
53. The proposal separately records additional/raised/upgraded airbricks.
54. The report and operative instructions retain both the before and proposed-after position.

Evidence: Existing report page showing airbrick counts by elevation

External Ground Levels

There were no apparent ground level issues.

Recommendation

All ground levels to be maintained at a minimum of 150mm below DPC level, paths, drives, yards etc should not cause rainwater etc to run against your property walls. You should arrange work to correct the above issues to be carried out as soon as possible, under separate contract and costs.

Damp Proof Course

There is evidence of an original damp proof course in the mortar bed of the property.

There is evidence of a chemical injection damp proof course to the property.

It is possible that work may have been carried out by another company in the past.



Injection

Recommendation

You should check if any guarantee exists and if the work now required is covered by that guarantee as any work carried out by ourselves may invalidate existing guarantees.

Proposal

Install a low pressure injection damp proof course system, into the mortar courses of the walls as indicated on the attached sketch plan.

Sub Floor Ventilation

The sub floor voids were ventilated by the following 'visible' number of airbricks:

- 2 To the front elevations
- 5 To the left elevations
- 2 To the rear elevations

Sub floor timbers

It was not possible to inspect the sub floor moisture content due to the following:

- Laminate, vinyl, Lino or cushion-floor overlay
- Furniture obstructing access

3 of 6

Existing report example - airbricks recorded by elevation

POINT 10 The survey opening page needs job ID, client/site addresses and admin notes at the top

Office-to-surveyor handover | **HIGH**

Finding: The key booking information is spread across the page. The surveyor needs to see the unique job ID, customer, site address and office notes immediately. Landlords, agents and property companies may have a correspondence address different from the property being inspected.

Operational impact: Searching through tabs wastes site time and increases the risk of using the wrong address or missing access/inspection instructions.

Required change

- Show job/reference ID, customer/client name, site address, separate correspondence address where different, survey date/time, attending surveyor and admin survey notes at the top.

- Add “customer address same as site address” to avoid duplicate entry.
- Keep admin notes internal unless the surveyor deliberately includes relevant information in the final report.


Technical instruction for Dom and the AI development agents

- Admin completes the fields when booking.
- The job ID links the report, quotation, photos, costing and later work record.
- The site address flows to the report/quotation/operative job; the correspondence address is used for the instructing customer.


Acceptance test

55. Admin enters two different addresses for a landlord/agent case.
56. Steven, Mike or Graeme opens the job and immediately sees the correct site and notes.
57. Internal notes do not automatically appear in the customer report.


Evidence: Videos 10A-10C - office-admin improvement request

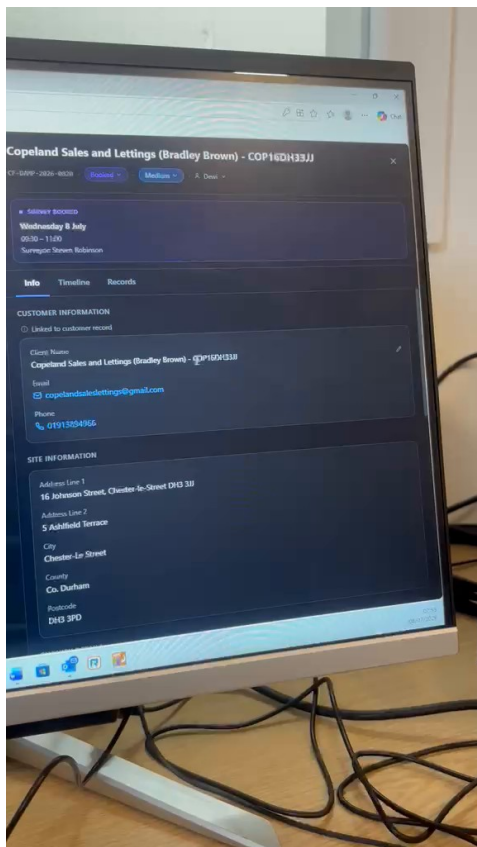

Video still 10A - client/contact detail area

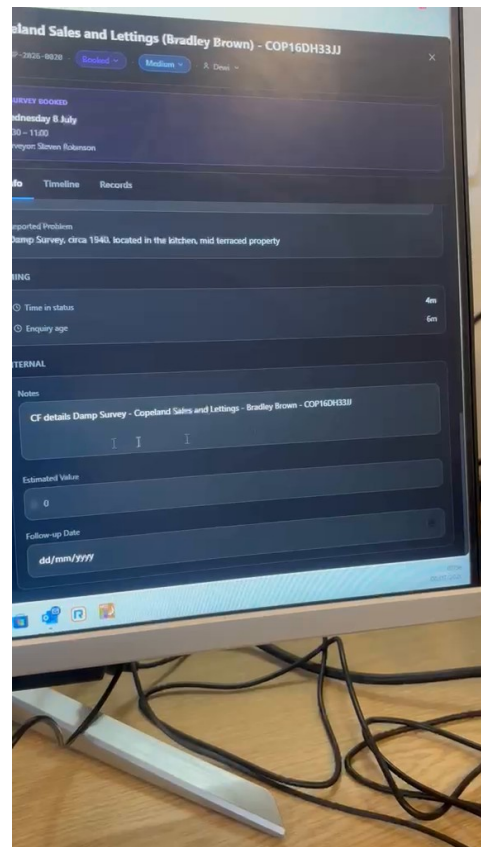

Video still 10B - survey-page information layout

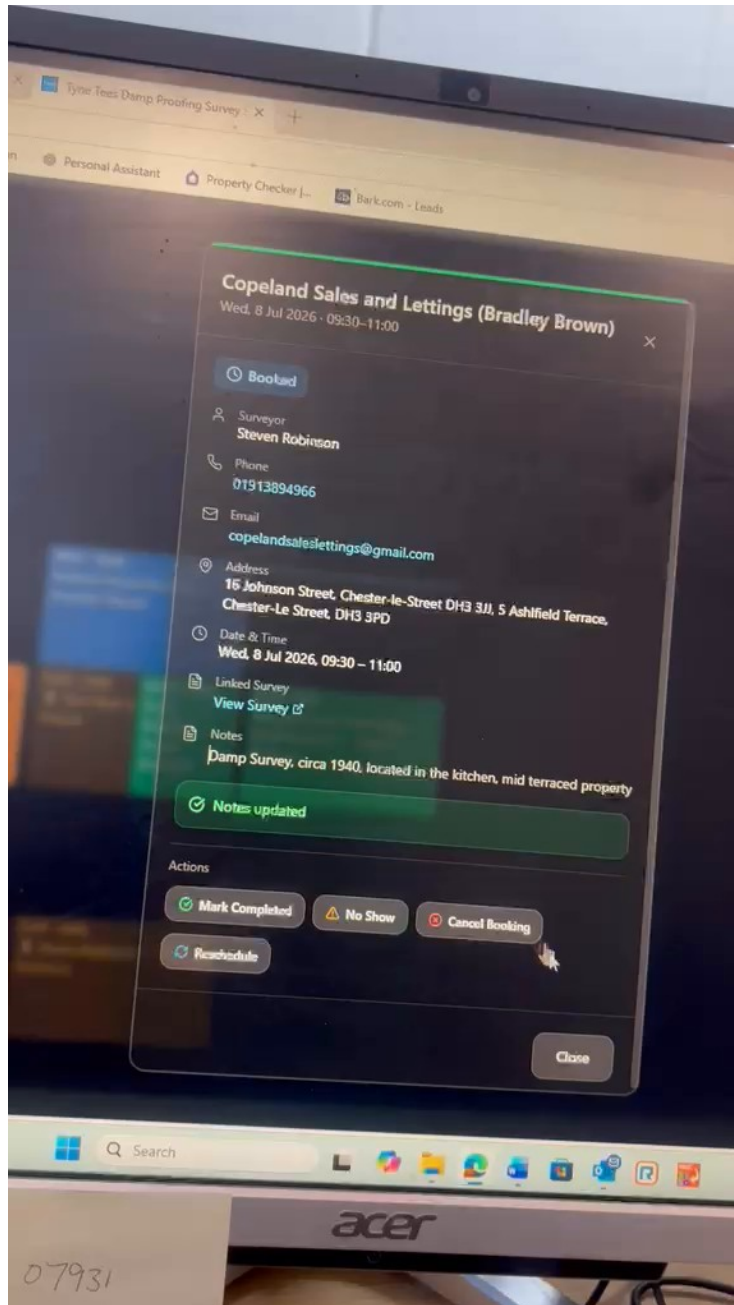

Video still 10C - admin survey notes

POINT 12 External defects need an unlimited Other/Custom Defect option with photographs

External inspection / photo evidence | **HIGH**

Finding: The surveyor can dictate a defect that is not in the preset list, but cannot attach a photograph unless one of the listed defect types is selected.

Operational impact: Important evidence can be described but left without the associated photograph, or the surveyor may choose an inaccurate preset merely to upload the image.

Required change

- Retain quick preset defects.
- Add "Other / Add Custom Defect".
- Allow custom title, dictated description, elevation/location, urgency, action and one or more photos.

- Allow multiple custom defects in one survey.

Technical instruction for Dom and the AI development agents

- Store each custom defect as its own record linked to its photographs.
- Do not force the surveyor to select an unrelated preset.
- Include the custom observation and photos in the correct report section.


Acceptance test

58. A non-listed defect is added, dictated and photographed.

59. More than one custom defect can be added.

60. Each photo remains linked to the correct defect in the final report.

Evidence: Video 12A - external defect not on the preset list

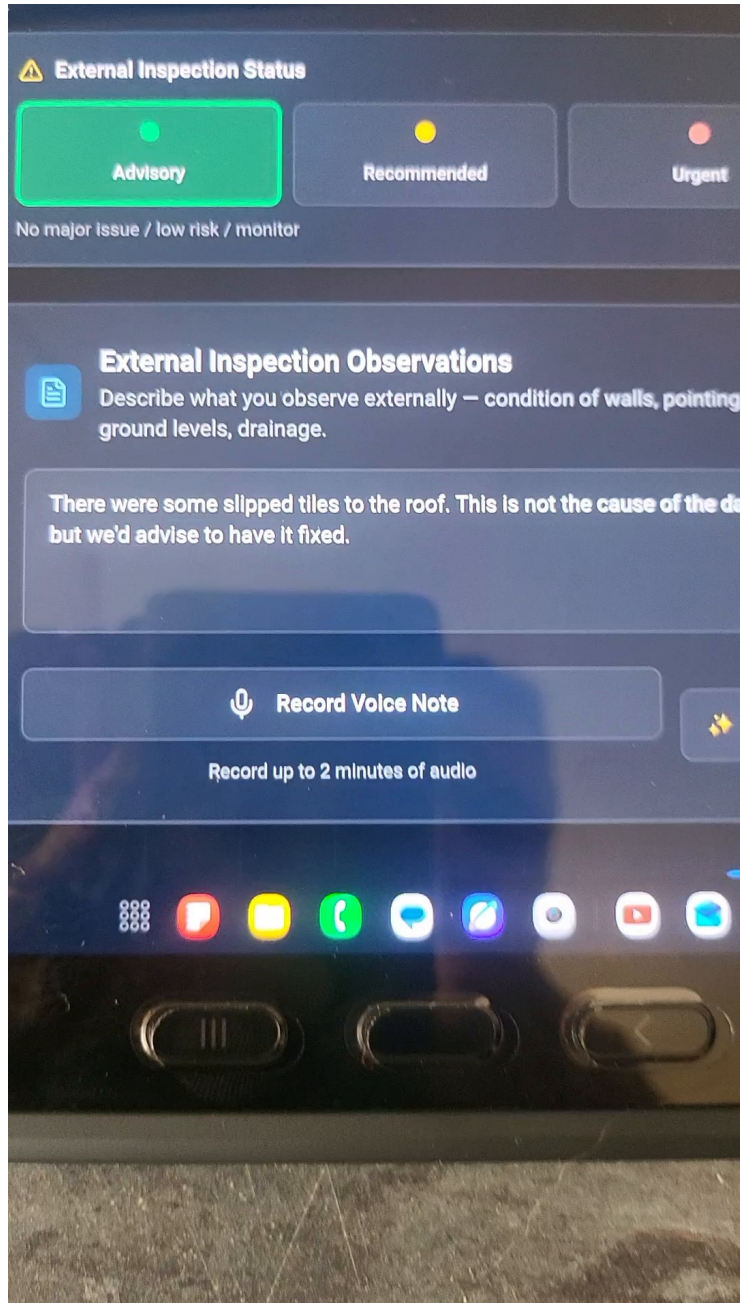

Video still 12A - general observation exists but no custom photo-linked defect

6. What the Existing Workbooks Actually Do

The workbook suite is not simply a price list. It is an established operational calculation system developed through approximately forty or more stages of revision. It combines customer pricing with the information needed to plan, resource, purchase and pay for the work.

Workbook family reviewed

Workbook	Operational role
Customer Details for Linked Documents	Office enters customer/site details and mileage once; linked reports and costing files use the same record.
Damp Costing v47	DPC, membrane, tanking, floor resin, plastering, Warmline, floor joists/decking, airbricks, spray treatment, drains, external treatments, asbestos, travel, customer summary, material list and subcontractor costs.
Condensation PIV Costing v37	Loft and wall-mounted PIV, electrical packs, ducting, fans, passive vents, core holes, mould treatment, loft-access work, airbricks, travel, customer summary and subcontractor costs.
Timber Costing v33	Suitable for larger timber/dry-rot jobs and many rooms; includes detailed timber, flooring, treatment, damp-related sections, subcontractor costs and outputs.
Woodworm Costing v25	Treatment, strip-out, floor/decking, plastering and airbrick-related outputs with customer and subcontractor summaries.
Rendering	Not prioritised in this review, as requested.

Outputs already calculated

- Itemised customer prices and optional/mandatory work sections.
- Material quantities, pack/roll rounding and usage rules.
- Employee labour time and operating labour cost.
- Subcontractor projected pay and projected hours by work section.
- Travel time, vehicle/travel cost, number of days and men travelling.
- Section-level price-adjustment percentages.
- Customer summary, Contractor Foreman CSV upload and internal office notes.
- Report text, photographs and scope information connected to the selected treatment.

Examples of connected business logic

Different rooms and floor types

Five metres in a solid-floor room may require a wall/floor fillet detail; five metres in a timber-floor room can require a different construction and cost. The total is not always one generic ten-metre entry.

Material rounding

Membrane rolls, tape and other materials are rounded to the practical pack/roll quantities actually supplied.

DPC thickness

Wall thickness changes drilling/material requirements without changing the measured linear length.

Floor resin components

Primer, top coat, grip grit and fillet joint can be independently selected.

Subcontractor instruction

Meterage and work type feed projected hours and pay, supporting job allocation and payment checks.

Travel responsibility

Distance is an office input; crew size is selected after the survey.

Completed benchmark - Brad Brown, 16 Benson Street

Output	Workbook result
Customer subtotal ex VAT	£4,659.51
VAT	£931.90
Total inc VAT	£5,591.41
Projected subcontractor cost	£1,405.01
Projected working hours	50.179 hours
Project-specific overheads	£459.59

Why this matters

Simplifying the screen is desirable. Simplifying the underlying logic before it is mapped and tested is a commercial risk. A modern interface can still use the complete, proven calculations.

7. Recommended Hybrid Delivery Route

Recommended user experience

61. Admin creates the job once, entering customer, site, correspondence, mileage and survey notes.
62. The surveyor completes findings, photographs, measurements, sketch and proposed treatment on the tablet.
63. The surveyor enters or reviews the costing measurements once in a tablet-friendly version of the existing cost sheet.
64. The approved workbook logic - or an exact tested translation - calculates materials, labour, subcontractor pay, time on site, travel, overheads and customer prices.
65. The surveyor reviews the itemised customer price and any authorised section adjustments.
66. The system produces one report-and-quotation package for the customer and the appropriate internal outputs for admin and operatives.

Important: no unnecessary double entry

Where a measurement has already been captured reliably in the survey, the platform may prefill the cost field. It should not build a complicated transfer process that creates another mandatory entry step. The simplest correct workflow is preferred.

Three possible technical approaches

Approach	Assessment
A - Excel-backed calculation service (fastest/lowest initial risk)	Keep the protected workbook as the calculation engine. Dom's interface writes approved inputs and reads validated outputs. Strong short-term route while the full business logic is mapped.
B - Exact formula translation with automated parity tests (best long-term native route)	Rebuild the calculation logic in code/database only after every input, formula and output is documented. Every change runs against golden-master workbooks.
C - Continue patching isolated UI formulas (not recommended)	Fast for individual visible faults, but high risk of repeated knock-on effects, missing operational outputs and months of rework.

Recommended decision

Build a small proof of concept using Approach A or B for two representative jobs before spending further time recreating every costing option natively. The proof should demonstrate that one set of inputs produces the correct customer total, subcontractor pay, materials, hours, travel and report outputs.

Permission model

Role	Access
Steven / owner	Full visibility: materials, employed labour, subcontractor cost, overhead, margin, customer price and audit history.
Authorised admin	Booking data, mileage, job scheduling, approved subcontractor/operative instructions and payment-processing information.
Surveyors - Steven, Mike, Graeme	Technical survey, measurements, treatment choices, crew size, authorised price adjustments and customer price review.

Operatives / workmen	Scope, sketch, photographs, measurements, access notes and practical instructions only; no company margin or unnecessary customer cost information.
Customer	Technical report, proposed works, itemised approved selling prices, VAT, payment schedule and terms.

8. Proposed Implementation Sequence

Phase 1 - Immediate customer and live-site fixes

Correct developer email; browser/PDF fallback; report and quote in one email; customer itemisation; survey header/admin notes; custom external defect; collapsible cost summary.

Phase 2 - Costing safety and parity

Freeze calculation changes; establish golden-master test jobs; correct Warmline, DPC, floor resin, core holes, travel, crew size and payment calculations.

Phase 3 - Internal operational outputs

Expose subcontractor pay/hours, materials, time-on-site and work instructions with correct permissions.

Phase 4 - Hybrid proof of concept

Connect the tablet-friendly costing screen to the approved workbook logic or exact translated calculation service.

Phase 5 - Wider combined-report testing

Test damp plus condensation, damp plus timber, woodworm and large timber/dry-rot workflows.

Phase 6 - Release and training

Run device/browser regression, live shadow testing, admin/surveyor training and a controlled go-live while keeping the old sheets available as fallback.

Suggested regression test set

67. Simple 10 LM damp job with one wall thickness.
68. Mixed solid-floor and timber-floor rooms requiring different junction details.
69. DPC at 330 mm and a thicker stone-wall option.
70. Warmline DC job.
71. Floor resin: top coat only; primer plus top coat; grip grit optional.
72. Replacement fan using existing opening; new fan requiring core hole.
73. PIV plus mould treatment and external dryer vent.
74. Existing airbricks recorded by front/rear/side/offshoot and proposed additions.
75. Damp plus condensation on one property.
76. Small damp job with limited timber items.
77. Large multi-room timber/dry-rot job.
78. Woodworm treatment job.
79. Admin mileage with surveyor-selected crew size and offline access.
80. Edge, Chrome, Safari and phone/tablet customer document tests.

Release gate

A costing change should not be marked complete until the relevant golden-master jobs match to the penny and all connected outputs - customer, materials, subcontractor, labour, travel and time on site - pass.

9. Recommended Working Session with Dom

A practical screen-sharing meeting will save development time because the workbooks contain operational reasoning that is not obvious from formulas alone.

81. Open one completed damp workbook and show the office inputs.
82. Walk through a mixed floor-type job and explain why the same total meterage can have different details.
83. Trace one input through material quantity, labour hours, subcontractor pay, travel and customer summary.
84. Repeat the same customer in Dom's system and compare line by line.
85. Show Warmline, DPC thickness, floor resin component selection and core-hole scenarios.
86. Agree the golden-master test cases and decide whether the first hybrid proof uses Excel directly or an exact formula service.
87. Confirm which items are immediate fixes and which require design discussion or compromise.

Decisions requested from Dom

- Confirm the immediate customer-facing fixes and owners.
- Confirm that the existing workbooks will be treated as the calculation benchmark.
- Agree a temporary freeze on untested costing changes.
- Agree the hybrid proof-of-concept route and representative jobs.
- Agree how subcontractor, material and time-on-site outputs will be surfaced.
- Agree the acceptance-test process and change-control log.

Appendix A - Evidence Index

Reference	Evidence	What it demonstrates
Point 1	Five customer/internal quotation screenshots	Itemisation missing from customer view.
Point 2	Laptop quotation photograph	Edge/laptop opening or display issue.
Point 4	Two Warmline screenshots	No Warmline option in wall treatment.
Point 5	Existing report page	Airbrick counts by elevation.
Point 6	DPC selector photograph	Brick-course depth control.
Point 7	Mileage/men photograph	Role ownership and offline issue.
Point 8	Quotation photograph	Developer email address.
Point 9	Report-footer photograph	Incomplete office/location detail.
Point 10	Three videos/stills	Client/site addresses and admin survey notes.
Point 11	Two videos/stills	Core-hole issue repeated.
Point 12	External-defect video/still	No photo-linked custom defect.
Point 13	Costing-screen video/still	Fixed summary restricts view.
Point 14	Cost summary screenshot and completed workbook	£638.41 ex-VAT benchmark variance.
Point 14A	Two floor-resin screenshots and workbook	All components automatically charged.
Point 15	Damp/PIV/Timber/Woodworm workbooks	Subcontractor, hours and internal outputs.
Point 16	Quotation screenshots	Initial-payment arithmetic/wording review.

Appendix B - Source Files Reviewed

- Customer Details for Linked Documents.xlsm
- Damp Costing v45/v47 completed and master variants
- Condensation PIV Costing v37 completed and master variants
- Timber Costing v33 master
- Woodworm Costing v25 master
- Completed damp and condensation reports supplied in this project
- Live-testing photographs and seven supporting videos
- Rendering workbook noted but not prioritised in this review

Final note

The target is not to prove that one system is better than another. The target is a reliable combined system:

Dom's strong survey/report platform, Tyne Tees' practical surveying and operating knowledge, and the proven costing logic refined through years of live work.