# **General Accessories for AC Drives**

# **Drives Accessories – Line/Load Reactors**

### LR(2) Series Line Reactors

<u>Input</u> line reactors protect the AC drive from transient overvoltage conditions typically caused by utility capacitor switching. Input line reactors also reduce the harmonics associated with AC drives and are recommended for all installations.

Output line (load) reactors protect the motor insulation against AC drive short circuits and IGBT reflective wave damage, and also allow the motor to run cooler by "smoothing" the motor current waveform. They are recommended for operating "non-inverter-duty" motors, and for any motors where the length of wiring between the AC drive and motor is less than 100 feet. For AC Drive-to-Motor wiring distances over 100 feet, use of the VTF series output filter is recommended.

### Features:

- Universal mounting feet with multiple mounting slots; can replace most reactors using existing mounting holes
- Short-term overload rating: 200% of rated current for 3 minutes maximum
- Overload inductance: 95% @ 110% load; 80% @ 150% load
- Impedence: 3%
- 10-year warranty


### **Agency Approvals:**

- CULUS listed (E197592)
- CE marked
- RoHS







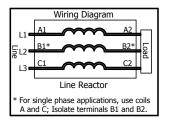

LR2-10P2-1PH

LR-2100

LR2-40P2

Wiring

**Typical Line Reactors** 

# LR(2) Series Line/Load Reactors - Compatibility with AutomationDirect AC Drives

For Reactor compatibility with CFW100 AC Drives, please refer to "General Accessories for CFW100 Drives" on page tCFW-15.

For Reactor compatibility with CFW300 AC Drives, please refer to "General Accessories for CFW300 Drives" on page tCFW-8.

For Reactor compatibility with GS1 AC Drives, please refer to "GS1 Specifications" on page tGSX-2.

For Reactor compatibility with GS2 AC Drives, please refer to "GS2 Specifications" on page tGSX-9.

For Reactor compatibility with GS3 AC Drives, please refer to "GS3 External Accessories List" on page tGSX-25.

For Reactor compatibility with GS4 AC Drives, please refer to "GS4 Line Reactors and Output Filters" on page tGSX-50.

tDGA-1 AC Drives General Accessories

LR(2) Series Line/Load Reactors for AC Drives - Specifications

			Li	ne/Loa	d Rea	ctors fo	r AC Driv	ves – LR(2) Serie	S			
Part Number <sup>(0)</sup>	Price	Dimen- sion Drawing	Max Rated Amps	Induc- tance [mH]	Watt Loss	System Voltage	Weight (lb [kg])	Wire Range	Terminal Torque ( lb∙in )	Operating Temperature	Storage Temper- ature	Environ- ment
LR-10P2-1PH <sup>(2)(3)</sup>	\$68.00	1	5.8	1.58	8.0		2.6 [1.2]	18–12 AWG	10			
LR2-10P2-1PH (2)	\$73.00	13	10	1.35	21		4	18–12 AWG	10		-40 – 149 °F [-40 – 65 °C] no	
LR-10P5-1PH <sup>(2)(3)</sup>	\$77.00	1	9.8	0.93	11.7		2.7 [1.2]	18–12 AWG	10			NEMA: open
LR2-10P5-1PH (2)	\$81.00	13	12	0.971	29	120	4	18–12 AWG	10	-40 – 104 °F [-40 – 40 °C]		IP00 no corrosive gases
LR-11P0-1PH <sup>(2)(3)</sup>	\$98.00	2	16	0.57	17.4		4.2 [1.9]	18–12 AWG	20	[ .0 .0 0]		
LR2-11P0-1PH <sup>(1)(2)</sup>	\$107.00	14	17	1.03	53		8	18–4 AWG	20			
LR2-11P5-1PH <sup>(2)</sup>	\$127.00	15	34	0.342	64		12	18–4 AWG	20			
LR2-20P2-1PH (2)(4)	\$61.00	16	4.2	6.4	23.5	240	1.4	22-12 AWG	9	122°F [50°C] max		
LR2-20P2 <sup>(4)</sup>	\$61.00	16	3.4	7.4	26.4	240	1.4	22-12 AWG	9	122°F [50°C] max		
LR-20P5-1PH <sup>(2)(3)</sup>	\$66.00	1	4.9	3.74	11.2	240	2.8 [1.3]	18–12 AWG	10	104°F [40°C] max		
LR2-20P5-1PH (2)	\$75.00	17	7.6	3.56	39	240	3	22-12 AWG	9	122°F [50°C] max		
LR2-20P5 <sup>(4)</sup>	\$68.00	16	5	4.6	30.6	240	1.4	22-12 AWG	9	122°F [50°C] max		
LR2-20P7 <sup>(4)</sup>	\$75.00	17	8.2	2.9	49	240	3	22-12 AWG	9	122°F [50°C] max		
LR-21P0-1PH <sup>(2)</sup>	\$72.00	1	8	2.29	15.9	240	2.8 [1.3]	18–12 AWG	10	104°F [40°C] max		
LR2-21P0-1PH (1)(2)(4)	\$101.00	13	10	2.31	31	240	4	18–12 AWG	10	104°F [40°C] max 104°F [40°C] max 122°F [50°C] max 104°F [40°C] max 122°F [50°C] max 104°F [40°C] max		
LR-21P0 <sup>(3)</sup>	\$68.00	3	4.6	2.46	11	208/240	4.0 [1.8]	18–12 AWG	10		-40 – 149 °F OP	
LR2-21P0 <sup>(4)</sup>	\$75.00	17	11.6	2.0	64	240	3.2	22-12 AWG	9			
LR2-21P5-1PH <sup>(2)(4)</sup>	\$90.00	13	14	1.68	40	240	4	18–12 AWG	10			
LR2-21P5 <sup>(4)</sup>	\$75.00	17	11.6	2.0	64	240	3.2	22-12 AWG	9			
LR-22P0-1PH <sup>(2)</sup>	\$80.00	2	12	1.53	24.3	240	4.3 [2.0]	18–12 AWG	20			
LR2-22P0-1PH (1)(2)(4)	\$107.00	14	17	1.03	53	240	8	18–4 AWG	20	104°F [40°C] max		NEMA: open IP00
LR-22P0 (3)	\$76.00	3	7.5	1.35	21	208/240	4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-22P0 (4)	\$84.00	17	11.6	2.0	64	240	3.2	22-12 AWG	9	122°F [50°C] max		
LR-23P0-1PH <sup>(2)</sup>	\$101.00	2	17	1.08	27.3	240	4.3 [2.0]	18–12 AWG	20	104°F [40°C] max	[-40 – 65 °C]	no corrosive
LR-23P0	\$85.00	3	10.6	0.97	38	208/240	4.0 [1.8]	18–12 AWG	10	104°F [40°C] max	ga	gases
LR-25P0	\$112.00	4	16.7	0.626	48	208/240	8.0 [3.6]	18–4 AWG	20	104°F [40°C] max		
LR-27P5	\$119.00	4	24.2	0.434	65	208/240	8.0 [3.6]	18–4 AWG	20	104°F [40°C] max		
LR-2010	\$132.00	5	30.8	0.342	96	208/240	12 [5.4]	18–4 AWG	20	104°F [40°C] max 104°F [40°C] max 104°F [40°C] max		
LR-2015	\$166.00	5	46.2	0.22	64	208/240	12 [5.4]	18–4 AWG	20			
LR-2020	\$181.00	5	59.4	0.172	85	208/240	12 [5.4]	18–4 AWG	20			
LR-2025	\$267.00	6	74.8	0.138	94	208/240	15 [6.8]	18–4 AWG	18–16 AWG: 25 14–6 AWG: 30 4 AWG: 35	104°F [40°C] max		
LR-2030	\$284.00	7	88	0.116	135	208/240	33 [15]	6AWG-2/0 (AL or CU)	120	104°F [40°C] max 104°F [40°C] max 104°F [40°C] max 104°F [40°C] max		
LR-2040	\$399.00	7	114	0.0886	149	208/240	33 [15]	6AWG-2/0 (AL or CU)	120			
LR-2050	\$465.00	8	143	0.0699	154	208/240	36 [16]	6AWG–250kcmil (AL or CU)	275			
LR-2060	\$521.00	18	180	0.0624	209	208/240	46	6AWG-250MCM	275			
LR-2075	\$535.00	19	211	0.0487	294	208/240	52	4AWG-600MCM	500	104°F [40°C] max		
LR-2100	\$590.00	19	280	0.0364	276	208/240	52	4AWG-600MCM	500	104°F [40°C] max		

<sup>0)</sup> Impedence = 3% for all reactors, except as otherwise noted.

( table continued next page )

tDGA-2 AC Drives General Accessories 1 - 8 0 0 - 6 3 3 - 0 4 0 5

<sup>1)</sup> Impedence = 5% for reactors marked with this note, but they function as 3% reactors in the ADC drive application.

<sup>2)</sup> Single-phase line reactors are for use only with single-phase drive inputs. Single-phase line reactors should NOT be installed on the output side of AC drives.

<sup>3)</sup> This reactor is recommended for existing installations only; product will be discontinued after existing stock is depleted.

<sup>4)</sup> Optional mounting accessories are available for these models. See "Line/Load Reactors - Mounting Accessories" section for details.

<sup>5)</sup> LR-4250 & LR-4300 have dual-connector lugs, and will require multiple conductors per phase of the appropriate size to fit the lugs.

LR(2) Series Line/Load Reactors for AC Drives - Specifications

		Lin	e/Load R	eactors f	or AC D	rives – L	R(2) Series	(continued from prev	rious page)			
Part Number <sup>(1)</sup>	Price	Dimen- sion Drawing	Max Rated Amps	Induc- tance [mH]	Watt Loss	System Voltage	Weight (lb [kg])	Wire Range	Terminal Torque [lb·in]	Operating Temperature	Storage Temper- ature	Environ- ment
LR2-40P2 <sup>(4)</sup>	\$48.00	16	1.4	31.5	5		1.3	22–12 AWG	9	122°F [50°C] max		
LR2-40P3 <sup>(4)</sup>	\$49.00	16	1.7	27.6	6.2		1.3	22–12 AWG	9	122°F [50°C] max		
LR2-40P5 <sup>(4)</sup>	\$50.00	16	1.6	20	9.7		1.3	22–12 AWG	9	122°F [50°C] max		
LR2-40P7 <sup>(4)</sup>	\$53.00	16	2.3	13.8	12.1	12.1	1.3	22–12 AWG	9	122°F [50°C] max	-40 – 149°F [-40 – 65°C]	NEMA: open IP00 no corrosive gases
LR2-41P0 <sup>(4)</sup>	\$55.00	16	2.3	10.5	25.2		1.2	22–12 AWG	9	122°F [50°C] max		
LR2-41P5 <sup>(4)</sup>	\$62.00	16	3.4	7.4	26.4		1.4	22–12 AWG	9	122°F [50°C] max		
LR-42P0 (3)	\$73.00	3	3.4	5.79	19		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-42P0 (4)	\$61.00	16	4.2	6.5	23.5		1.4	22–12 AWG	9	122°F [50°C] max		
LR-43P0 <sup>(3)</sup>	\$81.00	3	4.8	4.27	23		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-43P0 <sup>(4)</sup>	\$68.00	16	5	4.6	30.6		1.4	22–12 AWG	9	122°F [50°C] max		
LR2-44P0 (4)	\$75.00	17	7.6	3.56	39		3	22–12 AWG	9	122°F [50°C] max		
LR-45P0 <sup>(3)</sup>	\$84.00	3	7.6	2.77	49		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-45P0 <sup>(4)</sup>	\$75.00	17	8.2	2.9	49		3	22–12 AWG	9	122°F [50°C] max		
LR-47P5 <sup>(3)</sup>	\$94.00	3	11	1.68	40	480	4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-47P5 <sup>(4)</sup>	\$84.00	17	11.6	2	64		3.2	22–12 AWG	9	122°F [50°C] max		
LR-4010	\$119.00	3	14	1.29	64		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR-4015	\$137.00	4	21	0.912	65		8.0 [3.6]	18–4 AWG	20	104°F [40°C] max		
LR-4020	\$151.00	4	27	0.694	79		8.0 [3.6]	18–4 AWG	20	104°F [40°C] max		
LR-4025	\$161.00	5	34	0.569	96		10 [4.5]	18–4 AWG	20	104°F [40°C] max		
LR-4030	\$202.00	5	40	0.469	105		10 [4.5]	18–4 AWG	20	104°F [40°C] max		
LR-4040	\$221.00	6	52	0.387	114		15 [6.8]	18–4 AWG	20	104°F [40°C] max		
LR-4050	\$259.00	9	65	0.295	114			5 [11] #22–4 AWG	22–16 AWG: 25 14–6 AWG: 30 4 AWG: 35	104°F [40°C] max		
LR-4060	\$268.00	9	77	0.227	169		25 [11]			104°F [40°C] max		
LR-4075	\$406.00	7	96	0.196	193		33 [15]	2/0 – 6AWG (AL or CU)	120	104°F [40°C] max		
LR-4100	\$460.00	10	124	0.152	225			, , ,	275	104°F [40°C] max		
LR-4125	\$557.00	10	156	0.117	254		46 [21]	250kcmil – 6AWG (AL or CU)		104°F [40°C] max		
LR-4150	\$645.00	10	180	0.103	299			or Co)		104°F [40°C] max		
LR-4200	\$860.00	11	240	0.0839	280		74 [34]	(1) 4 AWG – 600kcmil (2) 1/0 – 250kcmil	500	104°F [40°C] max		
LR-4250 <sup>(5)</sup>	\$928.00	12	302	0.0654	337			(2)** 1 AVVC 250kcmil		104°F [40°C] max	1	
LR-4300 <sup>(5)</sup>	\$947.00	12	361	0.0565	381		74 [34] (2) 4 AVVG - 530KCITIII (AL or CU)	275	104°F [40°C] max	1		
LR-51P0 <sup>(3)</sup>	\$78.00	3	1.7	15.9	12		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-51P0 <sup>(4)</sup>	\$59.00	16	2.1	16.2	16.2	2 2 5 3 575/600	1.3	22–12 AWG	9	122°F [50°C] max	-40 - 149 °F [-40 - 65 °C]	NEMA: open IP00 no corrosive gases
LR2-51P5 <sup>(4)</sup>	\$75.00	16	3.4	11.5	17.2		1.4	22–12 AWG	9	122°F [50°C] max		
LR-52P0 <sup>(3)</sup>	\$84.00	3	2.7	9.29	22		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-52P0 <sup>(4)</sup>	\$80.00	16	3.2	10.2	20.5		1.5	22–12 AWG	9	122°F [50°C] max		
LR-53P0 <sup>(3)</sup>	\$87.00	3	3.9	6.74	23.3		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-53P0 <sup>(4)</sup>	\$81.00	17	4.8	7.07	30		3.5	22–12 AWG	9	122°F [50°C] max		
LR2-54P0 <sup>(4)</sup>	\$85.00	17	7.6	5.63	30		2.9	22–12 AWG	9	122°F [50°C] max		
LR-55P0 (3)	\$90.00	3	6.1	4.51	34.7		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		
LR2-55P0 (4)	\$89.00	17	7.6	4.52	44		3	22–12 AWG	9	122°F [50°C] max		
LR2-57P5 (4)	\$104.00	17	9.6	3.1	57		3.2	22–12 AWG	9	122°F [50°C] max	-	
LR-5010	\$121.00	3	11	2.47	43.8		4.0 [1.8]	18–12 AWG	10	104°F [40°C] max		

<sup>1)</sup> Impedence = 3% for all reactors.

tDGA-3 AC Drives General Accessories

<sup>2)</sup> Single-phase line reactors are for use only with single-phase drive inputs. Single-phase line reactors should NOT be installed on the output side of AC drives.

<sup>3)</sup> This reactor is recommended for existing installations only; product will be discontinued after existing stock is depleted.

<sup>4)</sup> Optional mounting accessories are available for these models. See "Line/Load Reactors – Mounting Accessories" section for details.

<sup>5)</sup> LR-4250 & LR-4300 have dual-connector lugs, and will require multiple conductors per phase of the appropriate size to fit the lugs.


# **Drives Accessories – Line/Load Reactor Mounting Accessories**

# LR(2) Series Line/Load Reactors - Mounting Accessories

LR(2) series reactors have differing mounting options depending on the model. The models listed below have an integral two-bolt mounting method, and also offer optional mounting adapters that allow other mounting methods.

Adapter Plate Kits  $\underline{LR2-AP1}$  and  $\underline{LR2-AP2}$  allow for universal panel mounting with these models.

DIN Rail Mounting Kits <u>LR2-DR1</u> and <u>LR2-DR2</u> allow DIN rail mounting with these models.

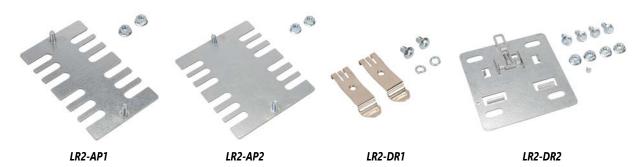

LR2 Series Line Reactor Mounting Adapters						
Part Number	Price	Description	Dimension Drawing			
LR2-AP1	\$14.00	Adapter Plate Kit; includes 2 flange nuts (10-32); Dimensions 4.45" x 2.63"	16a			
LR2-AP2	\$14.00	Adapter Plate Kit; includes 2 flange nuts (10-32); Dimensions 4.45" x 3.51"	16b			
LR2-DR1	\$14.00	DIN Rail Mounting Clips and Hardware Kit; includes 2 screws (M5-0.8 x 8mm), 2 washers, 2 clips	16c			
LR2-DR2	\$26.00	DIN Rail Mounting Plate and Hardware Kit; includes 4 bolts (0.25-20 x 0.50) and 4 flange nuts	17a			

LR2 Line Reactor Mounting Adapter Selection Table									
4DC1' D( D(#	Adapter Pla	te Kits Part #	DIN Rail Mount Kits Part #						
ADC Line Reactor Part #	LR2-AP1	LR2-AP2	LR2-DR1	LR2-DR2					
LR2-20P2-1PH	√	√	√	_					
LR2-20P2	√	√	√	_					
LR2-20P5-1PH	_	_	_	√					
LR2-20P5	√	√	√	_					
LR2-20P7	_	_	_	√					
LR2-21P0	_	_	_	√					
LR2-21P5	_	_	_	√					
LR2-22P0	_	_	_	√					
LR2-40P2	√	√	√	_					
LR2-40P3	√	√	√	_					
LR2-40P5	√	√	√	_					
LR2-40P7	√	√	√	_					
LR2-41P0	√	√	√	_					
LR2-41P5	√	√	√	_					
LR2-42P0	√	√	√	_					
LR2-43P0	√	√	√	_					
LR2-44P0	_	_	_	√					
LR2-45P0	_	_	_	√					
LR2-47P5	_	_	_	√					
LR2-51P0	√	√	√	_					
LR2-51P5	√	√	√	_					
LR2-52P0	√	√	√	-					
LR2-53P0	_	_	_	√					
LR2-54P0	_	_	_	√					
LR2-55P0	_	_	_	√					
LR2-57P5	_	_	_	√					


tDGA-4 AC Drives General Accessories

# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>www.AutomationDirect.com</u> for complete engineering drawings.

# 1) LR(2) LINE REACTORS DIMENSION DRAWING #1 LR-10P2-1PH, LR-10P5-1PH, LR-20P5-1PH, LR-21P0-1PH

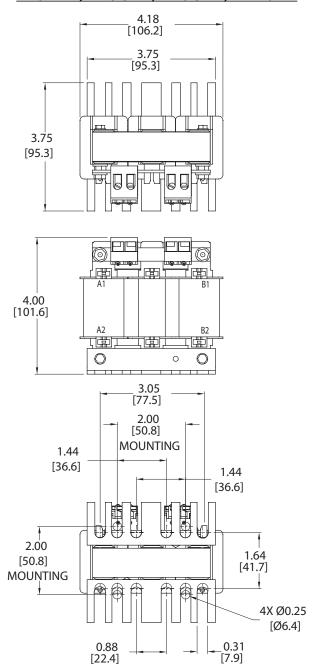

### 2) LR(2) LINE REACTORS DIMENSION DRAWING #2 LR-11P0-1PH, LR-22P0-1PH, LR-23P0-1PH

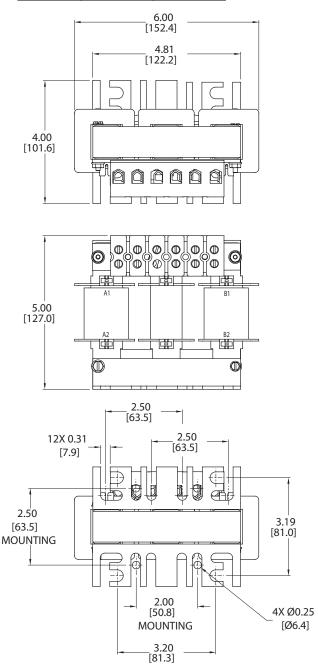


# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

 $\textit{See our website:} \ \underline{\textit{www.AutomationDirect.com}} \ \textit{for complete engineering drawings}.$ 

3) LR(2) LINE REACTORS DIMENSION DRAWING #3 <u>LR-21P0, LR-22P0, LR-23P0, LR-4010, LR-42P0, LR-43P0, LR-45P0, LR-55P0, LR-55P0, LR-55P0, LR-55P0</u>

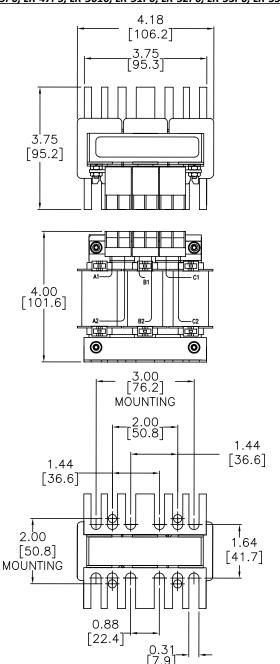

### 4) LR(2) LINE REACTORS DIMENSION DRAWING #4 LR-25P0, LR-27P5, LR-4015, LR-4020

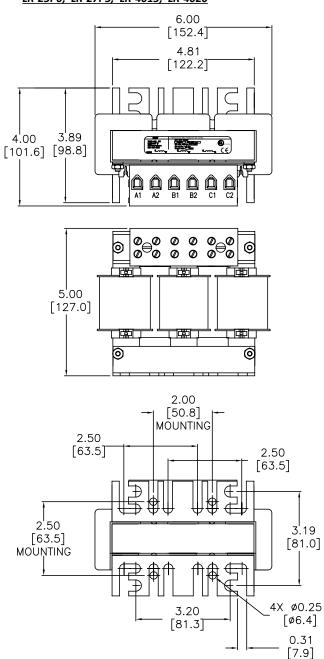



# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.


### 5) LR(2) LINE REACTORS DIMENSION DRAWING #5 LR-2010, LR-2015, LR-2020, LR-4025, LR-4030

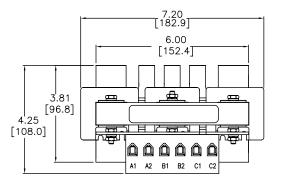

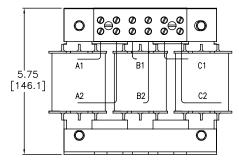

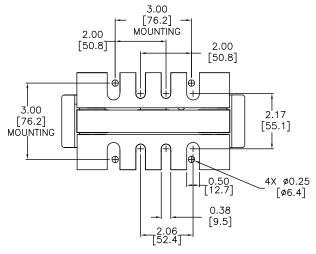

### 6) LR(2) LINE REACTORS DIMENSION DRAWING #6 LR-2025, LR-4040

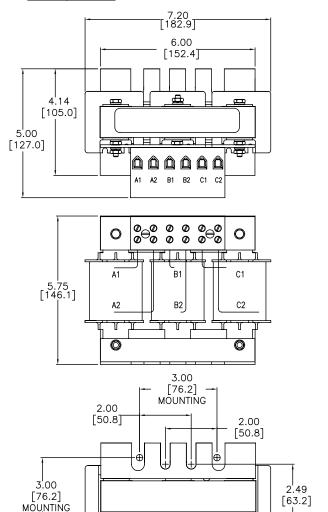

Φ,

\_0.50 [12.7]

0.38 [9.5] 4X Ø0.25

[ø6.4]

-Ф

1.00


[25.4]


# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>www.AutomationDirect.com</u> for complete engineering drawings.


### 7) LR(2) LINE REACTORS DIMENSION DRAWING #7 LR-2030, LR-2040, LR-4075

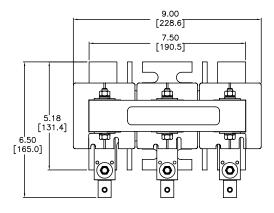


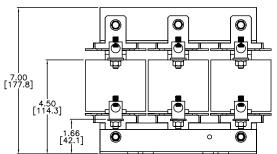


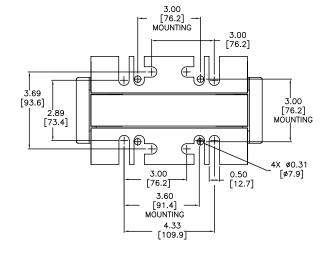

# 8) LR(2) LINE REACTORS DIMENSION DRAWING #8 LR-2050

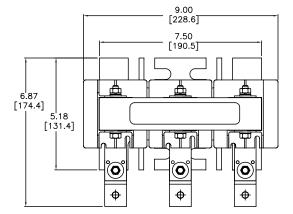

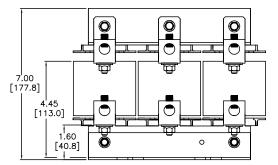

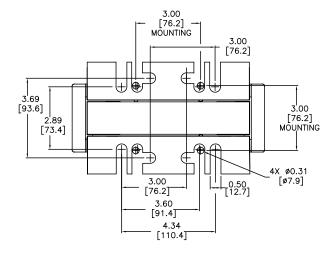



# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>www.AutomationDirect.com</u> for complete engineering drawings.


### 9) LR(2) LINE REACTORS DIMENSION DRAWING #9 LR-4050, LR-4060

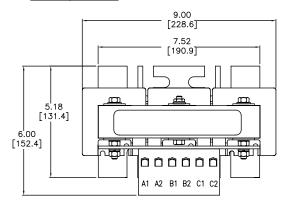


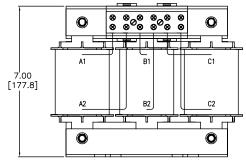


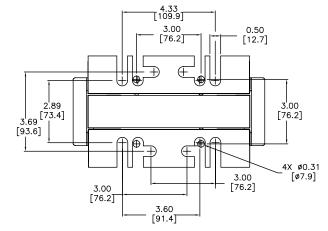

### 10) LR(2) LINE REACTORS DIMENSION DRAWING #10 LR-4100, LR-4125, LR-4150

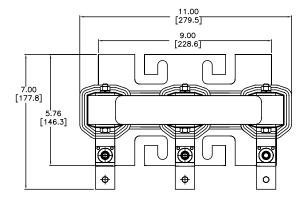

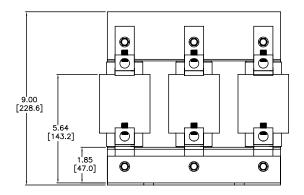

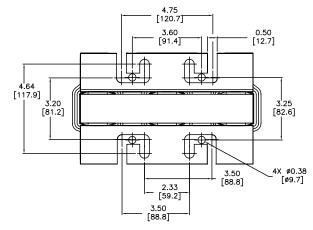


# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>www.AutomationDirect.com</u> for complete engineering drawings.

# 11) LR(2) LINE REACTORS DIMENSION DRAWING #11 LR-4200

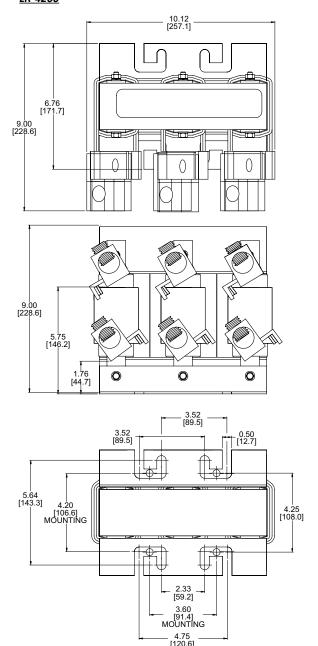

### 12) LR(2) LINE REACTORS DIMENSION DRAWING #12 LR-4250, LR-4300

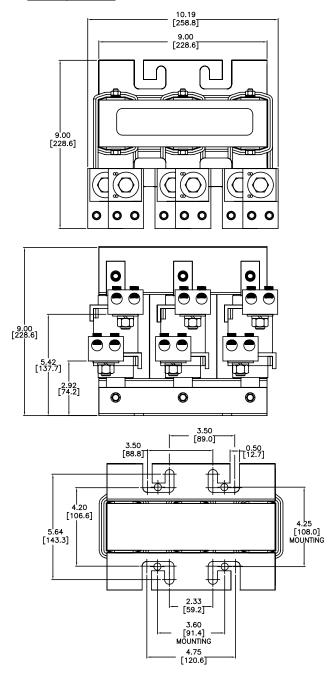



# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.


# 13) LR(2) LINE REACTORS DIMENSION DRAWING #13 LR2-10P2-1PH, LR2-10P5-1PH, LR2-21P0-1PH, LR2-21P5-1PH

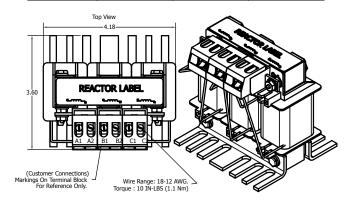


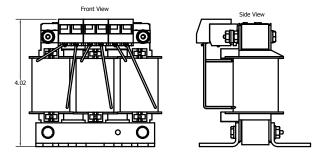


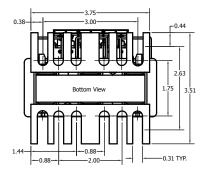


### 14) LR(2) LINE REACTORS DIMENSION DRAWING #14 LR2-11PO-1PH, LR2-22PO-1PH

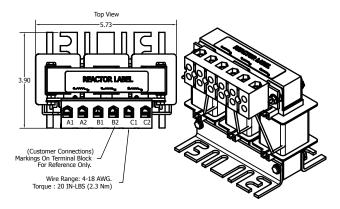

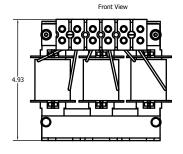

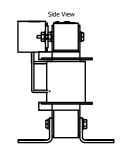

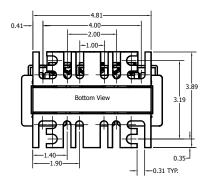


# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.

### 15) LR(2) LINE REACTORS DIMENSION DRAWING #15 LR2-11P5-1PH

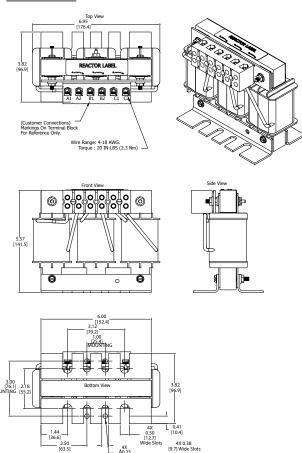

16) LR(2) LINE REACTORS DIMENSION DRAWING #16
LR2-20P2-1PH, LR2-20P2, LR2-20P5, LR2-40P2, LR2-40P3,
LR2-40P5, LR2-40P7, LR2-41P0, LR2-41P5, LR2-42P0,
LR2-43P0, LR2-51P0, LR2-51P5, LR2-52P0

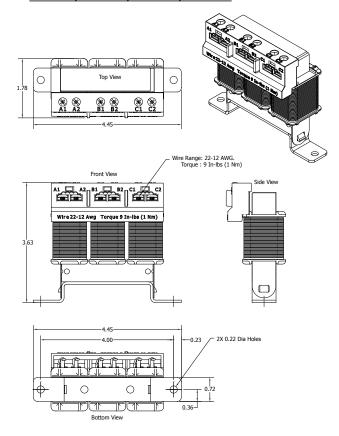

# LR(2) Series Line/Load Reactors - Dimensions

( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.


### 16A) LR(2) LINE REACTORS DIMENSION DRAWING #16A LR2-AP1 ADAPTER PLATE FOR UNIVERSAL MOUNTING FOR:

LR2-20P2-1PH, LR2-20P2, LR2-20P5, LR2-40P2, LR2-40P3, LR2-40P5, LR2-40P7, LR2-41P0, LR2-41P5, LR2-42P0, LR2-43P0, LR2-51P0, LR2-51P5, LR2-52P0

# 10-32 Adapter Plate Adapter Plate


### 16B) LR(2) LINE REACTORS DIMENSION DRAWING # 16B <u>LR2-AP2</u> ADAPTER PLATE FOR UNIVERSAL MOUNTING FOR:

LR2-20P2-1PH, LR2-20P2, LR2-20P5, LR2-40P2, LR2-40P3, LR2-40P5, LR2-40P7, LR2-41P0, LR2-41P5, LR2-42P0, LR2-43P0, LR2-51P0, LR2-51P5, LR2-52P0

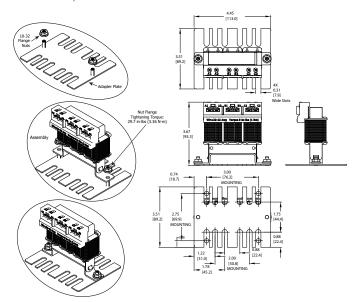

# 16c) LR(2) LINE REACTORS DIMENSION DRAWING #16c LR2-DR1 HARDWARE KIT FOR DIN RAIL MOUNTING FOR:

LR2-20P2-1PH, LR2-20P2, LR2-20P5, LR2-40P2, LR2-40P3, LR2-40P5, LR2-40P7, LR2-41P0, LR2-41P5, LR2-42P0, LR2-43P0, LR2-51P0, LR2-51P5, LR2-52P0

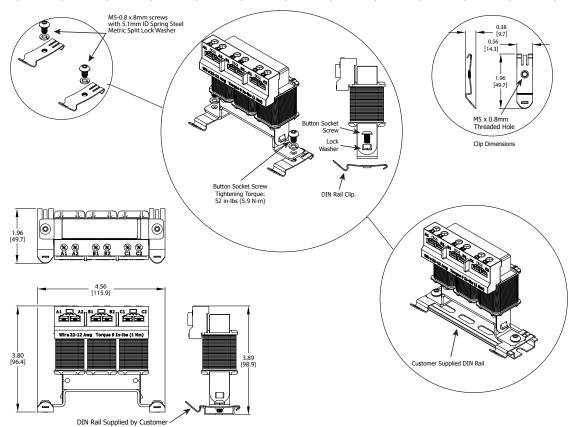


# LR(2) Series Line/Load Reactors - Dimensions

( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.

17) LR(2) LINE REACTORS DIMENSION DRAWING #17

LR2-20P5-1PH, LR2-20P7, LR2-21P0, LR2-21P5, LR2-22P0, LR2-44P0, LR2-45P0, LR2-47P5, LR2-53P0, LR2-54P0, LR2-55P0, LR2-57P5

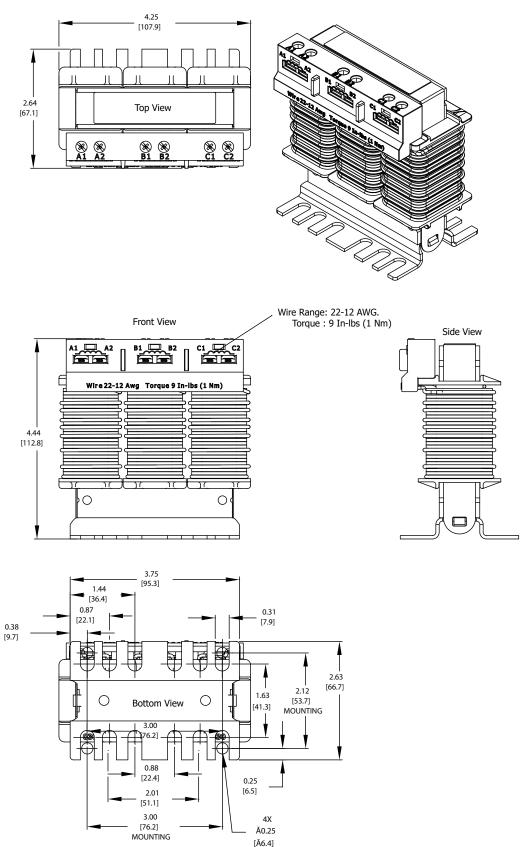


# LR(2) Series Line/Load Reactors - Dimensions

( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.

### 17a) LR(2) LINE REACTORS DIMENSION DRAWING #17A LR2-DR2 HARDWARE KIT FOR DIN RAIL MOUNTING FOR:

LR2-20P5-1PH, LR2-20P7, LR2-21P0, LR2-21P5, LR2-22P0, LR2-44P0, LR2-45P0, LR2-47P5, LR2-53P0, LR2-54P0, LR2-55P0, LR2-57P5

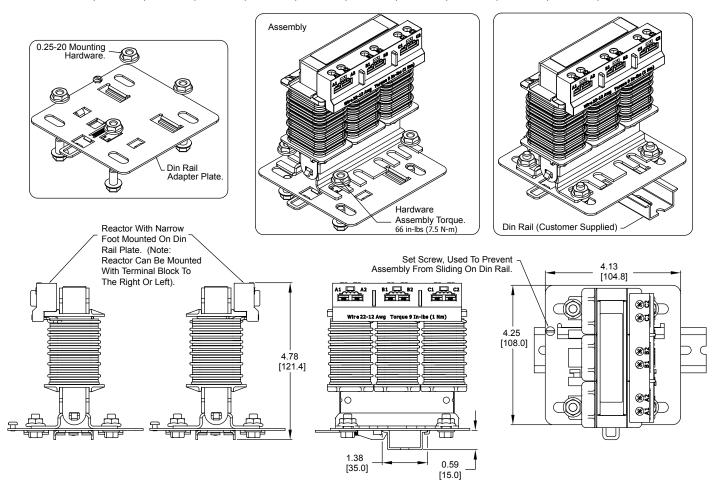


tDGA-15 AC Drives General Accessories

# LR(2) Series Line/Load Reactors - Dimensions


( UNITS = IN [MM] )

SEE OUR WEBSITE: <u>WWW.AUTOMATIONDIRECT.COM</u> FOR COMPLETE ENGINEERING DRAWINGS.

# 18) LR(2) LINE REACTORS DIMENSION DRAWING #18 LR-2060

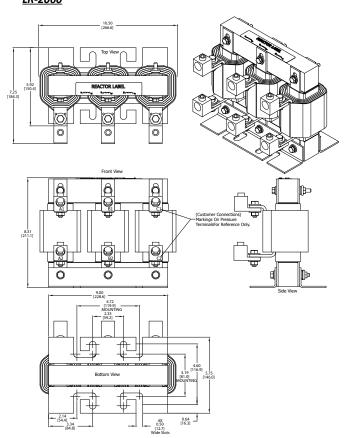

### 19) LR(2) LINE REACTORS DIMENSION DRAWING #19 LR2075, LR2100

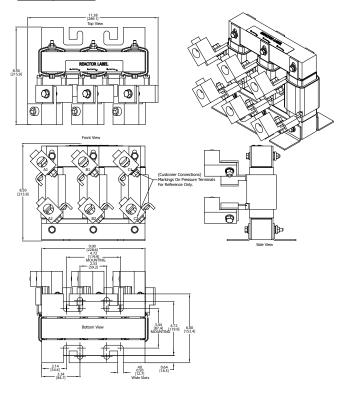

# GS/DURAPULSE Drives Accessories - Line/Load Reactors

Line/Load Reactors for GS/DURAPULSE AC Drives - Generic One-Line Wiring Examples




WARNING: CONSULT THE APPLICABLE GS DRIVE USER MANUAL BEFORE ACTUALLY WIRING THE DRIVE!

### Input side of the drive

When installed on the input side of the AC drive, line reactors will reduce line notching, and limit current and voltage spikes and surges from the incoming line. The line reactor will also reduce harmonic distortion from the drive onto the line. Units are installed in front of the AC drive as shown.



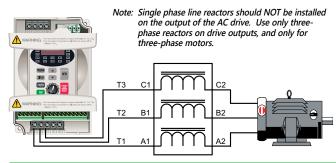


### Output side of the drive


When installed on the output side of the drive, line reactors protect the drive from short circuits at the load. Voltage and current waveforms from the drive are enhanced, reducing motor overheating and noise emissions.

Note: If installing a line reactor on the output side of the drive, especially with motor lead lengths in excess of 75 feet, lower the drive PWM output carrier frequency to 4kHz in order to protect the line reactor from excess heating and possible damage.

# Multiple drives

Individual line reactors are recommended when installing multiple drives on the same power line. Individual line reactors eliminate crosstalk between multiple drives and provide isolated protection for each drive for its own specific load.

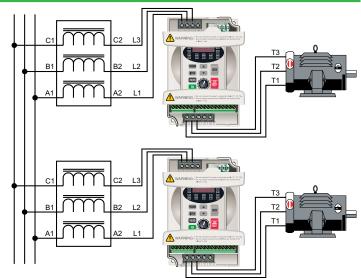

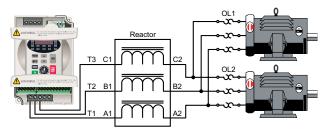

### Multiple motors

A single reactor can be used for multiple motors on the same drive, if the motors operate simultaneously. Size the reactor based upon the total horsepower of all the motors. Select a reactor with a current rating greater than the sum of the motor full-load currents. Overload relays are recommended for use in multimotor applications.


Note: A single reactor should be used with multiple motors only when the motors will always operate simultaneously.

# Single phase applications

Some of the line reactors are listed for use with single-phase input power. Make sure that terminals B1 and B2, if present, are properly insulated before any connections are made.




WARNING: Ensure that terminals B1 and B2 are properly insulated before making any connections to single-phase power.

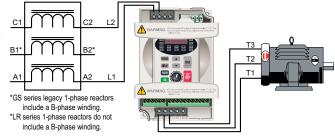

# GS/DURAPULSE Series AC Drives Optional Accessories - Overview

GS/DURAPULSE Accessories (not all accessories are applicable for every drive model)

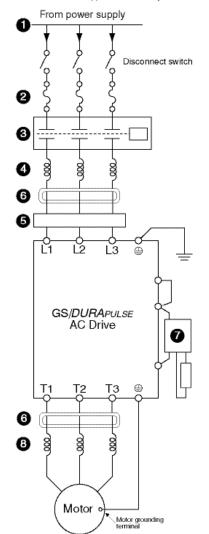

# Power Supply

Please follow the specific power supply requirements shown in Chapter 1 of the applicable GS/DURAPULSE AC Drives User Manual (Automation Direct.com).

2 Fuses (SeepagestGSX-89,tGSX-90,pg,tGSX-92,formoreinformation.)

Input fuses protect the AC drive from excessive input current due to line surges, short circuits, and ground faults. They are recommended for all installations and may be required for UL-listed installations.

### 3 Contactor (Optional)

(Contactors are available from <u>AutomationDirect.com</u>)

Do not use a contactor or disconnect switch for run/stop control of the AC drive and motor. This will reduce the operating life cycle of the AC drive. Cycling a power circuit switching device while the AC drive is in run mode should be done only in emergency situations.

# 4 Input Line Reactor (Optional)

(See pages tGSx-74, tGSX-50, and tGSX-51 for more information.)

Input line reactors protect the AC drive from transient overvoltage conditions, typically caused by utility capacitor switching. The input line reactor also reduces the harmonics associated with AC drives. Input line reactors are recommended for all installations.

### **5** EMI filter (Optional) (SeepagestDGA-29 and tDGA-26 formore information.)

Input EMI filters reduce electromagnetic interference or noise on the input side of the AC drive. They are required for CE compliance and recommended for installations prone to or sensitive to electromagnetic interference.

### **6** RF filter (Optional) (See page <u>tGSx-1</u> for more information.)

RF filters reduce the radio frequency interference or noise on the input or output side of the inverter.

# 7 Braking Unit and/or Braking Resistor (Optional)

(See pages tGSX-77, tGSX-50, tGSX-79 for more information.)

Dynamic braking allows the AC drive to produce additional braking (stopping) torque. AC drives can typically produce between 15% & 20% braking torque without the addition of any external components. The addition of optional braking may be required for applications that require rapid deceleration or high inertia loads.

# 8 Output Load Reactor (Optional)

(See pages tGSx-74, tGSx-72, and tGSX-51 for more information.)

Output line reactors protect the motor insulation against AC drive short circuits and IGBT reflective wave damage, and also "smooth" the motor current waveform, allowing the motor to run cooler. They are recommended for operating "non-inverter-duty" motors and when the length of wiring between the AC drive and motor exceeds 75 feet.

tGSX-76 AC Drives 1 - 8 0 0 - 6 3 3 - 0 4 0 5