
Printer Off
Radians
3 2 1 0
mode1
G2
Learn
Learn+Print
Step
List
Learn+Print
FP
3 2 1 0
mode0
K
CN-24
CN-36 (1 of 3)
XH
XL
XS(3)
A15
LEARN
PRIME
Keyboard
return
call
STK2
STK1
1
0
J
Prt drum pos.
CN-36 (2 of 3)
Kbd
DH
DL
C4
C5
B9
A12
A10
Prt tach
N.C.
CN-24
Cass data
G
Z I C
ALU
ACC
a
C0 B15
B
D
c
F
E
AH
AM
AL
C1
C2
C3
A*
A2
A5
A3
A6
4Kx4 RAM
A11-8
A7-4
A3-0
RD
WR
ALE
b0
A4
A5
A6
MR
C6
A1
A2
A3
H
L
XR
Display
4Kx4 Expansion ROM(s)
CN-36 (3 of 3)
B12
Prog Err
Key Pressed
B14
Mach Err
C0
C1
C2
C3
C4
C5
C6
C7
C
PRIME
VERIFY PROG
SET P.C.
RECORD PROG
S.M.
B.S.
INS
DEL
000
001
002
003
004
005
006
007
NEXT
F7
PC
2Kx42 ROM
!return
c'
008
RAM size
F E NEXT J B K A D' L D C G H
41 40 39 38 37 36 35 34 33 32 31 30 29 28 27 26 25 24 23 22 21 20 19 18 17 16 15 14 13 12 11 10 9 8 7 6 5 4 3 2 1 0
Clock timing:
a b b b b c
a = early latch, uCode load
b = serial data move
c = late latch, rd/wr RAM, latch uCode Addr

A op:
0: NOP?
1: wr(AH,AM,AL)
2: wr(15,15,AL)
3: wr(15,15, K)
4: rd(AH,AM,AL)
5: rd(15,15,AL)
6: rd(15,15, K)
7: Ld Prtr Hammer bits
8: Printer Feed
9: ?
10: DL = periph
11: Tape Data = bit 0 (DL)
12: DH,DL = Prt/Tape Sts
13: Tape Motor ON
14: Tape Motor OFF
15: XH,XL = <G>,<H>

B op:
0: NOP?
1: set bit 0 (ACC)
2: set bit 1 (ACC)
3: set bit 2 (ACC)
4: set bit 3 (ACC)
5: res bit 0 (ACC)
6: res bit 1 (ACC)
7: res bit 2 (ACC)
8: res bit 3 (ACC)
9: clear 6184
10: bit 0 (ACC) = !Z
11: bit 1 (ACC) = Z
12: Set Prog Err
13: clear ACC
14: Set Mach Err
15: ACC = (ALU) [if C0]

C op:
0: ACC = (ALU) [if B15]
1: AH = (ALU)
2: AM = (ALU)
3: AL = (ALU)
4: DH = (ALU)
5: DL = (ALU)
6: MR = (ALU)
7: NOP?

D op: (D'==0)
0: ALU = <G> + <H>
1: ALU = <G> + <H> + 1
2: ALU = <G> + <H>
3: ALU = <G> + <H> + C
4: ALU = <G> + <H> + 1
5: ALU = <G> & <H>
6: ALU = <G> | <H>
7: ALU = 0b0000

D op: (D'==1)
0: ALU = <H> - <G>
1: ALU = <H> - <G> - 1
2: ALU = <H> - <G>
3: ALU = <H> - <G> - C
4: ALU = <H> - <G> - 1
5: ALU = <G> & <H>
6: ALU = <G> ^ <H>
7: ALU = 0b0000

0-6 update Z flag
0-4 update I flag
2-4 update C flag

E op: conditional branch bit1
0: bit 0 (NEXT) = 0
1: bit 0 (NEXT) = 1
2: bit 0 (NEXT) = bit 0 (ACC)
3: bit 0 (NEXT) = bit 2 (ACC)
4: bit 0 (NEXT) = Prog Err
5: bit 0 (NEXT) = I
6: bit 0 (NEXT) = Any Key Down
7: bit 0 (NEXT) = Return

F op: conditional branch bit0
0: bit 1 (NEXT) = 0
1: bit 1 (NEXT) = 1
2: bit 1 (NEXT) = bit 1 (ACC)
3: bit 1 (NEXT) = bit 3 (ACC)
4: bit 1 (NEXT) = Z
5: bit 1 (NEXT) = ?
6: bit 1 (NEXT) = C
7: bit 1 (NEXT) = ?

G op:
0: 0b0000
1: K
2: mode 0*
3: mode 1
4: DH
5: DL
6: MR
7: XR

* Clears STEP

H op:
0: ACC
1: AH
2: AM
3: AL
4: DH
5: DL
6: MR
7: XR
L op 0: 0b000

J op: (F!=7)
0: jump
1: call

K op:
K = <imm>*

RAM size if PC=008

L op:
0: <H> = 0b0000
1: <H> = <H>

	F	E	NEXT	J	B	K	A	D'	L	D	C	G	H	
	41 40 39	38 37 36	35 34 33 32 31 30 29 28 27	26	25 24 23 22	21 20 19 18	17 16 15 14	13	12	11 10 9	8 7 6	5 4 3	2 1 0	
(LSB)	6180	6170	6160 / 6090	6080		6070 / 6060		6050		6040	6030		6020	(MSB)

Keyboard direct jump
(microcode address)

PRIME	000
Verify Prog	001
Set PC	002
Rec Prog	003
Search Mk	004
B.S.	005
Insert	006
Delete	007

Clock timing:
a = early latch, uCode load
b = serial data move
c = late latch, rd/wr RAM, latch uCode Addr

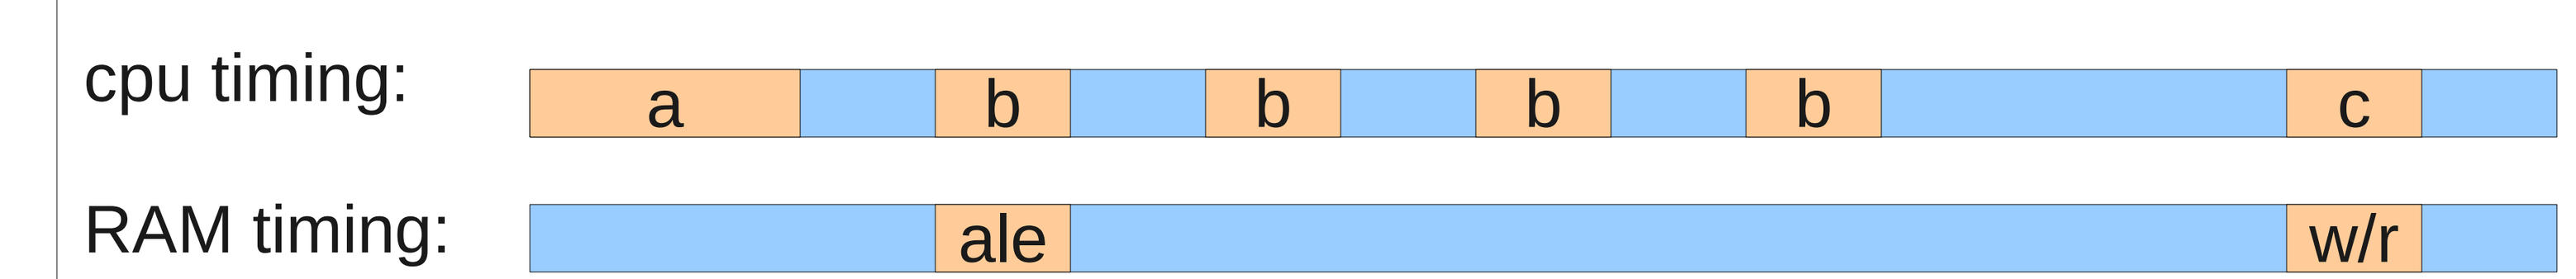

NOTE: RAM Timing – AH,AM,AL are <u>previous</u> values (before cycle), MR is not overwritten until after cycle (read). I.e. <u>Old</u> values of AH,AM,AL are used, <u>new</u> value of MR is used (write).

RAM Addresses	Reg #	Prog Steps
0xfff - 0xff0	15 15	
0xfef - 0xfe0	15 14	
0xfdf - 0xfd0	15 13	
0xfcf - 0xfc0	15 12	
0xfbf - 0xfb0	15 11	
0xfaf - 0xfa0	15 10	
0xf9f - 0xf90	15 09	
0xf8f - 0xf80	15 08	
0xf7f - 0xf70	15 07	
0xf6f - 0xf60	15 06	0000-0007
0xf5f - 0xf50	15 05	0008-0015
0xf4f - 0xf40	15 04	0016-0023
0xf3f - 0xf30	15 03	0024-0031
...	...	...
0x13f - 0x130	01 03	1816-1823
0x12f - 0x120	01 02	1824-1831
0x11f - 0x110	01 01	1832-1839
0x10f - 0x100	01 00	1840-1847
0x0ff - 0x0f0	00 15	
0x0ef - 0x0e0	00 14	
0x0df - 0x0d0	00 13	
0x0cf - 0x0c0	00 12	
0x0bf - 0x0b0	00 11	
0x0af - 0x0a0	00 10	
0x09f - 0x090	00 09	
0x08f - 0x080	00 08	
0x07f - 0x070	00 07	
0x06f - 0x060	00 06	
0x05f - 0x050	00 05	
0x04f - 0x040	00 04	
0x03f - 0x030	00 03	
0x02f - 0x020	00 02	
0x01f - 0x010	00 01	
0x00f - 0x000	00 00	

System register usage

```
15 15  System memory
15 14  ?
15 13  "Scientific" display
15 12  "Floating Point" display
15 11  "Learn Mode" display
15 10  ?
15 09  (used for pi)
15 08  Prog Stack (4 words/entry)
15 07  Prog Stack

Prog Stack starts with 00 of 15 08
and proceeds to 15 of 15 08, then
continues at 00 of 15 07.

Note, the system does not prevent
use of these "registers", but using
them almost certainly causes Mach
Errs.
```

System memory "15 15"

```
15   bit0=Keytrace
14   (2..11 for prog step lo)
13   bit0=ProgTrace, bit1=GroupI/O
12   ?
11   Prog Stack Depth
10   ?
09   ?
08   Keyboard code, lo
07   Keyboard code, hi
06   ?
05   ?
04   ?
03   bit0=Run, bit1=GroupI/O
     bit2=ROM
02   Prog Step (RAM adr lo)
01   Prog Step (RAM adr mi)
00   Prog Step (RAM adr hi)
```

Display segment decoder
(except digits 0 and 13)

```
val  segments                 symbol
00   a b c d e f - - - -      '0'
01   - - - - - - - h i -      '1'
02   a b – d e – g - - -      '2'
03   a b c d - - g - - -      '3'
04   - b c - - f g - - -      '4'
05   a – c d – f g - - -      '5'
06   - - c d e f g - - -      '6'
07   a b c - - - - - - -      '7'
08   a b c d e f g - - -      '8'
09   a b c - - f g - - -      '9'
10   - - - - - - - - - p      '.'
11   - - c d - - g - - -      '>'
12   - b - - - f g - - -      'u'
13   a - - d - f g - - -      '≤'
14   - - - d e f g - - -      '£'
15   - - - - - - - - - -      ' '
```

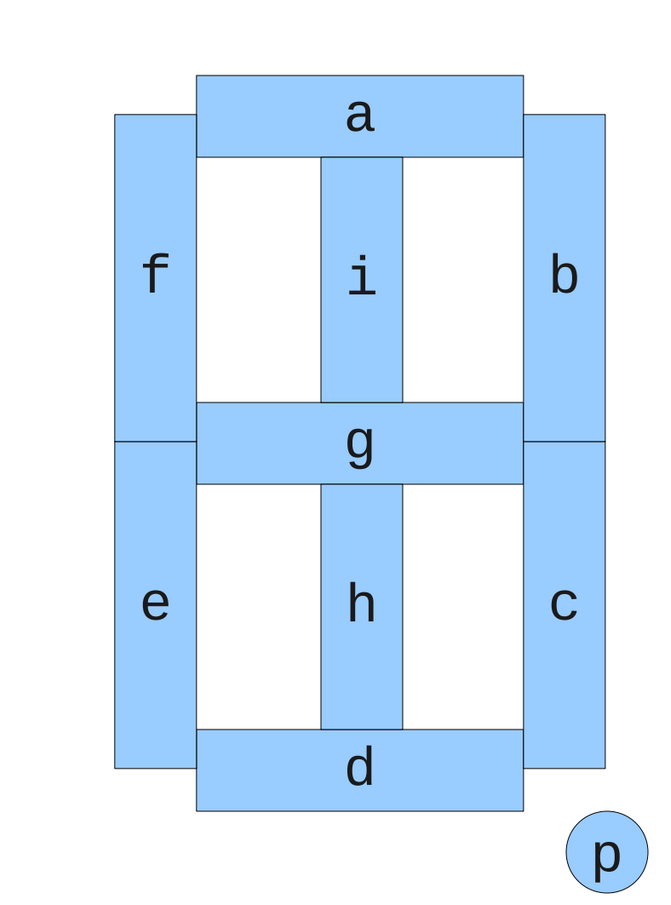

Digits 0 and 13:

```
11   - - - - - - g - - -      '-'
12   - - - - - - g h i -      '+'
```

Digit positions map directly to AL of register "15 11"

Printer drum column-symbol decoder

val	columns symbols 0-15	16	17	18	19	20
00	0	E	O	S	M	X
01	1	T	1	RE	ST	Y
02	2	+	2	W	α	Z
03	3	-	3	Go	SP	A
04	4	×	4	J○	Jø	B
05	5	÷	5	J+	J_E	C
06	6	ST	6	SN	S^{-1}	D
07	7	RE	7	CS	C^{-1}	E
08	8	*	8	TN	T^{-1}	F
09	9	*	9	RD	DR	G
10	.	f	10	LN	LG	H
11	○	F	11	e^x	10^x	I
12	***	A	12	x^2	I	J
13	+	B	13	√x	|x|	K
14	-	C	14	LP	EP	L
15	Δ	D	15	$^1/_x$	RT	M

"***" spells "...OVERFLOW..." across the 16 columns