


WSL Phase 8 rev-B - Connector Pin-Number Map

Pin 1 = the SQUARE pad (red outline; others oval/round). Numbers count sequentially from pin 1. Green=power, grey=ground, blue=signal, faded=no-connect.

J1 - PI ribbon (2x10) . TOP edge, between J2 & J14

square pad = pin 1 = VCC_5V, the corner nearest J2

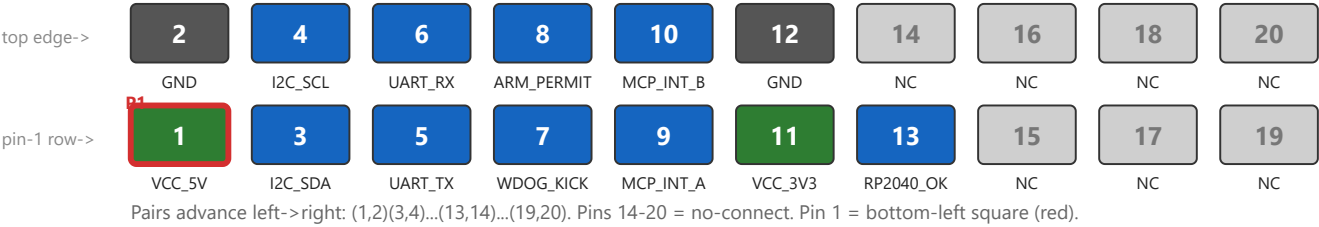

J2 - 5V IN (3) . TOP edge, leftmost

square pad = pin 1 = +5 V input (pins 2 & 3 are both GND)



J14 - SAFETY (4) . TOP edge, rightmost

square pad = pin 1 = VCC_5V, the end nearest J1




J13 - LED LAMPS (6) . BOTTOM edge

square pad = pin 1 = VCC_5V (opposite the lamp-return pins)



J3 - FAST A (10) . LEFT edge (top)

square pad = pin 1 (opposite the two GND pins 9-10). nets = FIELD_FAST_*

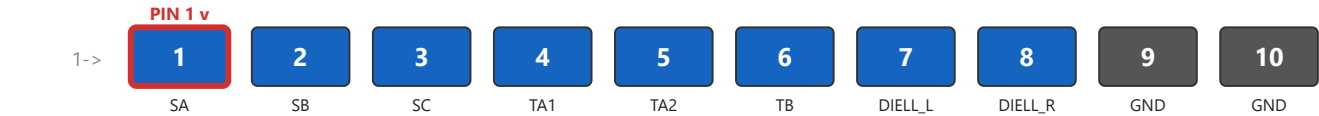

J4 - SLOW A (14) . LEFT edge (mid)

square pad = pin 1 (GND is pin 14, far end). nets = FIELD_SLOW_*




J5 - SLOW B (12) . LEFT edge (bot)

square pad = pin 1 (GND is pin 12, far end). nets = FIELD_SLOW_*



J6-J11 - MOTION OUTPUTS (2-pin each) . RIGHT edge

square pad (red) = pin 1 = OUT_x_B . pin 2 = OUT_x_A (relay dry contacts)

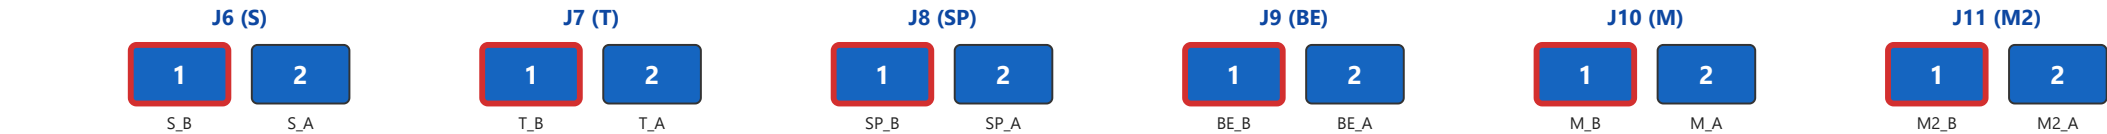

J12 (M1) is DNP - not populated. . Source: wsl-phase8b.routed-manual.kicad_pcb