

E1DA #9038SG3/#9038D firmware updating.

Warning: You need Windows 7/8/10, 32b either 64b PC, make sure if 9038SG3 works stable with that PC and particular USB cable. Do not interrupt power of PC either 9038SG3 during the re-flash process, do not shake or touch USB cable as well, otherwise the probability of brick your DAC is >0%!

- 1) install the audio driver first CT7601 20180717 3732 WHQL by start ct7601 setup.exe
- 2) install the FW tool driver Comtrue-inc_Firmware_Update_Device_2fc6 by start dpinst64.exe or dpinst32.exe depend on your Windows 64 either 32 bits. Don't worry if there is no digital signature! That driver isn't critical and may be needed only if 9038SG3/D was flashed wrong.

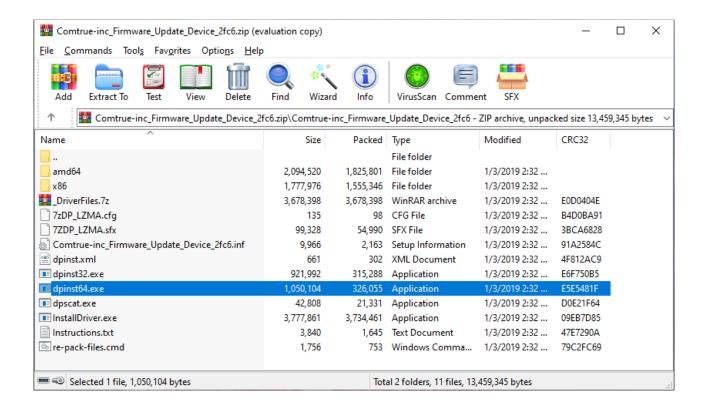

- 3) plug 9038SG3 in the USB and start CT7601_ISP_Tool.exe
- 4) Off the check "Detect Device" and change the PID for 6013, set the check "Detect Device" On again. You should see the indicator of the available device is green.

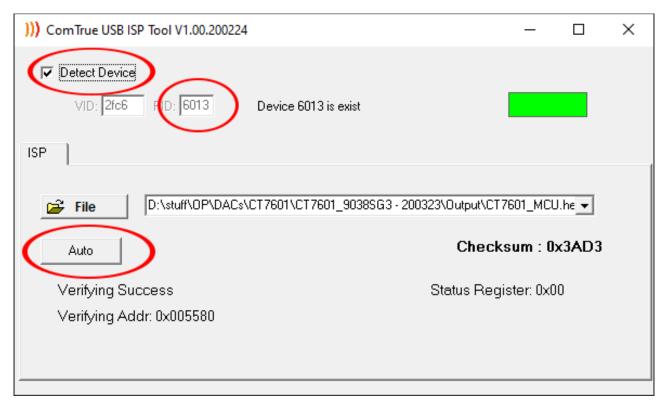

5) click on the "File" button to choose the FW file, and click "Auto" button. After the reflashing process finished you'll see the msg "Verifying Success". 9038SG3 FW is updated.